20120-01-001

Proposed Wind Farm at Castlebanny, Co. Kilkenny

ROAD SAFETY AUDIT STAGE 1/2

December 2020



CONSULTING

7, Ormonde Road Kilkenny R95 N4FE

Tel: 056 7795800 info@roadplan.ie

1. INTRODUCTION

- 1.1 This report describes a Stage 1/2 Road Safety Audit carried out on a proposed wind farm at Castlebanny, Co. Kilkenny on behalf of Tobin Consulting Engineers. The audit was carried out on 23rd November 2020 in the offices of Roadplan Consulting, Kilkenny.
- 1.2 The audit team members were as follows:
 - George Frisby, BE CEng MIEI
 Auditor Number GF51255
 - Richard Frisby, BSc AEng MIEI Auditor Number RF1337391
- 1.3 Both audit team members visited the site on the 02nd November 2020. The audit comprised an examination of the drawings relating to the scheme supplied by Tobin Consulting Engineers and an examination of the site.
- 1.4 An examination of the RSA collision database shows that there have been one serious collision within close proximity to the location of the proposed access to the wind farm from the R704 in the period of 2005 to 2016 inclusive. The collision is recorded as a single vehicle collision. The location of the collision is shown in Figure 1 below:

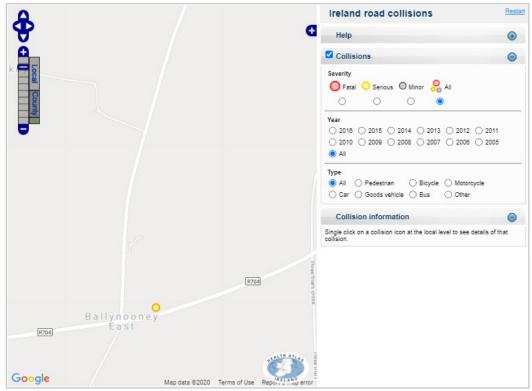


Figure 1: Road Collisions

1.5 This Stage 1/2 Audit has been carried out in accordance with the relevant sections of TII GE-STY-01024. The team has examined only those issues

within the design relating to the road safety implications of the scheme and has therefore not examined or verified the compliance of the design to any other criteria.

- 1.6 All of the problems described in this report are considered by the audit team to require action in order to improve the safety of the scheme and minimise accident occurrence.
- 1.7 Appendix A lists the audited drawings.

2. STAGE 1 / 2 AUDIT

2.1 Problem.

There is an existing dip in the vertical alignment located on the western side of the R704 carriageway. Visibility splays at the proposed access to the wind farm may be restricted by the vertical alignment of the R704 regional road. A lack of adequate visibility at the proposed access may contribute to a side impact collision at the access.



Recommendation

Ensure adequate horizontal and vertical visibility splays are provided at the proposed access onto the R704 regional road.

2.2 Problem.

The swept path analysis at the proposed access to the wind farm suggests that the access cannot adequately cater for a HGV entering and exiting the development at the same time. A delay in a HGV turning into the development from the R704 may lead to a rear-end collision.


Recommendation

Ensure the proposed access can adequately cater for HGV's entering and exiting the site access simultaneously.

2.3 Problem.

At the proposed crossing point located on the local road the proposed internal access road is approximately 5m wide. The proposed width may not adequately cater for opposing HGV's passing one another at the

access points. A delay in a HGV entering the access points may lead to a side impact collision with a vehicle on the mainline.

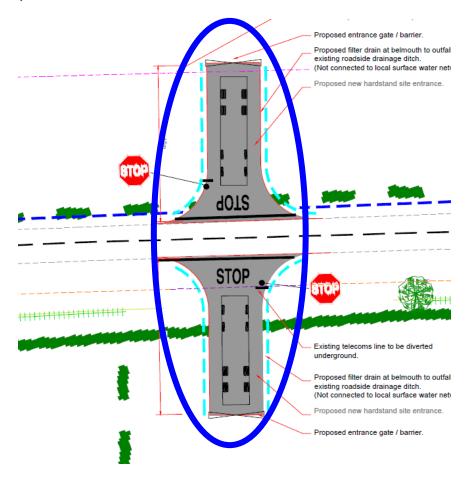

Recommendation

Ensure adequate width is provided at the access points to cater for opposing HGV's to pass one another.

2.4 Problem.

Hazard warning signs are provided on the approaches to the site access on the R704 and the site crossing point on the local road. However, no supplementary plate is provided to inform motorist of the nature of the hazard. In addition, the directional supplementary distance plates provided on the approach to the crossing point on the local road indicates one directional arrow only (left arrow) instead of two.

Recommendation

Provide a supplementary plate to inform motorist of the nature of the hazard and ensure two arrows (left & right) are provided on the directional supplementary distance plate provided on the approach to the crossing point on the local road.

3. AUDIT TEAM STATEMENT

3.1 We certify that we have examined the drawing listed in Appendix A and have inspected the site. This examination has been carried out with the sole purpose of identifying any features of the design that could be removed or modified to improve the safety of the scheme.

Signed	George Frisby
Date25 th November 2020	
Signed	Richard Frisby


Date 25th November 2020......


APPENDIX A

List of Drawings Examined

The following drawing numbered have been provided electronically in PDF format by Tobin Consulting Engineers.

Drawing number	Rev	Drawing title
10730-2050	D01	Site Entrance Visibility Sightlines R704
10730-2051	D01	Site Entrance Visibility Sightlines L7451
10730-2052	D01	Site Entrance Improvement Works & Autotrack Assessment R704
10730-2053	D01	Site Entrance Improvement Works L7451

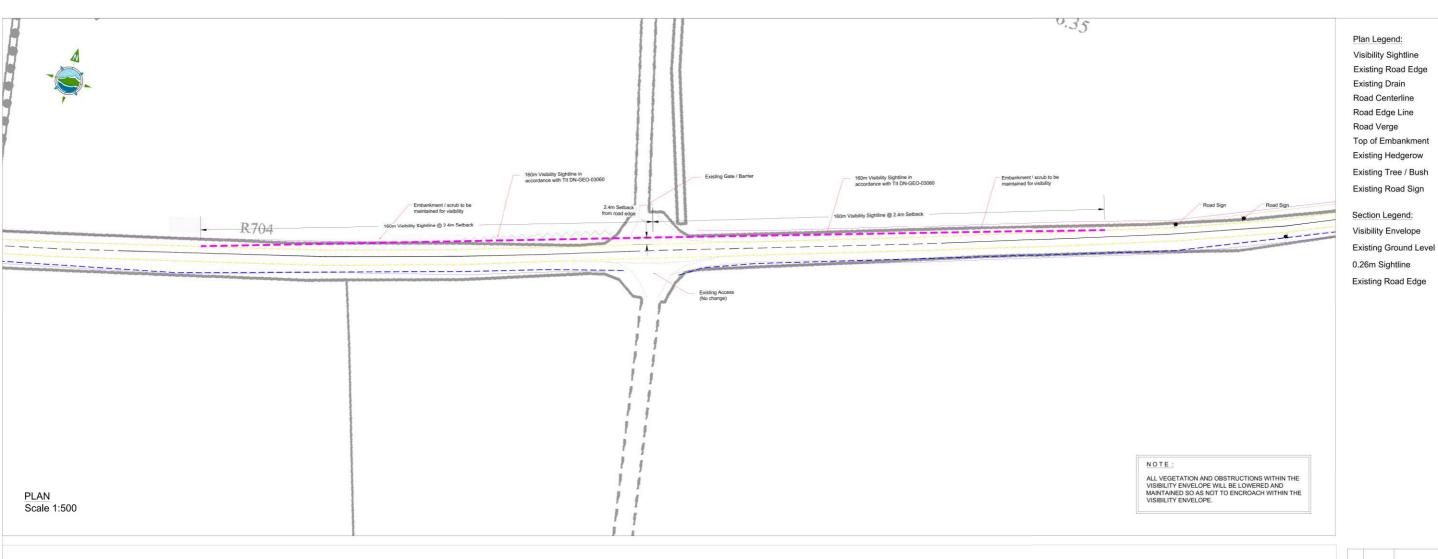

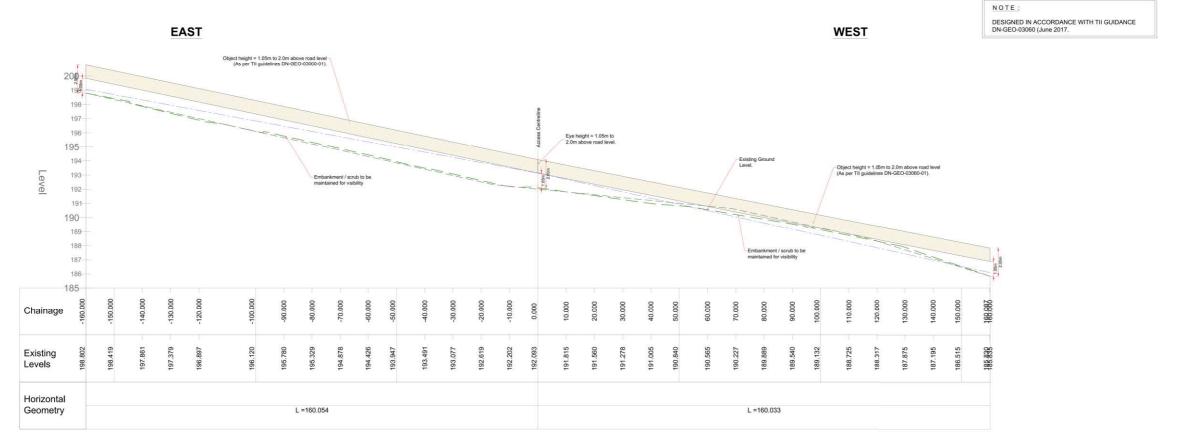

CB_1-1 - LONGSECTION SCALE: H 1:500,V 1:100. DATUM: 185.000



*



Project:

CASTLEBANNY WIND FARM

Title:

SITE ENTRANCE VISIBILITY SIGHTLINES R704


Prepared by:	Checked:	
M. Nolan	J. Staunton	June 2020
Project Director:		
Drawing Status:	Information	


TOBIN CONSULTING ENGINEERS

Block 10-4, Blanchardstown Corporate Park, Dublin 15, Ireland. tel: +353-(0)1-8030406 fax:+353-(0)1-8030409 e-mail: dublin@tobin.ie www.tobin.ie

TOTAL Counting Engineers and set he lided for our are of this discount for our purposes of the libert for the purposes of the engineer for the purposes of the libert for the purpose of the engineer for the purposes of the engineer for the engineers of the engin



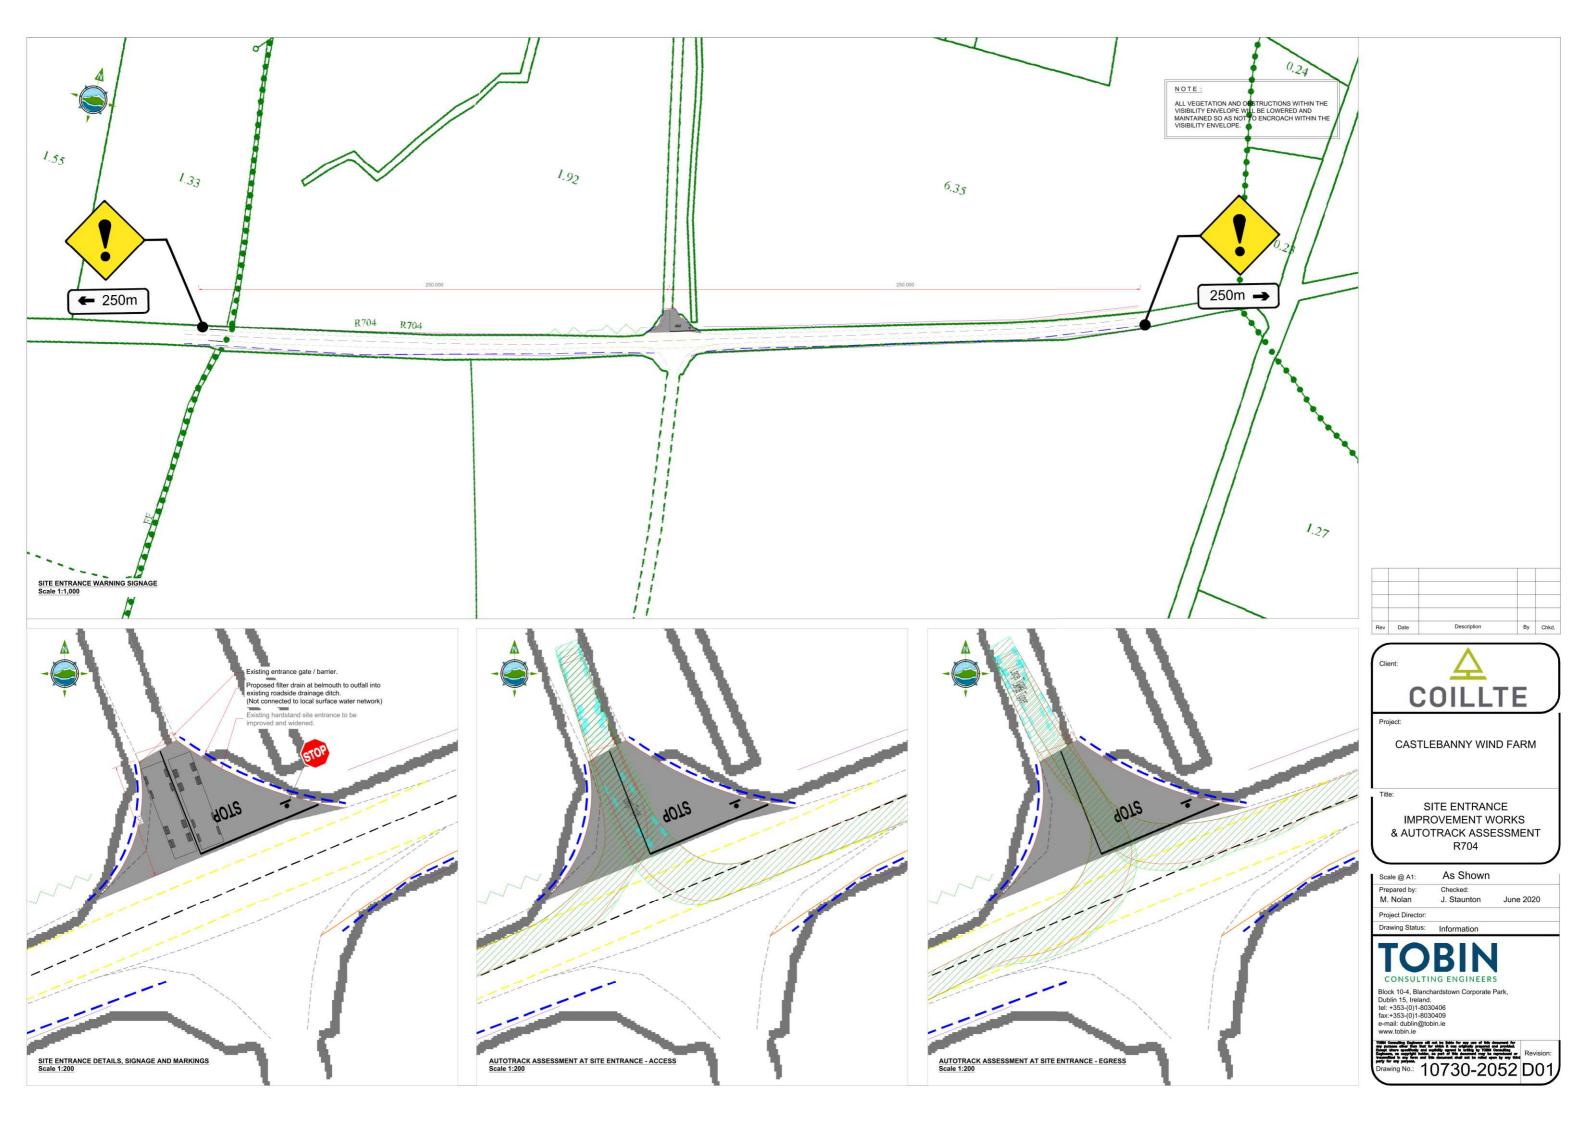

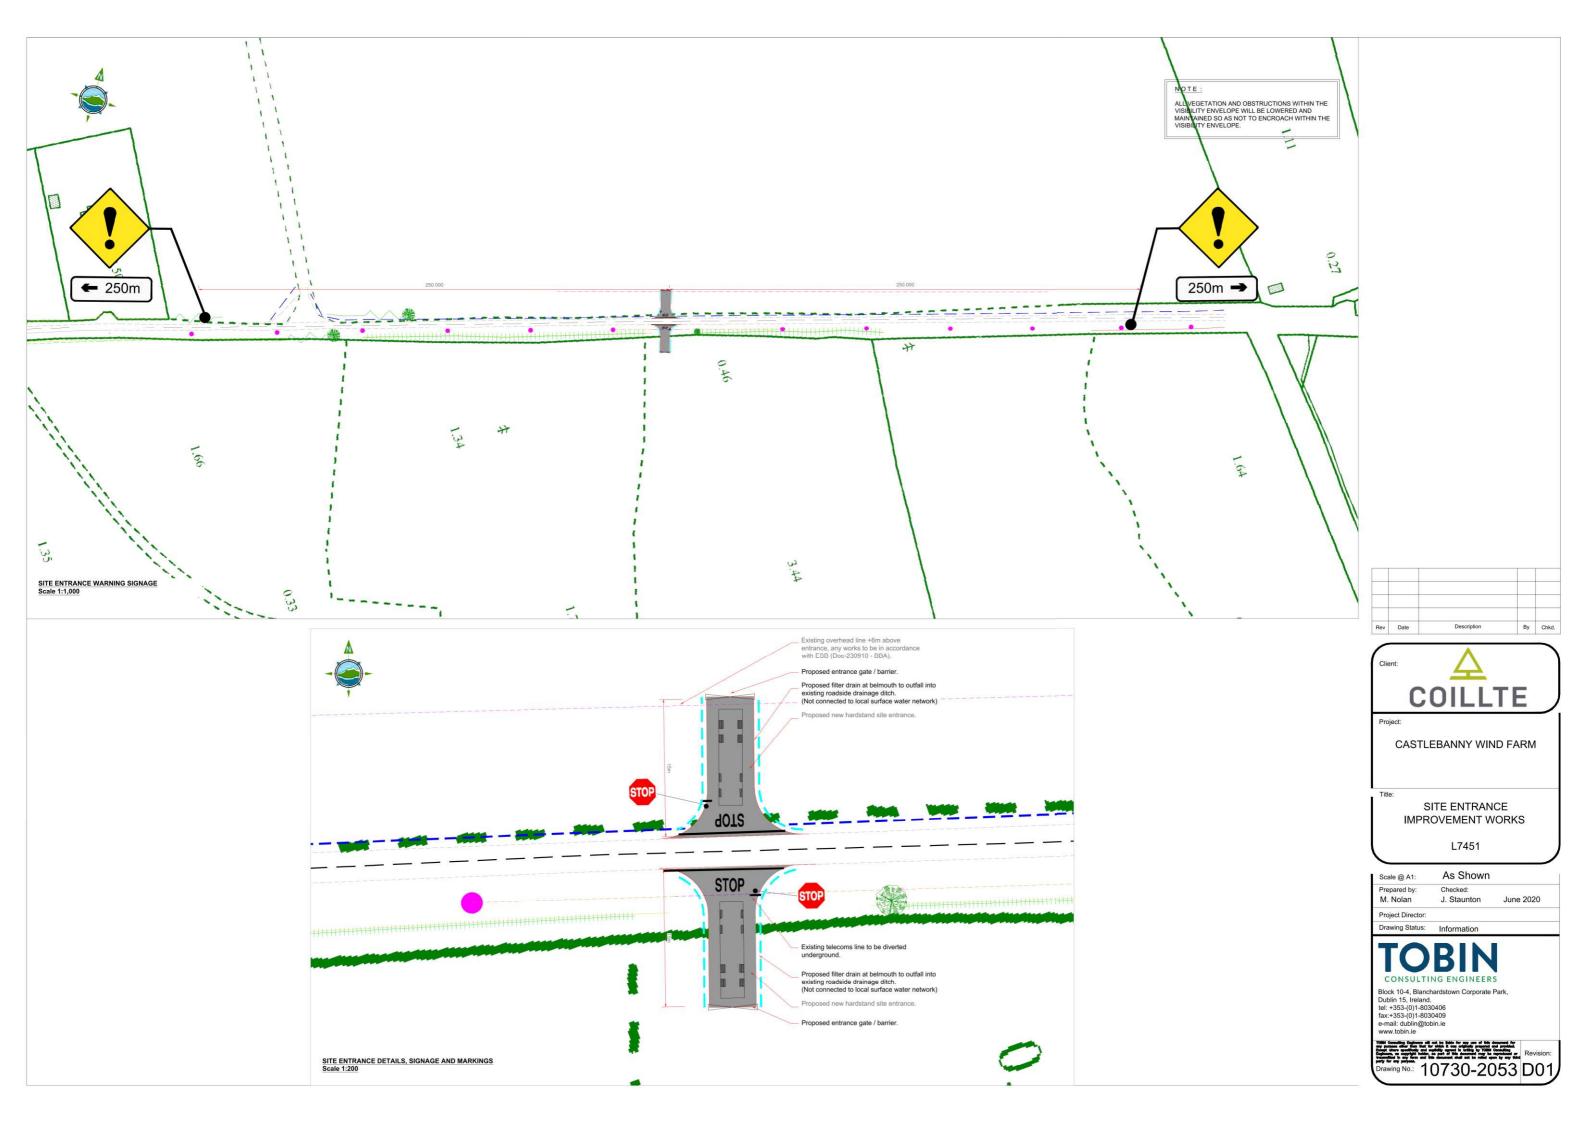

SAFETY AUDIT FEEDBACK FORM

Scheme: Proposed Wind Farm at Castlebanny, Co. Kilkenny

Document Number: 20120-01-001

Audit Stage: Stage 1/2

Date Audit Completed: 25th November 2020

Paragraph	To Be Completed By Designer			To Be Completed by Audit Team Leader
No. in Safety Audit Report	Problem accepted (yes/no)	Recommended measure accepted (yes/no)	Describe alternative measure(s). Give reasons for not accepting recommended measure. Only complete if recommended measure is not accepted.	Alternative measures or reasons accepted by auditors (yes/no)
2.1	Yes	Yes		
2.2	Yes	Yes		
2.3	Yes	Yes		
2.4	Yes	Yes		

Safety Audit		
Signed off John Stanto Design Team Leader		
Print NameJohn Staunton	Date	7 th Dec 2020
Safety Audit		
Signed off Employer		
Print NameKieran O'Malley	Date	9 th Dec 2020
Safety Audit Signed off Audit Team Leader		
Print Name GEORGE FRISBY	Date	14/12/2020

Please complete and return to: Roadplan Consulting Ltd.

7, Ormonde Road

Kilkenny

E-mail: info@roadplan.ie