Schedule Of Building Fabric Repair Works

recommendations.

Summary of works

unless otherwise stated.

replacement stone slates.

Chimney Repair

Internal Plaster Repair

Existing Door Upgrading

and repairs to brickwork and stone as necessary.

box frames unless otherwise stated.

Please note, all works to historic buildings will be carried out in accordance with the Conservation Architects

All modern uPVC/alumin windows within the existing facade to be replaced with multi-pane vertical sliding sash in box frames

All blocked openings and missing windows within the existing facade to be replaced with multi-pane vertical sliding sash in

Salvage all existing stone slate on the historic structures for reuse on the building. Remove all concrete roof tiles and other

All existing lead flashings, parapet gutters and dpc to roof fabric to be removed and replaced with appropriate materials as recommended by the Conservation Architect.

In cases where the masonry is loose and damaged and there is risk of moisture penetration the conservation architect may

Generally all existing suspended timber floors are to be retained, repaired and upgraded to meet loading requirements.

Clean and treat brickwork in accordance with Conservation Architects recommendations. Allow for repointing of brickwork

All internal plaster surfaces and joinery to be finished in matt emulsion and oil paints, and external plaster rendered surfaces

An intumescent system is to be used to upgrade raised and fielded panel doors to fire rated doors. Envirograf papers to be used in conjunction with intumescent paints to achieve 30 min fire rating.

contemporary roof finishes, repair, replace and treat roofing elements as necessary, and finish with salvaged and

Chimneys that are plaster rendered are to have render removed, flashings replaced and rerendered.

instruct the top few courses of brick to be removed and rebedded on a bitumen coated lead dpc.

Repair all existing lime plaster in accordance with Conservation Architects recommendations.

to be finished in mineral paint as recommended by the Conservation Architect.

Replace all circular down pipes & decorative hopper heads with heritage cast iron rainwater goods.

Please see the Conservation Architect's Specifications for further information.

Early timber windows to remain in situ following repair by specialist joiners.

Historic roof timbers to be repaired on a minimum intervention basis.

Generally all existing brick chimneys are to be repaired and repointed.

7 New covered main entrance from Ellen Street to Aparthotel

(10) Replace existing shop front - refer to Indicative Shopfront Design Guide


(11) Restore existing shopfront in accordance with Conservation Officers report/approval.

(16) Ashlar Stone

Proposal Key:

(18) Marley Eternit dark grey fibre cement cladding

(19) Kalzip standing seam roof in light grey

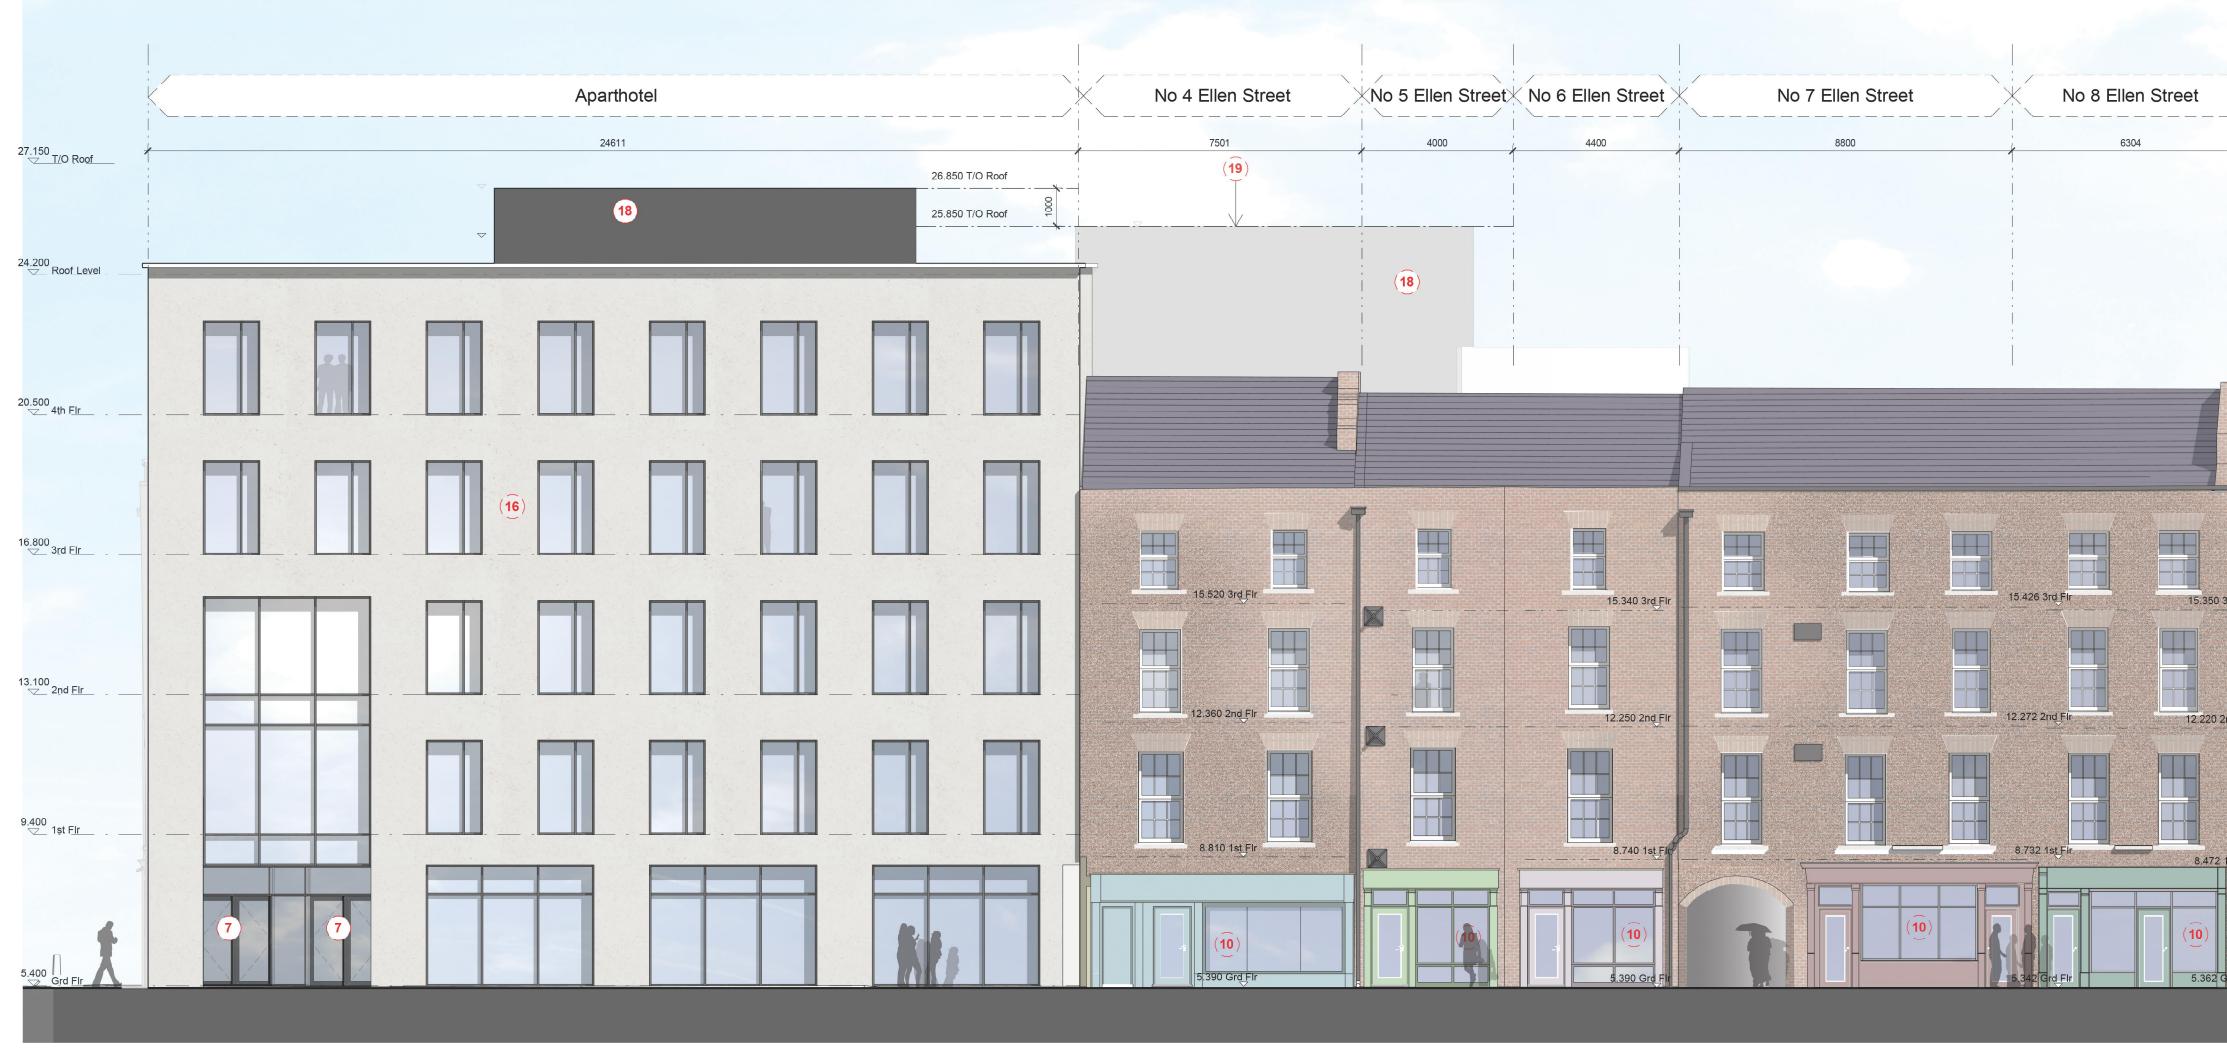

1 South Elevation - Ellen Street SCALE: 1:100

No 4 Patrick Street 26.850 T/O Roof 25.850 T/O Roof 24.850 T/O Roof at Stairs 23.650 T/O Roof 2nd F<u>lr</u> 3.100

2 | West Elevation - Patrick Street SCALE: 1 : 100




Opera Site

Limerick City and County Council

CONSULTANT

AECOMThe Clarence Street West Building
2 Clarence Street West Belfast BT2 7GP United Kingdom Tel +44 (0)28 90607200 www.aecom.com

All levels referenced to Malin Head Datum

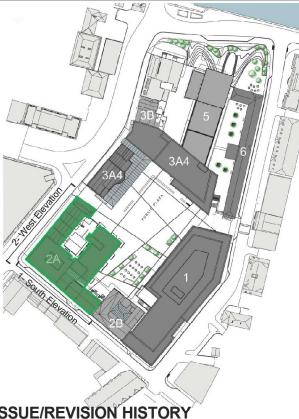

ISSUE/REVISION HISTORY

- Jan 19 Planning Submission
I/R DATE DESCR DESCRIPTION

PROJECT NUMBER 60568520

SHEET TITLE Parcel 2A - Proposed Elevations -Patrick + Ellen Streets from South and

SHEET NUMBER

OPRA-ACM-Z2A-ZZ-DR-AR-13002