BUILDING LIFECYCLE REPORT


PROPOSED DEVELOPMENT: JACOB'S ISLAND SHD MAHON, CORK



aramark

TABLE OF CONTENTS

1.0	INTRODUCTION	4
2.0	DESCRIPTION OF DEVELOPMENT	6
3.0	EXECUTIVE SUMMARY – BUILDING LIFE CYCLE REPORT	8
4.0	EXTERNAL BUILDING FABRIC SCHEDULE	10
4.1	Roofing	10
4.2	Rainwater Drainage	12
4.3	External Walls	13
4.4	External Windows & Doors	14
4.5	Balconies	15
5.0	INTERNAL BUILDING FABRIC SCHEDULE	17
5.1	Floors	17
5.2	Walls	19
5.3	Ceilings	20
5.4	Internal Handrails & Balustrades	20
5.5	Carpentry & Joinery	21
6.0	BUILDING SERVICES	23
6.1	Mechanical Systems	23
6.2	Electrical / Protective Services	25
7.0	CONCLUSION & CONTACT DETAILS	30
	DOCUMENT CONTROL SHEET	31

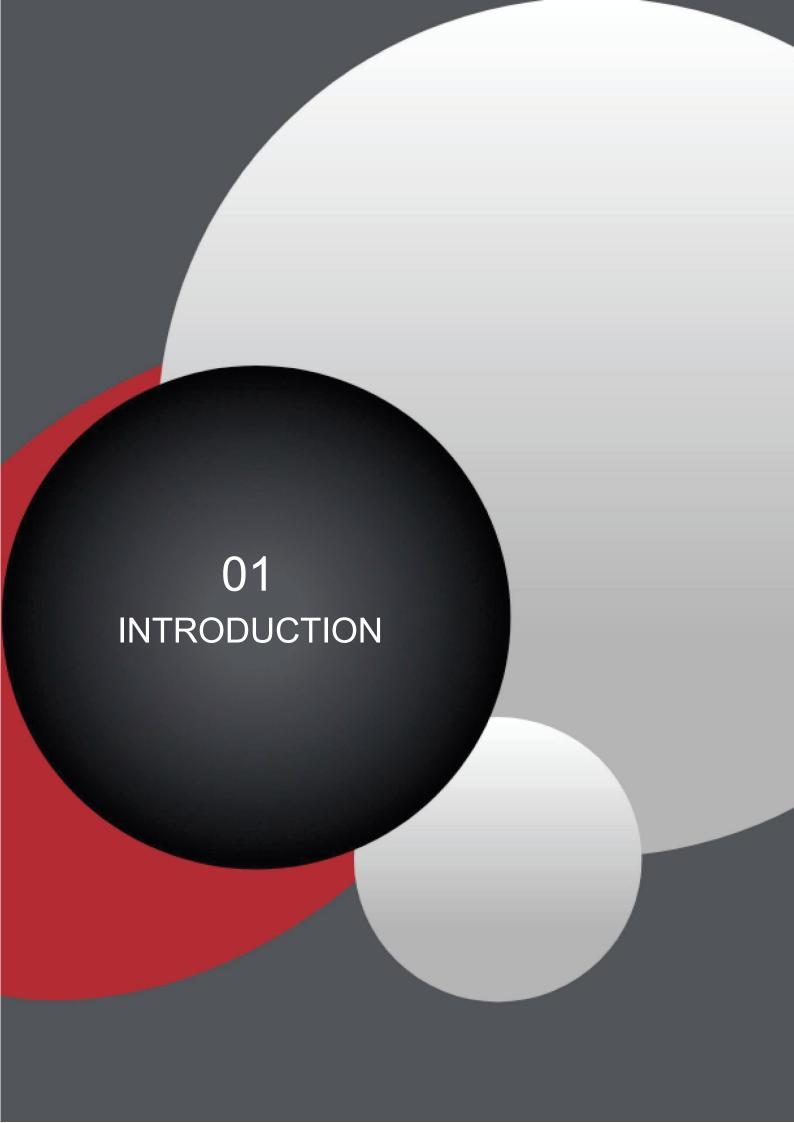

1.0 INTRODUCTION

Aramark Property were instructed by Hibernia Star Limited, to provide a Building Lifecycle Report for their proposed development comprising 489 no. apartments, creche and offices in 5 no. buildings ranging in height from part-1 to part-8 no. storeys over lower ground and semi-basement podium levels at Jacob's Island, Mahon, Cork.

The purpose of this report is to provide an initial assessment of long-term running and maintenance costs as they would apply on a per residential unit basis at the time of application, as well as demonstrating what measures have been specifically considered to effectively manage and reduce costs for the benefit of the residents. This is achieved by producing a Building Lifecycle Report.

This Building Lifecycle Report has been developed on foot of the revised guidelines for Sustainable Urban Housing: Design Standards for New Apartments - Guidelines for Planning Authorities issued under Section 28 of the Planning and Development Act 2000 (as amended) December 2020. Within these guidelines, current guidance is being provided on residential schemes.

Section 6.13 of the Apartments and the Development Management Process guidelines for Sustainable Urban Housing: Design Standards for New Apartments (December 2020) requires that:

"planning applications for apartment development shall include a building lifecycle report which in turn includes an assessment of long-term running and maintenance costs as they would apply on a per residential unit basis at the time of application, as well as demonstrating what measures have been specifically considered by the proposer to effectively manage and reduce costs for the benefit of residents."



2.0 DESCRIPTION OF DEVELOPMENT

The development will consist of:


The construction of a Strategic Housing Development of 489 no. apartments, creche and offices in 5 no. buildings ranging in height from part-1 to part-8 no. storeys over lower ground and semi-basement podium levels. The development will contain 1 no. studio, 161 no. 1 bedroom apartments and 327 no. 2 bedroom apartments.

- Blocks 12 and 13 will contain ancillary commercial areas including a creche (381 sq m) and offices (4,112 sq m). The development will also contain supporting internal resident amenity spaces (576 sq m) and external communal amenity spaces.
- Block 11 is part-3 to part-6 no. storeys over semi-basement podium and lower ground levels and will contain 101 no. apartments.
- Block 12 is part-1 to part-4 no. storeys over undercroft car parking and lower ground level office building (4,112 sq m) comprising 2,934 sq m of office floor area.
- Block 13 is part-2 to part-8 no. storeys over lower ground levels and will contain a crèche over 2 no. levels (381 sq m) and 39 no. apartments.
- Block 14 is part-3 to part-6 no. storeys over lower ground level and contains 130 no. apartments.
- Block 15 is part-3 to part-6 no. storeys over semi-basement, podium and lower ground level and contains 219 no. apartments and ancillary resident amenity spaces (576 sq m).

The proposed development also provides for hard and soft landscaping, boundary treatments, public realm works, car parking, bicycle parking, bin stores, signage, lighting, PV panels, sprinkler and water tank, substations, plant rooms and all ancillary site development works above and below ground.

.



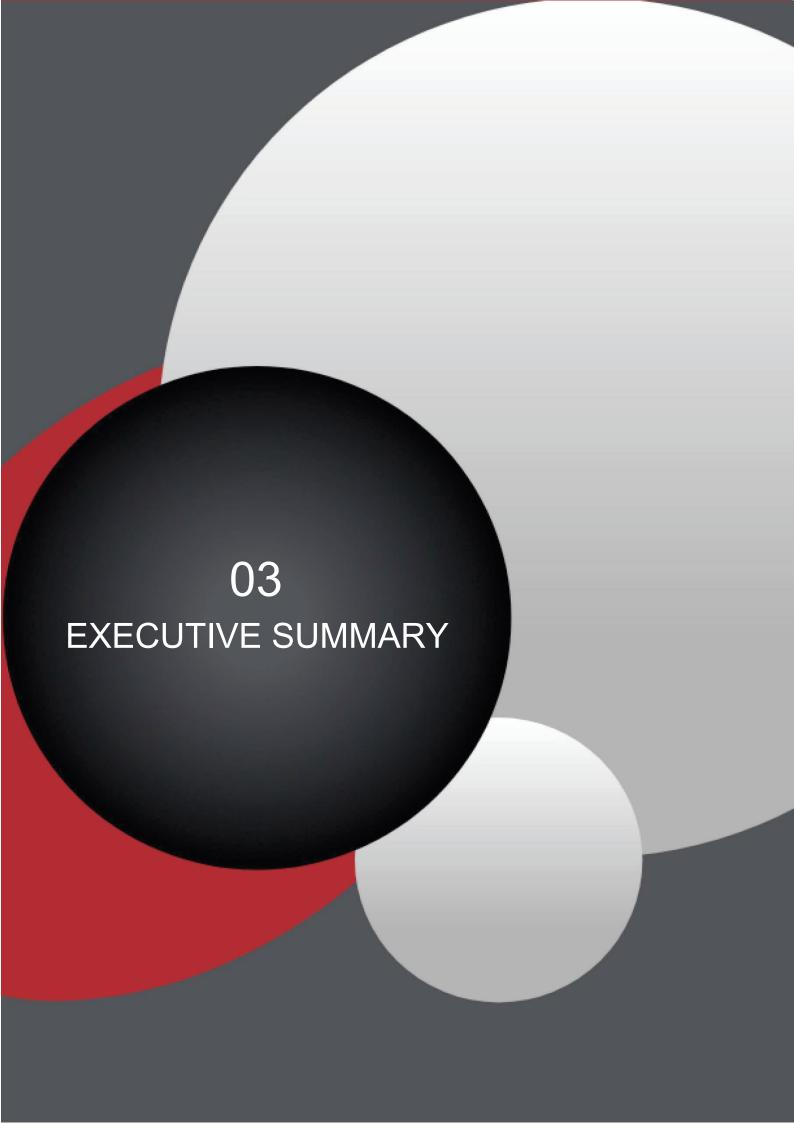

3.0 EXECUTIVE SUMMARY – BUILDING LIFE CYCLE REPORT

Measures to effectively manage and reduce costs for the benefit of residents

The following document reviews the outline specification set out for the proposed development comprising 489 no. apartments, creche and offices in 5 no. buildings ranging in height from part-1 to part-8 no. storeys over lower ground and semi-basement podium levels at Jacob's Island, Mahon, Cork and explores the practical implementation of the design and material principles which has informed design of building roofs, façades, internal layouts and detailing of the proposed development.

Building materials proposed for use on elevations and in the public realm achieve a durable standard of quality that will not need regular fabric replacement or maintenance outside general day to day care. The choice of high quality and long-lasting materials, as well as both soft and hardscape in the public, semi-public and private realm will contribute to lower maintenance costs for future residents and occupiers.

Please note that detailed specifications of building fabric and services have not been provided at this stage. This report reflects the outline material descriptions contained within O'Mahony Pike Architects' planning drawings received.

For any elements where information was not available, typical examples have been provided of building materials and services used for schemes of this nature and their associated lifespans and maintenance requirements. All information is therefore indicative subject to further information at detailed design stage.

As the building design develops this document will be updated and a schedule will be generated from the items below detailing maintenance and replacement costs over the lifespan of the materials and development constituent parts in a summary document. This will enable a robust schedule of building component repair and replacement costs which will be available to the property management company so that running, and maintenance costs of the development are kept within the agreed Annual operational budget, this will take the form of a Planned Preventative Maintenance Schedule (PPM)* at operational commencement of the development.

*PPM under separate instruction





4.0 EXTERNAL BUILDING FABRIC SCHEDULE

4.1 Roofing

4.1.1 Green Roofs (Manufacturer / Supplier TBC)

Location	Selected Flat Roof Areas (maintenance access only)
Description	Extensive green roof system to engineer's specification.
Lifecycle	Average lifecycle of 15-35 years on most green roofs. Lifecycle will be extended with robust proven detailing to adjoining roof elements and appropriate and regular maintenance of the roof materials.
Required	Quarterly maintenance visits to include inspection of drainage layer and
maintenance	outlets and removal of any blockages to prevent ponding. Inspection of
	vegetation layer for fungus and decay. Carry out weeding as necessary.
	No irrigation necessary with sedum blankets.
Year	Bi-annually
Priority	Medium
Selection process	A green roof will add to the character of the overall scheme, as well as providing attenuation to storm water run-off and less burden on rainwater goods, increased thermal and sound insulation to the building and increased biodiversity. Natural soft finishes can provide visual amenity for residents where roof areas are visible or accessible from within areas of the scheme. Sedum roofs are a popular and varied choice for green roofs requiring minimal maintenance.
Reference	O'Mahony Pike Architects' planning drawings & design statement.

4.1.2 Roof (Manufacturer / Supplier TBC)

Location	Selected Flat Roof Areas (maintenance access only)
Description	Single layer membrane roof system to engineer's specification.
	Selected membrane and pressed metal cappings.
Lifecycle	Average lifecycle of 15-25 years on most membrane roofs. Lifecycle
	will be extended with robust proven detailing to adjoining roof elements
	and appropriate and regular maintenance of the roof materials.
Required	Half-yearly maintenance visits to include inspection of membrane
maintenance	material for puncture / cracks on sheeting; seams and flashing details;
	around drainage and ventilation outlets and removal of any
	vegetation/moss blockages to prevent ponding.
Year	Half-Yearly / Annual
Priority	Medium
Selection	A membrane roof with appropriate built-up system will provide
process	durability, lacks water permeability, and easily maintain without
	shutting down building operations during application.
Reference	O'Mahony Pike Architects' planning drawings and design statement.

4.1.3 Fall Arrest System for Roof Maintenance Access

Location	Flat roof areas to all blocks (maintenance access only)
Description	 Fall Protection System on approved anchorage device. Installation in accordance with BS 7883:2019 (Anchor System designed to protect people working at height) by the system manufacturer or a contractor approved by the system manufacturer.
Lifecycle	25-30 years dependent on quality of materials. Generally, steel finishes to skyward facing elements can be expected to maintain this life expectancy. As used across the industry nationally and the UK, long lifecycle is typically achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required maintenance	Check and reset tension on the line as per manufacturer's specifications. Check all hardware components for wear (shackles, eye bolts, turn buckles). Check elements for signs of wear and/or weathering. Lubricate all moving parts. Check for structural damage or modifications.
Year	Annually
Priority	High
Selection process	Fall protection systems are a standard life safety system, provided for safe maintenance of roofs and balconies where there is not adequate parapet protection. Fall protection systems must comply with relevant quality standards.
Reference	N/A

4.1.4 Roof Cowls

Location	Selected Flat Roof Areas
Description	Roof Cowl System to be supplied with weather apron for flat roofs.
Lifecycle	25-35 years. As used across the industry nationally and the UK, typically longer lifecycle is achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required maintenance	Check fixings annually, inspect for onset of leading-edge corrosion if epoxy powder coat finish and treat.
Year	Annually
Priority	Low
Selection process	Standard fitting for roof termination of mechanical ventilation system.
Reference	N/A

4.1.5 Flashings

Location	All flashing locations
Description	Lead to be used for all flashing and counter flashings.
Lifecycle	Typical life expectancy of 70 years recorded for lead flashings. Recessed joint sealing will require regular inspections. Longer lifecycle achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required maintenance	Check joint fixings for lead flashing, ground survey annually and close- up inspection every 5 years. Re-secure as necessary.
Year	Ground level inspection annually and close-up inspection every 5 years
Priority	Medium
Selection process	Lead has longest life expectancy of comparable materials such as copper (60 years) and zinc (50 years). Provided appropriate safety precautions are taken, lead is the recommended choice for large residential, commercial, or industrial builds. Lead is easily formed into the required shapes for effective weathering of building junctions according to standard Lead Sheet Association details.
Reference	N/A

4.2 Rainwater Drainage

Location	All buildings
Location	
Description	Rainwater outlets: Suitable for specified roof membranes
	Pipework: Cast aluminium downpipes/uPVC downpipes
	Below ground drainage: To Engineers' design and specification
	Disposal: To surface water drainage to Engineers' design
	Controls: To Engineers' design and specification
	 Accessories: allow for outlet gradings, spigots, downspout nozzle, hopper heads, balcony and main roof outlets
Lifecycle	Metal gutters and downpipes have an expected life expectancy of 40
	years in rural and suburban conditions (25 years in industrial and
	marine conditions), this is comparable to cast iron of 50 years and
	plastic, less so at 30 years. As used across the industry nationally and
	the UK, typically longer lifecycle is achieved by regular inspection and
	maintenance regime to ensure the upkeep of materials.
Required	As with roofing systems routine inspection is key to preserving the
maintenance	lifecycle of rainwater systems. Regular cleaning and rainwater heads
	and gutters, checking joints and fixings and regularly cleaning polyester coated surfaces (no caustic or abrasive materials).
	, i
Year	Annually, cleaning bi-annually
Priority	High
Selection	As above, metal fittings compare well against cast iron (in terms of cost)
process	and plastic (in terms of lifespan and aesthetic).
Reference	N/A



4.3 External Walls

4.3.1 Brick

Location	Façades
Description	Contrasting light and dark tone brickwork.
Lifecycle	Selected colour bricks have a high embodied energy, they are an extremely durable material. Brickwork in this application is expected to have a lifespan of 50-80 years. The mortar pointing however has a shorter lifespan of 25-50 years. Longer lifecycle achieved by regular inspection and maintenance regime.
Required maintenance	In general, given their durability, brickwork finishes require little maintenance. Most maintenance is preventative: checking for hairline cracks, deterioration of mortar, plant growth on walls, or other factors that could signal problems or lead to eventual damage.
Year	Annual
Priority	Low
Selection process	Aesthetic, lightweight, cost-efficient and low maintenance cladding option, indistinguishable from traditional brick construction.
Reference	O'Mahony Pike Architects' drawings & design statement.

4.3.2 Metal Cladding

Location	Façades
Description	 Lightweight metal frame system to select finish. PPC aluminium parapet capping. Balcony surrounds.
Lifecycle	Lifespan expectancy generally in excess of 40 years. As used across the industry nationally and the UK, typically longer lifecycle is achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required maintenance	Metal cladding requires little maintenance and is resistant to corrosion. It can contribute to lower ongoing maintenance costs in comparison to exposed porous materials which may be liable to faster deterioration. Long term cleaning requirements should be taken into consideration.
Year	Inspection annually; cleaning 5 yearly
Priority	Low
Selection process	Metal cladding protects the building's structure from rainwater and weathering. Metal cladding systems are also chosen for their aesthetic impact, durability and weathering properties.
Reference	O'Mahony Pike Architects' drawings & design statement.



4.3.3 Concrete (Manufacturer / Supplier TBC)

Location	Façades
Description	Precast Concrete frame / colonnade
Lifecycle	While concrete has a high embodied energy, it is an extremely durable material. As used nationwide and in the UK, typically longer lifecycle is achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required maintenance	In general concrete requires little maintenance. Most maintenance is preventative: checking for hairline cracks, vegetation growth on facades, or other factors that could signal problems or lead to eventual damage.
Year	Annual
Priority	Low
Selection process	Concrete is a durable product which is chosen for its structural properties, aesthetic, cost efficiency and rapid construction.
Reference	O'Mahony Pike Architects' planning drawings & Design Statement.

4.4 External Windows & Doors

Location	Façades
Description	 Full height, mixture of clear and obscure glazed windows with aluminium powder coated frames to select finish. All units to be double glazed with thermally broken frames. All opening sections in windows to be fitted with suitable restrictors. Include for all necessary ironmongery; include for all pointing and mastic sealant as necessary; fixed using stainless steel metal straps screwed to masonry reveals; include for all bends, drips, flashings, thermal breaks etc.
Lifecycle	Aluminium has a typical lifespan of 45-60 years in comparison to uPVC which has a typical lifespan of 30-40 years. As used nationwide and in the UK, typically longer lifecycle is achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required	Check surface of windows and doors regularly so that damage can be
maintenance	detected. Vertical mouldings can become worn and require more
	maintenance than other surface areas. Lubricate at least once a year.
	Ensure regular cleaning regime. Check for condensation on frame from
	window and ensure ventilation.
Year	Annual
Priority	Medium
Selection	Aluminium is durable and low maintenance with an average lifespan of
process	45-60 years, exceeding uPVC (30-40 years). Alu-clad timber windows compare favorably when compared to the above, extending timber windows typical lifespan of 35-50 years by 10-15 years.
Reference	O'Mahony Pike Architects' drawings & design statement.



4.5 Balconies

4.5.1 Structure

Location	Apartment Block Façades
Description	 Concrete balcony system to engineer's detail, or Powder-coated steel frame balcony system to engineer's detail Thermally broken farrat plate connections to main structure of building.
Lifecycle	 Metal structure has a typical life expectancy of 70 years dependent on maintenance of components. Precast concrete structures have a high embodied energy; however, it is an extremely durable material. Concrete frame has a typical life expectancy of 80 years.
	As used across the industry nationally and the UK, longer lifecycle is achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required maintenance	Relatively low maintenance required. Check balcony system as per manufacturer's specifications. Check all hardware components for wear. Check elements for signs of wear and/or weathering. Check for structural damage or modifications.
Year	Annual
Priority	High
Selection process	Engineered detail; designed for strength and safety.
Reference	N/A

4.5.2 Balustrades and Handrails

Location	Apartment Block Balconies
Description	Metal vertical balustrades and railings to select finish.Fixing in accordance with manufacturer's details.
Lifecycle	General metal items have a lifespan of 25-45 years. Longer lifecycle is achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required maintenance	Annual visual inspection of connection pieces for impact damage or alterations.
Year	Annual
Priority	High
Selection	Metal option will have a longer lifespan and require less maintenance
process	than timber options (10-20 years).
Reference	N/A





5 INTERNAL BUILDING FABRIC SCHEDULE

5.1 Floors

5.1.1 Common Areas

Location	Entrance lobbies / Common corridors
Description	 Selected anti-slip porcelain or ceramic floor tile complete with inset matwell. Selected loop pile carpet tiles.
Lifecycle	 Lifespan expectation of 20-25 years in heavy wear areas, likely requirement to replace for modernisation within this period also. 10-15 year lifespan for carpet. Likely requirement to replace for modernisation within this period also.
Required	Visual inspection with regular cleaning, intermittent replacement of
maintenance	chipped / loose tiles
Year	Annual for floor tiles.
	Quarterly inspection and cleaning of carpets as necessary
Priority	Low
Selection	Durable, low maintenance floor finish. Slip rating required at entrance
process	lobby, few materials provide this and are as hard wearing. Using carpet allows flexibility to alter and change as fashions alter and change providing enhanced flexibility.
Reference	N/A

Location	Stairwells, landings / half landings
Description	Selected carpet covering. Approved anodised aluminium nosings to
	stairs.
Lifecycle	• 10-15 year lifespan for carpet. Likely requirement to replace for
	modernisation within this period also.
	20-year lifespan for aluminium nosings.
Required	Visual inspection with regular cleaning.
maintenance	
Year	Quarterly inspection and cleaning as necessary.
Priority	Low
Selection	Using carpet allows flexibility to alter and change as fashions alter and
process	change providing enhanced flexibility.
Reference	N/A

Location	Lift Lobbies
Description	Carpet/vinyl and porcelain tiles to match adjacent apartment
	common lobbies.
Lifecycle	 Lifespan expectation of 20-30 years in heavy wear areas, likely requirement to replace for modernisation within this period also. 10-15 year lifespan for carpet. Likely requirement to replace for
	modernisation within this period also.
Required	Visual inspection with regular cleaning, intermittent replacement of
maintenance	chipped / loose tiles.
Year	Annual
Priority	Low
Selection process	Slip rating required for lifts, few materials provide this and are as hard wearing. Using carpet allows flexibility to alter and change as fashions alter and change providing enhanced flexibility.
Reference	N/A

5.1.2 Tenant Amenity Areas

Location	Residential amenity (e.g. creche)
Description	Timber laminate / parquet flooring, or
	Carpet covering
	Provide for inset matwell
Lifecycle	 Laminated / parquet timber flooring has an expected life expectancy of 25-35 years dependent on use
	10-15 year lifespan for carpet. Likely requirement to replace for modernisation within this period also
Required	Visual inspection. Sweep clean regularly ensuring to remove any dirt.
maintenance	Clean up spills immediately and use only recommended floor cleaners.
Year	Annual
Priority	Low
Selection	Materials chosen for aesthetics, durability and low maintenance.
process	
Reference	N/A

Location	All wet areas (e.g. WC's)
Description	Selected anti-slip ceramic floor tile.
Lifecycle	Lifespan expectation of 20-25 years in heavy wear areas, likely requirement to replace for modernisation within this period also.
Required	Visual inspection, intermittent replacement of chipped / loose tiles.
maintenance	
Year	Annual
Priority	Low
Selection	Slip rating required at entrance lobby, few materials provide this and
process	are as hard wearing.
Reference	N/A



5.2 Walls

5.2.1 Common Areas

Location	Entrance lobbies / Corridors
Description	Selected paint finish with primer to skimmed plasterboard.
Lifecycle	2-10 years for finishes; 40 years for plasterboard. Longer lifecycle achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required maintenance	Regular maintenance required and replacement when damaged.
Year	Bi-annually
Priority	Low
Selection	Decorative and durable finish.
process	
Reference	N/A

Location	Lift cores / lobbies / corridors / stairs
Description	Selected paint finish with primer to skimmed plasterboard.
Lifecycle	2-10 years for finishes; 40 years for plasterboard. Longer lifecycle achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required	Regular maintenance required and replacement when damaged.
maintenance	
Year	Bi-annually
Priority	Low
Selection	Decorative and durable finish.
process	
Reference	N/A

5.2.2 Tenant Amenity Areas

Location	Residential Amenity (e.g. creche)
Description	Selected paint finish with primer to skimmed plasterboard
Lifecycle	2-10 years for finishes; 40 years for plasterboard. Longer lifecycle achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required	Regular maintenance required and replacement when damaged.
maintenance	
Year	Bi-annually
Priority	Low
Selection	Decorative and durable finish.
process	
Reference	N/A



Location	Wet areas (e.g. WC's)
Description	Selected ceramic wall tile to plasterboard (moisture board to wet areas).
Lifecycle	Typical life expectancy of 35-40 years, less in wet room areas to 20-25 years.
Required	Bi-annual inspection to review damage, local repairs as necessary,
maintenance	particular detailed inspection in wet room areas.
Year	Annually
Priority	Medium
Selection	Wet room application requires moisture board and tiling.
process	
Reference	N/A

5.3 Ceilings

Location	Common areas & tenant amenity areas
Description	Selected paint finish with primer to skimmed plasterboard ceiling on
	metal frame ceiling system. Acoustic ceiling to lift core and apartment
	lobbies. Moisture board to wet areas.
Lifecycle	2-10 years for finishes; 40 years for plasterboard. Longer lifecycle
	achieved by regular inspection and maintenance regime to ensure the
	upkeep of materials.
Required	Regular maintenance required and replacement when damaged.
maintenance	
Year	Bi-annually
Priority	Low
Selection	Decorative and durable finish
process	
Reference	N/A

5.4 Internal Handrails & Balustrades

Location	Stairs & landings
Description	Mild steel painted balustrade and handrail.
Lifecycle	Over 40 years typical lifecycle. Longer lifecycle achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required	Regular inspections of holding down bolts and joints
maintenance	
Year	Annually
Priority	High
Selection	Hard-wearing long-life materials against timber options
process	
Reference	N/A



5.5 Carpentry & Joinery

5.5.1 Internal Doors and Frames

Location	All buildings
Description	Selected white primed and painted/varnished solid internal doors, or hardwood veneered internal doors
	 All fire rated doors and joinery items to be manufactured in accordance with B.S. 476 (Fire Tests). Timber saddle boards.
	Brushed aluminium door ironmongery or similar
Lifecycle	30 years average expected lifespan. Longer lifecycle achieved by
	regular inspection and maintenance regime to ensure the upkeep of
	materials.
Required	General maintenance in relation to impact damage and general wear
maintenance	and tear
Year	Annual
Priority	Low, unless fire door High
Selection	Industry standard
process	
Reference	N/A

5.5.2 Skirtings & Architraves

Location	All buildings
Description	Painted timber/MDF skirtings and architraves
Lifecycle	30 years average expected lifespan. Longer lifecycle achieved by regular inspection and maintenance regime to ensure the upkeep of materials.
Required	General maintenance in relation to impact damage and general wear
maintenance	and tear
Year	Annual
Priority	Low
Selection	Industry standard
process	
Reference	N/A

5.5.3 Window Boards

Location	All Buildings
Description	Painted timber/ Medium-density fibreboard (MDF) window boards
Lifecycle	30 years average expected lifespan
Required	General maintenance in relation to impact damage and general wear
maintenance	and tear
Year	Annual
Priority	Low
Selection	Industry standard
process	
Reference	N/A





6.0 BUILDING SERVICES

6.1 Mechanical Systems

6.1.1 Mechanical Plant

Location	Residential / Apartments
Description	Water Heating shall consist of Exhaust Air Heat Pumps, (EAHP) Further details to be provided by the M&E Consultant at detailed design stage.
Lifecycle	 Annual Maintenance / Inspection to Heating System Annual Maintenance of Exhaust Air Heat Pumps (EAHP) Annual Maintenance / Inspection to Heating and Water Pumps. Annual Maintenance / Inspection to Water Tanks. Annual Maintenance / Inspection to Water Booster - sets. Annual Maintenance / Inspection to DHS Tanks. Cost for replacement equipment to be updated on completion of design matrix of equipment at detailed design stage. Replacement of equipment at End of Life (EOL) to be determined at detailed design stage.
Required maintenance	Annual Service Inspections to be included as part of Development Planned Preventative Maintenance (PPM) Programme
Year	Annually
Priority	Medium
Selection process	All equipment to be detailed as part of the detailed design section of the development. This equipment will be selected in conjunction with the design and management team to meet and exceed the Chartered Institution of Building Services Engineers of Ireland's (CIBSE) recommended lifecycles.
Reference	N/A

6.1.2 Soils and Wastes

Location	All Areas / Kitchens / Bathrooms etc
Description	Soils and Wastes Pipework – uPVC above basement and High-Density Polyethylene (HDPE) in basement.
Lifecycle	 Annual inspections required for all pipework within landlord areas. Cost for replacement equipment to be updated on completion of design matrix of equipment at detailed design stage.
Required	Annual Service Inspections to be included as part of Development
maintenance	Planned Preventative Maintenance (PPM) Programme
Year	Annually
Priority	Medium
Selection process	All equipment to be detailed as part of the detailed design section of the development. This equipment will be selected in conjunction with the design and management team to meet and exceed the Chartered Institution of Building Services Engineers of Ireland's (CIBSE) recommended lifecycles.
Reference	N/A



6.1.3 Water Services

Location	Residential / Apartments
Description	 Exhaust Air Heat Pump (EAHP) The water services installation in the Landlord basement and core areas will be copper. Within the apartments, the water services installation will be completed using a Pre-Insulated Multi Layered Alu-Plex type system.
Lifecycle	 Annual Inspection of Exhaust Air Heat Pump (EAHP). Annual inspections required for all pipework within landlord areas. Cost for replacement equipment to be updated on completion of design matrix of equipment at detailed design stage.
Required	Annual Inspections, including legionella testing to be included as part
maintenance	of Development Planned Preventative Maintenance (PPM) Programme
Year	Annually
Priority	High
Selection	All equipment to be detailed as part of the detailed design section of the
process	development. This equipment will be selected in conjunction with the
	design and management team to meet and exceed the Chartered
	Institution of Building Services Engineers of Ireland's (CIBSE) recommended lifecycles.
Reference	N/A

6.1.4 Ventilation Services

Location	Residential / Apartments
	•
Description	Exhaust Air Heat Pumps. (EAHP)
	Continuous mechanical ventilation system within each apartment.
Lifecycle	Annual inspection of extract fan / and grilles
	Annual Inspection of operation of fan and boost / setback facility if
	provided on units.
	Cost for replacement equipment to be updated on completion of
	design matrix of equipment at detailed design stage.
Required	Annual Service Inspections to be included as part of Development
maintenance	Planned Preventative Maintenance (PPM) Programme
Year	Annually
Priority	Medium
Selection	All equipment to be detailed as part of the detailed design section of the
process	development. This equipment will be selected in conjunction with the
	design and management team to meet and exceed the Chartered
	Institution of Building Services Engineers of Ireland's (CIBSE)
	recommended lifecycles.
Reference	N/A



6.2 Electrical / Protective Services

6.2.1 Electrical Infrastructure

Location	Switch rooms / Risers
Description	Maintenance of Electrical Switchgear
Lifecycle	 Annual Inspection of Electrical Switchgear and switchboards. Thermographic imagining of switchgear 50% of Medium Voltage (MV) Switchgear Annually and Low Voltage (LV) switchgear every 3 years. Cost for replacement equipment to be updated on completion of design matrix of equipment at detailed design stage.
Required	Annual / Every three years to be included as part of Development
maintenance	Planned Preventative Maintenance (PPM) Programme
Year	Annually
Priority	High
Selection	All equipment to meet and exceed Electricity Supply Board (ESB),
process	IS10101:2020, Chartered Institution of Building Services Engineers of
	Ireland's (CIBSE) recommendations and be code compliant in all cases.
Reference	N/A

6.2.2 Lighting Services internal

Location	All Areas – Internal
Description	Lighting – Light-Emitting Diode (LED) throughout with Presence
	detection in circulation areas and locally controlled in apartments.
Lifecycle	Annual Inspection of All Luminaires
	Quarterly Inspection of Emergency Lighting.
	Cost for replacement equipment to be updated on completion of
	design matrix of equipment at detailed design stage.
Required	Annual / Quarterly Inspections certification as required per above
maintenance	remedial works.
Year	Annually / Quarterly
Priority	High
Selection	All equipment to meet requirements and be in accordance with the
process	current IS3217:2013 + A1 2017, Part M and Disability Access
	Certificate (DAC) Requirements.
Reference	N/A



6.2.3 Lighting Services External

Location	All Areas – Internal
Description	Lighting – All Light-Emitting Diode (LED) with Vandal Resistant
	Diffusers where exposed.
Lifecycle	Annual Inspection of All Luminaires
	Quarterly Inspection of Emergency Lighting
	Cost for replacement equipment to be updated on completion of
	design matrix of equipment at detailed design stage.
Required	Annual / Quarterly Inspections certification as required as per the
maintenance	Planned Preventative Maintenance (PPM) schedule.
Year	Annually / Quarterly
Priority	High
Selection	All equipment to meet requirements and be in accordance with the
process	current IS3217:2013 + A1 2017, Part M and Disability Access
	Certificate (DAC) Requirements.
Reference	N/A

6.2.4 Protective Services – Fire Alarm

Location	All areas – Internal
Description	Fire alarm
Lifecycle	Quarterly Inspection of panels and 25% testing of devices as per IS3218:2013 + A1 2019 requirements.
	 Cost for replacement equipment to be updated on completion of design matrix of equipment at detailed design stage.
Required	Annual / Quarterly Inspections certification as required as per the
maintenance	Planned Preventative Maintenance (PPM) schedule.
Year	Annually / Quarterly
Priority	High
Selection	All equipment to meet requirements and be in accordance with the
process	current IS3218:2013 + A1 2019 and the Fire Cert
Reference	N/A

6.2.5 Protective Services – Fire Extinguishers

Location	All Areas – Internal
Description	Fire Extinguishers and Fire Blankets
Lifecycle	Annual Inspection
Required	Annual with Replacement of all extinguishers at year 10
maintenance	
Year	Annually
Priority	Cost for replacement equipment to be updated on completion of design
	matrix of equipment at detailed design stage.
Selection	All fire extinguishers must meet the requirements of I.S 291:2015
process	Selection, commissioning, installation, inspection and maintenance of
	portable fire extinguishers.
Reference	N/A



6.2.6 Protective Services – Apartment Sprinkler System (Where Applicable by Fire Cert)

Location	Residential / Apartments.				
Description	Apartment Sprinkler System				
Lifecycle	Weekly / Annual Inspection				
Required	Weekly Check of Sprinkler Pumps and plant and annual testing and				
maintenance	certification of plant by specialist.				
Year	All				
Priority	Cost for replacement equipment to be updated on completion of design				
	matrix of equipment at detailed design stage.				
Selection	The Apartment sprinkler system shall be installed in accordance with				
process	BS 9251:2005 – Sprinkler Systems for Residential and Domestic				
	Occupancies – Code of Practice				
Reference	N/A				

6.2.7 Protective Services - Dry Risers

Location	Common Area Cores of Apartments				
Description	Dry Risers				
Lifecycle	Weekly / Annual Inspection				
Required	Visual Weekly Checks of Pipework and Landing Valves with Annual				
maintenance	testing and certification by specialist.				
Year	Annually				
Priority	Cost for replacement equipment to be updated on completion of design				
	matrix of equipment at detailed design stage.				
Selection	The system shall be installed in accordance with BS 5041 - Fire				
process	Hydrant Systems Equipment & BS 9999 – Effective Fire Safety in the				
	Design, Management and Use of Buildings.				
Reference	N/A				

6.2.8 Fire Fighting Lobby Ventilation (To Fire Consultants Design and Specification)

Location	Common Area Lobbies					
Description	Smoke Extract / Exhaust Systems					
Lifecycle	Regular Tests of the system					
	Annual inspection of Fans					
	Annual inspection of automatic doors and Automatic Opening Vents					
	(AOV)					
	All systems to be backed up by life safety systems.					
Required	Annual Service Inspections to be included as part of Development					
maintenance	Planned Preventative Maintenance Programme					
Year	Weekly / Annually					
Priority	Medium					
Selection	All equipment to be detailed as part of the detailed design section of the					
process	development. This equipment will be selected in conjunction with the					
	design and management team to meet and exceed the Chartered					
	Institution of Building Services Engineers of Ireland's (CIBSE)					
	recommended lifecycles.					
Reference	N/A					



6.2.9 Sustainable Services

Location	Residential / Apartment				
Description	Heat Pumps (EAHP)				
Lifecycle	 Annual Maintenance of Exhaust Air Heat Pumps (EAHP) Cost for replacement equipment to be updated on completion of design matrix of equipment at detailed design stage. 				
Required maintenance	Annual Service Inspections to be included as part of Development Planned Preventative Maintenance (PPM) Programme				
Year	Annually				
Priority	Medium				
Selection process	All equipment to be detailed as part of the detailed design section of the development. This equipment will be selected in conjunction with the design and management team to meet and exceed the Chartered Institution of Building Services Engineers of Ireland's (CIBSE) recommended lifecycles.				
Reference	N/A				

Location	Roof					
Description	Photovoltaic (PV) Panels.					
Lifecycle	Regular Tests of the system.					
	Annual inspection of Panels					
	Annual Clean of Panels.					
Required	Annual Service Inspections to be included as part of Development					
maintenance	Planned Preventative Maintenance Programme					
Year	Weekly / Annually					
Priority	Medium					
Selection	All equipment to be detailed as part of the detailed design section of the					
process	development. This equipment will be selected in conjunction with the					
	design and management team to meet and exceed the CIBSE					
	recommended lifecycles.					
Reference	N/A					





7.0 CONCLUSION & CONTACT DETAILS

Based on the information provided, Aramark Property have considered the schemes proposals. From our experience to date of similar schemes we manage, we have set out an overview of how we believe the overarching management of the scheme can be successfully managed in best practice for the benefit of the owners of this scheme and the future occupiers.

Contact Details

Darren Davidson

Director

E: Davidson-darren@aramark.ie

M: +353 83 450 8794 D: +353 1 871 5494

W: www.aramarkproperty.ie

Aramark Key Service Lines



DOCUMENT CONTROL SHEET

Client:	HIBERNIA STAR LIMITED	
Project Title:	JACOB'S ISLAND SHD	
Document Title:	BUILDING LIFECYCLE REPORT	

Rev.	Status	Author	Reviewed By	Issue Date
AP 01.	DRAFT	Conor Fahey	Dean Brassington	07/06/2022
AP 02.	FINAL	Conor Fahey	Dean Brassington	20/06/2022

