
Appendix 4.12 B
Site Investigation Report

THIS PAGE IS INTENTIONALLY BLANK



Appendix B. IGSL Site Investigation Report

IGSL Ltd

Lands at Halverstown

**Ground Investigation &
Geotechnical
Interpretative Report**

Project No. 24330

July 2023



**M7 Business Park
Naas
Co. Kildare
Ireland**

**T: +353 (45) 846176
E: info@igsl.ie
W: www.igsl.ie**

DOCUMENT ISSUE REGISTER

Distribution	Report Status	Revision	Date of Issue	Prepared By:	Approved By:
DOBA	Draft Report, PDF by email	0	31 January 2023	J. Lawler BSc MSc PGeo EurGeol FGS	P. Quigley BEng CEng MICE MIEI FGS RoGEP Adviser
DOBA	Draft Report, PDF by email	1	13 July 2023	J. Lawler	P. Quigley
DOBA	Report, PDF by email	2	18 July 2023	J. Lawler	P. Quigley

TABLE OF CONTENTS

Foreword

1. Introduction

2. Fieldworks

- 2.1 General
- 2.2 Trial Pits – including Additional Works April-May '23
- 2.3 Cable Percussion Boreholes
- 2.4 Dynamic Probing
- 2.5 Plate Bearing Testing
- 2.6 Soakaway Tests (to BRE 365) – including Additional Works April-May '23
- 2.7 Resistivity Survey
- 2.8 Rotary Drilling - Additional Works April-May '23
- 2.9 Rotary Open Hole Drilling - Additional Works April-May '23
- 2.10 Groundwater Monitoring
- 2.11 Gas Monitoring
- 2.12 Surveying of Exploratory Hole Locations

3. Laboratory Testing

4. Desk Study

5. Ground Conditions & Groundwater

- 5.1 Ground Profile – Superficial Deposits
 - 5.1.1 Area 1
 - 5.1.2 Area 2
 - 5.1.3 Area 3
- 5.2 Bedrock
- 5.3 Groundwater

6. Ground Assessment & Engineering Recommendations

- 6.1 General
- 6.2 Foundation Solutions
 - 6.2.1 DC Bld 1
 - 6.2.2 DC Bld 2
 - 6.2.3 DC Bld 3
 - 6.2.4 DC Bld 4
 - 6.2.5 DC Bld 5
 - 6.2.6 DC Bld 6
 - 6.2.7 GiS Sub
- 6.3 Earthworks & Ground Improvement
- 6.4 Groundwater / Infiltration
- 6.5 Slopes / Batters
- 6.6 Pavement Construction
- 6.7 Buried Concrete
- 6.8 Ground Gas
- 6.9 Environmental Testing - *Water*
- 6.10 Waste Acceptance Criteria [WAC] & Environmental Testing

References

FIGURES

Figure 1	- Site Location Plan
Figure 2A & 2B	- ca. 1940's OSI drawing for the Halverstown site and Modern (2013-2018) orthophotograph
Figure 3	- OSI 1897-1913 survey with 2004-2005 inset showing former extraction pits or 'Gravel Pit' at Halverstown, 350m west of the site.
Figure 4	- Quaternary Soils Plot for Halverstown Site
Figure 5	- Bedrock Geological Map for the Halverstown Site
Figure 6	- SPT Vs Depth plot for Open-holes TPRO-01, 02 & 03
Figure 7	- Mixed probe results in southern fields at Area 1
Figure 8A – 8B	- Sidewall photo of TP05 showing SILT over dense GRAVEL at 2.0m (78.91m OD). Boulder found in pit at 1.,80m measuring 1200mm
Figure 9	- SPT Vs Depth plot for BH01-BH04
Figure 10	- SPT Vs Depth plot for TPRO-04, TPRO-09 & RC03
Figure 11	- Tussock grasses in triangular-shaped field to east of Area 2. View SE.
Figure 12	- Sandy stratum from 1.20-2.40m in TP25
Figure 13	- Probe results for DP43
Figure 14	- Mixed probe results in the triangular field in Area 2
Figure 15	- Sidewall profile in BRE SA06
Figure 16	- SPT Vs Depth plot for TPRO-05, TPRO-06, TPRO-07 & RC01 / 01A & RC02
Figure 17A & 17B	- Upper organic soils in PB04 & PB05
Figure 18	- SPT Vs Depth plot for BH05-BH08
Figure 19A	- TP13 with firm silty CLAY from 2.40m to 2.70m
Figure 19B	- Spoil with excavated silty CLAY on top of heap
Figure 19C	- Sidewall stratigraphy in TP/RO08
Figure 19D	- TP/RO08 Spoil
Figure 20	- Probe blowcounts in dynamic probes DP18, DP25, DP27 and DP28 in the southern section of 'Area 3'
Figure 21A	- Sidewall in TP20 showing firm and firm to stiff clayey SILT and silty CLAY to 2.60m. A firm occasionally soft to firm blackish grey clayey SILT was logged from 2.60m to 3.0m (76.78m OD)
Figure 21B	- Sidewall collapse in BRE SA05
Figure 22	- SPT Vs Depth plot for TPRO-08, TPRO-10 & RC04
Figure 23	- Bedrock Geological Map for the Halverstown Site
Figure 24	- Bedrock cores from RC02
Figure 25	- Pulverised returns at the surface following open-hole drilling through crystalline calcite at RC01
Figure 26	- Is(50) strengths obtained from diametrial Point Load Strength Index testing
Figure 27	- Trial pits and boreholes where groundwater entry was recorded
Figure 28	- Sidewall collapse in grey silty SAND upon completion of TP/RO09 excavation
Figure 29	- DC Building Layout and ESB GiS Substation with 2023 investigation point overlay
Figure 30	- Probes positioned in NW corner of DC Building 3
Figure 31	- DP13 & DP14 profiles - both located towards the southeast of Building 4
Figure 32	- DP19 and DP28 profiles
Figure 33	- Probes positioned W to E across GiS Sub showing low N ₁₀₀ values for 1m bgl

TABLES

Table 1	- Water Monitoring and Sampling Dates at on site wells
Table 2	- Supplementary (2023) investigation points in Areas 1, 2 and 3
Table 3	- Occurrences of GRAVEL-dominant strata and waterstrikes in trial pits across the southern fields of 'Area 1'
Table 4	- Water measurements in on-site exploratory holes
Table 5	- Summary of Ground Gas (Peak) Measurements
Table 6	- Sample description of soils used in Earthworks testing
Table 7	- Summary Details of Laboratory Testing samples
Table 8	- Moisture Condition Value [MCV] at natural moisture content for overburden soil samples and MCV at varying % lime and % lime / cement content
Table 9	- Summary of CBR Tests at NMC and with addition of Lime / Lime-Cement Binders
Table 10	- Measured infiltration rates (f) expressed as exposed area (metre) per unit time (minute)
Table 11	- Equivalent CBR % Values obtained in Plate Bearing Testing
Table 12	- Elevated values (Water Analysis compared to EPA Interim Guideline Values & S.I. No.9 of 2010)

APPENDICES

Appendix 1	- Trial Pit Logs & Photographs
Appendix 1A	- Trial Pit Logs (TP/RO) & Photographs
Appendix 2	- Cable Percussion Borehole Logs
Appendix 3	- Dynamic Probe Records
Appendix 4	- Plate Bearing Test Records and Photographs
Appendix 5	- Soakaway Test Records
Appendix 5A	- Soakaway Test Records (BRE SA)
Appendix 6	- Resistivity Survey
Appendix 7	- Rotary Drillhole Logs & Photographs
Appendix 8	- Rotary Openhole Drilling Records
Appendix 9	- Groundwater Monitoring
Appendix 10	- Gas Monitoring
Appendix 11	- Geotechnical Laboratory Results (Soil)
Appendix 12	- Chemical / Environmental Laboratory Results (Soil)
Appendix 13	- Waste Characterisation Assessment (OCM)
Appendix 14	- Environmental Laboratory Results (Water)
Appendix 15	- Geotechnical Laboratory Results (Rock)
Appendix 16	- Exploratory Hole Location Plans

FOREWORD

The following conditions and notes on the geotechnical site investigation procedures should be read in conjunction with this report.

Standards

The ground investigation works for this project (**Lands at Halverstown**) have been carried out by IGSL in accordance with Eurocode 7 - Part 2: Ground Investigation & Testing (EN 1997-2:2007). This has been used together with complementary documents such as Engineers Ireland Specification for Ground Investigation (2nd Ed, 2016), BS 5930 (2015+A1:2020) and BS 1377 (Parts 1 to 9) and the following European Norms:

- EN 1997-2 Eurocode 7: 2007 – Geotechnical Design – Part 2: Ground Investigation & Testing
- EN ISO 22475-1:2006 Geotechnical Investigation and Sampling – Sampling Methods & Groundwater Measurements
- EN ISO 14688-1:2017 Geotechnical Investigation and Testing – Identification and Classification of Soil, Part 1: Identification and Description
- EN ISO 14688-2:2017 Geotechnical Investigation and Testing – Identification and Classification of Soil, Part 2: Principles for a classification
- EN ISO 14689-1:2017 Geotechnical Investigation and Testing – Identification, description & classification of rock

The Eurocode 7, Part 2 – Ground Investigation and Testing GI specification shall be read in conjunction with the Specification and Related Documents for Ground Investigation in Ireland, 2nd Edition, published by Engineers Ireland in 2016.

Reporting

No responsibility can be held by IGSL Ltd for ground conditions between exploratory hole locations. The engineering logs provide ground profiles and configuration of strata relevant to the investigation depths achieved and caution should be taken when extrapolating between exploratory points. No liability is accepted for ground conditions extraneous to the investigation points. Unless specifically stated, no account has been taken of possible subsidence due to mineral extraction, mining works or karstification below or close to the site.

This report has been prepared for DOBA Consulting Engineers and the information should not be used without their prior written permission. IGSL Ltd accepts no responsibility or liability for this document being used other than for the purposes for which it was intended.

Boring Procedures

Where required, 'shell and auger' or cable percussive boring technique is employed as defined by Section 6.3 of IS EN ISO 22475-1:2006. The boring operations, sampling and in-situ testing meet with the recommendations set out in IS EN 1997-2:2007 and BS 1377:1990 and EN ISO 22476-3:2005. The shell and auger boring technique allows for continuous sampling in clay and silt above the water table and sand and gravel below the water table (Table 2 of IS EN ISO 22475-1:2006).

It is highlighted that some disturbance and variation is unavoidable in particular ground (e.g. blowing sands, gravel / cobble dominant glacial deposits etc). Attention is drawn to this condition, whenever it is suspected. Where cobbles and boulders are recorded, no conclusion should be drawn concerning the size, presence, lithological nature, or numbers per unit volume of ground.

In-Situ Testing

Where required, Standard Penetration Tests (SPT's) are conducted strictly in accordance with Section 4.6 of IS EN 1997-2:2007. The SPT equipment (hammer energy test) has been calibrated in accordance with EN ISO 22476-3:2005 and the Energy Ratio (E_r). A calibration certificate is

available upon request. The E_r is defined as the ratio of the actual energy E_{meas} (measured energy during calibration) delivered to the drive weight assembly into the drive rod below the anvil, to the theoretical energy (E_{theor}) as calculated from the drive weight assembly. The measured number of blows (N) reported on the engineering logs are uncorrected. In sands, the energy losses due to rod length and the effect of the overburden pressure should be taken into account (see IS EN ISO 22476-3:2005).

Soil Sampling

Three categories of sampling methods are outlined in EN ISO 22475-1:2006. The categories are referenced A, B and C for any given ground conditions and are shown in Tables 1 and 2 of EN ISO 22475-1:2006. Reference should be made to EN 1997-2:2002 for guidelines on sample class and quality for strength and compressibility testing. Samples of quality classes 1 or 2 can only be obtained by using Category A sampling methods.

Class 1 thin wall undisturbed tube samples (UT100) were obtained in fine grained soils and strictly meet the requirements of EN 1997-2:2002 and EN ISO 22475-1:2006. Soil samples for laboratory tests are divided into five classes with respect to the soil properties that are assumed to remain unchanged during sampling, handling transport and storage. The minimum sample quality required for testing purposes to Eurocode 7 compatibility (EN 1997-2:2002) is shown in Table A.

Table A – Details of Sample Quality Requirements

EN 1997 Clause	Test	Minimum Sample Quality Class
5.5.3	Water Content	3
5.5.4	Bulk Density	2
5.5.5	Particle Density	N/S
5.5.6	Particle Size Analysis	N/S
5.5.7	Consistency Limits	4
5.5.8	Density Index	N/S
5.5.9	Soil Dispersivity	N/S
5.5.10	Frost Susceptibility	N/S
5.6.2	Organic Content	4
5.6.3	Carbonate Content	3
5.6.4	Sulphate Content	3
5.6.5	pH	3
5.6.6	Chloride Content	3
5.7	Strength Index	1
5.8	Strength Tests	1
5.9	Compressibility Tests	1
5.10	Compaction Tests	N/S
5.11	Permeability	2

N/S – not stated. Presume a representative sample of appropriate size.

Samples recovered from trial pits or trenches meet the requirements of IS EN ISO 22475-1. It is highlighted that unforeseen circumstances such as variations in geological strata may lead to lower quality sample classes being obtained.

Groundwater

The depth of entry of any influx of groundwater is recorded during the course of boring operations. However, the normal rate of boring does not usually permit the recording of an equilibrium level for any one water strike. Where possible, drilling is suspended for a period of twenty minutes to monitor the subsequent rise in water level. Groundwater conditions observed in the borings or pits are those appertaining to the period of investigation. It should be noted however, that groundwater levels are

subject to diurnal, seasonal and climatic variations and can also be affected by drainage conditions, tidal variations etc.

Engineering Logging

Soil and rock identification has been based on the examination of the samples recovered and conforms with IS EN ISO 14688-1:2017 and IS EN ISO 14688-2:2017. Rock weathering classification conforms to IS EN ISO 14689-1:2017 along with discontinuities (bedding planes, joints, cleavages, faults etc) as classified in Section 6.4 of IS EN ISO 14689-1:2017 and Annex C of same. Rock mechanical indices (TCR, SCR, RQD) are defined in accordance with IS EN ISO 22475-1:2006.

Where peat has been encountered, samples have been logged in accordance with the Von Post Classification (ref. Von Post, L. 1992. Sveriges Gologiska Undersoknings torvinventering och nogra av dess hittills vunna resultat (SGU peat inventory and some preliminary results) Svenska Mosskulturforeningens Tidskrift, Jonkoping, Swedden, 36, 1-37 and Hobbs N. B. Mire morphology and the properties of some British and foreign peats. QJEG, Vol. 19, 1986.

Retention of Samples

After satisfactory completion of all the scheduled laboratory tests on any sample, the remaining material will be discarded. Unless a period of retention of samples is agreed, it is our normal practice to discard all soil samples one month after submission of our final report.

1. INTRODUCTION

At the instruction of DOBA Consulting Engineers, IGSL has carried out a ground investigation at a greenfield site in the townland of Halverstown, 2.5 kilometres west of the town of Naas, Co. Kildare. The site comprises a number of connected field enclosures, all contained within one farm, centred around a now derelict, former family homestead with functioning farmyard / outbuildings. The site is located to the south of the R409 Regional Road and directly west of the M7 Motorway. The M7 Business Park is located to the south and south east of the site with the Osberstown Industrial Park to the northeast.

Figure 1 – Site Location Plan (perimeter outlined in red)



Retrieved from Google Earth Professional 08/2022

Two high voltage transmission lines run across the property with a three-phase line also running north-south through the farm. The site is relatively flat lying, falling towards a stream which forms the southern boundary. Levels range from 85m OD in the northwest to 77.6m OD in the southeast. Intrusive investigation locations were set out as per the J&L Surveys Limited drawing entitled "Lands at Halverstown, Naas, Co. Kildare." Micro-siting was performed where proposed locations were found to lie too close to tress, field boundaries / ditches or in proximity to the hazard zone of overhead power lines. ESB Networks HV Transmission overseers were contacted ahead of works

commencing to inform them of our presence on site and of the safety measures to be employed when moving plant on site.

The investigation comprised cable percussion boreholes, machine-dug trial pits, dynamic probes, in situ plate load testing and soakaway testing (to BRE365). A resistivity survey was undertaken by Minerex Geophysics Limited.

Following a review of the findings from the initial investigation, a supplementary investigation comprising rotary cored drillholes, rotary openholes along with machine excavated trial pits and soakaway tests were undertaken. The investigations were executed in accordance with BS 5930, Code of Practice for Site Investigations (2015+A1:2020) and EN 1997-2 Eurocode 7 Part 2 Ground Investigation & Testing and supervised by an IGSL geotechnical engineer.

Geotechnical, chemical and environmental laboratory testing was scheduled on a range of soil samples with an environmental suite of testing also conducted on water samples retrieved from the standpipe wells and the neighbouring stream. The geotechnical testing included moisture contents, Atterberg Limits, compactions and MCV testing among others. Varying percentage lime and cement binder was added to samples to investigate any improvement in performance under subsequent CBR and MCV testing. Chemical testing was undertaken to BRE SD-1 on both natural 'as received' samples and on the soil stabilised samples (analysis ongoing). Environmental tests were undertaken on soil samples (RPS Suite A, B, C & E - WAC *Rifta* suite) to assess suitability for off-site disposal to landfill and/or Soil Recovery Facility. Rock strength tests were undertaken on the recovered cores.

In addition to presenting the field and laboratory test records this report provides an interpretation of the data and an assessment of the key geotechnical issues. In addition, a separate Waste Characterisation Report was prepared by O'Callaghan Moran Environmental Consultants, conducted in accordance with the Environmental Protection Agency (EPA) Guidelines on the Classification of Waste (2015). It assesses the environmental test results and apportions a List of Waste classification for each of the nominated samples. Based on that appraisal, a particular waste management option is generated for each analysed sample. This report is presented separately in Appendix 13.

2. FIELDWORK

2.1 General

The initial tranche of IGSL Limited fieldworks were undertaken in October and November 2022. The works completed on site comprised the following:

- Trial Pits (34 No.)
- Cable Percussion Boreholes (14 No.)
- Dynamic Probing (55 No.)
- Plate Bearing Testing (23 No.)
- Soakaway Tests (to BRE 365) (14 No.ⁱ)
- Resistivity Survey
- Groundwater Monitoring / Sampling
- Gas Monitoring
- Surveying of Exploratory Hole Locations

ⁱ A second shallow soakaway test (SA05B) was conducted at location SA05 following interception of water in SA05A at 1.70m bgl

Supplementary works were undertaken during April and May 2023 following a review of the findings from the 2022 investigation. The additional works comprised:

- Trial Pits (TP RO) (10 No.)
- Soakaway Tests (BRE SA) (6 No.ⁱⁱ)
- Rotary Drilling
- Rotary Openhole Drilling
- Groundwater Monitoring
- Surveying of Exploratory Hole Locations

ⁱⁱ Soakaway tests were conducted in only two of the six pits due to sidewall instability and groundwater ingress during excavation.

2.2 Trial Pits

Trial pitting was undertaken at thirty-four locations across the site ca. 90 acre site. The locations were set out as per the J&L Surveys Limited drawing entitled “Lands at Halverstown, Naas, Co. Kildare.” The trial pits were excavated, logged and sampled under the direction of an IGSL geotechnical engineer in accordance with BS 5930 (2015+A1:2020). Bulk disturbed samples (typically 20 to 30kg) were taken as the pits progressed.

The bulk samples were placed in heavy-duty polyethylene bags and sealed before being transported to Naas for laboratory testing. The trial pits were backfilled with the as-dug arisings and reinstated to the satisfaction of IGSL’s site geotechnical engineer. The trial pit logs and photos are presented in Appendix 1 and include descriptions of the soils encountered, groundwater conditions and stability of the pit sidewalls.

Additional trial pits were undertaken in April and May 2023 at ten locations across the site. The pits were excavated with a 13 tonne tracked excavator. Pits were extended from 2.30m to 3.60m with sidewall collapse and groundwater entry generally limiting the depths attainable on site. The pit logs and photographs are presented in Appendix 1A.

2.3 Cable Percussion Boreholes

Cable percussive boring (200mm diameter) was undertaken at fourteen locations using a Dando 2000 rig. The boreholes extended to depths of between 1.10m and 3.90m. At all locations, boring commenced through hand-dug service inspection pits. Disturbed bulk samples were recovered at 1m intervals or change of strata during boring and these are denoted ‘B’ on the engineering logs.

Standard Penetration Tests (SPT's) were performed in the boreholes and given the nature of the soils, a solid cone was used. It is noted that the SPT N-Values reported are the number of blows for 300mm increment penetration (e.g. BH01 at 1.0m where N=10). These exclude the seating blow values, which represent the initial 150mm depth of penetration. Where partial penetration was achieved during testing, the number of blows is shown for the actual penetration depth achieved (e.g. BH06 at 1.0m where N=48/225mm). In accordance with Eurocode 7, the SPT hammer has been calibrated and the energy ratio (Er) value is incorporated on the engineering logs. It is highlighted that the SPT N-Values reported on the engineering logs are uncorrected for energy ratio.

Descriptions of the soils encountered, in-situ tests undertaken and samples recovered are presented on the borehole records in Appendix 2. Details of groundwater strikes and hard strata boring (i.e. chiselling) are also presented on the aforementioned records.

2.4 Dynamic Probing

In-situ "Heavy" dynamic probing (DPH) was performed at fifty-five locations using a compact crawler rig. The tracked Archway probing unit meets the requirements of BS 1377, Part 9 (1990) and IS EN 1997-2:2007. The probing rig utilized a 50kg drop weight and 500mm drop height with a 60° cone. In accordance with the standards, the number of blows required to drive the cone each 100mm increment into the sub-soil was recorded. Probing is generally terminated when blow counts, N_{100} values, exceed 25, in order to avoid damage to equipment. The probe records are presented in Appendix 3 and include blow-counts in both numerical and graphical format.

2.5 Plate Bearing Testing

Plate bearing tests were conducted at twenty-three locations at depths ranging 0.40m to 0.60m below ground level [bgl]. Plate testing was undertaken to evaluate the modulus of sub-grade reaction (K_s) and equivalent CBR value. A 450mm diameter plate was used for the tests with kentledge provided by a mechanical excavator. Two load cycle tests were performed and the load / settlement plots, K_s and equivalent CBR values are presented in Appendix 4.

2.6 Soakaway Tests (to BRE 365)

Fourteen number infiltration tests were performed to assess the suitability of the sub-soils for dispersion of storm water through a soakaway system. The infiltration tests were each performed in accordance with BRE Digest 365 'Soakaway Design'. To obtain a measure of the infiltration rate of the sub-soils, water was poured into each test pit, with records taken of the fall in water level against time. Following the first soak cycle, the procedure was repeated to ensure saturation of the sub-soils. The infiltration rate is the volume of water dispersed per unit of exposed area per unit of time, and is generally expressed as metres / minute or metres / second. Designs are based on the slowest infiltration rate, which is generally calculated from the final soak cycle. The soakaway design logs are presented in Appendix 5. Two soak test locations (a deep soak pit initially followed by a shallow soak pit) were constructed at location SA05 due to water ingress in the first attempted pit.

Additional soakaway tests were scheduled for the April 2023 re-visit. Of the six locations, actual tests were only possible in two of the opened pits. This was attributable to the poor sidewall stability witnessed during pit construction. Instability was often accompanied by groundwater entry. Where groundwater entered prior to achieving test depth, no soakaway test was performed. SA01 and SA06 saw tests run with limited success. As with the additional pits, the soak pits were excavated using a 13 tonne tracked excavator. The soakaway test logs together with pit logs and photographs are presented in Appendix 5A.

2.7 Resistivity Survey

A resistivity survey was conducted by Minerex Geophysics Limited. It consisted of two different methods. The methodology employed used both Vertical Electrical Sounding (VES) and Soil Resistivity (SR) in the Wenner electrode configuration at a range of electrode spacing agreed with the client prior to the fieldwork. The increase in the electrode spacing leads to an increase in the

depth - the VES permitting deeper soundings and Soil Resistivity Tests shallow. The Minerex report is presented in Appendix 6.

2.8 Rotary Drilling - Additional Works April-May '23

Rotary drilling was carried out at five locations (holes denoted RC_) using a tracked Comacchio GEO-205 top-drive rig. This hydraulic rig utilised Symmetrex drilling system within the superficial deposits and through initial fractured rockhead, with coring techniques deployed in the underlying bedrock. Coring was also attempted in CLAY intercepted at depth in RC01A. Rotary core drilling produced 78mm diameter cores which, in bedrock, was logged as variably weak to strong, thickly to thinly bedded, pale to mid bluish grey fine-grained LIMESTONE. The limestone was likely locally slightly dolomitised, with stromatolitic structure and abundant calcite veining. The rock was further described as slightly weathered. In the case of RC01 and RC01A, crystalline calcite was noted at depth in the rock record with a complete absence of competent limestone bedrock.

The cores were placed in 3m capacity timber boxes and logged by an IGSL engineering geologist. This included photography of the cores with a digital camera. Where rock core was recovered, a graphic fracture log is also presented alongside the mechanical indices. This illustrates the fracture state of the rock cores and allows easy identification of highly fractured / non-intact zones and discontinuity spacings. It should be noted that no correction for dip of the joints has been made and that the spacings shown are successive joint / core intersections within the core.

The core log record is presented in Appendix 7 and this includes engineering geological descriptions, details of the bedding / discontinuities and mechanical indices (TCR, SCR and RQD's) for each core run. Core photographs are also presented in Appendix 7 and these illustrate the structure and fracture state of the bedrock.

2.9 Rotary Open Hole Drilling - Additional Works April-May '23

Rotary Open-Hole [TPRO_] drilling was carried out at ten locations on site. The holes (TPRO-01 to TPRO-10) were carried out using a tracked Comacchio GEO-205 top-drive drill rig and extended to a maximum depth of 5.20m bgl. Wells installed in the holes permit groundwater monitoring. SPT testing was undertaken during open-hole drilling with the resulting test records featuring on the logs in Appendix 8.

Symmetrex open-hole drilling was utilised within the overlying superficial deposits stopping shy of the underlying bedrock (not intercepted). The groundwater monitoring standpipes installed consisted of 50mm diameter HDPE pipework with proprietary 1mm slots and incorporated a pea gravel filter pack and cement / bentonite grout seal. Headwork covers were concreted in place. The drilling records are presented in Appendix 8.

2.10 Groundwater Monitoring

The initial fieldworks period saw the installation of standpipes in five newly constructed cable percussion boreholes. The standing groundwater levels in each of the installations was measured following the fieldworks. Groundwater levels were measured using an electric dipmeter. The levels recorded are shown in Appendix 9. The dates of monitoring are shown in Table 1.

Water sampling was undertaken during the first monitoring visit (02-Dec-22). Prior to sampling, installations were developed in accordance with ISO 14868 (2003) and then purged of three times well volume (in accordance with BS 6068). Water samples were dispatched to Chemtest Laboratories (UK) under controlled conditions (ice packed cooler box) to preserve the integrity of the individual samples.

The additional works saw the introduction of a further fourteen wells across the site. Of the fourteen, ten were placed in the holes constructed using Symmetrex openholing methods with a further four in the rotary core drillholes.

Table 1 – Water Monitoring and Sampling Dates at on site wells

Borehole Water Monitoring Dates	Borehole Water Sampling Date
02-12-22	02-12-22 (excl. BH05)
19-12-22	-
10-07-23	-

2.11 Gas Monitoring

Following installation of 50mm diameter standpipes in the four cable percussion boreholes, a gas tap was fitted to each well (BH03, BH10, BH12, BH13). This enabled gas monitoring post project completion. Gas level measurements, taken in accordance with CIRIA C665:2007, were performed using a calibrated GA5000 gas monitor. Both steady state and peak gas results are presented in Appendix 10 accompanied by groundwater measurements. The flow rate measurements recorded by the GA5000 were logged after the initial gas quantification readings were taken. The unit does not allow for simultaneous monitoring of gas quantities and gas flow. At all times the Geotech GA5000 portable gas analyser was used as per the guidelines whilst conforming to the on-screen notifications.

2.12 Surveying of Exploratory Hole Locations

Following completion of the exploratory works, surveying was carried out using GPS techniques. Co-ordinates (x, y) were measured to Irish Transverse Mercator and ground levels (z) established to Malin Head. The co-ordinates and ground levels are shown on the exploratory hole logs with locations shown on the exploratory hole plan in Appendix 16.

3. LABORATORY TESTING

Geotechnical laboratory testing was carried out at IGSL's INAB-accredited laboratory in accordance with BS1377; British Standard Methods of Test for Soils for Civil Engineering Purposes; British Standards Institute:1990. Soil testing was performed on selected trial pit samples and included tests to assess earthwork characteristics (MCV & CBR) and trial mix testing by the addition of lime to re-engineer the soils as high strength fill ('ground improvement'). A number of fine-grained samples were selected for testing with 1%, 2% and 3% lime (calcium oxide) or a combination of lime and cement binders. The geotechnical laboratory test results will feature in Appendix 11.

Five soil samples were selected for Waste Acceptance Criteria (WAC) analysis as per the *Rilta* set of testing (RPS Suite E). The results can be used to classify the material with regard to its potential for disposal to landfill. A further thirty-one soil samples were selected for analysis using RPS Suites A, B and C. These results are enclosed in Appendix 12. The chemical analysis tests on natural soil samples, in addition to testing on soils following treatment with cement / lime binders (to BRE SD1), also feature in Appendix 12.

A Waste Characterisation Report, prepared by O'Callaghan Moran Environmental Consultants, will assess the environmental test results arising from RPS Suite E / 'IGSL *Rilta*' testing. A 'List of Waste' classification and a particular waste management option for each of the five samples is included in that report. The reports features in Appendix 13.

Water samples were taken from three of the four wells - BH10 was found to be dry. Prior to sampling, installations were developed in accordance with ISO 14868 (2003) and then purged of three times well volume (in accordance with BS 6068). In addition to the well samples, two stream samples were collected from points along the sites' southern boundary. Samples were dispatched to Chemtest in December 2022. The resulting environmental analysis features in Appendix 14 (Report 22-47891).

Point load strength index (PLSI) tests were conducted on selected core samples. These are presented in Appendix 15.

4. DESK STUDY

The site comprises a number of field enclosures separated by mature tree-lined hedgerows. The 6" Cassini map (retrieved from the OSI website) shows the central farmyard but also reveals the presence of a bronze age 'Fulacht Fia'. The online Historic Environment Viewer on the National Monuments Service website (archaeology.ie) also highlights the presence of this prehistoric feature and notes the following;

"Some 30m N of a small, NW-flowing stream in well-drained, level pasture. Described in 1985 as horseshoe-shaped mound (diam. c. 6m N-S; H. 1m) open towards the S (SMR file). No obvious surface trace survived in 2000, but the area, although recently drained with a plastic field-pipe (Wth 0.5m; D 0.3m) just N of the site was still wet and rushy to the SE of the site. Sub-surface features may survive intact."

Figure 2A & 2B – ca. 1940's OSI drawing for the Halverstown site and Modern (2013-2018) orthophotograph

Fig 2A

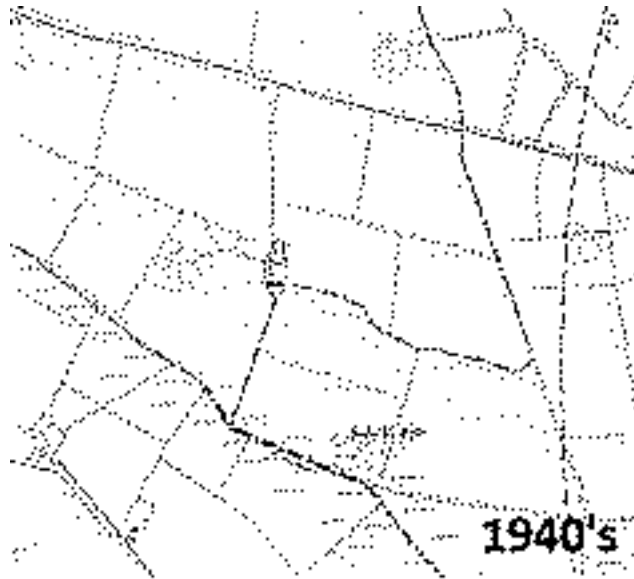


Fig 2B



From the 2013-2018 aerial image (Fig 2B), some of the lower lying areas can be identified as they are covered in tussocky grasses which appear light brown in colour. The areas are located towards

the southern fringe of the site and in the northeastern triangular-shaped field. The construction in 1983 of the adjacent motorway, then the Naas Motorway Bypass, bisected the farmland. Truncated hedgelines can be identified in the landscape to this day both east and west of the motorway.

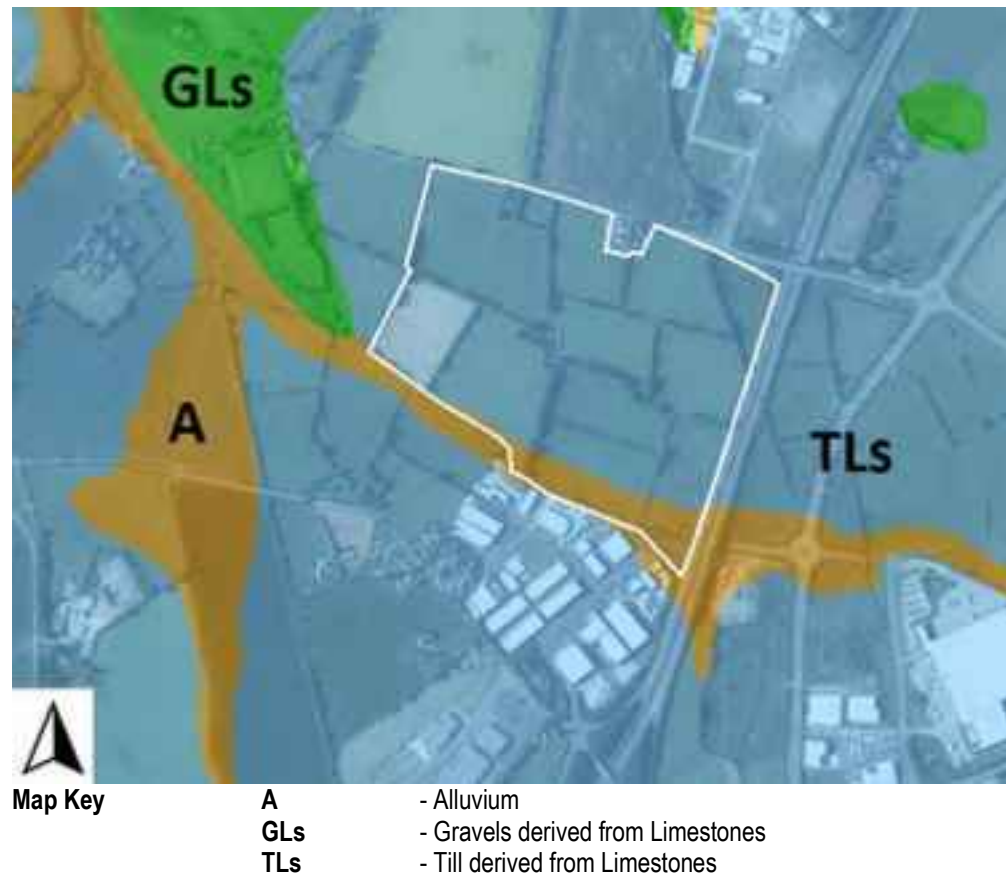
The OSI drawing dated 1897-1913 (Figure 3) shows the presence of a series of NW-SE trending 'Gravel Pit' open pits located ca. 350m west of the site (site outlined in red). The scar on the landscape can be viewed clearly in the OSI 2004-2005 aerial image. The western site boundary is lined in red.

Figure 3 – OSI 1897-1913 survey with 2004-2005 inset showing former extraction pits or 'Gravel Pit' at Halverstown, 350m west of the site. Dashed section equals approximate area shown in 2004-2005 orthophotograph.



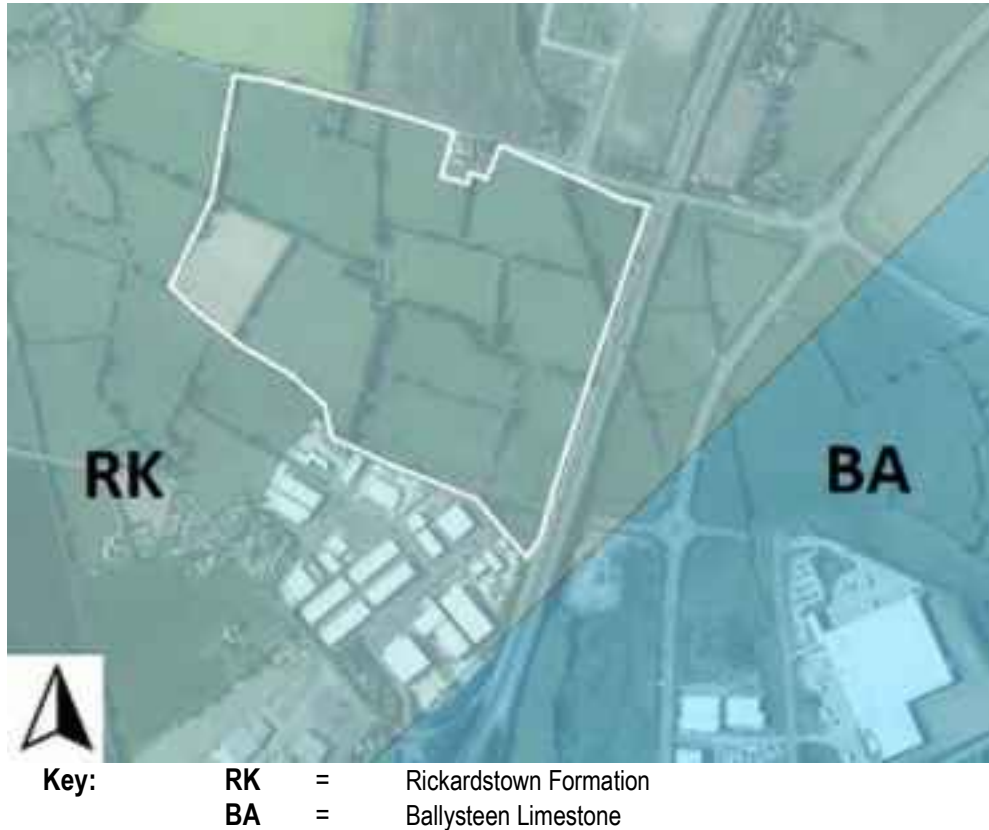
The Quaternary Soils map indicates the presence of both natural glacial till and alluvial deposits. The majority of the site is highlighted as being underlain by 'Till derived from Limestones' (Figure 4).

Figure 4 – Quaternary Soils Plot for Halverstown Site (site outlined)



Reference to the GSI map for the area (Figure 5, 1:100,000 Solid Geology series) shows that the site is underlain by the Carboniferous, Viséan-aged Rickardstown Formation. The rock formation consists of cherty often dolomitised limestone. No outcrops were found on site. Rotary drilling was carried out at five locations and proved a variably weak to strong limestone bedrock described as thickly to thinly bedded, pale to mid bluish grey fine-grained LIMESTONE. Crystalline calcite was unearthed at depth in coreholes RC01 and RC01A.

Figure 5 - Bedrock Geological Map for the Halverstown Site (retrieved from GSI website)



5. GROUND CONDITIONS & GROUNDWATER

5.1 Ground Profile – Superficial Deposits

The following is a summary of the ground conditions encountered across the ca. 90 acre site. The summary is presented in three parts. The works to the west of the access lane (off the R409) comprise 'Area 1'. The fields to the east of the main access lane are termed 'Area 2'. Finally, the fields to the southeast of the centrally located farmyard are termed 'Area 3'. This area includes the lowest lying area of the farm.

The newly completed intrusive locations (April / May 2023) are included in the synopsis with the information used to enhance the findings for each of Areas 1, 2 and 3 (as per Table 2).

Table 2 – Supplementary (2023) investigation points in Areas 1, 2 and 3

Exploratory Hole Locations	Area 1 (West)	Area 2 (East)	Area 3 (South)
Trial Pits	TP/RO 01 TP/RO 02 TP/RO 03 TP/RO 04 TP/RO 09	TP/RO 05 TP/RO 06 TP/RO 07	TP/RO 08 TP/RO 10
Soakaway Pits & Tests	BRE SA01 BRE SA02 BRE SA03 BRE SA04	BRE SA06	BRE SA05
Rotary Open-Hole Wells	TPRO-01 TPRO-02 TPRO-03 TPRO-04 TPRO-09	TPRO-05 TPRO-06 TPRO-07	TPRO-08 TPRO-10
Rotary Drillhole	RC03	RC01 RC01A RC02	

5.1.1 Area 1

In the northwest, ground levels along the R409 road boundary measure approximately 85m OD (DP50). These fall to 77.3m OD (PB03) towards the M7 Business Park in the southeast. The boreholes extended to depths ranging 1.80m to 3.90m without reporting bedrock. Rotary open-holes were extended in overburden to 5.20m bgl. Rotary core drillhole RC03 proved rock at a depth of 8.80m bgl (70.57m OD).



Of the fifteen trial pits in 'Area 1' constructed during the initial phase of the investigation, each reported completion depths ranging 2.30m to 3.0m. The pits in the supplementary investigation (listed in Table 2) also ranged from 2.30m to 3.0m in depth. Twenty-nine probes were undertaken, the deepest of which achieved a termination depth of 4.90m (DP14). Some probes terminated at a shallow 1.0m bgl. In 2023, four additional soakaway pits were excavated to depths ranging 2.50m to 3.0m. However, due to sidewall instability and water ingress, soakaway testing was only undertaken in one pit (SA BRE01).

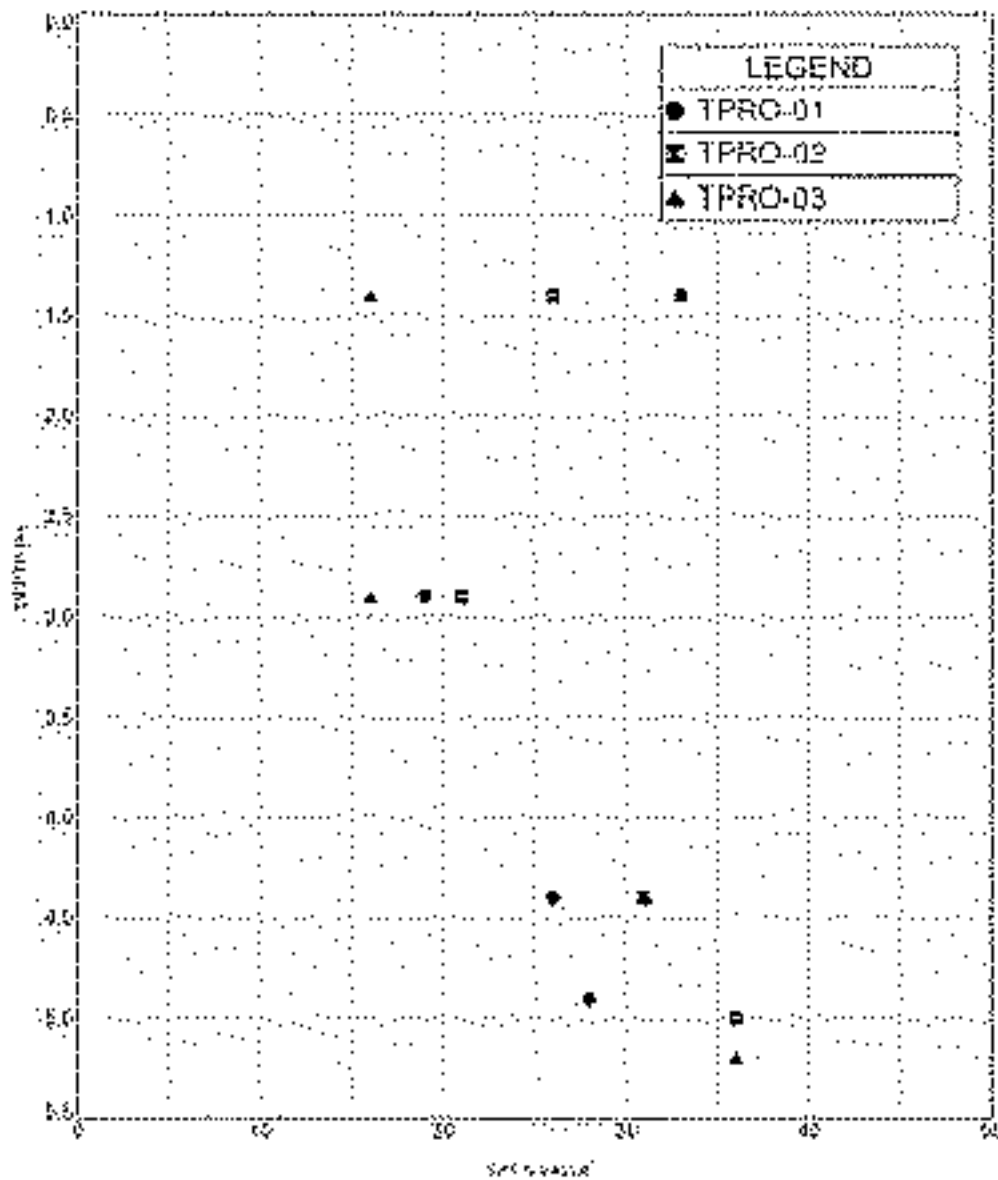
TOPSOIL

- In the northern half of 'Area 1' (the northernmost field), the topsoil noted varies in thickness from 0.15 to 0.40m. In the case of BH13, no topsoil was remarked. Given the consistent recording of between 0.30m and 0.40m of topsoil in trial pits, this is likely to be a more reliable measurement.
- In the southern half of 'Area 1' (the two fields to the south), a 200 to 400mm thick cover of topsoil was logged. The mantle of topsoil appears to have been omitted from the borehole records.

GLACIAL DEPOSITS

Area 1 - Northern Field

- A firm brown and brownish orange very sandy gravelly slightly silty CLAY was reported underlying topsoil in all trial pits in the northern half of 'Area 1'. Hand vanes were regularly undertaken in this layer which extended to a depth of between 0.80m and 0.90m bgl. Resulting shear vane values show a progressive stiffening with depth, with an improvement in values when comparing test results obtained from 0.20m bgl to 0.50m bgl depth. The values from the 0.50m horizon measured between 60 and 80kPa indicative of firm to stiff soils. Vanes attempted at ca. 0.70m bgl in the additional pits returned shear values ranging 65 – 110 indicative of stiff and firm to stiff soil. It was remarked that the soils at this depth were often 'too gravelly' to complete a vane test.
- The four trial pits in the northern section of 'Area 1' each reported firm to stiff and stiff becoming very stiff soil with depth beyond 0.80m and 0.90m (TP31-TP34). Corroborating this increase in stiffness, dynamic probes generally show a progressive increase in N_{100} values with shallow refusals found in numerous probes (DP33-DP36, DP49 & DP54) at depths ranging 1.0m to 1.70m.
- Of the three open-holes carried out in the northern field (TPRO-01, 02 & 03), SPT values indicate firm to stiff soils from 1.50m. There was negligible improvement at 3.0m but some stiffening noted from 4.50m depth (See Figure 6).

Figure 6 – SPT Vs Depth plot for Open-holes TPRO-01, 02 & 03

- There are incidences of consecutive zero N_{100} values found in probes extending from ground level throughout the same area, namely DP51 to 1.40m bgl, DP52 to ca. 0.70m, DP53 to ca. 0.80m and DP55 to 0.90m (See Figure 33). It is assumed that these probes, rather than passing through very soft or soft soils, are in fact penetrating a predominantly fine sand deposit. A firm very sandy slightly gravelly silty CLAY was logged in a number of trial pits. This type of stratigraphy, occasionally becoming more sand-dominant at shallow levels, would explain the mixed probe results obtained locally.
- Plate test results in the same area suggest soft to firm soils at depths of 0.50m. A SPT N-value of 3 was recorded at 1.0m in BH14 which again highlights the presence of loose, likely sand-dominant upper soils. SPT N-values improved significantly with depth.

- The deepest probe in the area, DP50, achieved a depth of 4.10m bgl (80.95m OD) and shows a consistent N_{100} value of ≥ 6 from a depth of 0.80m bgl. This suggests the presence of uniformly stiff soils beyond the initial upper layer.
- Trial pit TP/RO01 indicates soft to firm grey brown very sandy very gravelly CLAY at a depth of 1.80-2.30m. However, no softening was reported in the corresponding open-hole SPT testing. The softening may be related to water softening and/or disturbance upon bucket excavation.
- Three of the additional pits (TP/RO01, TP/RO02 & BRE SA01) reported deep-seated sandy clayey GRAVEL from 2.30m (81.80m OD), from 1.20m (81.38m OD) and from 2.40m (82.33m OD). A very gravelly sand layer was also remarked in TP/RO02 from 1.80-2.20m bgl. Seepages were coincident with these lower granular strata along with instability.
- The most pronounced ("rapid") water strikes occurred in both TP/RO03 at 2.0m (79.59m OD) in a sandy very gravelly CLAY and in pit BRE SA02 at 2.60m (79.63m OD) in a slightly sandy very gravelly CLAY. It appears from pitting that water-charged granular deposits underlie the Northern Field interspersed with firm to stiff and stiff CLAY-dominant soils. This is further reinforced by the findings of rotary open-hole TPRO-01 and TPRO-02. Clay-dominant TPRO-03 did not encounter any gravel deposits to a depth of 5.20m nor was there any water strike intercepted during its construction.

Area 1 – Southern Fields

- Beneath the upper cover of topsoil, a firm grey very sandy slightly clayey SILT was noted in many trial pits. This was found to persist to ca. 1.50m bgl. In places, the silt was replaced by brownish grey gravelly clayey SAND with localised sand lenses, e.g., TP02 from 0.80–0.90m, or sand pockets, e.g., TP01 from 1.60m to 2.60m.
- Gravelly clayey SAND layers were intercepted within the first metre of pits TP02 and TP03. A brownish grey very gravelly silty SAND with cobbles and boulders was intercepted at depth in TP03 (2.20-2.90m). In the case of TP10, a greyish brown gravelly SAND was found from 0.80m to 1.60m bgl. Strata in the area were generally remarked as 'very sandy'.
- Dense brown silty sandy GRAVEL was frequently found at depth in a number of pits. Table 3 lists the frequent intervals where it was observed during pitting.

Table 3 – Occurrences of GRAVEL-dominant strata and waterstrikes in trial pits across the southern fields of ‘Area 1’

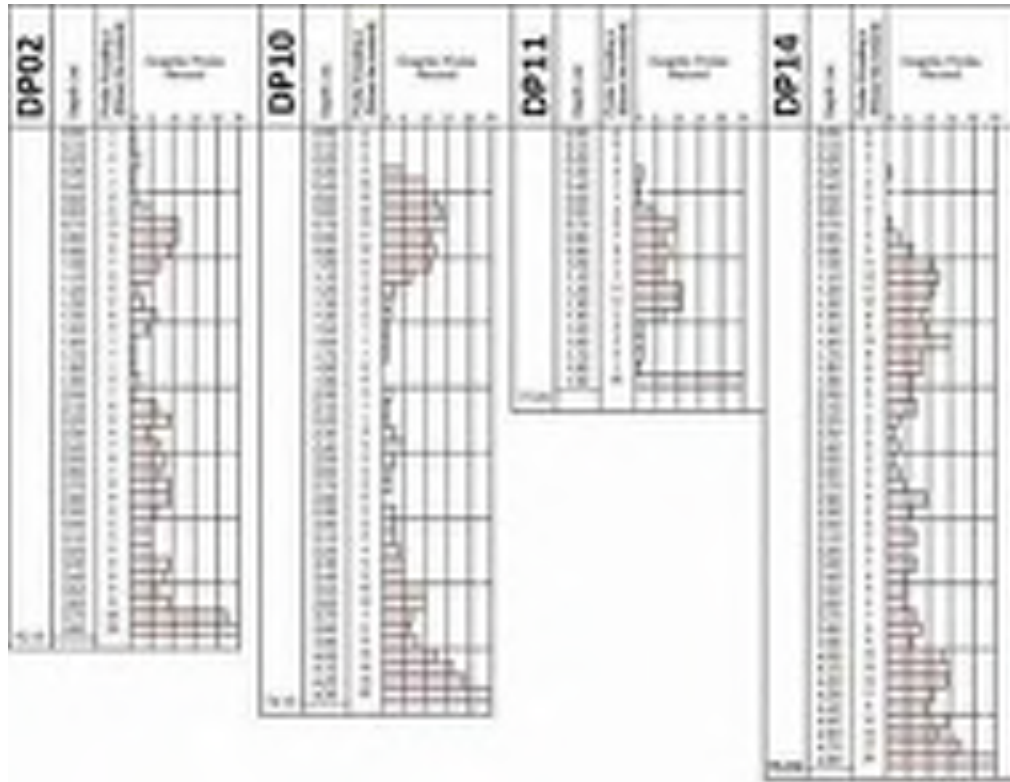
Trial Pit No.	GRAVEL STRATUM Depth m bgl (m OD)	DESCRIPTION	Waterstrike m bgl (m OD)
BRE SA03	0.30 (79.38) to 1.10 (78.58) and again from 2.0 (77.68) to base of pit (77.18)	Initially brownish grey very sandy GRAVEL with a low cobble content Secondly, a grey sandy clayey GRAVEL with a high cobble and medium boulder content	1.40 (78.28) – Seepage 2.40 (77.28) – Rapid
TP01	2.60 (77.03) to base of pit at 2.90 (76.73)	Brown silty sandy GRAVEL with a medium cobble content	2.90 (76.73) – Seepage
TP/RO04	1.70 (78.65) to base of pit at 2.30 (78.05)	Grey brown sandy very clayey GRAVEL with a high cobble content and occasional boulders	1.80 (78.55) – Rapid
TP05	2.0 (78.91) to base of pit at 2.90 (78.01)	Brown silty sandy GRAVEL with a medium cobble content	2.90 (78.01) – Seepage
TP07	2.20 (78.59) to base of pit at 2.80 (77.99)	Brown silty sandy GRAVEL with a medium cobble content	2.80 (77.99) – Seepage
TP08	2.30 (78.09) to base of pit at 3.0 (77.39)	Brown silty sandy GRAVEL with a medium cobble content	3.0 (77.39) – Seepage
TP09	1.60-2.40 (78.06 to 77.26)	Brown silty sandy GRAVEL with a medium cobble content	2.50 (77.16) – Seepage
BRE SA04	0.30 (78.01) to 1.20 (77.11)	Grey sandy slightly clayey GRAVEL with a high cobble content	Multiple seepages 0.70 (77.61) 1.20 (77.11) 1.50 (76.81)
TP/RO09	0.30 (77.01) to 1.0 (76.31) underlain by slightly gravelly silty SAND to pit base at 2.80 (74.51)	Grey very sandy silt SAND with rare cobbles	No Waterstrike

- The occurrence of sand intervals within mixed firm and stiff fines and gravelly strata can generate an inconsistent N_{100} profile. Figure 7 demonstrates the passage of high N_{100}

values passing abruptly into low values and vice versa. This is attributed to the sand pockets and lenses found in the mixed fluvio-glacial deposit.

- In proximity to DP10, TP/RO09 reports the presence of a very sandy GRAVEL overlying a grey slightly gravelly silty SAND from 1.0m (76.31m OD). It extends to the pit base at 2.80m depth (73.11m OD). This tallies well with the high blowcounts initially recorded in DP10 followed by the low blowcounts from 1.40m (77.13m OD) to ca. 2.80m (75.73m OD). However, equally, BRE SA04 shows the existence of an upper GRAVEL layer (0.30-1.20m) underlain by a soft to firm dark grey slightly sandy very gravelly CLAY. This sequencing also appears plausible when viewing the pattern of the probe blowcounts in DP10.

Figure 7 - Mixed probe results in southern fields at Area 1



- Probes extended to depths ranging 1.0m and 4.90m. They regularly highlighted the potential for intercepting both shallow and deep obstructions. For probes which penetrated deepest, N_{100} values were typically consistent showing N_{100} values of 4-6 per 100mm, often higher – the exceptions being those probes pictured in Figure 6 where it is thought sand lenses, or possibly soft to firm CLAY, entered the soil column. N_{100} values from 4-6 would suggest stiff consistency.
- Hand vanes undertaken at 0.50m showed shear values ranging 50-80kPa indicative of firm and firm to stiff soil deposits. Those completed at 0.70m were notably higher, ranging from 70-80kPa. These set of values are more indicative of a stiff deposit. A shear strength value of 120kPa was recorded at 0.70m in TP07.

- Cases of large diameter, rounded boulders occurring in pits were common, some of which were up to 1200mm (TP05 at 1.80m bgl) (Figure 8B)
- SPT's were undertaken in boreholes BH01-BH04 in the southern part of 'Area 1'. A plot showing the scatter of N values achieved versus depth is presented in Figure 9. It illustrates the presence of generally firm soils at 1.0m, passing to stiff from 2.0m depth.
- SPT N-values obtained from testing in the two southern fields of Area 1 highlight the presence of both soft and soft to firm / loose soils in the upper metre. This extends to 3m bgl in the case of TPRO-09 located in the southeastern corner. The low blowcounts are attributable to a grey silty SAND which was identified to a depth of 3.40m in TPRO-09. Where GRAVEL strata were intercepted, higher N values, typical of a more dense deposit, were recorded.
- As with the northern field in Area 1, medium dense to dense GRAVEL underlies much of the area. There is a definite heterogeneity however, with clay and sand soils intertwined. The granular deposits are often accompanied by water ingress. Shallow CLAY was remarked as 'soft to firm' in both BRE SA04 (1.20 – 3.0m) and TP/RO04 (1.0-1.70m). Elsewhere, it is found as 'firm' in BRE SA03 to the west of the site.
- Limestone bedrock was cored in RC03 from a depth of 8.80m bgl (70.57m OD). The drillhole reported initially loose (N=7 at 1.50m) becoming dense grey brown sandy silty/clayey GRAVEL.

Figure 8A & 8B – Sidewall photo of TP05 showing SILT over dense GRAVEL at 2.0m (78.91m OD). Boulder found in pit at 1.80m measuring 1200mm.



Figure 9 – SPT Vs Depth plot for BH01-BH04

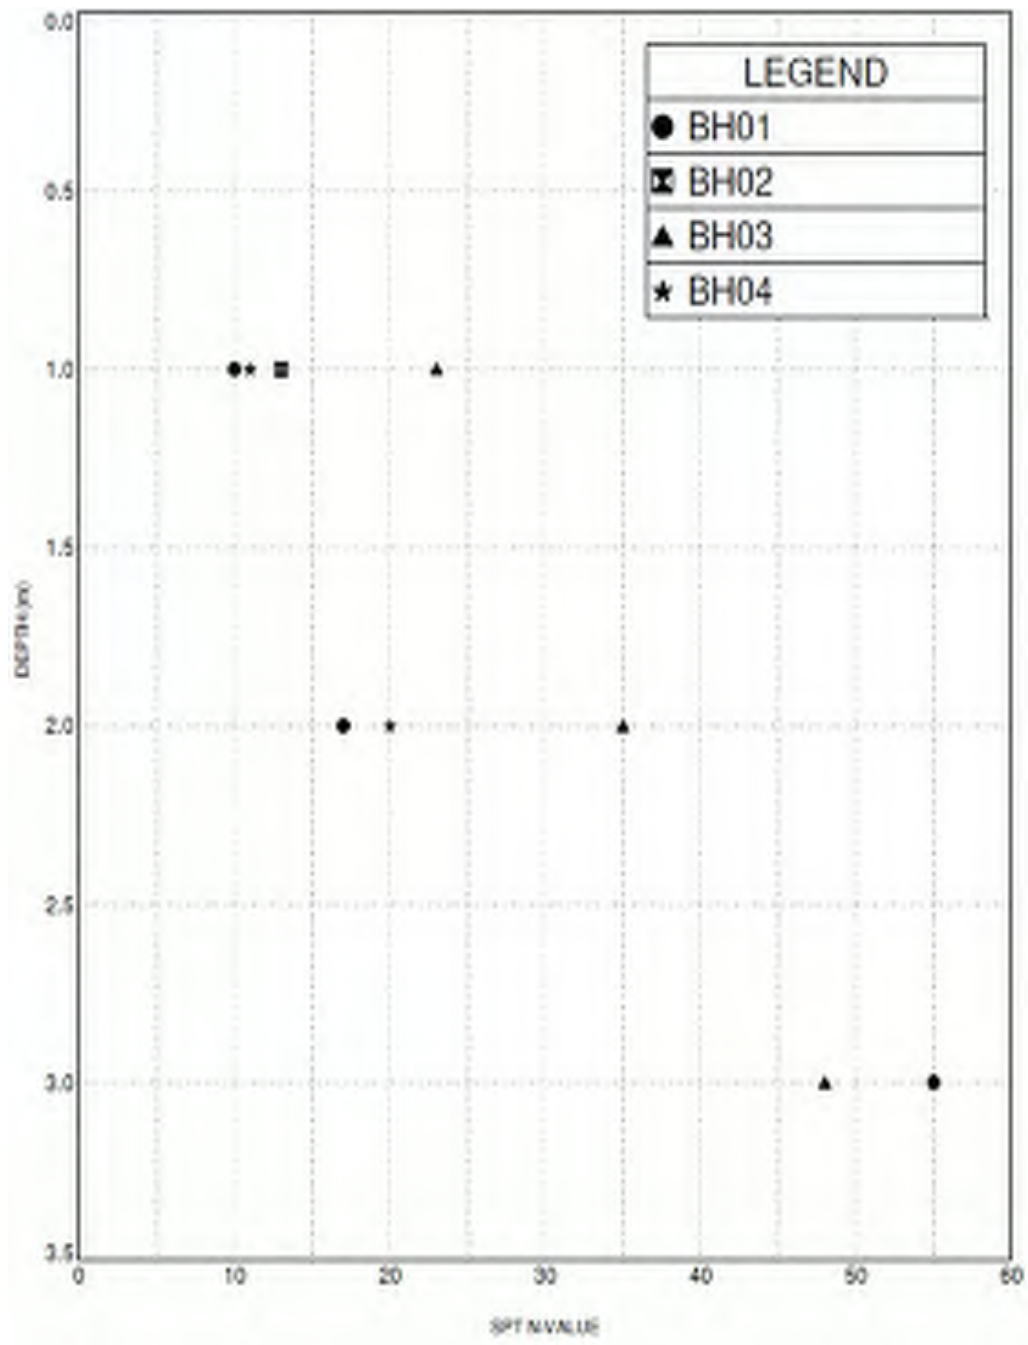
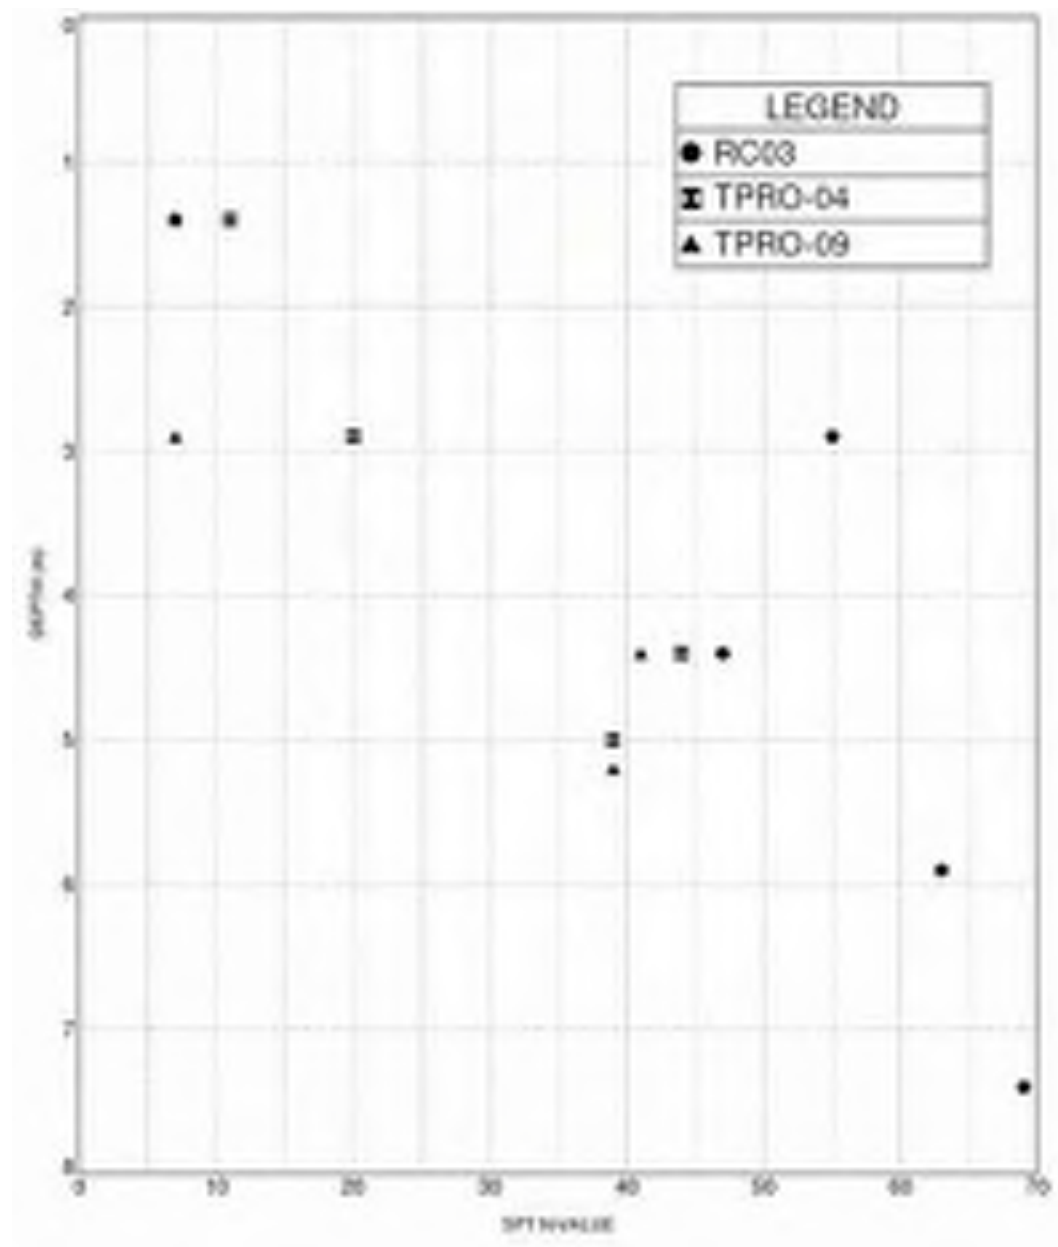


Figure 10 – SPT Vs Depth plot for TPRO-04, TPRO-09 & RC03

5.1.2 Area 2

Ground levels range from ca. 85m OD in the west (BH10) to 80.50m OD (BH12) in the east, closest to the M7 motorway. The initial 2022 suite of intrusive works completed in this area included nine trial pits and thirteen dynamic probes. The deepest probe achieved a depth of 3.80m bgl (76.80m OD) with the pits extending to depths of between 2.50m (80.61m OD) and 3.10m (78.24m OD). The three cable percussion boreholes (BH10-BH12) reached depths ranging 1.80m to 3.50m bgl (80.03m OD).



The supplementary works in April / May 2023 consisted of three rotary core drillholes and three rotary open-holes. Additionally, three trial pits were excavated at each rotary open-hole. A soakaway test (BRE SA06) was excavated with a soak test performed in the overburden soils.

TOPSOIL

- Topsoil ranges in thickness from 0.20m to 0.50m across the area, thinning towards the east in the low-lying field adjacent to the motorway (Figure 11). It was noted that up to 0.50m of topsoil was present in TP28.

Figure 11 – Tussock grasses in triangular-shaped field to east of Area 2. View SE.



GLACIAL DEPOSITS

- The pits along the western edge of 'Area 2', closest to the main farm access track, revealed the presence of generally firm and firm to stiff sandy slightly gravelly silty CLAY to ca. 1.0m, underlain by a stiff brown slightly sandy gravelly SILT. Hand vanes conducted at 0.80m in TP22 range from 75-84 suggestive of stiff material. The probes conducted across the same area (DP's 23, 37, 38, 39 & 40) each indicate progressively stiffer deposits with

depth, albeit only achieving probe depths between 1.10m and 1.70m prior to refusal. Equally, the SPT plot for the tests undertaken in the drillholes in the area reflect the firm nature of the soils from 1.50m (Figure 16).

- Shallow refusal was also encountered in nearby BH10 where a depth of 1.80m (82.99m OD) was realised before termination. 1.50 hours of chiselling were used from 1.50m to 1.80m in attempting to further the depth of the borehole. The shallow refusal in BH10 at 1.80m coincides with the entry of a grey brown clayey sandy GRAVEL in TPRO-05. This may be the reasoning behind the refusal. Trial pit TP/RO05 also reported sandy clayey GRAVEL with cobbles and boulders from 1.50m (83.18m OD).
- A band of buried sand was flagged in both TP25 and in BRE06 / SATP06. From 1.20m (84.16m OD) to 2.40m (82.96m OD) in TP25, a greyish brown gravelly clayey SAND with cobbles and occasional boulders was recorded (Figure 10). In nearby SATP06, a grey brown gravelly silty SAND with cobbles was logged from 1.20m (82.25m OD) to a pit end depth of 2.0m (81.45m OD). Probes did not extend deep enough to penetrate this layer. However, given the stability viewed in sidewalls, and the reported stiffness of adjacent layers, it is likely to be dense / medium dense. The log for BRE12 / SATP12 also notes the presence of grey brown gravelly silty SAND from 1.20m (83.12m OD) to the pit base at 2.20m (82.12m OD).
- Rotary works in the western field of Area 2 show firm CLAY passing to progressively stiffer CLAY with occasional gravel bands. A deep-seated GRAVEL was encountered towards the base of TPRO-05 from 4.60m (80.04m OD) to pit base at 5.10m bgl (79.54m OD). A GRAVEL was also encountered from 3.70m (81.33m OD) to pit base (5.0m) in TPRO-06. Both GRAVEL layers were reported dry.

Figure 12 – Sandy stratum from 1.20-2.40m in TP25



- Based on SPT testing, rotary drilling at RC01 revealed the presence of firm gravelly silty sandy CLAY soil at 1.50m improving to stiff consistency at 3.0m. GRAVEL was logged at

depth from 7.50m (77.83m OD) to 9.60m (75.73m OD) and again from 10.40m (74.93m OD) to 14.80m (70.53m OD). At this point the gravel changed colour from grey brown to brown. There was also a water strike at 14.50m (70.33m OD). The driller notes rockhead or 'possible weathered rock' from 16.30m bgl (69.03m OD).

- Corroborating the weathered nature of the rock at depth, a sequence of orange brown sandy gravelly CLAY was met from 17.10m (68.23m OD) to 18.70m (66.63m OD) in RC01A. This material contained highly weathered angular to subangular fine to coarse gravel, thought to be a mixture of crystalline calcite and dolomitised limestone. A water strike was observed at 16.80m (68.53m OD).
- Progressing eastwards, the next field east shows a firm and soft to firm soil extending towards 1.0m in BH11. An SPT N-value of 10 at 1.0m coupled with some low N_{100} blowcounts in adjacent probes point to a relatively lower strength upper stratum. Low shear vane values at 0.50m (47-52kPa) in trial pit TP29 indicate firm soil. Overall, however, shear vane values at 0.50m and at 0.70m in pits indicate generally firm to stiff and stiff soils. The stratigraphy in rotary open-hole TPRO-07 suggests a uniformly firm and firm to stiff becoming stiff CLAY soil extending from ca. 1.50m to 4.60m (78.26m OD).
- The most complete probe records in the area are DP41, DP43 and DP45. DP41 suggests stiff and very stiff soil from 1.0m in line with the findings of nearby trial pit TP26 and borehole BH11. DP41 ended at a depth of 2.90m (80.83m OD). DP43, from 2.10 – 2.80m, showed some localised softening with relatively lower N_{100} blowcounts. However, the soil would still be classed as firm and was visually confirmed as so in TP28. Similarly, in DP45, blowcounts from 1.30m to 1.80m are consistently recorded as 3. They are somewhat lower than N_{100} blowcounts both above and below this interval. Nearby trial pit TP27 reports stiff SILT in this same interval, becoming firm from 1.80 to 3.10m bgl.
- Trial pit TP/RO07 intercepted a layer of soft to firm light brown sandy very gravelly CLAY from 1.80m (81.06m OD) to 2.50m (80.36m OD). Two seepages were encountered in this stratum. Potential water-softening may be accountable for the low blowcounts registered in nearby DP43 (Figure 13). The marked increase in blowcounts from 2.80m (79.26m OD) likely hints to a basal dense GRAVEL as found in TP/RO07 from 2.50m (80.36m OD) to the pit base at 3.30m (79.56m OD).
- Trial pit TP29 demonstrated the presence of uniformly stiff soils from 0.60m bgl to an end depth of 2.90m. In this pit, all strata are recorded as very sandy from a depth of 0.60m. Where isolated sand lenses exist, devoid of a larger granular clast component, such deposits are thought to report low N_{100} values in probe drives.

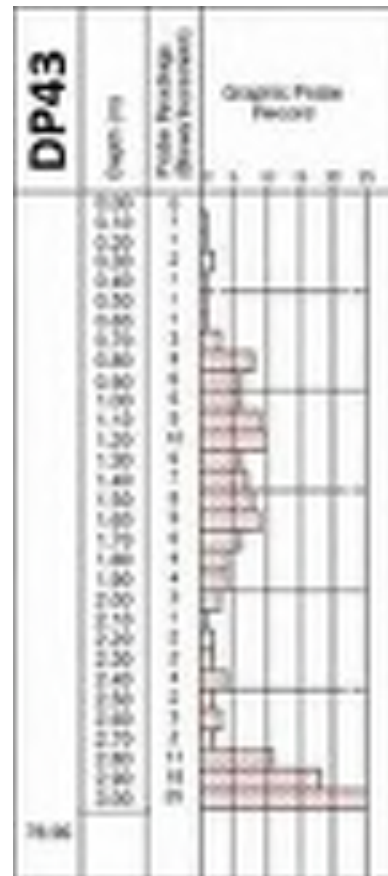
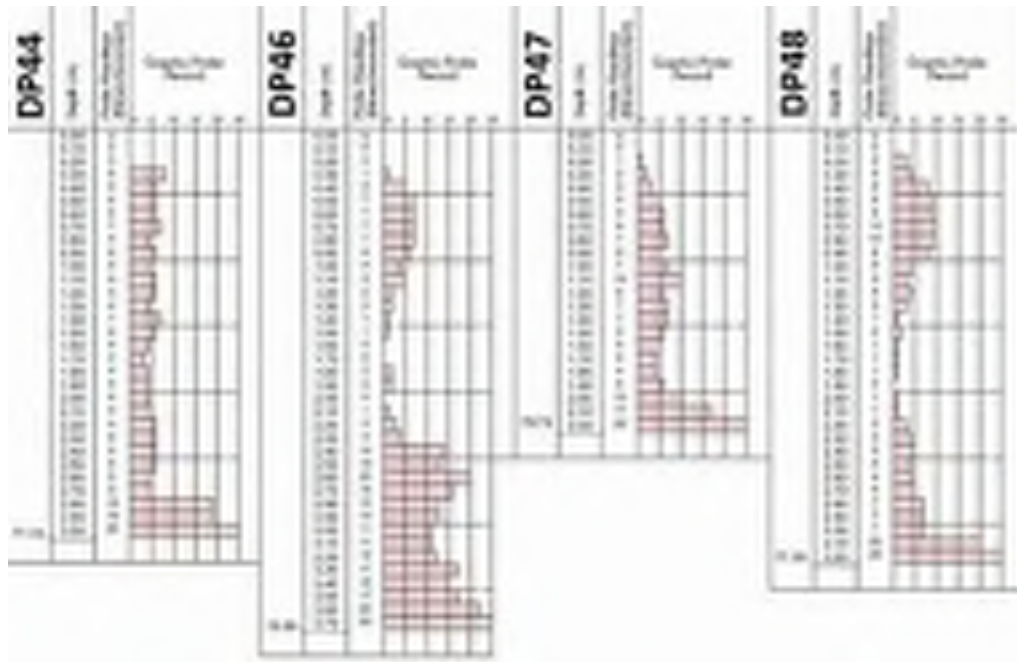


Figure 13 – Probe results for DP43

- Rotary core drillhole RC02 reported a grey brown sandy clayey GRAVEL from ground level to 13.90m (69.02m OD). Ahead of rockhead, a CLAY band was logged by the driller. At 15.10m OD, a strong to very strong, thickly to medium bedded light grey blue fine grained LIMESTONE, possibly slightly dolomitised with abundant calcite veining was cored.
- The triangular field to the northeast of the site is covered intermittently with tussock grasses, which can be an indicator of locally high water levels. Deeply cut drainage ditches also traverse the same field. The motorway, separated from the field by a mature hedgeline, is almost at grade with the level of the field (80.30 – 81.10m OD).
- Visual observation in trial pit TP30 shows initially silty SAND to 1.0m. Plate bearing tests in PB21 and PB22 performed on this silty SAND to sandy SILT revealed reasonably high values, most especially for reload cycles (6.4% & 18.9%). A stiff and firm to stiff sandy and very sandy gravelly clayey SILT completes pit TP30 at 2.50m. A water seepage was observed at 2.40m. Later recorded levels in the standpipe at BH12 were approx. 1.0m bgl.
- The resulting blowcounts from probes DP44, DP46-48 are shown in Figure 14. Both probe DP46 and probe DP48 show low (0 and 1) N_{100} values from ca. 1.50m to 2.0m. The pit nearby, BRE09 / SATP09, shows the presence of grey brown gravelly silty SAND from 0.80m to 1.80m. This stratum, it is thought, is responsible for the low to freefall drop in respective probe drives DP46 and DP48.

Figure 14 - Mixed probe results in the triangular field in Area 2



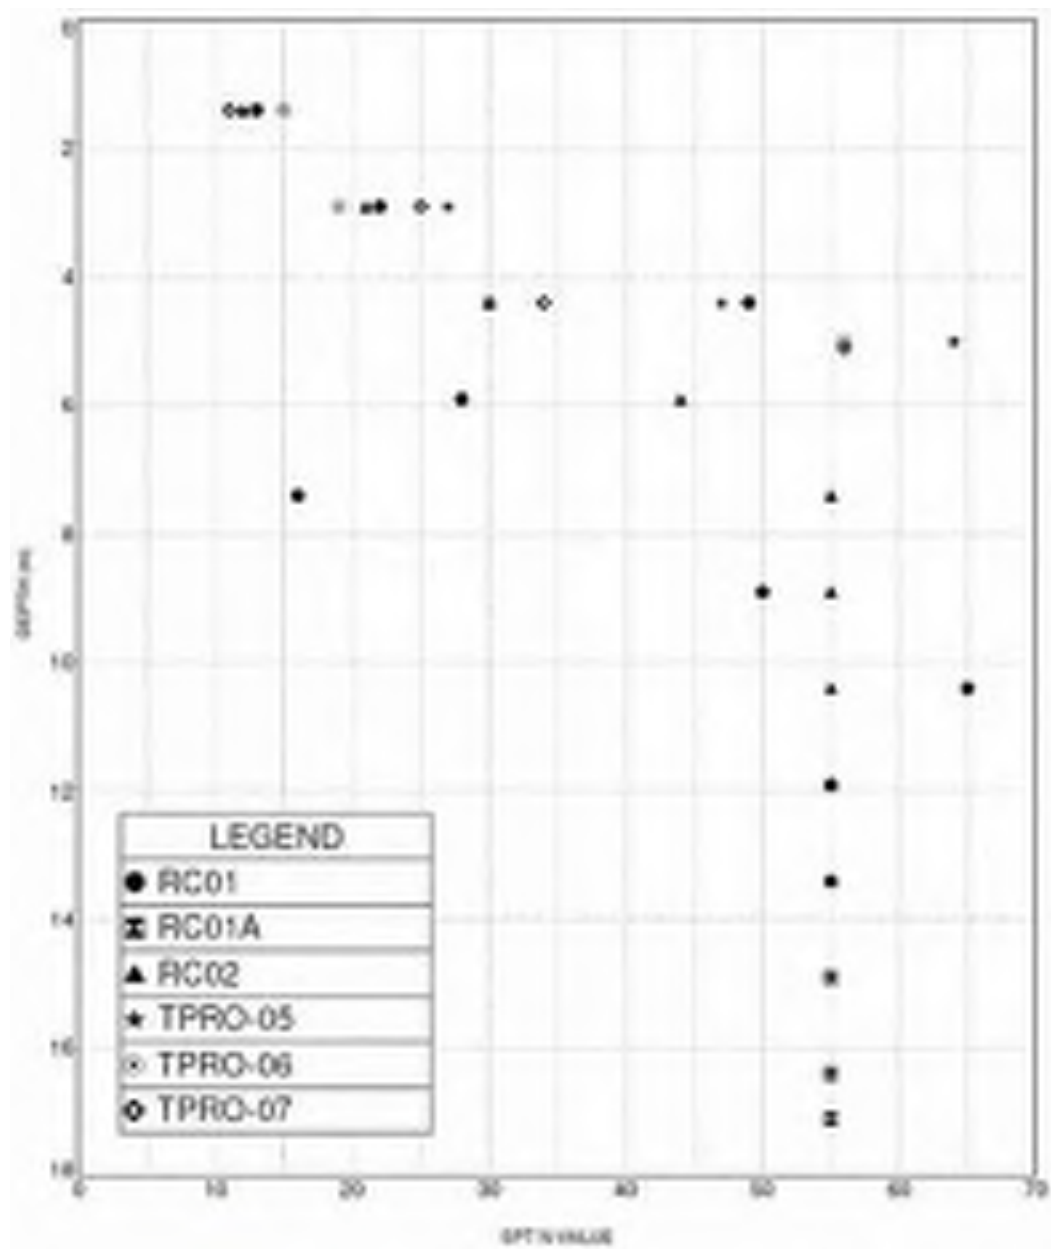
- Neither DP44 nor DP47 show any fluctuation in N_{100} blowcount to depths of 3.10m and 2.30m. The N_{100} values are remarkably consistent throughout each probe drive suggestive of an homogeneous stiff soil stratigraphy.

- BH12, sited close to an existing drainage ditch, extended to 2.40m depth (78.10m OD) before termination. A very stiff CLAY was intercepted at 1.80m (78.70m OD). A SPT test undertaken at 1.0m recorded a N value of 10. This soft to firm consistency aligns well with the findings of probe DP46 and DP48 from 1.0m to ca. 2.0m. However, no sand layers were logged during the drilling of the borehole.
- BRE SA06 (2023 phase of works) was undertaken in the same field as BRE07 (2022 phase of works). BRE SA06 demonstrates a more complete stratigraphy ranging from near surface firm brown CLAY (as found in BRE07), to a soft to firm light brown mottled golden brown and grey sandy gravelly CLAY (1.40-2.25m) to a basal stiff and very stiff dark grey CLAY (Figure 15). The pit was ended at 3.30m (79.25m OD) in the very stiff dark grey CLAY.

Figure 15 – Sidewall profile in BRE SA06. Pit walls unstable from 1.25m bgl.



Figure 16 – SPT Vs Depth plot for TPRO-05, TPRO-06, TPRO-07 & RC01 / 01A & RC02



5.1.3 Area 3

Area 3 covers the three fields to the southeast of the project. The fields are accessed via the central farmyard. Aside from BRE08 / SATP08, all of the intrusive investigation locations are positioned in the two westernmost fields.

Ground levels range from 81m OD, near the farmyard in the northwest, to 78m OD nearing the southern field boundary and stream. Termination depths in probing across the two main fields range from 1.0m to 5.60m. The trial pits conducted on site achieved depths between 1.50m to 3.20m. The cable percussion boreholes mirrored these depths, being terminated between 1.10m and 3.60m bgl.



A rotary corehole suggests rockhead lies at 10.60m (67.72m OD) with coring commencing in RC04 from 11.60m (66.72m OD). Elsewhere, rotary open-holes permitted the installation of a further two water wells in the area, namely TPRO-08 and TPRO-10. Two trial pits were also conducted adjacent to the rotary open-holes. A soak pit, BRE SA05, was also opened but no soak test was performed due to shallow water ingress.

TOPSOIL

- Topsoil ranges in thickness from 0.15m to 0.40m. The normally soft brown slightly gravelly sandy silty CLAY topsoil gives way to a darker peaty CLAY nearing the southernmost stream as evidenced in the trenches excavated for plate test PB04 (Figure 17A) and PB05 (Figure 17B). At PB05, the upper organic soil was underlain by stiff grey sandy gravelly CLAY.

Figures 17A & 17B – Upper organic soils in PB04 & PB05



Fig 17A



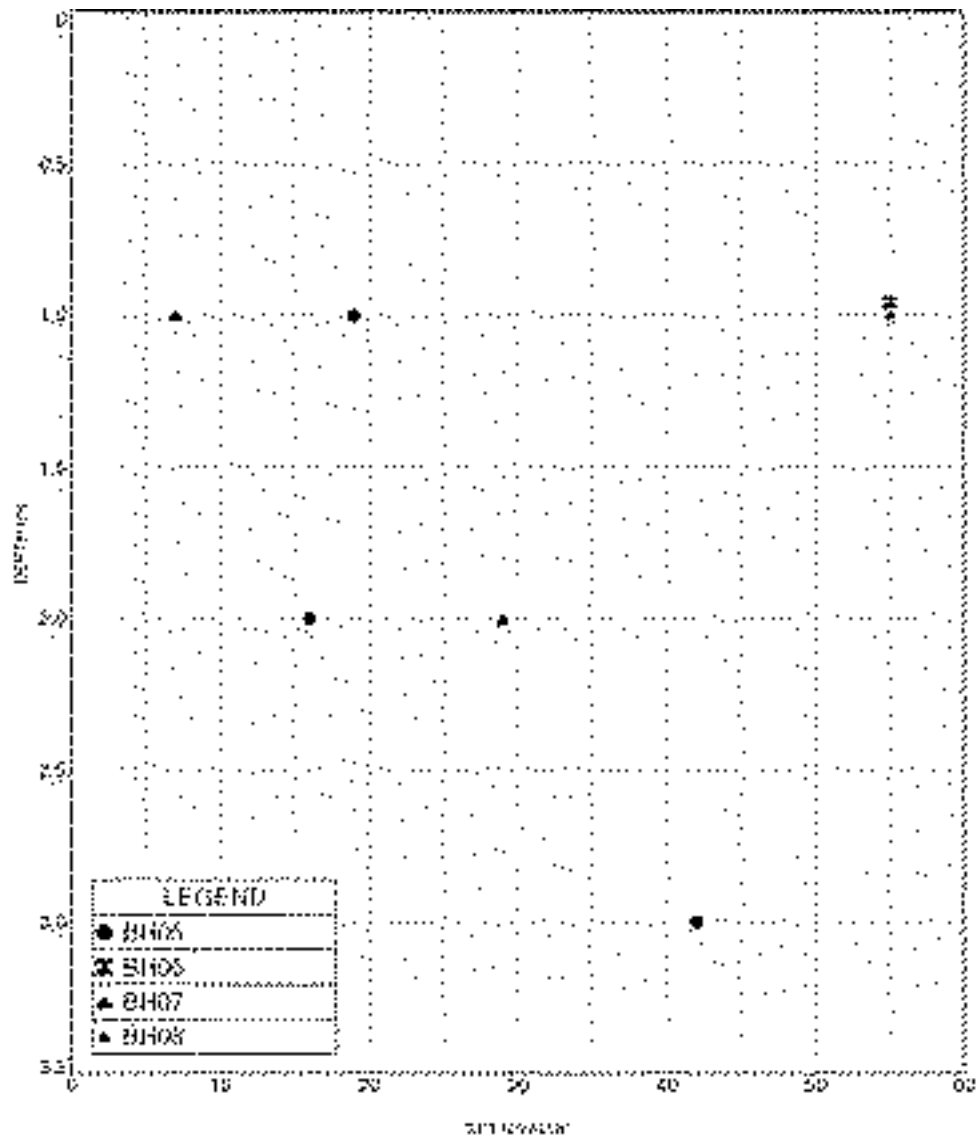
Fig 17B

GLACIAL DEPOSITS

- The westernmost fringe of 'Area 3' is underlain exclusively by stiff and dense deposits. Trial pit TP12 outlines a changeable stratigraphy between stiff light brown very sandy very gravelly clayey SILT and dense silty gravelly SAND. Predominantly granular soils extend to 2.40m where a firm to stiff dark brown to dark grey gravelly SILT was found. The pit was terminated at 2.70m (78.01m OD).

- Borehole BH05 reported firm to stiff and later stiff soils (based on SPT N values) to a base depth of 3.60m (74.28m OD) (See Figure 18).

Figure 18 – SPT Vs Depth plot for BH05-BH08



- Mirroring the high strength soils found in both TP12 and in BH05, dynamic probe DP20 achieved only 1.0m before refusal. DP19 also reported high N_{100} values in the upper 2.0m. However, in DP19 a notable 800mm long sequence of $N_{100}=0$ blowcounts was logged from 2.30m to 3.10m bgl. This is considered to be a pocket of uniform SAND or CLAY/SILT offering little in the way of resistance to the driven probe. It is not thought to be a soft to very soft soil - the assumption is based on the generally high strength, consolidated nature of the soils both above and below the same stratum in addition to the visual observation made in nearby TP13 where a 'firm slightly sandy gravelly silty CLAY' was logged from 2.40m to 2.70m (See Figure 19A & 19B).
- BH06 in the original phase of investigation refused in very stiff light brown CLAY at a depth of 1.10m bgl (80.19m OD). In the supplementary investigation, trial pit TP/RO08 was

scheduled nearby. It encountered a band of GRAVEL from 1.30m to 1.50m. It is thought that this may have halted the progress of the cable percussion boring rig at BH06. The underlying soils, as evidenced in the trial pit, comprised firm grey brown CLAY from becoming stiff to very stiff dark brown CLAY to a depth of 3.30m (78.10m OD).

- The high strength lower till is also intercepted in both rotary open-hole TPRO-08 and TPRO-10 with SPT refusals from 3.0m depth. Trial pits TP/RO08 and TP/RO10 both show stiff to very stiff dark brown sandy very gravelly CLAY from 2.90m (78.50m OD) and 2.70m (74.57m OD). At 1.50m, SPT N-values suggest the presence of firm soils.

Figure 19A – 19D – Fig 19A TP13 with firm silty CLAY from 2.40m to 2.70m. **Fig 19B** Spoil with excavated silty CLAY on top of heap. **Fig 19C** TP/RO08 intercepted firm CLAY to 1.30m, GRAVEL from 1.30-1.50m underlain by firm CLAY passing to stiff to very stiff dark brown CLAY from 2.90-3.30 (pit base). **Fig 19D** TP/RO08 spoil.



Fig 19A



Fig 19B



Fig 19C

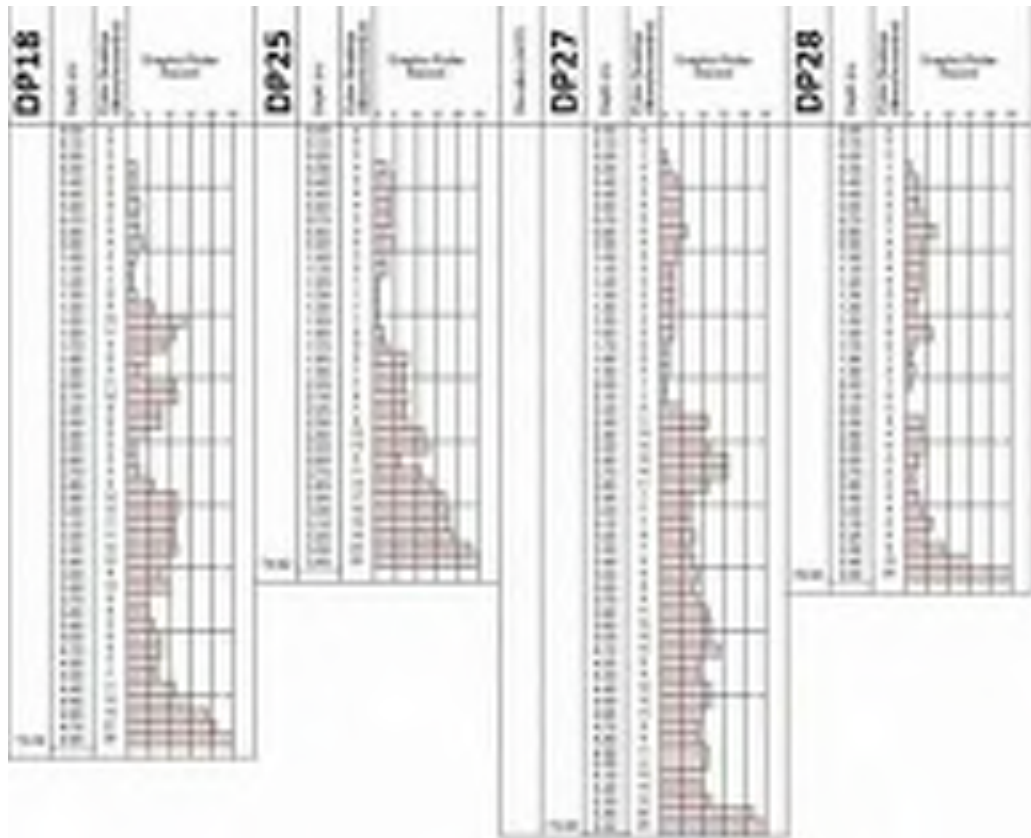


Fig 19D

- TP14 failed to penetrate the high strength upper soils formed of very sandy silty CLAY, gravelly SILT and dense gravelly SAND. The pit was ended at 1.50m (77.80m OD).

- Towards the south of the site, in situ SPT test results show the presence of soft / loose soils in BH07 at a depth of 1.0m. Equally, in nearby RC04, SPT testing at 1.50m shows an N-value of 9 (See Figure 18). Elsewhere, SPT N-values generally indicate the progression from firm to firm to stiff and stiff soils. The shallow refusal at 1.0m in both boreholes BH06 (1.10m) and BH08 (1.30m) is also depicted in the SPT plot (Figure 18).
- Towards the central / southern part of the site, probes DP18, DP25, DP27 and DP28 combined with the findings of borehole BH07 (from 0.50m to 1.70m), signal a decrease in strength in the uppermost soil layer. Probes extended to significant depth locally (5.60m at DP27 – Figure 15) and suggest collectively that the upper 1.50m to 2.0m comprises a mix of firm and firm/stiff or medium dense soils. Based on blowcounts, there appears to be a discrete stratum of possible soft and soft to firm soil / loose fine sand from 1.10m-1.30m in DP18, 1.20-1.60m in DP25, 2.0m to 2.20m in DP27 and 2.0 to 2.30m in DP28 (See Figure 20). Lenses of fine sand were observed in nearby TP17 from 1.10 to 1.30m with very sandy SILT to 2.0m bgl. These lenses may account for the localised low blowcounts.
- Supplementary pitting at TP/RO10 (near DP28) did encounter a soft to firm grey brown sandy very gravelly CLAY with “frequent pockets of sand” from 1.0m to 1.80m (76.27-75.47m OD). This aligns well with the findings in DP28 and nearby probes where the upper strata generated often mixed N_{100} blowcounts. No other soil softening was noted in TP/RO10 in what was otherwise a pit comprising firm and stiff CLAY. No SPT results suggestive of soft soils were generated in either TPRO-08 or TPRO-10 (See Figure 22).

Figure 20 – Probe blowcounts in dynamic probes DP18, DP25, DP27 and DP28 in the southern section of ‘Area 3’



- Overall, the N_{100} values viewed in DP18 show no coherent pattern of strengthening or densifying deposits with depth in the upper three metres. This may highlight the locally changeable till composition and consistency as well as possible cobble / clast content which may cause obstructions locally.
- SATP04 / BRE04 indicates the presence of a grey silty gravelly SAND from 0.40m to 0.90m with SATP05 / BRE05 also showing very gravelly SAND and sandy GRAVEL from 0.50m to 1.70m (76.91m OD). Pit TP19 also identified a mixed silty SAND from 2.0m to pit base at 3.20m bgl (75.78m OD). Sidewalls were notably unstable in these strata. Sands and Gravels were also logged in SATP05 / BRE05 from 0.50m to pit end depth at 1.70m. Moderate water ingress was observed at 1.70m.
- Supplementary soakaway pit BRE SA05 reported a thin cover of topsoil and firm CLAY to 0.40m overlying SAND to the pit end depth at 1.70m (77.14m OD). A moderate water strike was encountered at 1.70m bgl (77.14m OD) (See Figure 21B).
- Probes to the northeastern extent of 'Area 3' show a marked consistency in blowcounts from ground level to, in the case of DP29, 5.20m. Soils are clearly stiff and dense in probes DP29 and DP30 and do not show any loose / soft intervals. Both probes DP31 and DP32 terminated on shallow, apparently progressively stiff to very stiff / dense soils. In the base of nearby pit TP20, the soils were remarked as 'firm, occasionally soft to firm'. In any case, the vertical pit sidewalls appear stable to 3.0m (76.78m OD) depth (Figure 16A).
- Plate bearing tests undertaken on the upper soils (PB04, PB05 & PB09 & PB10) at depths of 0.40m and 0.50m report equivalent CBR values of between 2.0% and 3.5% (discounting the low result from PB04 of 0.1%). These are indicative of a firm subgrade.

Figure 21A & 21B – Sidewalls in trial pits located in Area 3. Fig 21A Sidewall in TP20 showing firm and firm to stiff clayey SILT and silty CLAY to 2.60m. A firm occasionally soft to firm blackish grey clayey SILT was logged from 2.60m to 3.0m (76.78m OD) **Fig 21B** Sidewall collapse in BRE SA05. Water sitting at 1.70m bgl.

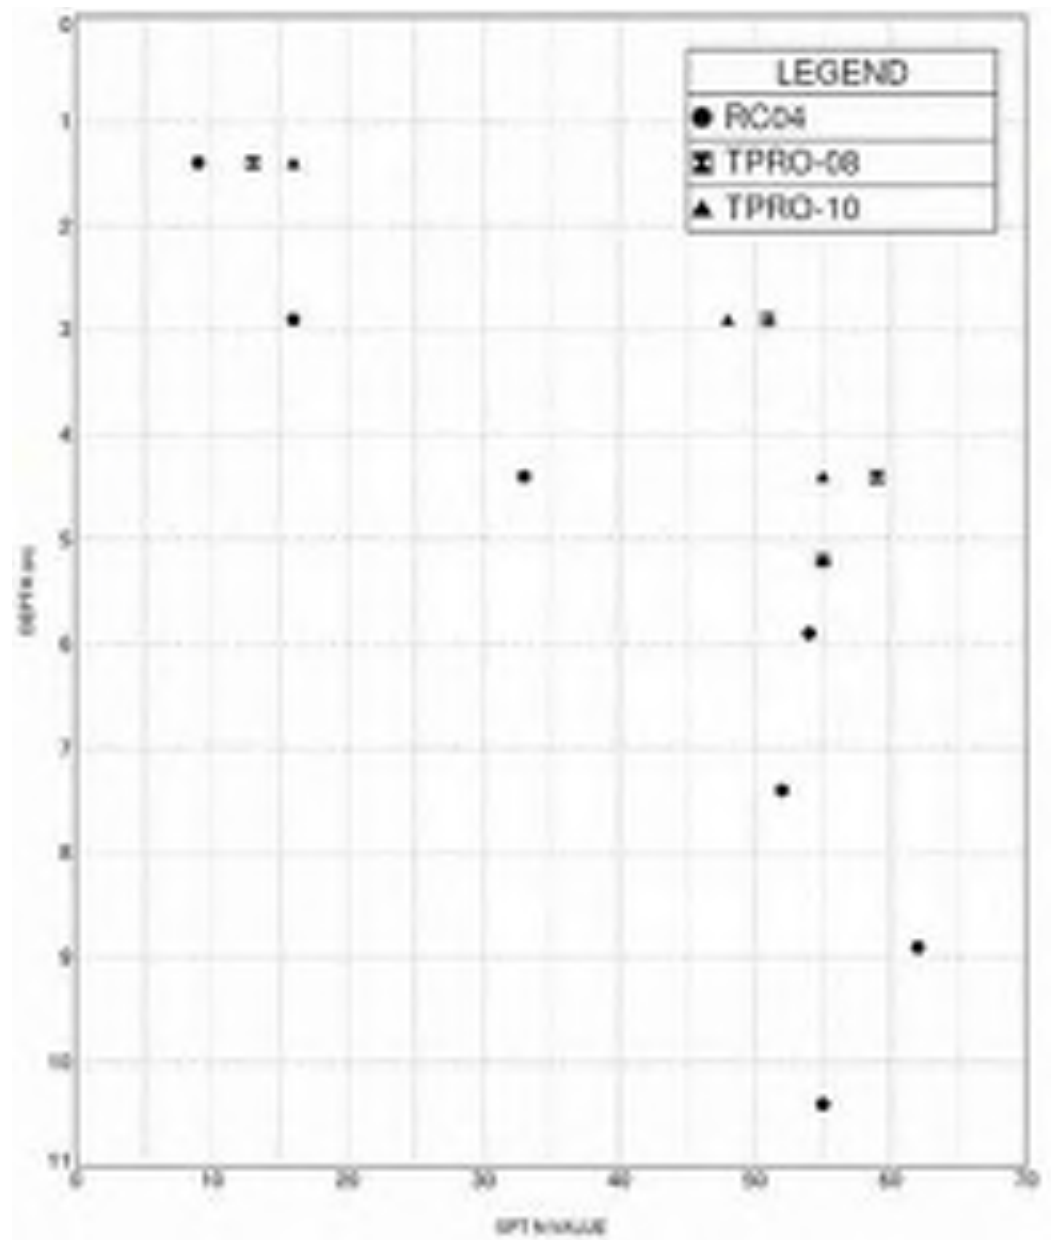


Fig 21A



Fig 21B

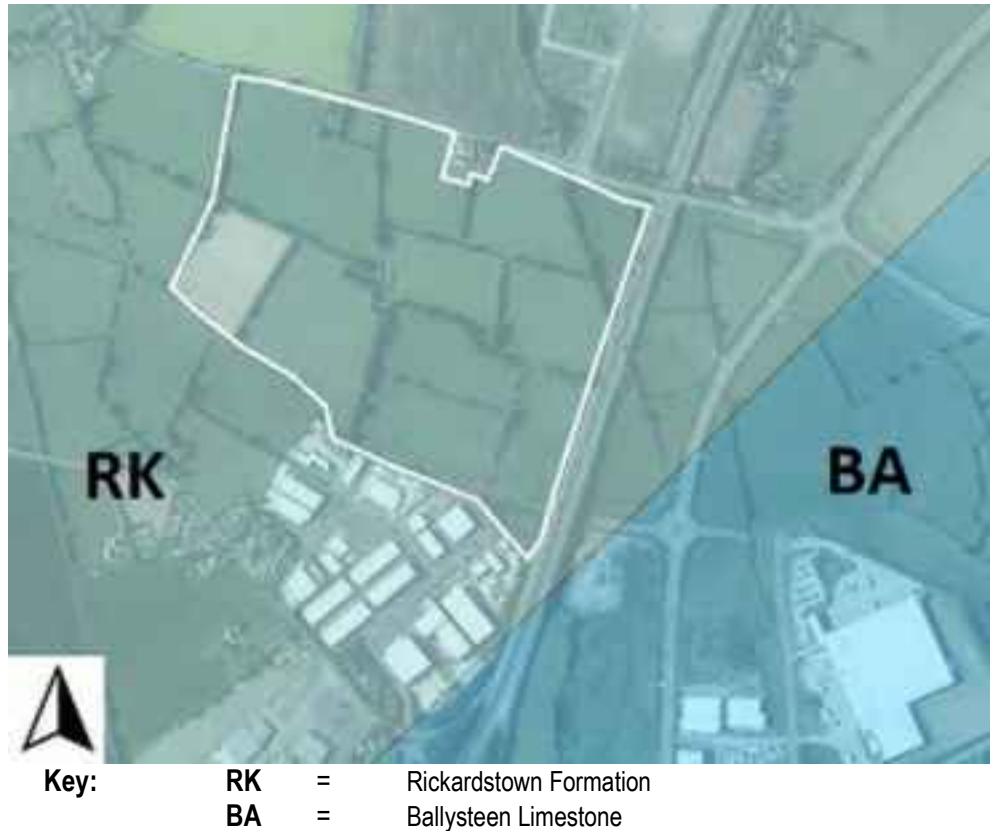
Figure 22 – SPT Vs Depth plot for TPRO-08, TPRO-10 & RC04



5.2 Bedrock

Reference to the GSI map for the area (Figure 23, 1:100,000 Solid Geology series) shows that the site is underlain by the Carboniferous, Viséan-aged Rickardstown Formation. The rock formation consists of cherty often dolomitised limestone. No outcrops were found on site.

Figure 23 - Bedrock Geological Map for the Halverstown Site (retrieved from GSI website)



Bedrock was not intercepted at either the base of machine excavated trial pits or cable percussion boreholes. However, rotary core drilling, undertaken as part of the supplementary investigation, did prove rock at each of the five locations. Of the five locations, one rotary corehole was undertaken in Area 1 (western fields), three in Area 2 (eastern fields) and one in Area 3 (southeastern fields).

Recovered cores in RC02, RC03 and RC04 were logged as slightly weathered, thickly to thinly bedded, light blue grey, fine-grained LIMESTONE with localised dolomitization. A stromatolitic structure was evident in the cores as well as abundant calcite veining (Figure 24). RC04 displayed more visibly interbedded calcisiltite and argillaceous layers. In the case of RC01 and RC01A, no competent bedrock was met. Instead, the recovered cores (RC01A) returned a clay / calcite crystal mix from 17.30 – 18.70m. Given the un lithified, brittle crystalline structure of the calcite, open-hole techniques were deployed in both RC01 and RC01A. SPT testing was undertaken to provide further detail on density of the calcite veinfill. Arisings from the drilling at RC01 were photographed on the ground following drilling (Figure 25).

Discontinuity spacings in the limestone rotary cores ranged from widely (600 to 2000mm) to closely (60 to 200mm) spaced, medium (200 to 600mm) to closely spaced in the case of RC02. The rock encountered in RC01 and RC01A comprised crystalline calcite, presumed localised veinfill hosted in the limestone bedrock. Given the dolomitised nature of the limestone in the area, the development of fissures / fractures in the rock and subsequent infill by calcite is not surprising. However, in the

case of RC01 and RC01A (performed approximately 5m apart), the calcite is extensive and not restricted to thin veinfill in dolomitised bedrock (as observed in RC02 & RC03 and to a lesser extent in RC04).

The discontinuity surfaces in the limestone are typically smooth to very locally rough, planar. Apertures are tight to locally moderately open, occasionally exhibiting clay smearing. Calcite veins (1-10mm thick) and slight iron oxide staining were often noted. Dips are subhorizontal and locally 30° and 40°.

Figure 24 – Bedrock cores from RC02

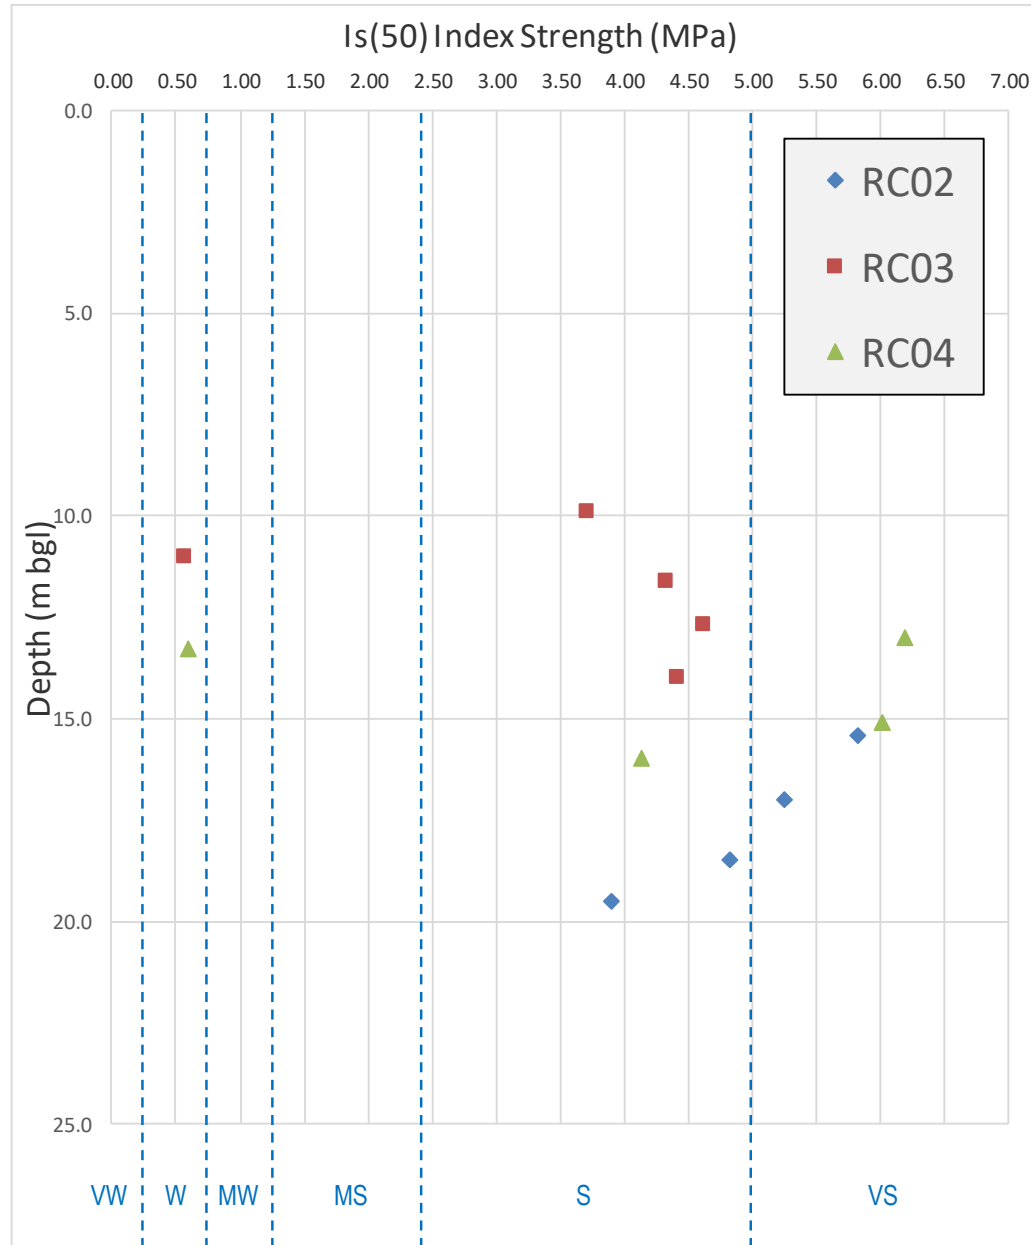


Figure 25 – Pulverised returns at the surface following open-hole drilling through crystalline calcite at RC01



The point load strength index (PLSI) test data produced $I_s(50)$ values ranging from 0.57 to 6.20 MPa, with a mean value of 4.19 MPa. The strengths when plotted show a broad scatter but are chiefly placed in the centre of the PLSI chart (Figure 26), corroborating the largely medium strong strengths recorded in core logging.

Figure 26 – $I_s(50)$ strengths obtained from diametrial Point Load Strength Index testing



VW = Very Weak, W = Weak, MW = Moderately Weak, MS = Medium Strong, S = Strong, VS = Very Strong (ISO 14689:2017 (E))

Using a correlation factor (K) of 20 to assess compressive strength, this suggests a characteristic strength envelope in the order of 11 to 124 MPa and categorizes the bedrock as weak (5 to 12.5 MPa) to very strong (100 to 250 MPa). The visual strength descriptors determined during engineering geological logging marry well with the overall plot scatter in Figure 26.

ISO 14689:2017 (E) rock strength parameters are drawn on Figure 26 to allow correlation between UCS and Point Load Strength tests. A correlation factor (K) of 20 was used to plot the ISO 14689:2017 (E) MPa strength divisions on the Point Load strength ($I_s(50)$) plot.

5.3 Groundwater

Water strikes (seepage, slow and moderate inflows) were intercepted during shallow trial pit excavation, with groundwater also struck during borehole construction at BH01, BH02, BH04 and BH12. A well installed in BH13 later reported water only to be dipped dry in July 2023. With the exception of TP30 and BH12 in the northeast, during the 2022 phase of investigation, shallow groundwater was found exclusively towards the south of the site, near the stream boundary (See holes identified on Figure 27 & Table 4).

Figure 27 – Trial pits and boreholes where groundwater entry was recorded (initial 2022 phase of investigation)



During the supplementary investigation in April / May 2023, of the ten rotary open-holes drilled across the site, six remained dry to their bases on the date of construction. These were TPRO-03, 05, 06, 07, 08 and 10. Standpipes were installed in each well to permit future monitoring. In July 2023, groundwater was found in all standpipes. In the case of the trial pits excavated near each corresponding open-hole, with the exception of TP/RO9 and 10, water strikes in various forms, ranging from seepages to rapid inflows, were encountered. Occasionally, multiple strikes were recorded in a single trial pit. In the case of the six soakaway pits, water strikes were again prolific, being encountered in each of the six pits. This may account for the erroneous results in both tests run in BRE SA06, namely SA06_A and SA06_A1, where the water levels rose during the respective soak tests. No soak tests were performed in pits BRE SA02 – BRE SA05 due to water ingress accompanied by poor pit sidewall stability.

Finally, of the five rotary coreholes constructed on the site, where rock was found at appreciable depths, strikes were encountered at depth. Where rock was met at higher levels, noted in both RC03 and RC04, water strikes were generally intercepted at higher levels. It should be added that both RC03 and RC04 were conducted in the topographically lower (southern) portion of the site

where groundwater was typically found at higher levels. As with the rotary open-holes, each cored drillhole had a standpipe installed to permit later groundwater monitoring. The holes were dipped in early July 2023.

During the 2022 investigation, for the most part the groundwater entries were reported as seepages in trial pits, frequently in gravel horizons at the base of trial pits at ca. 3.0m. Instability and sidewall collapse generally accompanied the entry of water into open pits. Figure 27 shows the individual exploratory hole locations where water strikes were encountered (2022). There is a pattern across the site which follows, for the most part, the occurrence of buried Gravel and Sand at depth (at ca. 2.50-3.0m).

In 'Area 1', groundwater was met between elevation 76m OD and 79.50m OD, related to the occurrence of granular water-bearing soils or potentially isolated lenses in more extensive clays. Charged groundwater strikes were intercepted in each of BH1, BH03 and BH04 where, at each bore, groundwater was found to rise considerably during the 20minute observation period. This may be suggestive of a significant piezometric pressure at depth.

During the April / May 2023 investigation, in the northern field of 'Area 1', gravel and sand strata hosted seepages in TP/RO01, TP/RO02, TP/RO03 as well as BRE SA01 at depths ranging 1.50-2.80m. At depth, in both TP/RO03 and BRE SA02, rapid ingress was observed at 2.0m (79.59m OD) and 2.60m (79.63m OD), strikes clearly linked in elevation despite being located ca. 160m apart.

Within the fields to the south of 'Area 1', trial pits again encountered water strikes, save for TP/RO09 which remained dry to its base at 2.80m (74.51m OD). It may be the case that the pit did not remain open for a period long enough to allow groundwater equilibrate. Nearby, rotary open-hole TPRO-09 reported 'blowing sands' from 1.20-4.20m with a water strike encountered at 4.0m bgl. For sands to 'blow' in the casing, there must be water present to allow for sand solifluction to occur. It is deemed therefore that the sands observed were likely water saturated. Collapse during trial pit excavation suggests water-laden silty sands were present (Figure 28).

Figure 28 – Sidewall collapse in grey silty SAND upon completion of TP/RO09 excavation.



Strikes in the southern field in 'Area 1' were observed as seepages to rapid flow, sometimes occurring in the same pit, eg., BRE SA03 where a seepage was recorded at 1.40m followed by a rapid strike at 2.40m. Once again, water strikes were generally found in clayey GRAVEL and very gravelly CLAY layers and ranged in depth from 0.70m (seepage) to 2.40m (rapid). The water strike intercepted at 5.90m in RC03 was later found to have risen (by drillhole completion) to a depth of 1.70m bgl. It was later dipped at 3.33m (July 2023).

The strikes in 'Area 2' were restricted to the lower elevation locations of BH12 and TP30, both positioned beside a deep drainage ditch. Strike levels were remarkably consistent at 78.20 and 78.30m OD with the strike in the borehole noted to rise inside the drill casing from 2.20m to 0.70m bgl (over the twenty-minute monitoring period).

The additional phase of works in 'Area 2' reported water strikes in trial pits TP/RO05, TP/RO06 and TP/RO07. A moderate strike was intercepted in TP/RO05 at 2.30m (82.38m OD) with only seepages in TP/RO06. A seepage and rapid strike were both observed in TP/RO07, the rapid strike at 2.40m bgl (80.46m OD) immediately above a very clayey GRAVEL layer at 2.50m bgl. Some softening appears to be present in what was described on site as a "soft to firm light brown CLAY" coincident with the appearance of the seepage and rapid ingress in TP/RO-07. Likewise, in TP/RO06, a soft to firm layer was encountered from 1.50-2.50m with a seepage recorded at 2.0m. Rotary open-holes 05, 06 and 07 remained dry during their construction but were later found to have water levels between 2.43 to 3.79m bgl (between 80.43-81.27m OD) when dipped in July 2023.

Coreholes intercepted bedrock at significant depth (between 14.80-17.10m bgl), in the case of RC01 and RC01A, encountering what is thought to be an extensive calcite veinfill rather than limestone bedrock. Across the five holes, water strikes were encountered at depths ranging 11.80m to 16.80m bgl. By completion of drilling at each of the five cored locations, water in the respective coreholes had risen to levels ranging 3.40m to 6.0m bgl.

Finally, in 'Area 3', during the initial phase on investigation, strikes were measured between 75m OD and 77m OD, the deepest being the water strike observed in BH05 at 2.80m bgl (75.08m OD). Strikes in trial pits were, as with other areas, observed between 2.50m and 3.0m bgl. The shallowest ingress was reserved for both BH07 (1.30m) and SATP05 / BRE05 (1.70m), both of which were located in closest proximity to the stream / southern boundary.

In the case of the two boreholes, BH02 and BH03, water strikes were recorded at greater depths than in nearby trial pits. The depths are noted in Table 4. Once encountered, groundwater rose inside the drill casings suggestive of a buildup of piezometric pressure at depth. Water levels were documented to rise by 1.0m and 3.20m respectively from initial strike levels of 4.0m (104.01m OD) and 5.20m (100.86m OD). As with trial pits, the two strikes were seated in clayey/silty sandy Gravel layers.

In relation to the additional 2023 works, a moderate water strike was encountered in BRE SA05 at 1.70m (77.14m OD) marrying exactly with the findings in SATP05 / BRE05. Elsewhere, the two nearby TP/RO pits remained largely dry with only a seepage recorded in TP/RO08 at 2.30m (79.10m OD). No strikes were noted in either rotary open-hole, TPRO-08 or TPRO-10. Rotary corehole RC04 intercepted groundwater at 5.40m with water dipped inside the casing at the end of drilling at 3.50m bgl (74.82m OD). It was dipped in July 2023 at 1.12m bgl (77.20m OD).

The potential does exist for there to be seasonal changes in groundwater level. The limited groundwater monitoring information collected over the course of the project suggests there is such a variation present.

Table 4 – Water measurements in on-site exploratory holes (TP-, SA-, BH-, TP/RO, TPRO-, RC- and BRE SA-)

Exploratory Hole No.	Water Struck m bgl (m OD)	Stratum Description	Rate of Flow	Remarks / Stratum of water ingress (m OD)	
AREA 1 (WEST)					
2022 Works	BH01	2.80 (77.24)	Firm to stiff dark brown sandy gravelly silty CLAY	Moderate	Rose to 1.30m (78.74) after 20minutes
	BH03	2.70 (75.92)	Stiff light brown very sandy gravelly CLAY	Moderate	Rose to 0.60m (78.02) after 20minutes. Installation dipped at 1.30m (77.32) & 1.80m (76.82) & 2.05m (76.57)
	BH04	1.60 (79.46)	Firm to stiff and stiff dark and light brown sandy gravelly silty CLAY	Slow	Rose to 0.60m (80.46) after 20minutes
	BH13	-	-	-	Installation dipped at 2.20m (80.60m) & 2.38m (80.42). Dry on 10-07-23
	TP01	2.90 (76.73)	Brown silty sandy GRAVEL	Seepage	Slightly unstable from 1.60m – seepage at base of pit
	TP05	2.90 (78.01)	Silty sandy GRAVEL	Seepage	Unstable w/ sidewall collapse from 2.80m – seepage at base of pit
	TP07	2.80 (77.99)	Brown silty sandy GRAVEL	Seepage	Unstable from 2.0m – seepage at base of pit
	TP08	3.0 (77.39)	Brown silty sandy GRAVEL	Seepage	Unstable from 2.30m – seepage at base of pit
	TP09	2.50 (77.16)	Dark grey very sandy gravelly clayey SILT	Seepage	Unstable w/ sidewall collapse from 1.60m
2023 Works	TP/RO01	2.40 (81.70)	Grey brown sandy very clayey GRAVEL	Seepage	Slightly unstable from 1.90m
	TP/RO02	2.10 (80.48)	Brown slightly clayey very gravelly SAND	Seepage	Unstable from 0.40m
	TP/RO03	1.50 (80.09)	Firm light brown sandy very gravelly CLAY	Seepage	Unstable from 1.0m
		2.0 (79.59)		Rapid	
	TP/RO04	1.80 (78.55)	Grey brown sandy very clayey GRAVEL	Rapid	Unstable from 1.50m
	TPRO-01	3.50 (80.56)	Grey brown slightly clayey sandy GRAVEL	Seepage	Depth to water at end of drilling = 4.90m (79.16) Installation dipped at 3.63m (80.43m)
	TPRO-02	4.40 (78.12)	Grey brown clayey sandy GRAVEL	Seepage	Depth to water at end of drilling = 4.80m (77.72) Installation dipped at 3.16m (79.36m)
	TPRO-03	Dry	-	Dry	Installation dipped at 1.49m (80.14m)
	TPRO-04	4.50 (75.78)	Dark grey slightly clayey sandy GRAVEL	Seepage	Depth to water at end of drilling = 4.70m (75.58) Installation dipped at 2.27m (78.01m)

Cont.

2023 Works	TPRO-09	4.0 (73.31)	Grey silty gravelly SAND ("blowing sands")	Seepage	Depth to water at end of drilling = 4.80m (72.51) Installation dipped at 0.64m (76.67m)
	BRE SA01	2.80 (81.93)	Brownish grey sandy clayey GRAVEL	Seepage	Unstable from 2.0m
	BRE SA02	2.60 (79.63)	Firm to stiff light brown slightly sandy very gravelly CLAY	Rapid	Strike rising 150mm in 14minutes
	BRE SA03	1.40 (78.28)	Firm yellowish grey sandy very gravelly CLAY	Seepage	Sidewall collapse from 0.40m – Rapid ingress rising 150mm in 4minutes
		2.40 (77.28)	Grey sandy clayey GRAVEL	Rapid	
	BRE SA04	0.70 (77.61)	Grey sandy slightly gravelly CLAY	Seepage	Sidewall collapse from 0.70m
		1.20 (77.11)	Soft to firm dark grey slightly sandy very gravelly CLAY	Seepage	
		1.50 (76.81)	Soft to firm dark grey slightly sandy very gravelly CLAY	Seepage	
RC03	5.90 (73.47)	Grey brown sandy silty/clayey GRAVEL	Seepage	Depth to water at end of drilling = 1.70m (77.67) Installation dipped at 3.33m (76.04m)	
AREA 2 (NORTHEAST)					
2022 Works	BH12	2.20 (78.30)	Light brown sandy silty gravelly CLAY	Moderate	Rose to 0.70m (79.80) after 20minutes. Installation dipped at 0.98m (79.52) & 1.0m (79.50) & 1.54 (78.96)
	TP30	2.40 (78.21)	Grey very sandy gravelly clayey SILT	Seepage	Unstable w/ sidewall collapse from 0.20m
2023 Works	TP/RO05	2.30 (82.38)	Brownish grey sandy clayey GRAVEL	Moderate	Slightly unstable from 1.50m
	TP/RO06	2.0 (82.92)	Soft to firm light brown sandy very gravelly CLAY	Seepage	Slightly unstable from 1.50m
		3.0 (81.92)	Grey brown sandy very clayey GRAVEL	Seepage	
	TP/RO07	1.80 (81.06)	Soft to firm light brown sandy very gravelly CLAY	Seepage	Slightly unstable from 1.10m
		2.40 (80.46)		Rapid	
	TPRO-05	Dry	-	Dry	Installation dipped at 3.79m (80.85m)
	TPRO-06	Dry	-	Dry	Installation dipped at 3.76m (81.27m)
	TPRO-07	Dry	-	Dry	Installation dipped at 2.43m (80.43m)
	BRE SA06	2.50 (80.05)	Stiff occasionally very stiff grey slightly sandy very gravelly CLAY	Seepage	Slightly unstable from 1.25m

2023 Works	RC01	14.50 (70.83)	Grey brown clayey sandy coarse GRAVEL	Seepage	Depth to water at end of drilling = 3.50m (81.83)
	RC01A	16.80 (68.53)	Grey brown slightly clayey sandy GRAVEL	Seepage	Depth to water at end of drilling = 6.0m (79.33) Installation noted Dry on 10-07-23
	RC02	11.80 (71.12)	Grey brown sandy clayey GRAVEL	Seepage	Depth to water at end of drilling = 3.40m (79.52). Installation dipped at 2.85m (80.07m)
AREA 3 (SOUTH & SOUTHEAST)					
2022 Works	BH05	2.80 (75.08)	Dark brown sandy silty gravelly CLAY	Moderate	Rose to 1.50m (76.38) after 20minutes. Installation dipped at 0.87m (77.01m)
	BH07	1.30 (76.64)	Dark brown sandy SILT/CLAY	Slow	Rose to 0.90m (77.04) after 20minutes
	TP13	2.70 (77.13)	Slightly sandy gravelly silty CLAY	Seepage	Seepage at base of pit
	TP16	2.80 (76.27)	Brownish grey sandy very silty GRAVEL	Moderate	Slightly unstable, sidewall collapse at 2.0m
	TP18	3.0 (76.37)	Dark grey sandy gravelly SILT	Seepage	Slightly unstable, sidewall collapse at 2.50m - Seepage at base of pit
	TP19	2.50 (76.48)	Slightly gravelly silty SAND	Moderate	Slightly unstable, sidewall collapse at 2.50m
	SATP05 / BRE05	1.70 (76.91)	Grey sandy GRAVEL	Moderate	Unstable – sidewall collapse from 0.70m
2023 Works	TP/RO08	2.30 (79.10)	Firm grey brown sandy very gravelly CLAY	Seepage	Slightly unstable from 2.0m
	TPRO-08	Dry	-	Dry	Installation dipped at 1.22m (80.18m)
	TPRO-10	Dry	-	Dry	Installation dipped at 1.40m (78.20m)
	BRE SA05	1.70 (77.14)	Greyish brown SAND	Moderate	Unstable from 0.60m
2023 Works					
	RC04	5.40 (72.92)	Grey brown sandy silty/clayey GRAVEL	Seepage	Depth to water at end of drilling = 3.50m (74.82). Installation dipped at 1.12m (77.20m)

5.4 Ground Gases

Gas monitoring was undertaken in the borehole standpipes to measure concentrations of methane, carbon dioxide, oxygen and hydrogen sulphide. A Geotech GA5000 apparatus was used and the readings were conducted by an IGSL engineering geologist. Summary details of the gas concentrations are presented in Table 5. The monitoring works determined carbon dioxide concentrations (peak readings) of 0.6 to 2.3%. No methane (CH₄) or hydrogen sulphide (H₂S) ppm concentration was detected in any of the four wells.

Table 5 - Summary of Ground Gas (Peak) Measurements

BH	Reading Date	CH ₄ (%)	CO ₂ (%)	O ₂ (%)	CO (ppm)	H ₂ S (ppm)	Flow Rate (l/hr)
BH10	19-Dec-22	0	2.3	15.9	0	0	0.1
BH12	19-Dec-22	0	1.1	15.9	0	0	0.1
BH03	19-Dec-22	0	0.6	20.6	0	0	0.1
BH13	19-Dec-22	0	0.8	18.9	0	0	0.1

6. GROUND ASSESSMENT & ENGINEERING RECOMMENDATIONS

6.1 General

In light of the ground investigation findings, the following geotechnical issues are developed and discussed for engineering design:

- Foundation Solutions
- Earthworks & Ground Improvement
- Groundwater / Infiltration
- Slopes / Batters
- Pavement Construction
- Buried Concrete
- Ground Gas
- Environmental Testing - Water
- Waste Acceptance Criteria [WAC] & Environmental Testing

Figure 29 – DC Building Layout and ESB GiS Substation with 2023 investigation point overlay



Taken from RKD Drawing No. 22217-RKD-ZZ-ZZ-DR-A-1100

6.2 Foundation Solutions

6.2.1 DC Bld 1

DC Building 1 is located on glacial soils, typically firm to stiff and stiff in consistency. The dynamic probes did not extend beyond a depth of 1.70m (82.62m OD), each terminating or refusing in stiff soils. SPT N-values in BH09 and BH10 indicate firm soils to c3.0m. Visual observations during trial pitting show the upper soils are generally firm and firm to locally stiff. Shear vane tests at 0.50m in TP25 range from 80b to 90kPa and are suggestive of stiff deposits. The stiff fine grained soils (clay matrix) should be capable of offering a safe or allowable bearing capacity of 125 to 150kPa and appear mostly at a depth of 1.0m bgl. This depth and bearing capacity could be used to size conventional strip footings and pads at Building 1 (and to limit long term settlements to <15 to 20mm).

Levels range widely across the footprint of Building 1 from 83.0 to 85.30m OD, hence excavations to construct conventional strip footings and/or pads will subsequently vary. It is expected that considerable cut / fill earthworks will be required over the building footprint. For this reason, if significant mass excavation is planned, in order to re-use the material and reduce stockpiling or 'soil waste' removal from site, a programme of soil stabilisation could be undertaken. Laboratory testing on samples acquired from site was conducted using varying percentages of lime and lime/cement binders. The modification trial testing established an incremental increase in soil performance in terms of strength / stiffness (refer to Section 6.3). Given the greenfield site currently extends over a large unobstructed expanse, soil stabilisation is seen as a practical solution. In our experience, such soils treated with lime or lime / cement should offer bearing capacities in the order of 250 to 300kPa.

If the design makes provision for ground improvement / soil stabilisation methods, then a field demonstration trial (footprint of c. 10 x 10m) is advised to assess the performance of the modified soils with lime or lime / cement binders. This would allow for in-situ testing (plate load, nuclear gauge, sand replacement and CBR mould samples) to measure CBR / stiffness, relative compaction (percentage degree of compaction) and air voids.

A greyish brown gravelly clayey SAND with a medium cobble content and occasional boulders was intercepted at 1.20m (84.16m OD) in TP25. This is the only occurrence of a granular-type stratum found at the proposed building during the 2022 investigation. Plate bearing testing on exposed sand will offer some degree of assistance in determining the settlement regime within the sand / fine gravel layers. A series of plate bearing tests will allow for determination of dig depth upon which treated soils can be placed. A nominal CBR percentage of 3% for untreated soils should be sought ahead of placement.

No water was found in the shallow installation constructed at well BH10 to a base depth of 1.80m (82.99m OD) and so the shallow dig area should remain free of groundwater inundation. A drainage plan should be developed for surface water drainage however so as not to inadvertently cause softening of the freshly exposed soils through water ponding. There is also the potential to intercept water in isolated, perched sand/gravel lenses.

Additional investigation in 2023 at 'Building 1' involved the construction of two rotary coreholes, a rotary open-hole and a trial pit. The rotary holes each unearthed a sequence of initially firm soil passing to progressively stiff to very stiff / dense soils from 3.0m (based on SPT data – see Figure 16). TP/RO05, excavated in the central area of proposed 'Building 1' reported firm CLAY to 3.60m with an intervening water-bearing gravel horizon from 1.50-2.90m bgl. The gravel layer, deemed dense on the basis of probe blowcounts, is thought to be the reason for shallow termination in nearby probes DP37, 38 & 39. Rotary open-hole drilling also highlighted the presence of the gravel layer (from 1.60-2.0m) and showed (by SPT blowcounts) the underlying CLAY to be stiff, becoming very stiff. Gravel was again intercepted at depth (from 4.60m to 5.0m). The rotary coreholes both suggest stiff and very stiff soils extend to depth with some medium dense gravel interbeds (ca. 7.50 – 9.0m bgl). Rock was reported at depths ranging ca. 14.80m to 17.10m bgl. Should larger loadings be

required, the use of bored piling methods would be recommended. As the bedrock was not identified as limestone but rather crystalline calcite veinfill, and as the spatial extent of the calcite is unknown in the area around RC01 / RC01A, pile design should not be over reliant on end bearing but achieve its strength from skin friction in both the stiff clay overburden and intervening gravel. Given the uncemented, extremely closely fractured nature of the rock in the area, it should be treated from a geotechnical view as a dense gravel. The bearing capacities offered by the crystalline calcite would therefore be in the order of 300kPa.

6.2.2 DC Bld 2

This building straddles an existing field boundary. Currently, the topographically lower eastern field has the appearance of regular waterlogging due to its thick cover of tussocked grass. Deep drainage ditches traverse the same field to assist with drainage.

For the purposes of designing shallow foundations, safe or allowable bearing capacities will depend on soil type / composition and stiffness. Across the Building 2 area, the soils consist of initially firm becoming stiff Silt and Clay matrix till and should offer a similar capacity as that noted for Building 1, i.e., 125 to 150kPa at 1.0m bgl. Many strength indicators, from shear vanes, probes and SPT N-values, as well as visual strength descriptions made during pitting, point to the presence of firm and stiff soils generally. However, there are also outliers where probe values and SPT N values from 1.0m to 2.0m flag the potential for low strength soils to be present in the stratigraphy. Consecutive N_{100} values of 0 and 1 were recorded in DP46 and DP48 and SPT N values of 10 were returned for tests from 1.0-1.45m (indicative of soft to firm soil) in both BH11 and BH12. The possibility of there being fine sand and clast-free Silt and Clay may offer an explanation for the lower blowcounts in the driven dynamic tests. Such fine-grained coarse soils present little resistance to probing and often appear as successive zero blow counts.

Trial pit TP/RO07, excavated during the 2023 phase of works, intercepted a 'soft to firm' sandy very gravelly CLAY layer from 1.80m to 2.50m bgl. Its position aligns well with the lower blowcounts registered in nearby probe DP43 from 2.10m to 2.70m. Entry of gravel at depth in TP/RO07 (from 2.50m) is marked by an immediate rise in blowcounts in DP43, suggestive of a dense nature.

In light of the lower strength shallow horizons, it is recommended (if choosing conventional foundation design) to size pads and strip footings with a safe bearing capacity of 100kPa at c1.0m. Locally, if softened soils are intercepted, these can be excavated and replaced with low-grade C20 leanmix concrete to underside of foundation.

As with Building 1, the option to modify and stabilise soils should be considered thereby offering a significantly higher bearing capacity (250 to 300 kPa). It would also 'build out' the risk of foundations bearing on to or traversing zones of low strength (soft) soils.

Given the occurrence of possible lower strength soils from 1.50m to 2.50m, soil stabilisation would need to incorporate this layer. This would bring soil stripping and soil re-working close to the water-bearing gravel stratum on site. This makes modification of soils somewhat more impractical without first initiating water drawdown (water level in wells RC02 and TPRO-07 was found between 2.43-2.85 / 80.43-80.07m OD). As an alternative design solution, to homogenise the strength of the ground without extensive soil stabilisation, given consistently stiff / dense ground lies at ca. 5.0m bgl, it is recommended installing a network of controlled modulus columns to stiffen the ground. A load distribution mattress (comprised of SR21 compliant hardcore) should be installed to allow for construction of this network of columns. This cover will offer a foundation from which to develop the building floor / ground floor slab.

Water levels in well BH12 were dipped at ca. 1.0m / 79.50m OD in December 2022 which, although possibly generated from a deeper-seated water strike (at 2.20m), do present concerns for open excavations in the area. Any shallow excavations should be formed and backfilled once blinded to

prevent water entry. A dig plan should aspire to immediate blinding on the same day. Inundation of excavations will see a subsequent softening and associated lowering of shear strengths. This could lead to unnecessary over-excavation.

Bedrock cores were recovered from 15.10m comprising strong to very strong LIMESTONE. The cover of overburden soils was reported (based on SPT N values) as being as being dense from 4.50m. Extension of bored piles to depth is another potential foundation solution which would deliver larger loadings via skin friction and ultimately, end bearing (at ca. 15.0m). A piling contractor should be consulted with regard to depth of pile embedment based on loadings required.

6.2.3 DC Bld 3

Geotechnical inconsistencies are once again present when the findings of the intrusive holes over the 'Building 3' footprint are considered. These are illustrated most succinctly in the blowcount pattern recovered from probes DP06, DP07 and DP08. Shallow obstructions were recorded in both DP07 and DP08 but low N_{100} blowcounts were obtained in DP06 to a depth of ca. 1.50m (Figure 30). Nearby TP02 reported firm sandy gravelly cobbly SILT to ca. 3.0m. The only deviation from this was the occurrence of a brownish grey gravelly clayey SAND from 0.80m to 1.0m. This may be the cause of the low blowcounts in DP06 to ca. 1.50m.

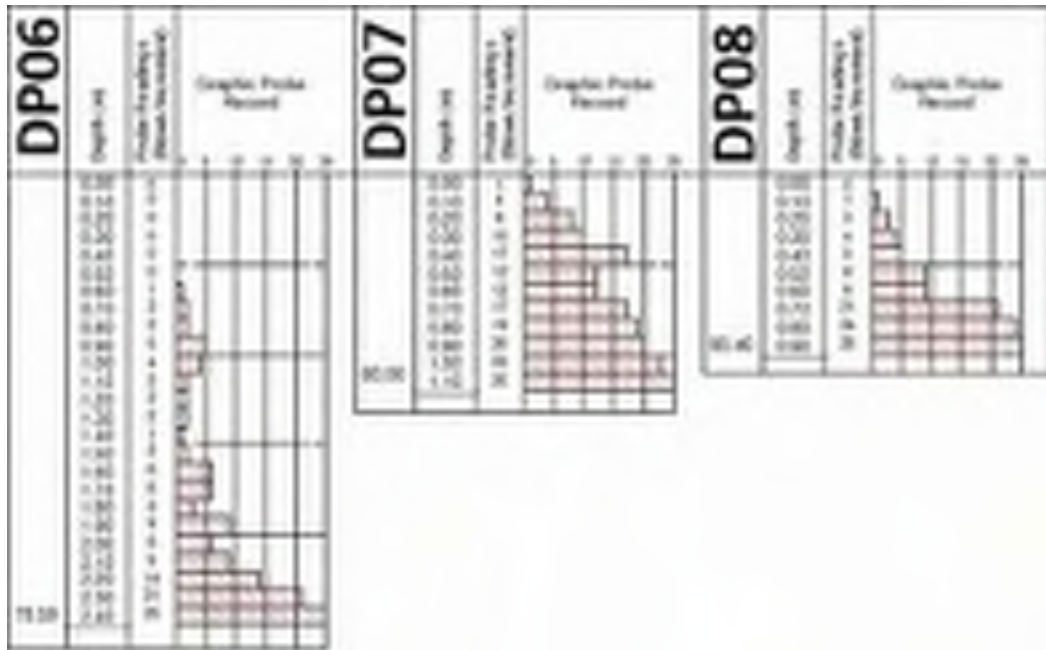
In light of this uncertainty, the additional SI undertaken in April / May 2023 saw trial pit TP/RO04 conducted a matter of metres away from DP06. This uncovered a 'soft to firm' stratum from 1.0m to 1.70m before encountering a sandy very clayey gravel at depth. This explains the blowcount pattern registered in DP06 where low N_{100} values were found in the clay, gradually increasing, and ultimately terminating in the underlying gravel. Nearby, rotary open-hole TPRO-04 did not intercept shallow dense gravels but rather firm becoming firm to stiff clay soils extending to ca. 3.50m (based on SPT N values). This suggests the gravel is variable in its spatial extent.

Elsewhere, BH01 and BH02 recorded SPT N-values at 1.0m indicative of lowerbound firm soils, with a slight improvement from 1.50-2.0m (See Figure 9). As with the other buildings, placing conventional footings on the upper soils could be considered. Given the disparity locally in stiffnesses, it is recommended that footings placed at depths of ca. 1.0m are assessed and approved by a competent engineering geologist / geotechnical engineer. Where deemed appropriate, plate load testing should be conducted to evaluate settlement under loading and stiffness (not ignoring the limited stress distribution by a plate load test). Positioning the pads at depths of ca. 1.0m should offer a safe or allowable bearing capacity of 100kPa bearing at best. Excavating to ca. 1.50m should see an increase in safe bearing pressure (up to 150Pa) but there will in all likelihood be areas of marked changes in soil type and these should be examined ahead of blinding.

The alternative to placing pads and strip footings in the upper soils would be to modify / stabilise the areal extent of the building thereby creating a uniform working platform in which to site pads and strip footings. Pads and trenches formed in stabilised fill should offer a bearing capacity of 250 to 300kPa.

As with Building 2, the operation of soil stripping and later modification with lime / lime-cement binder may see groundwater ingress during excavation / treated soil placement. The water levels dipped in July 2023 show elevations ranging by two metres, from 78m OD to 76m OD. The standpipe installed in TPRO-04 is likely to represent the local level (2.27m / 78.01m OD) given the pipework extends to 5.0m bgl. It equates approximately with a rapid ingress of water in gravels in nearby trial pit TP/RO04, intercepted at 1.80m bgl / 78.55m OD.

The use of piles to achieve greater bearing pressures would see bored piles extend to ca. 9.0m with limestone having been encountered at 8.80m (70.57m OD). Overlying bedrock in the area, a grey brown sandy silty clayey GRAVEL was reported which appears very dense from 3.0m bgl. A low SPT N value obtained at 1.50m ($N=7$) corroborates the presence of shallow soft soils in the area.

Figure 30 – Probes positioned in NW corner of DC Building 3

6.2.4 DC Bld 4

The 2023 investigation sited a trial pit TP/RO03 in the central area of proposed 'Building 4'. The pit proved a firm CLAY to 2.30m at which point the dig was terminated due to instability. A seepage at 1.50m (80.09m OD) was followed by a rapid inflow of water at 2.0m. Both strikes were recorded in a 'very gravelly CLAY'. Nearby rotary open-hole TPRO-03 suggested firm CLAY extends to at least 3.0m (SPT N values of 16 at both 1.50m and 3.0m bgl). CLAY was found to persist to the finish depth of 5.0m bgl. On the day of construction (02-05-23), the drillhole was reported dry. When dipped on 10-07-23, the well reported a water level of 1.49m (80.14m OD) equating to the seepage first registered in TP/RO03 at 1.50m bgl.

The original phase of investigation reported a firm to stiff and stiff dark and light brown CLAY from 1.20m to 2.80m in BH04. A slow water strike was recorded at 1.60m (79.46m OD). As with other boreholes in the area, BH09 registered firm soils to ca. 2.0 / 3.0m depth.

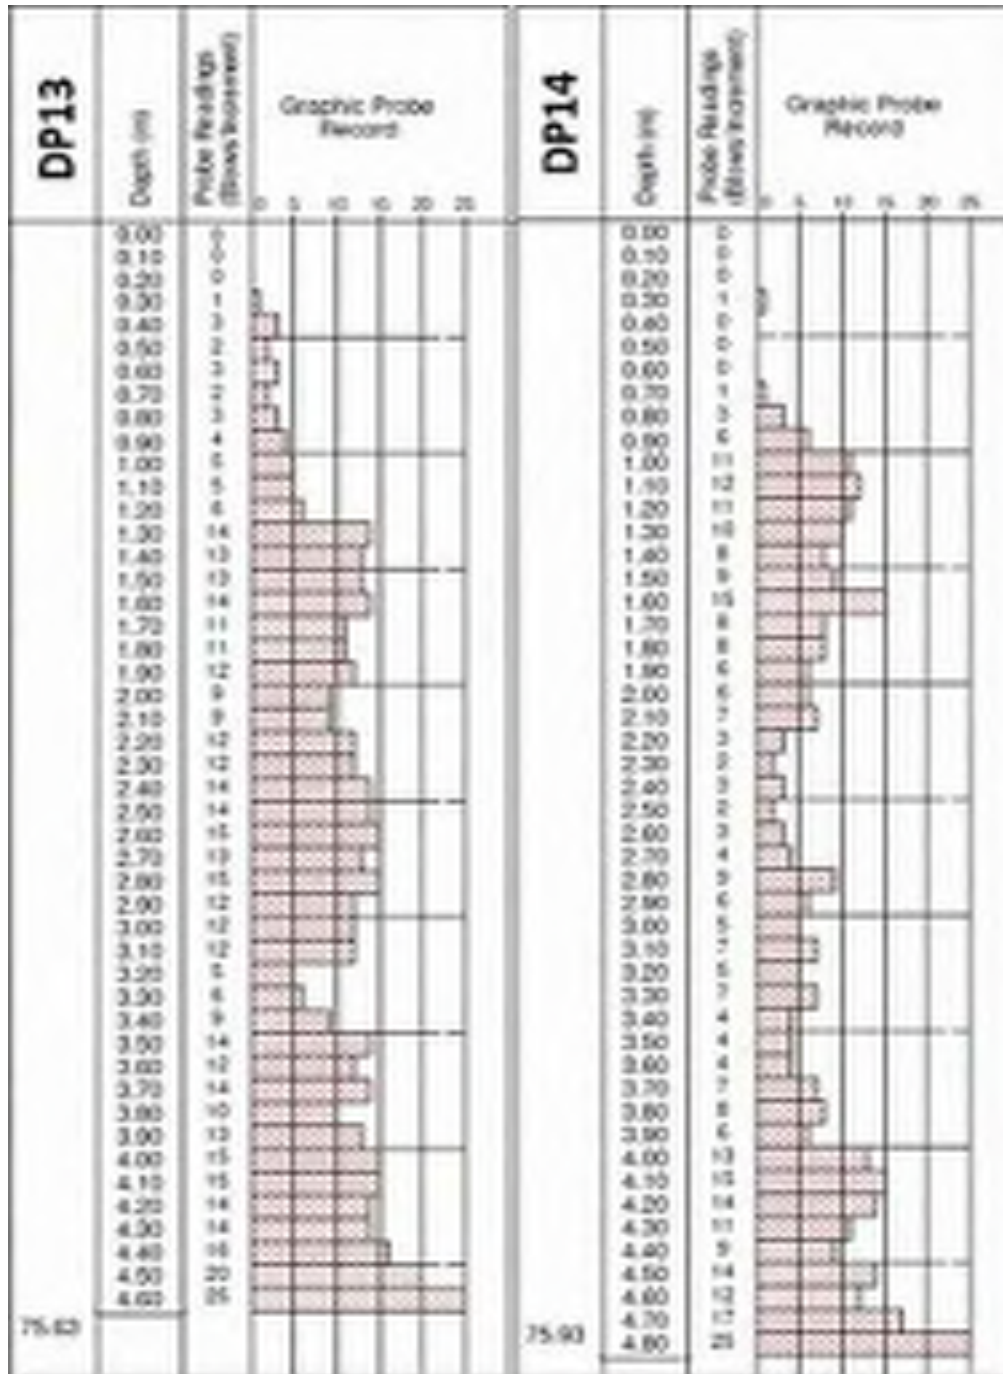
Aside from probes DP13 and DP14 located to the southeast of the proposed footprint, all other probes terminated at shallow levels generally shy of 1.60m bgl. These shallow refusals are thought attributable to increasing clast / gravel content in the till. The two probes which extended to depth (4.70m and 4.90m respectively) do not show an overly similar pattern in blowcounts (Figure 31). Given that locally pits reported the entry of gravel at depths between 2.0 to 2.30m bgl, the inconsistencies between probe N_{100} values are thought due to the heterogeneity of the gravel at depth interspersed occasionally with finer sand lenses. In contrast to SPT N values, probes DP13 and DP14 suggest dense / stiff soils from ca. 1.20m.

Given the variability in the area, allied with low SPT N values in boreholes indicative of firm / medium dense soils, a bearing capacity of 100kPa is recommended at c1.0m at Building 4. As with other buildings on the site, if greater load bearing capacities are required the use of excavate and replace and re-engineer the upper soils by stabilisation techniques could be used to produce a high strength engineered fill.

Alternatively, rotary open-hole drilling proved stiff soils from 4.0m (to 5.0m end depth). The use of CMC (controlled modulus columns) methods across the footprint to found into this stratum could be

considered. The installation of piles (rockhead levels unproven in the area of Building 4) to support the column loads should be considered with capacity derived from skin friction and end bearing (rockhead at 8.80m in RC03 / ca. 15m in RC01A). It is not known what the spatial extent of calcite veinfill as found in RC01 / RC01A is and further rotary holes should be considered if piling is selected.

Figure 31 – DP13 & DP14 profiles - both located towards the southeast of Building 4



6.2.5 DC Bld 5

Borehole BH05, to the south of the newly positioned 'Building 5', reported initially firm soils to ca. 2.0m. Stiffer soils, based on SPT N-values, extended to end depths of 3.60m. BH06 achieved only 1.10m before termination and so it does not provide much information on local stratigraphy. Likewise, a number of probes (DP20, 24, 31) achieved only shallow depths terminating at 1.0m.

A number of probes extended to depths ranging ca. 3.50 – 5.20m bgl at this area. In these probes, an array of N_{100} patterns exist. Some show steady increase in blowcounts with depth, ie., DP21, whilst others suggest the presence of deeply buried, potential soft / low strength zones, ie., DP19 & DP28 (Figure 32).

In the more recent 2023 investigation, rotary open-hole ROTP-08 was conducted along with trial pit TP/RO08. The rotary open-hole, based on SPT N-values recorded firm soils to ca. 2.0m with stiff soils from 2.40m, becoming very stiff from 3.20m to a base depth of 5.0m. The pit, TP/RO08, also registered a firm CLAY to 2.90m, being stiff to very stiff from 2.90m to pit base at 3.30m. A gravel was identified in TP/RO08 from 1.30m to 1.50m and this may be relevant when considering the shallow termination depths in nearby probes. The water level in standpipe TPRO-08 was read at 1.22m bgl (July 2023). This relatively elevated level may be linked to the shallow buried gravel layer.

The low blowcounts in DP19 and DP28 may reflect potential soft or low strength zones where water softening may be a factor. Alternatively, the probes may infer the presence of fine sands and gravels which offer little point load resistance compared to more gravelly Silt and Clay soils above and below.

Both DP19 and DP28 are placed spatially in a linear trend where waterstrikes were encountered in both trial pits and boreholes (See Figure 27). If this were the case, this would imply the presence of water saturated, likely granular soils at depth and this may correspond to the low N_{100} interval.

The use of conventional strip and pad footings should see a bearing capacity of 125kPa achievable at c 1.0m depth. Where it is deemed that unsuitable / low strength soils are in place at this depth, the use of excavate and replace methods (i.e. lean mix concrete to underside of footings) is advised to deepen excavations locally.

As with other proposed buildings, soil stabilisation offers a technique to homogenise the strength of the upper soils. A stiff dark grey brown CLAY appears in

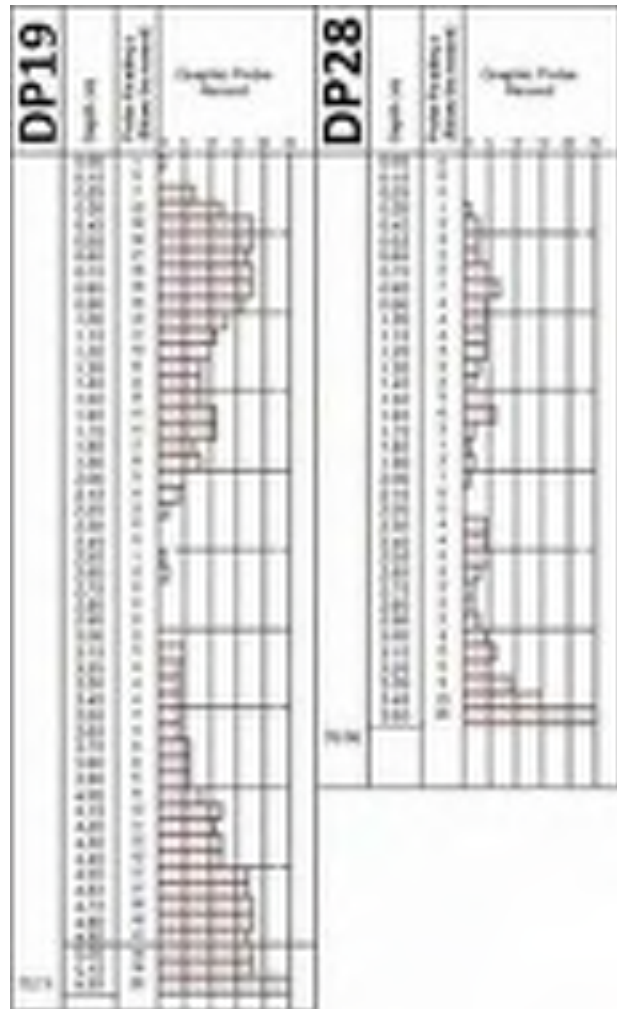


Figure 32 – DP19 and DP28 profiles

the deeper holes and pits (at ca. 3.0m) and this over-consolidated glacial till should provide a founding layer capable of offering ca. 200-250kPa. However, practical ways of founding on this layer would suggest use of shallow piles or CMC techniques to avoid excavation through water-saturated granular or low strength zones.

6.2.6 DC Bld 6

The disparity in soil stiffness observed between BH07 in the south and BH08 (2022 investigation) in the north underlines the variability in the soils underlying Building 6. Towards the south (the lowest topographical point on the site), soft soils were reported in BH07 to 1.70m (76.24m OD). Nearby probe DP25 reaffirms the possible soft nature of the upper stratum to a similar depth. However, DP26 shows no such softening. Instead, stiff / dense soils are reported from immediately below the topsoil. The potential softening in BH07 and DP25 is also reported at depth in both DP27 and DP28 where both probes registered their lowest probe N_{100} values in an interval from ca. 2.0m to 2.20m. Since this is roughly coincident with the water table, water softening or possible sand lenses may account for the low N_{100} values obtained. In any case, it would be advised to investigate further the soil type and strength at each of DP25, 27 and 28.

The presence of potentially soft / low strength soils to c 1.70m (BH07), coupled with the reported softening at 2.0m in some probe logs, implies shallow footings may not be suitable across the entire footprint without extensive excavation and replacement. Additionally, the higher water table could undermine shallow excavations where formed.

There is a 3m difference in levels between BH07 and BH08, from south to north. Ground Improvement (soil stabilization) could be adopted to produce a high strength engineered fill upon which the building could be sited. As outlined previously, this is a well proven method in achieving a significant improvement in strength and hence bearing capacity and would largely eliminate off-site disposal of low strength / unsuitable deposits. Utilising soil stabilisation would permit re-use of the site-won materials when forming an enhanced strength subgrade. A soil stabilised layer built off the underlying stiff soils should offer bearing capacities in the order of 250 to 300 kPa.

The alternative to employing soil stabilisation techniques would be to excavate and replace *en masse* the low strength soil and bring up with layers of imported granular fill (T0 to SR21 Annex E). The introduction of compacted gravel would provide a medium in which to found pads and strip footings at bearing capacities of ca.200kPa. This may not be practical on a large-scale basis given the likely excavation depths and volume of soil arising generated and subsequent fill required.

6.2.7 GiS Sub

Trial pitting across the GiS Sub area reported firm onto stiff soils at 1.0m bgl. The stratum was logged as very sandy throughout. Probes constructed through the upper layer revealed negligible resistance with successive 0 and 1 blowcounts per 100mm (Figure 33). It is thought this is related to the sandy nature of the soil rather than highlighting a soft zone. Equally, boreholes BH13 and BH14 reported low SPT N-values indicative of loosened soils. A bearing capacity of 125kPa should be possible on the sandy clay soils at 1.0m based on visual observations in trial pits. Use of large diameter plate bearing tests at formation level will allow for better assessment of the density of the soils at 1.0m. Should larger capacities be required, it is likely the use of soil stabilisation measures would see an increase in the bearing pressures of 250 to 300 kPa.

Figure 33 – Probes positioned W to E across GiS Sub showing low N_{100} values for 1m bgl

6.3 Earthworks & Ground Improvement

To evaluate the re-use properties of the upper soils, a programme of earthworks laboratory testing was conducted. This comprised CBR, Moisture Condition Value (MCV) and Dry Density / Moisture Content relationship. Bulk samples were acquired from a selection of trial pits excavated across the site with testing initially conducted on the material at their natural or 'as-received' moisture contents. Earthworks testing was undertaken on those samples listed in Table 6. Their respective depth intervals and soil descriptions are shown in the aforementioned table.

Table 6 – Sample description of soils used in Earthworks testing – soil strength taken from TP logs

Exploratory Hole No.	Sample Depth	Sample Description
TP04*	0.60	('Firm') Brown slightly sandy slightly gravelly CLAY
TP12*	0.50	('Stiff') Brown slightly sandy slightly gravelly CLAY
TP13	1.0	('Firm') Grey/brown sandy gravelly SILT/CLAY
TP13	1.50	('Firm') Brown slightly sandy, slightly gravelly, CLAY
TP16	1.0	('Stiff') Mottled brown slightly sandy, slightly gravelly, CLAY
TP18	0.50	('Firm to stiff') Mottled brown sandy gravelly SILT/CLAY
TP19*	0.50	('Firm to stiff') Brown sandy gravelly SILT/CLAY
TP20	0.60	('Firm') Grey/brown sandy gravelly SILT/CLAY
TP21	0.50	('Firm') Brown sandy gravelly SILT/CLAY
TP22	0.60	('Firm') Brown sandy gravelly SILT/CLAY
TP24	0.60	('Firm to stiff') Brown sandy gravelly SILT/CLAY
TP26*	0.50	('Firm') Brown slightly sandy, slightly gravelly, CLAY
TP28	0.70	('Firm') Mottled brown slightly sandy, slightly gravelly, CLAY
TP29	0.50	('Firm') Brown sandy gravelly SILT/CLAY
TP31*	0.50	('Firm') Brown slightly sandy slightly gravelly CLAY
TP33	0.60	('Firm') Brown slightly sandy, slightly gravelly, CLAY
TP34	0.60	('Firm') Brown sandy gravelly CLAY

*Soil samples subject to 1% Lime addition, 1% lime / 2% cement addition & 3% lime addition

The samples, ahead of being subject to reusability testing, each have their >20mm fraction removed. This, in the case of the CLAY and SILT/CLAY soils, removed 2.7 to 14% of the 'as received' soil sample.

The resultant earthworks testing (on natural 'as-received' samples) produced laboratory CBR results in the range 0.5 to 48% with MCV's of 0.2 to 12.7. Moisture contents ranged from 9.2 to 26%. Maximum dry densities were proven to range between 1.76 and 2.01mg/m³ at optimum moisture contents of 8% to 14% (refer to Table 7).

Table 7 - Summary Details of Laboratory Testing samples

Hole No.	Depth	Lab CBR Value % (Moisture Content %)	MCV at Natural Moisture Content (Moisture Content %)	Dry Density / Moisture Content Relationship
TP04*	0.60	1.9 (15)	4.6 (13)	Max Dry Density = 1.93mg/m ³ at 9% OMC
TP12*	0.50	2.1 (17)	6.0 (13)	Max Dry Density = 1.87mg/m ³ at 11% OMC
TP13	1.0	1.6 (13)	8.8 (12)	-
TP15	1.50	1.5 (13)	7.1 (13)	Max Dry Density = 1.99mg/m ³ at 10% OMC
TP16	1.0	0.5 (14)	0.2 (14)	Max Dry Density = 2.01mg/m ³ at 8% OMC
TP18	0.50	48 (10)	12.3 (9.2)	-
TP19*	0.50	8 (13)	8.2 (13)	Max Dry Density = 1.94mg/m ³ at 11% OMC
TP20	0.60	-	2.4 (18)	-
TP20	1.0	0.6 (19)	-	-
TP21	0.50	1.6 (20)	7.6 (20)	-
TP22	0.60	1.1 (20)	5.7 (20)	Max Dry Density = 1.80mg/m ³ at 14% OMC
TP24	0.60	47 (13)	11.2 (14)	-
TP26*	0.50	1.0 (13)	6.4 (14)	Max Dry Density = 1.96mg/m ³ at 10% OMC
TP28	0.70	0.5 (26)	2.8 (25)	Max Dry Density = 1.76mg/m ³ at 14% OMC
TP29	0.50	42 (9.2)	16 (9.9)	-
TP31*	0.50	7.4 (13)	12.7 (11)	Max Dry Density = 1.96mg/m ³ at 9% OMC

Following this initial classification, trial mixes were carried out to evaluate the performance of the soils following the addition of lime and lime / cement binders. Once mixed with the binder, the samples were then subjected to further Moisture Condition Value (MCV) and soaked CBR tests at designated time intervals. The MCV tests were conducted after mixing and air curing for one hour with soaked CBR tests following curing for 3, 5 and 7 days respectively. Tables 8 and 9 provide a summary of the laboratory test results on samples which, for comparative purposes, are presented with and without the lime and lime / cement addition.

Table 8 – Moisture Condition Value [MCV] at natural moisture content for overburden soil samples and MCV at varying % lime and % lime / cement content

Exploratory Hole No.	Sample Depth Range	MCV (Moisture Content %)			
		Initial MCV (MC %)	1% Lime MCV (MC %)	1% Lime / 2% Cement MCV (MC %)	3% Lime MCV (MC %)
TP04	0.60m	4.6 (13)	7.2 (10)	8.6 (14)	13.6 (11)
TP12	0.50m	6.0 (13)	8.0 (13)	8.9 (14)	11.7 (12)
TP19	0.50m	8.2 (13)	11.2 (13)	11.5 (12)	12.9 (12)
TP26	0.50m	6.4 (14)	8.4 (11)	9.8 (12)	11.9 (12)
TP31	0.50m	12.7 (11)	15.4 (9.5)	15.4 (10)	16.1 (9.2)

In classification testing, moisture contents for the natural soils examined were found to range from 6.5 to 19% (aside from some outliers) with those samples selected for reusability testing ranging from 12 to 18%. Optimum MCV and dry density values were obtained over a similar range of moisture contents (between 8 and 14%). The addition of lime / cement binder is seen to raise the MCV value since hydration further reduces moisture content. MCV testing shows effective improvement with lime addition. However, there are samples where the MCV value becomes dry of optimum suggesting optimum MCV results are achieved with a 1% lime admixture.

Table 9 – Summary of CBR Tests at NMC and with addition of Lime / Lime-Cement Binders

Exploratory Hole No.	Sample Depth	CBR % Value												
		Initial Unsoaked (Natural state)	1% Lime			2% Lime			3% Lime			1% Lime / 2% Cement		
			3-Day Soaked	5-Day Soaked	7-Day Soaked	3-Day Soaked	5-Day Soaked	7-Day Soaked	3-Day Soaked	5-Day Soaked	7-Day Soaked	3-Day Soaked	5-Day Soaked	7-Day Soaked
TP04	0.60m	1.9	11	34	49	34	41	42	31	52	61	41	67	90
TP12	0.50m	2.1	7.4	14.6	20.4	12	24	36	29	40	48	39	40	53
TP19	0.50m	8	14	24	37	39	55	60	39	77	86	74	82	122
TP26	0.50m	1.0	13	21	32	35	46	53	58	69	63	58	83	95
TP31	0.50m	7.4	7.6	19	37	41	41	63	35	50	62	46	74	95

There trial testing shows an incremental increase in strength over the CBR test duration. Clearly there is a distinct improvement with treatment using higher percentage lime and with the combined lime and cement binder. Values appear to level off with little divide noted in CBR values for treated soils by the 7-day period whether there was a 2% or 3% lime admixture added. A marked increase in CBR results was noted where cement (2%) was combined with lime (1%) being even more pronounced when allowed cure for 7 days compared with 5 days.

There is a marked heterogeneity in the uppermost soils on site. There are instances in the same pit where the CLAY subsoils are remarked as firm to stiff (BRE SA06 0.65-1.40m) with deeper soils logged as 'soft to firm' (1.40-2.25m). The use of binder will obviously improve those areas where lower strength compressible soils are encountered and will serve to elevate the already positive performance of the more firm / stiff soils. The investigation did not indicate a consistent pattern of soil strengths across the site. The various SPT plots drafted for the site (See Figures 6, 9, 10, 16, 18, 22) do suggest that the upper 2m to 3m of soil could be classed as generally firm, occasionally soft to firm as well as variably firm to stiff.

Therefore, in certain localised areas, without reworking / drying or modification with lime (calcium oxide), the natural, uppermost, surficial fine-grained soft to firm and occasionally soft soil would be unsuitable for re-use as a sub-structure formation. However, it is clear that the addition of binders, in its varying concentrations, will produce an acceptable sub-formation layer (high strength Class 2 engineered fill with an MCV 8 to 15). Soil stabilisation may also be relevant to the overall development of this gently sloping site, particularly if cut and fill operations are envisaged.

It is vital that during the soil stabilization process if chosen, that any stockpiles are graded and shaped so that surface water cannot collect or pond. Similarly, careful control of excavation, transporting, stockpiling, placing and compaction is advised to ensure that degradation of the shallow soil deposits does not occur. This is extremely important as poor earthworks management would render the fine soils as unsuitable for re-use.

Chemical analysis tests to measure sulphate and sulphur contents to BRES D1 were scheduled on the lime treated CBR samples (after 7 days curing). The results on the samples tested from TP04, TP26, TP19, TP12 & TP31 show negligible concentrations of water soluble sulphate, acid soluble sulphate and total sulphur (See Appendix 12) demonstrating no adverse reaction with lime.

If the design makes provision for ground improvement or soil stabilization methods, then a field demonstration trial (footprint of c. 10 x 10m) is advised to assess the performance of the modified soils with lime or lime / cement binders. This would allow for in-situ testing (plate load, nuclear gauge, sand replacement and CBR mould samples) to measure CBR / stiffness, relative compaction (percentage degree of compaction) and air voids.

6.4 Groundwater / Infiltration

As noted in Section 5.3, during the 2022 investigation, groundwater strikes were generally restricted to areas towards the southern half of the site (south of the existing farmyard). The construction of shallow monitoring wells throughout the site, augmented by the completion of further pits in April / May 2023, highlighted the occurrence of water in gravelly CLAY and GRAVEL layers in the northern half of the site between 1.50-2.80m bgl. Possible softened layers ('Soft to firm') were also documented in pits TP/RO06 and TP/RO07 coincident with water seepages and rapid ingress. Rotary open-holes 05, 06 and 07, which remained dry during their construction, were later found to have water levels between 2.43 to 3.79m bgl (between 80.43-81.27m OD) when dipped in July 2023.

A plan of the pits and boreholes where water strikes were encountered during the 2022 investigation is shown in Figure 27. The influence local topography has on the occurrence of groundwater strikes is clearly demonstrated in 'Area 3'. Strikes were intercepted generally in buried sandy GRAVEL soils at depths in the region 2.0m bgl in the trial pits and from 2.0m to 3.0m in boreholes. In boreholes, it was frequently noted that after a twenty-minute observation period, the strikes rose appreciably.

In 'Area 1', a water seepage, the shallowest noted on the project, was noted in BRE SA04 at 0.70m towards the southernmost field boundary. Rotary open hole TPRO-09 identified peat to 1.20m in this relatively low-lying area. The standpipe in TPRO-09 was dipped at 0.64m bgl (76.67m OD) in July 2023.

Given the depths where groundwater strikes were reported, ingress in shallow foundation excavation should be anticipated in certain areas of the site. However, it is generally regarded as unlikely, with the water sitting in deeper-seated Gravel. Should localised seepages occur, they should be readily controlled by sump pumping. Should water-bearing sandy deposits be encountered, pumping in these deposits will serve to remove sand-sized grains and may de-stabilise areas where wash-out occurs. This should be noted in any risk assessment developed for dewatering deep digs / service trenches.

As mentioned in Section 5.3 and evidenced in water monitoring, the potential exists for seasonal changes in groundwater levels. The works were mainly carried out during October 2022. It may be the case that the various waterbodies at depth are subject to seasonal variations. Further monitoring will assist in this matter.

Discounting the potentially erroneous results obtained from the April / May 2023 tests, fourteen soakaway tests were conducted on the site (See Table 10). A second shallow soakaway test (SA05B) was conducted at location SA05 following interception of water in SA05A at 1.70m bgl. The remaining soak pits were found to be devoid of groundwater. A test failure (no or negligible infiltration) was recorded in tests conducted in soak pits SA01, SA03 and SA08. These results are thought typical of largely impermeable fine glacial till material. Such soils would not be suitable for conventional soakaways offering only low or very limited natural infiltration.

Similarly, the infiltration rates where water did permeate through sidewalls were generally measured at -06E and -07E m/sec typical of sandy silts, very silty fine sands and laminated or mixed strata of silts/sand/clay. Permeability classification would be low to very low in these cases.

Table 10 – Measured infiltration rates (f) expressed as exposed area (metre) per unit time (minute)

Soakaway Test No.	Depth of Test (m bgl)	Infiltration Rate <i>f</i> (m/min)	Infiltration Rate <i>f</i> (m/sec)
SA01	1.60	0 m/min	0 m/sec
SA02	1.50	0.00015 m/min	2.441E-06 m/sec
SA03	1.80	0 m/min	0 m/sec
SA04	2.10	5.2E-05 m/min	8.591E-07 m/sec
SA05A	1.70	0.0005 m/min	8.333E-06 m/sec
SA05B	1.20 (Cycle 1)	0.00057 m/min	9.47E-06 m/sec
	1.20 (Cycle 2)	0.00041 m/min	6.887E-06 m/sec
SA06	2.0 (Cycle 1)	0.00029 m/min	4.851E-06 m/sec
	2.0 (Cycle 2)	0.00021 m/min	3.467E-06 m/sec
SA07	2.20	9.6E-05 m/min	1.603E-06 m/sec
SA08	2.10	0 m/min	0 m/sec
SA09	2.0 (Cycle 1)	0.00025 m/min	4.212E-06 m/sec
	2.0 (Cycle 2)	0.00016 m/min	2.718E-06 m/sec
SA10	1.60	0.000207039 m/min	3.451E-06 m/sec
SA11	1.80	8.46561E-05 m/min	1.411E-06 m/sec
SA12	2.20	0.0003 m/min	5.002E-06 m/sec
	2.20	0.00024 m/min	3.961E-06 m/sec
SA13	1.60	0.00022 m/min	3.59E-06 m/sec

6.5 Slopes / Batters

A maximum slope angle of 1V to 1.5H (33°) is recommended for temporary batters constructed within the upper medium to low strength fine grained soils. A long-term slope angle of 1V to 2H (26°) should be appropriate for batters in the same soils. Where deep excavation works are required in the

superficial deposits, the use of trench box support is advised especially given the instability noted at depth in some of the trial pits, more so upon encountering groundwater. In addition, the uppermost fine subsoils will be susceptible to softening and degradation and surface water or groundwater ingress can lead to a significant reduction in shear strength. Perched water can exist locally in isolated sand lenses and this should be considered in risk assessments for excavations.

Site operatives or personnel should not enter unsupported excavations and should be informed of potential risks. Where site operatives or engineering staff work in close proximity to temporary slopes or batters, these should be inspected and approved by a suitably experienced civil engineer, preferably with geotechnical experience. Where there is a risk of spalling of battered slopes, the use of a geogrid is recommended. The geogrid should be anchored at the top and bottom of the ridge face to contain particles such as gravel, cobbles and / or boulders that may become dislodged.

6.6 Pavement Construction

Twenty-three plate load tests were conducted on the shallow subsoil at depths ranging 0.40m bgl to 0.60m bgl. The plate load test permits an assessment of the in-situ stiffness of the upper soil. The test results are reported in Appendix 4 and summarised below in Table 11. The equivalent CBR values range from 0.1 to 3.5% on the initial load cycle (Cycle 1) and 0.2 to 18.9% on the reload cycle (Cycle 2).

Table 11 – Equivalent CBR % Values obtained in Plate Bearing Testing

Test No.	Depth	CBR at Load Cycle (%)	CBR at Re-Load (%)
PB 01	0.60	0.3	4.7
PB 02	0.60	0.3	0.8
PB 03	0.50	0.6	3.2
PB 04	0.40	0.1	2.2
PB 05	0.40	3.5	15.9
PB 06	0.40	0.3	3.8
PB 07	0.60	0.5	1.5
PB 08	0.50	0.2	0.8
PB 09	0.40	2.0	7.1
PB 10	0.50	2.7	3.0
PB 11	0.50	0.2	1.1
PB 12	0.50	0.2	0.7
PB 13	0.50	0.3	0.3
PB 14	0.40	0.2	0.3
PB 15	0.50	0.6	0.6
PB 16	0.60	0.2	0.6
PB 17	0.40	0.7	2.4
PB 18	0.50	0.2	0.7
PB 19	0.60	0.3	0.8
PB 20	0.40	1.5	8.3
PB 21	0.40	0.7	6.4
PB 22	0.50	2.4	18.9
PB 23	0.50	0.9	1.9

The majority of plate test results indicate extremely low CBR values (0.1 – 1.0%). For the most part, the plate tests were conducted on a sub-topsoil layer which was described as very sandy, potentially loose. There were areas where topsoil was reported as 0.50m thick (TP28) but generally 0.40m thick and so some plate tests may have been performed on a contact between lowerbound topsoil and upperbound loose subsoil. Often no appreciable increase is noted between load and reload cycle

implying no effectual increase in density with compaction. Where such a combination of results was obtained, the installation of a thickened sub-formation layer will be required.

There were instances of higher load and reload values, namely at PB05, PB09 and PB22. It is thought that these soils may have been stiffer and more gravelly in composition. In such cases, significant increases were observed between the initial load cycle and the following reload cycle. This infers room for gain with static pre-rolling.

Overall, a CBR design value of 1% should be adopted for the near surface soils in their current state. Ahead of road construction, and following compaction of the soils, a further set of plate testing (450 or 600mm diameter) could be undertaken to assess the improvement in stiffness of the formation. Given the negligible improvement seen in many tests (from load to reload), if the same test levels are again adopted it is unlikely that a significant improvement will be achieved.

In their current state, either geogrid reinforcement or the use of starter material (Class 6A / 6B) should be considered to provide a suitable foundation layer especially for access or haul / spine roads. Such a mechanically stabilized layer would be expected to consist of at least 1 layer of geogrid with 500 to 600mm of granular fill (well graded aggregate, possibly T1). Where geogrid is not utilized then approximately 500mm build-up of Class 6A / 6B starter layer material could be considered in conjunction with c300mm thick capping layer (Class 6F capping in line with Series 600 of TII SRW). This should provide a satisfactory foundation layer to adequately support the pavement.

During construction, it is important that the subgrade is not allowed to deteriorate if exposed to surface water. Locally the capping layer thickness may need to be increased if pockets or zones of lower strength formation areas are encountered. The time of year will play a role in subgrade strength especially during winter or early Spring where heavy rainfall would cause degradation of the formation. If there are particular concerns regarding the condition of the formation soils, then additional plate bearing tests should be considered during construction to verify or validate the stiffness / density of the formation soils and adequate capping thickness.

In addition, the durability of the capping material should be confirmed as capping will be exposed to the elements (especially if the works are undertaken during the winter / spring period). It is important that argillaceous sedimentary rocks (i.e. muddy limestone, calcareous mudstone, shale, etc.) are not used as capping or as a starter layer. These have high potential to give rise to degradation (i.e. poor durability and soundness) and slaking and therefore would not be suitable. All granular fills used in pavement construction should be tested and approved in advance of being used in the pavement construction.

Should soil stabilisation methods be used on site, significantly increased CBR values should be achievable on near surface soils upon the addition of lime and lime-cement binders. This may prove to be a useful method in re-using the soils on site without importation of granular material. If soil stabilisation with lime/cement is envisaged, additional plate load tests (450 or 600mm diameter) would be prudent during construction operations to verify or validate the improvement in stiffness of the formation prior to construction of the base course layer.

6.7 Buried Concrete

The chemical analysis tests on natural soil samples show pH (2.5:1) values range from 8.2 to 8.7. The sulphate aqueous extract (SO₄) results from shallow trial pit soil samples and from borehole samples produced values of <10mg/l. This would suggest the 'as-received' soil samples tested could be categorised as BRE Class DS-1. Table C1 ACEC for greenfield sites in BRE SD 1 (2005) can be used in the selection and design of concrete. If mobile groundwater conditions prevail at the site and given the pH values obtained from the testing, then ACEC class AC-1^d would be expected to be appropriate for buried concrete in the soils. In line with I.S. EN 206-1:2013, concrete could be

manufactured to Class XA1 where founded or positioned in the upper soils (Class XA1 being ≥ 2000 and $\leq 3000 \text{ SO}_4^{2-} \text{ mg/kg}$).

6.8 Ground Gas

Peak Carbon dioxide gas levels recorded on site were found to measure 0.6% to 2.3%. No detectable methane gas, carbon monoxide nor hydrogen sulphide were found in any of the four wells. Peak flow rates measured 0.1l/hr implying negligible generation within the individual wells. The gas measurements are presented in Appendix 8.

An RSK Group report commissioned by the National House-Building Council (NHBC) entitled 'Guidance on Evaluation of Development Proposals on Sites Where Methane and Carbon Dioxide are Present' (2007) offers some explanation for the derivation of carbon dioxide. Carbon dioxide gas is known to have both anthropogenic and natural sources. In relation to generation from anthropogenic sources, the decomposition of organic material results in the production of methane and carbon dioxide in approximately equal proportions. As equivalent methane levels were not recorded on site, it is unlikely that the CO_2 levels were generated from the decomposition of organic-containing waste materials – in any case, none were found on site during pitting or boring. Likewise, the potential for carbon dioxide to be generated naturally from the underlying limestone bedrock can be discounted since the wells are all shallow.

Offering a potential reason for the carbon dioxide levels, the report (NHBC, 2007) states that;

'the drilling and installation of monitoring wells will introduce artificially high concentrations of oxygen into the ground, which will cause aerobic conditions to develop. Biological micro-organisms in the ground that thrive in such conditions will not generate methane, although they will generate carbon dioxide. Any trace amounts of methane generated would typically be expected to be readily oxidised. As the microorganisms consume the oxygen, the ground conditions will revert back from aerobic to anaerobic (oxygen deficient)'

This would suggest that the increased carbon dioxide levels measured in December 2022 are likely the result of temporary fluctuations in the overall background concentration rates. It would also imply that further monitoring would eventually see a return to original background levels once the anaerobic conditions became re-established.

6.9 Environmental Testing - Water

Environmental analysis was conducted on five water samples. Three samples were bailed from installed monitoring wells, BH03, BH12 and BH13. Well samples were acquired only after having first developing each installation. Two additional samples were acquired from the stream at its eastern entry point ('Stream Start') and at the point where its course leaves the site, towards the western end ('Stream End'). Results from analysis have been compared to standards outlined in the EPA publication *Towards Setting Guideline Values for the Protection of Groundwater in Ireland Interim Report*, EPA 2003 (EPA IGV) and to the *European Communities Environmental Objectives (Groundwater) Regulations, 2010* (S.I. No. 9 of 2010) (See Table 14). Lastly, where trigger values were not available, results have been compared to standards outlined in the fourth edition of the World Health Organization's (WHO) *Guidelines for drinking-water quality* (GDWQ) (2017).

No hydrocarbon contamination was detected in the samples. Table 12 shows the instances where exceedances were recorded. The universal Total Hardness exceedances may be reflective of the calcium carbonate limestone bedrock upon which the soils overlie.

Table 12 – Elevated values (Water Analysis compared to EPA Interim Guideline Values & S.I. No.9 of 2010)

Parameter	Stream Start (East)	Stream End (West)	BH03	BH12	BH13	Environmental Guideline Source [EPA IGV]
Total Hardness as CaCO ₃	360	360	230	360	270	200 mg/l
Manganese (Dissolved)	0.57	0.58	450	170	1.3	50 µg/l

6.10 Waste Acceptance Criteria [WAC] & Environmental Testing

Environmental soil samples were taken across a range of depths from trial pits. Samples were analysed for their compliance to the criteria set out in the 2002 European Council Decision (2003/33/EC). O'Callaghan Moran & Associates have conducted a waste characterisation assessment of the samples in accordance with the Environmental Protection Agency (EPA) Guidelines on the Classification of Waste (2015). This report, together with conclusions and recommendations, is presented in Appendix 13.

REFERENCES

- 1.0** BS 5930 (2015+A1:2020) Code of Practice for Site Investigation, British Standards Institution (BSI).
- 2.0** BS 1377 (1990) Methods of Testing of Soils for Civil Engineering Purposes, BSI.
- 3.0** Eurocode 7, Part 2: Ground Investigation & Testing (EN 1997-2:2007)
- 4.0** Irish Standard IS 888:2016, NSAI (Published in March 2016)
- 5.0** National House-Building Council [NHBC] (2007). Guidance on Evaluation of Development Proposals on Sites Where Methane and Carbon Dioxide are Present. Report No. 10627-R01(04). NHBC and RSK Group.
- 6.0** Site Investigation Practice: Assessing BS 5930 (1986), Geological Society Special Publication, No. 2.
- 7.0** Sowers, G.F. (1962) Shallow Foundations, Foundation Engineering, McGraw Hill
- 8.0** SR21:2014+A1:2016 Guidance on the use of IS EN 13242+A1:2007
- 9.0** Terzaghi, K., Peck, R.B., & Mesri, G. (1996). Soil Mechanics in Engineering, 3rd Edition. New York, Wiley.
- 10.0** Tomlinson, M.J. Pile Design & Construction Practice, 4th Edition
- 11.0** Site Investigation Practice: Assessing BS 5930 (1986), Geological Society Special Publication, No. 2.

Appendix 1

Trial Pit Logs and Photographs

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown				TRIAL PIT NO. TP01		SHEET Sheet 1 of 1				
LOGGED BY MB		CO-ORDINATES 686,064.74 E 719,680.12 N		DATE STARTED 18/10/2022		DATE COMPLETED 18/10/2022				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 79.63		EXCAVATION METHOD 7t Hitachi						
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm grey very sandy slightly clayey SILT. Sand is fine to medium		0.30	79.33		AA186957	B	0.50-0.60	38 42 34 45 56 59	
1.0										
	Firm brown very sandy very gravelly SILT with pockets of yellow fine sand and medium cobbles. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.60	78.03		AA186958	B	1.60-1.70		
2.0										
	Brown silty sandy GRAVEL with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.60	77.03		AA186959	B	2.60-2.70		
3.0	End of Trial Pit at 2.90m		2.90	76.73	 (Seepage)					
Groundwater Conditions Seepage at 2.90m										
Stability Slightly unstable from 1.60m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. TP02
SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,127.58 E
719,725.08 NDATE STARTED 18/10/2022
DATE COMPLETED 18/10/2022CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 81.08

EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown sandy gravelly CLAY with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.20	80.88		AA181997	B	0.50-0.50	38 42 32	
	Brownish grey gravelly clayey SAND. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.		0.80	80.28		AA181998	B	0.70-0.70		
1.0	0.80-0.90m Fine to medium sand lens Firm brown sandy gravelly SILT with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.00	80.08						
						AA181999	B	1.70-1.70		
2.0						AA181200	B	2.60-2.60		
3.0	End of Trial Pit at 3.00m		3.00	78.08						

Groundwater Conditions
DryStability
Good

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vane (set of three) carried out at 0.30m bgl. Vane attempted at 0.50m - too gravelly. Pit backfilled with arisings.



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. TP03

SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,128.56 E
719,683.63 N

DATE STARTED 18/10/2022

DATE COMPLETED 18/10/2022






CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 80.45


EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Brownish grey slightly gravelly silty SAND. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.		0.30	80.15		AA186953	B	0.50-0.60	39 31 34	
	Stiff grey mottled orange sandy gravelly SILT. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.		0.80	79.65		AA186954	B	1.20-1.20		
1.0										
	Firm to stiff brown sandy gravelly clayey SILT with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.80	78.65		AA186955	B	1.80-1.80		
2.0										
	Brownish grey very gravelly silty SAND with medium cobbles and occasional boulders. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded. Cobbles and boulders are subrounded to rounded of limestone.		2.20	78.25		AA186956	B	2.50-2.60		
	End of Trial Pit at 2.90m		2.90	77.55						
3.0										



Groundwater Conditions
Dry**Stability**
Slightly unstable from 2.20m**General Remarks**
Pit footprint scanned using cable avoidance tool [CAT]. Shear vane (set of three) carried out at 0.30m bgl. Pit backfilled with arisings.

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP05		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,195.58 E 719,693.69 N			DATE STARTED 18/10/2022		DATE COMPLETED 18/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 80.91			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brownish grey slightly clayey sandy gravelly SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded		0.40	80.51		AA186960	B	0.50-0.60	32 38 35 65 72 76	
1.0	Firm brown sandy gravelly SILT with a medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		1.20	79.71		AA186961	B	1.50-1.60		
	Boulder at 1.80m (up to 1200mm)									
2.0	Brown silty sandy GRAVEL with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone. Sidewall collapse at 2.0m		2.00	78.91		AA186962	B	2.50-2.60		
3.0	End of Trial Pit at 2.90m		2.90	78.01	 (Seepage)					
Groundwater Conditions Seepage at 2.90m										
Stability Unstable, side wall collapse from 2.80m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.										


IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP06		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,189.63 E 719,600.91 N			DATE STARTED 19/10/2022		DATE COMPLETED 19/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 79.75			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.		0.30	79.45		AA186979	B	0.50-0.60	45 56 42 58 67 74	
1.0	Firm grey mottled orange very gravelly sandy SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.		1.20	78.55		AA186980	B	1.50-1.60		
2.0	Firm brown very sandy very gravelly SILT with a medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone. Sidewall collapse at 1.20m		2.70	77.05		AA186981	B	2.50-2.60		
3.0	End of Trial Pit at 2.70m									
Groundwater Conditions Dry										
Stability Unstable, side wall collapse at 1.20m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP07		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,233.75 E 719,669.34 N			DATE STARTED 18/10/2022		DATE COMPLETED 18/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 80.79			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brownish grey sandy gravelly silty CLAY with pockets of silty SAND. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.		0.30	80.49		AA186963	B	0.50-0.60	24 27 38 70 76 77 120	
1.0	Firm to stiff brownish grey sandy gravelly SILT with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.10	79.69		AA186964	B	1.50-1.60		
2.0	Brown silty sandy GRAVEL with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.20	78.59		AA186965	B	2.50-2.60		
	End of Trial Pit at 2.80m		2.80	77.99	 (Seepage)					
3.0										
Groundwater Conditions Seepage at 2.80m										
Stability Unstable from 2.0m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Single vane attempted at 0.70m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown		TRIAL PIT NO. TP08				SHEET Sheet 1 of 1				
LOGGED BY MB		CO-ORDINATES 686,254.83 E 719,606.17 N				DATE STARTED 19/10/2022 DATE COMPLETED 19/10/2022				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 80.39				EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.		0.20	80.19		AA186966	B	0.50-0.60	38 42 36 71 60 65	
	Firm brownish grey sandy gravelly SILT. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.		0.90	79.49		AA186967	B	1.50-1.60		
1.0	Firm brown slightly clayey sandy gravelly SILT with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.30	78.09		AA186968	B	2.50-2.60		
2.0	Brown silty sandy GRAVEL with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		3.00	77.39	 (See page)					
3.0	End of Trial Pit at 3.00m									
Groundwater Conditions Seepage at 3.0m										
Stability Unstable from 2.3m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Vane attempted at 0.70m - too stiff. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO.

TP09

LOGGED BY MB

CO-ORDINATES

686,274.81 E
719,546.61 N

SHEET

Sheet 1 of 1

CLIENT

ENGINEER DOBA

GROUND LEVEL (m)

79.66

DATE STARTED

19/10/2022

DATE COMPLETED

19/10/2022

EXCAVATION

METHOD

7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm grey mottled orange sandy gravelly SILT with silty sand lenses. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	79.36		AA186975	B	0.50-0.60	40 38 46 60 63 67	
	Firm greyish brown sandy gravelly clayey SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.80	78.86		AA186976	B	1.20-1.30		
	Brown silty sandy GRAVEL with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.60	78.06		AA186977	B	1.90-2.00		
	Side wall collapse at 1.60m									
	Firm dark grey very sandy gravelly clayey SILT with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone. (Recovered wet)		2.40	77.26		AA186978	B	2.50-2.60		
3.0	End of Trial Pit at 3.00m		3.00	76.66						

Groundwater Conditions


Seepage at 2.50m

Stability

Unstable, side wall collapse from 1.60m

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown						TRIAL PIT NO. TP10				
LOGGED BY MB						SHEET Sheet 1 of 1				
CO-ORDINATES 686,322.16 E 719,619.95 N						DATE STARTED 19/10/2022 DATE COMPLETED 19/10/2022				
CLIENT ENGINEER DOBA						GROUND LEVEL (m) 80.87 EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown sandy CLAY with rootlets. Sand is fine to coarse.									
	Firm to stiff grey mottled orange sandy gravelly clayey SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	80.57		AA186969	B	0.50-0.60	38 42 35 63 65 71	
	Greyish brown gravelly SAND with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.80	80.07		AA186970	B	1.20-1.30		
1.0										
	Firm brown slightly silty sandy gravelly CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.60	79.27						
2.0										
	End of Trial Pit at 2.80m		2.80	78.07		AA186971	B	2.60-2.70		
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO.

TP11

SHEET

Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES

686,313.08 E
719,522.07 N

DATE STARTED

19/10/2022

DATE COMPLETED

19/10/2022

CLIENT

ENGINEER DOBA

GROUND LEVEL (m)

79.52

EXCAVATION

METHOD

7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown sandy CLAY with rootlets. Sand is fine to coarse.		0.20	79.32		AA186972	B	0.50-0.60	49 45 48 56 52 61	
	Firm grey mottled orange sandy gravelly clayey SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.									
	0.70-0.80m Fine to medium sand lens									
1.0	Stiff grey brown sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.10	78.42		AA186973	B	1.50-1.60		
2.0	Firm to stiff dark grey slightly clayey sandy gravelly SILT with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.20	77.32		AA186974	B	2.50-2.60		
3.0	End of Trial Pit at 2.90m		2.90	76.62						

Groundwater Conditions

Dry

Stability

Good

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. TP12
SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,361.01 E
719,589.72 NDATE STARTED 06/10/2022
DATE COMPLETED 06/10/2022CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 80.71





EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy silty CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Stiff light brown very sandy very gravelly clayey SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.30	80.41		AA185481	B	0.50-0.60	20 25 22	
	(Dense) Silty gravelly SAND with a low cobble content. Sand is fine to medium. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.70	80.01		AA185482	B	0.80-0.90		
1.0										
	(Medium dense) Brown silty gravelly SAND with a medium cobble content. Sand is fine to medium. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.60	79.11		AA185483	B	1.80-1.90		
2.0										
	Firm to stiff dark brown to dark grey slightly clayey sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subangular to subrounded. Cobbles are subrounded to rounded of limestone		2.40	78.31		AA185484	B	2.50-2.60		
	End of Trial Pit at 2.70m		2.70	78.01						
3.0										

Groundwater Conditions
DryStability
Good

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vane (set of three) carried out at 0.20m bgl. Vane attempted at 0.50m - too gravelly. Pit backfilled with arisings.

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown		TRIAL PIT NO. TP13				SHEET Sheet 1 of 1				
LOGGED BY MB		CO-ORDINATES 686,381.27 E 719,525.82 N				DATE STARTED 04/10/2022				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 79.83				DATE COMPLETED 04/10/2022				
						EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly silty gravelly sandy CLAY with a low cobble content and rootlets. Sand is fine to coarse. Gravel is fine to medium subrounded. Cobbles are subrounded of limestone									
	Firm to stiff brown mottled grey slightly sandy gravelly silty CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.40	79.43		AA185474	B	0.50-0.50	45	
	Firm greyish brown slightly sandy gravelly clayey SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone		0.90	78.93		AA185475	B	1.00-1.00	55	
1.0	Firm brownish grey sandy gravelly silty CLAY with a low cobble content. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.40	78.43		AA185476	B	1.50-1.50		
2.0	Firm slightly sandy gravelly silty CLAY. Gravel is fine to medium subrounded.		2.40	77.43		AA185477	B	2.50-2.50		
	End of Trial Pit at 2.70m		2.70	77.13	↓ (Seepage)					
3.0										
Groundwater Conditions Seepage at 2.70m										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes carried out at both 0.30m & 0.50m bgl. Vane attempted at 0.60m - too gravelly. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. TP15
SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,444.04 E
719,538.61 NDATE STARTED 04/10/2022
DATE COMPLETED 04/10/2022CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 80.39

EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY with rootlets. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm greyish brown sandy gravelly slightly clayey SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone		0.30	80.09		AA185478	B	0.50-0.50		
1.0	Firm greyish brown sandy gravelly SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone		1.00	79.39						
	Firm rarely soft to firm brown slightly sandy gravelly silty CLAY with a low cobble content with pockets of coarse yellow sand from 2.50m. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone		1.70	78.69		AA185479	B	1.50-1.50		
2.0	Side wall collapse from 2.0m to 2.50m									
						AA185480	B	2.30-2.30		
	End of Trial Pit at 2.80m		2.80	77.59						
3.0										

Groundwater Conditions
DryStability
Slightly unstable, side wall collapse at 2.0mGeneral Remarks
Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings.

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown				TRIAL PIT NO. TP16		SHEET Sheet 1 of 1				
LOGGED BY MB		CO-ORDINATES 686,437.15 E 719,442.70 N		DATE STARTED 03/10/2022		DATE COMPLETED 03/10/2022				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 79.07		EXCAVATION METHOD 7t Hitachi						
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY with rootlets. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm to stiff brown mottled orange very sandy silty gravelly CLAY with a low cobble content. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone		0.30	78.77		AA185460	B	0.50-0.50	45	
	Stiff light grey slightly clayey sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone		0.70	78.37					60	
1.0						AA185461	B	1.00-1.00		
						AA185462	B	1.50-1.50		
2.0	(Medium dense) Brownish grey sandy very silty GRAVEL with a low cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone Side wall collapse from 2.0m to 3.0m		1.80	77.27						
						AA185463	B	2.20-2.20		
3.0	End of Trial Pit at 3.00m		3.00	76.07	 (Moderate)					
Groundwater Conditions Moderate flow at 2.80m										
Stability Slightly unstable, side wall collapse at 2.0m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes carried out at both 0.30m & 0.70m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO.

TP17

LOGGED BY MB

CO-ORDINATES 686,475.64 E
719,507.57 N

SHEET

Sheet 1 of 1

CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 80.15

DATE STARTED 06/10/2022
DATE COMPLETED 06/10/2022EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly silty gravelly sandy CLAY with a low cobble content and rootlets. Sand is fine to coarse. Gravel is fine to medium subrounded. Cobbles are subrounded of limestone Localised sidewall collapse from 0.20m to 2.0m Stiff greyish brown slightly sandy gravelly clayey SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	79.85		AA185485	B	0.60-0.60	57 39 42 80 72 66	
1.0	(Loose) Light brown to grey silty SAND. Sand is fine to medium. Sand tapers to the north. 1.10-1.30m Fine to medium sand lens Firm grey very sandy gravelly SILT. Sand is fine to medium. Gravel is fine to coarse subrounded.		1.10 1.30	79.05 78.85		AA185486	B	1.40-1.40		
2.0	Firm brown to dark grey gravelly sandy silty CLAY with a low cobble content. Sand is fine to medium. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.00	78.15		AA185487	B	2.20-2.20		
3.0	End of Trial Pit at 2.90m		2.90	77.25						

Groundwater Conditions
Dry

Stability

Unstable - wall collapse from 0.20m with renewed collapse in unstable sandy horizon at 2.50m

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown		TRIAL PIT NO. TP18				SHEET Sheet 1 of 1				
LOGGED BY MB		CO-ORDINATES 686,500.35 E 719,443.56 N				DATE STARTED 03/10/2022 DATE COMPLETED 03/10/2022				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 79.37				EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown sandy CLAY with rootlets. Sand is fine to coarse.									
	Firm to stiff brown mottled grey slightly sandy gravelly silty CLAY with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.40	78.97		AA185464	B	0.50-0.50	30	54
	Stiff greyish brown slightly sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.80	78.57						
1.0										
	Firm brownish grey sandy slightly gravelly SILT. Sand is fine to coarse. Gravel is fine to medium subrounded		1.60	77.77		AA185465	B	1.50-1.50		
2.0										
	Firm and soft dark grey sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone (Recovered wet)	2.50	76.87		AA185466	B	2.50-2.50			
	Side wall collapse from 2.50m to 3.0m									
3.0	End of Trial Pit at 3.00m		3.00	76.37	 (See page)	AA185467	B	3.00-3.00		
Groundwater Conditions Seepage at 3.0m										
Stability Slightly unstable, side wall collapse at 2.50m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes carried out at both 0.20m & 0.50m bgl. Vane attempted at 0.70m - too stiff. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. **TP19**
SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,519.89 E
719,387.48 NDATE STARTED 03/10/2022
DATE COMPLETED 03/10/2022CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 78.98

EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown sandy CLAY with rootlets. Sand is fine to coarse.									
	Firm to stiff grey mottled orange sandy gravelly silty CLAY with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.30	78.68		AA185468	B	0.50-0.50	50	
1.0	Firm grey gravelly sandy SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.90	78.08		AA185469	B	1.00-1.00		
2.0	(Medium dense) Slightly gravelly silty SAND with a low cobble content. Sand is fine. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.00	76.98		AA185470	B	2.20-2.20		
	(Dense) Slightly gravelly silty SAND with a medium cobble content and occasional boulders. Sand is fine. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone. Side wall collapse from 2.50m to 3.20m		2.50	76.48	1 (Moderate)					
3.0						AA185471	B	2.90-2.90		
	End of Trial Pit at 3.20m		3.20	75.78						

Groundwater Conditions
Moderate flow at 2.50m**Stability**
Slightly unstable, side wall collapse at 2.50m**General Remarks**
Pit footprint scanned using cable avoidance tool [CAT]. Shear vane carried out at 0.30m bgl. Vane attempted at 0.50m - too stiff. Pit backfilled with arisings.



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. TP20

SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,566.81 E
719,458.67 N

DATE STARTED 06/10/2022

DATE COMPLETED 06/10/2022

CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 79.78

EXCAVATION
METHOD 7t Hitachi




	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy silty CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm grey slightly sandy gravelly clayey SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.40	79.38		AA185488	B	0.60-0.60	45 40 65 70 60	
	Slow progress from 0.80m onwards due to cobbles and boulders.									
1.0										
	Firm to stiff brown mottled grey very silty slightly sandy gravelly CLAY with silt pockets. Sand is fine to coarse. Gravel is fine to coarse subrounded.		1.40	78.38		AA185489	B	1.60-1.70		
2.0										
	Firm slightly clayey slightly gravelly sandy SILT. Sand is fine to coarse. Gravel is fine to medium subrounded.		2.40	77.38		AA185490	B	2.40-2.50		
	Firm occasionally soft to firm blackish grey slightly sandy gravelly clayey SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to medium subrounded.		2.60	77.18						
3.0	End of Trial Pit at 3.00m		3.00	76.78		AA185491	B	2.90-2.90		

Groundwater Conditions
DryStability
Good

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.40m & 0.60m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP21 SHEET Sheet 1 of 1				
LOGGED BY MB			CO-ORDINATES 686,295.25 E 719,774.44 N			DATE STARTED 14/10/2022 DATE COMPLETED 14/10/2022				
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 82.96			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brownish orange slightly gravelly silty sandy CLAY . Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.		0.40	82.56		AA181983	B	0.50-0.60	34 38 43 77 81 83	
1.0	Firm to stiff brown very gravelly sandy silty CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.90	82.06		AA181984	B	1.50-1.60		
2.0	Firm to stiff brownish grey slightly sandy gravelly clayey SILT with a medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		2.20	80.76		AA181985	B	2.50-2.60		
3.0	End of Trial Pit at 2.90m		2.90	80.06						
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.20m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. TP22
SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,367.54 E
719,727.88 NDATE STARTED 11/10/2022
DATE COMPLETED 11/10/2022CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 83.38



EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown sandy slightly gravelly silty CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	83.08		AA185497	B	0.60-0.60	50 48 52 60 68 70 75 84 81	
1.0	Stiff brown slightly sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.90	82.48		AA185498	B	1.40-1.40		
	Stiff brownish grey sandy gravelly silty CLAY with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.80	81.58		AA185499	B	1.90-1.90		
2.0	Brownish grey slightly silty gravelly SAND with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.20	81.18		AA185500	B	2.40-2.40		
3.0	End of Trial Pit at 2.90m		2.90	80.48						

Groundwater Conditions
DryStability
Good



General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m, 0.50m & 0.70m bgl. Vane attempted at 0.90m - too gravelly. Pit backfilled with arisings.

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP23		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,365.66 E 719,792.47 N			DATE STARTED 11/10/2022		DATE COMPLETED 11/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 84.33			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown sandy slightly gravelly silty CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	84.03		AA181957	B	0.50-0.60	45 50 55 62 63 65 67	
1.0	Stiff brown sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.30	83.03		AA181958	B	1.50-1.50		
2.0	Very stiff sandy gravelly clayey SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.		2.30	82.03		AA181959	B	2.50-2.60		
3.0	End of Trial Pit at 2.80m		2.80	81.53						
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m, 0.50m & 0.70m bgl. Vane attempted at 0.80m - too gravelly. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330	
CONTRACT Halverstown						TRIAL PIT NO. TP24		SHEET Sheet 1 of 1	
LOGGED BY MB		CO-ORDINATES 686,354.34 E 719,849.15 N				DATE STARTED 12/10/2022		DATE COMPLETED 12/10/2022	
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 85.19				EXCAVATION METHOD 7t Hitachi			

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm to stiff brown mottled orange very sandy gravelly CLAY. Sand is fine to coarse. Gravel is fine to coarse subangular to subrounded.		0.40	84.79		AA181960	B	0.60-0.70	30 35 32 76 81 89	
1.0	Firm brown very sandy slightly gravelly CLAY with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.20	83.99						
			1.60	83.59		AA181961	B	1.50-1.60		
2.0	End of Trial Pit at 2.60m					AA181962	B	2.60-2.70		
3.0										

Groundwater Conditions
 Dry



Stability
 Good

General Remarks
 Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.20m & 0.30m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown						TRIAL PIT NO. TP25				
LOGGED BY MB						SHEET Sheet 1 of 1				
CO-ORDINATES 686,425.96 E 719,809.88 N						DATE STARTED 12/10/2022 DATE COMPLETED 12/10/2022				
CLIENT ENGINEER DOBA						GROUND LEVEL (m) 85.36 EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown mottled orange very sandy gravelly CLAY. Sand is fine to coarse. Gravel is fine to coarse subangular to subrounded.		0.40	84.96		AA181963	B	0.50-0.60	50 52 47 80 95 83	
1.0	Greyish brown gravelly clayey SAND with a medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		1.20	84.16		AA181964	B	1.50-1.60		
2.0	Firm brownish grey very sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.40	82.96		AA181965	B	2.50-2.60		
3.0	End of Trial Pit at 3.00m		3.00	82.36						
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.30m & 0.50m bgl. Vane attempted at 0.80m - too gravelly. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP26		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,611.58 E 719,726.52 N			DATE STARTED 13/10/2022		DATE COMPLETED 13/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 83.00			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy silty CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown sandy gravelly silty CLAY with root hairs. Sand is fine to coarse. Gravel is fine to coarse subangular to subrounded.		0.30	82.70		AA181975	B	0.50-0.60	38 46 42 66 73 68	
1.0	Stiff brown very sandy very gravelly silty CLAY with a medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		0.90	82.10		AA181976	B	1.30-1.40		
	Boulder at 1.80m (up to 400mm)									
2.0	Firm to stiff brown sandy very gravelly silty CLAY with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.10	80.90		AA181978	B	2.40-2.50		
	End of Trial Pit at 2.70m		2.70	80.30						
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.20m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. **TP27**
SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,682.52 E
719,695.28 N

DATE STARTED 13/10/2022

DATE COMPLETED 13/10/2022

CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 81.34






EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy silty CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm grey mottled orange sandy gravelly SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	81.04		AA181972	B	0.50-0.60	45 48 49 78 85 82 120 118	
1.0	Stiff grey sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.10	80.24		AA181973	B	1.50-1.60		
2.0	Firm brown sandy gravelly clayey SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.80	79.54		AA181974	B	2.20-2.30		
3.0	End of Trial Pit at 3.10m		3.10	78.24						

Groundwater Conditions
DryStability
Good

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m, 0.50m & 0.70m bgl. Pit backfilled with arisings.

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP28		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,668.41 E 719,756.26 N			DATE STARTED 13/10/2022		DATE COMPLETED 13/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 81.28			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy silty CLAY with rootlets and timber roots. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm grey mottled orange sandy gravelly SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.50	80.78		AA181969	B	0.60-0.70	38 35 41	
1.0	Firm grey mottled orange sandy gravelly SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.		1.30	79.98		AA181970	B	1.60-1.70	80 95 98	
2.0	Firm brown sandy gravelly clayey SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.20	79.08		AA181971	B	2.50-2.60		
	End of Trial Pit at 2.70m		2.70	78.58						
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.20m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330			
CONTRACT Halverstown						TRIAL PIT NO. TP29					
LOGGED BY MB						CO-ORDINATES 686,647.26 E 719,817.71 N					
CLIENT ENGINEER DOBA						GROUND LEVEL (m) 81.66					
						SHEET Sheet 1 of 1					
						DATE STARTED 13/10/2022 DATE COMPLETED 13/10/2022					
						EXCAVATION METHOD 7t Hitachi					
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)	
						Sample Ref	Type	Depth			
0.0	TOPSOIL: Soft brown gravelly sandy silty CLAY with rootlets. Sand is fine to coarse. Gravel is fine to medium subrounded.										
	Firm brown sandy gravelly CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	81.36						28 31 34	
	Stiff grey very sandy gravelly CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.60	81.06		AA181966	B	0.50-0.60		47 52 48	
1.0	Stiff brown very sandy very gravelly silty CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		1.20	80.46		AA181967	B	1.50-1.60			
2.0	Stiff greyish brown very sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		2.20	79.46		AA181968	B	2.50-2.60			
3.0	End of Trial Pit at 2.90m		2.90	78.76							
Groundwater Conditions Dry											
Stability Good											
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.20m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.											

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. TP30

SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,733.51 E
719,786.79 N

DATE STARTED 13/10/2022

DATE COMPLETED 13/10/2022

CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 80.61

EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft dark brown sandy silty CLAY with rootlets. Sand is fine to coarse. Gravel is fine to medium subrounded.		0.20	80.41		AA181978	B	0.50-0.60	32 35 39	
	Firm grey mottled orange gravelly silty SAND. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.									
	Sidewall collapse from 0.20m									
1.0	Stiff greyish brown sandy gravelly clayey SILT with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.00	79.61		AA181979	B	1.50-1.60	>120	
	Firm to stiff grey very sandy gravelly clayey SILT with a low cobble content and bands of silty sand. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone. Recovered wet from 2.0-2.5.		1.70	78.91		AA181980	B	2.30-2.40		
2.0	1.70m-1.80m Fine to medium sandy silt lens									
	End of Trial Pit at 2.50m		2.50	78.11	↓ (Seepage)					
3.0										

Groundwater Conditions


Seepage at 2.40m

Stability




Unstable, sidewall collapse from 0.20m

General Remarks




Pit footprint scanned using cable avoidance tool [CAT]. Shear vane (set of three) carried out at 0.30m bgl. Single vane undertaken at 1.0m bgl. Pit ended at 2.50m due to instability. Pit backfilled with arisings.

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown		TRIAL PIT NO. TP31			SHEET Sheet 1 of 1					
LOGGED BY MB		CO-ORDINATES 686,101.19 E 719,955.04 N			DATE STARTED 17/10/2022 DATE COMPLETED 17/10/2022					
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 83.80			EXCAVATION METHOD 7t Hitachi					
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY with roolets. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown very sandy slightly silty gravelly CLAY. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.		0.30	83.50		AA181992	B	0.50-0.60	30 34 38 67 74 78	
1.0	Stiff brown very sandy gravelly CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.80	83.00		AA181993	B	1.40-1.50		
2.0	Obstruction - Possible Boulders Boulders from 2.30m		2.30	81.50						
3.0	End of Trial Pit at 2.80m									
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.20m & 0.50m bgl. Vane attempted at 0.70m - too gravelly. Pit backfilled with arisings.										


IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP32		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,084.15 E 719,879.36 N			DATE STARTED 17/10/2022		DATE COMPLETED 17/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 83.16			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY with rootlets. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown very sandy slightly gravelly silty CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.30	82.86		AA181994	B	0.50-0.60	25 34 29	
	Stiff brown very sandy slightly silty gravelly CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.80	82.36					50 56 58	
1.0						AA181995	B	1.40-1.50		
	Stiff greyish brown sandy gravelly clayey SILT with a medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		2.30	80.86		AA181996	B	2.50-2.60		
2.0										
	End of Trial Pit at 2.30m		2.80	80.36						
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at both 0.20m & 0.50m bgl. Vane attempted at 0.70m - too stiff. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP33		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,199.88 E 719,934.90 N			DATE STARTED 17/10/2022		DATE COMPLETED 17/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 84.73			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY with roolets. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown very sandy slightly gravelly CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.40	84.33		AA181989	B	0.50-0.60	25 26 32	
1.0	Stiff brown very sandy slightly silty gravelly CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.90	83.83		AA181990	B	1.40-1.50	51 53 48 58 62 63	
2.0	Firm to stiff brown sandy gravelly clayey SILT with a medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		2.20	82.53		AA181991	B	2.50-2.60		
	Boulder at 2.70m (up to 500mm)		2.80	81.93						
3.0	End of Trial Pit at 2.80m									
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.20m, 0.50m & 0.70m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP34		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,182.78 E 719,866.42 N			DATE STARTED 17/10/2022		DATE COMPLETED 17/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 83.94			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY with roolets. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown sandy slightly gravelly silty CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	83.64		AA181986	B	0.50-0.60	25 23 26 48 51 53	
1.0	Stiff brown very sandy slightly silty gravelly CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.90	83.04		AA181987	B	1.40-1.50	64 63 67	
2.0	Firm to stiff brown very sandy silty gravelly CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone. Large boulder at 2.60m (up to 900mm)		2.40	81.54		AA181988	B	2.50-2.60		
3.0	End of Trial Pit at 3.00m		3.00	80.94						
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.20m, 0.50m & 0.80m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

TP01 – 1 of 3



TP01 – 2 of 3



TP01 – 3 of 3



TP02 – 1 of 3



TP02 – 2 of 3



TP02 – 3 of 3



TP03 – 1 of 3



TP03 – 2 of 3



TP03 – 3 of 3



TP04 – 1 of 3



TP04 – 2 of 3



TP04 – 3 of 3



TP05 – 1 of 4



TP05 – 2 of 4



TP05 – 3 of 4



TP05– 4 of 4



TP06 – 1 of 3



TP06 – 2 of 3



TP06– 3 of 3



TP07 – 1 of 3



TP07 – 2 of 3



TP07 – 3 of 3



TP08 – 1 of 3



TP08 – 2 of 3



TP08 – 3 of 3



TP09 – 1 of 3



TP09 – 2 of 3



TP09 – 3 of 3



TP10 – 1 of 3



TP10 – 2 of 3



TP10 – 3 of 3



TP11– 1 of 3



TP11 – 2 of 3



TP11 – 3 of 3



TP12 – 1 of 3



TP12 – 2 of 3



TP12 – 3 of 3



TP13 – 1 of 3



TP13 – 2 of 3



TP13 – 3 of 3



TP14 – 1 of 3



TP14 – 2 of 3



TP14 – 3 of 3



TP15 – 1 of 3



TP15 – 2 of 3



TP15 – 3 of 3



TP16 – 1 of 3



TP16 – 2 of 3



TP16 – 3 of 3



TP17 – 1 of 3



TP17 – 2 of 3



TP17 – 3 of 3



TP18 – 1 of 3



TP18 – 2 of 3



TP18 – 3 of 3



TP19 – 1 of 3



TP19 – 2 of 3



TP19 – 3 of 3



TP20 – 1 of 3



TP20 – 2 of 3



TP20 – 3 of 3



TP21 – 1 of 3



TP21 – 2 of 3



TP21 – 3 of 3



TP22 – 1 of 3



TP22 – 2 of 3



TP22 – 3 of 3



TP23 – 1 of 3



TP23 – 2 of 3



TP23 – 3 of 3



TP24 – 1 of 3



TP24 – 2 of 3



TP24 – 3 of 3



TP25 – 1 of 3



TP25 – 2 of 3



TP25 – 3 of 3



TP26 – 1 of 4



TP26 – 2 of 4



TP26 – 3 of 4



TP26 – 4 of 4



TP27 – 1 of 3



TP27 – 2 of 3



TP27 – 3 of 3



TP28 – 1 of 3



TP28 – 2 of 3



TP28 – 3 of 3



TP29 – 1 of 3



TP29 – 2 of 3



TP29 – 3 of 3



TP30 – 1 of 3



TP30 – 2 of 3



TP30 – 3 of 3



TP31 – 1 of 3



TP31 – 2 of 3



TP31 – 3 of 3



TP32 – 1 of 3



TP32 – 2 of 3



TP32 – 3 of 3



TP33 – 1 of 4



TP33 – 2 of 4



TP33 – 3 of 4



TP33 – 4 of 4



TP34 – 1 of 4



TP34 – 2 of 4



TP34 – 3 of 4




TP34 – 4 of 4



Appendix 1A

Trial Pit Logs (TP/RO) and Photographs

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown		TRIAL PIT NO. TP/RO01				SHEET Sheet 1 of 1				
LOGGED BY IC		CO-ORDINATES 686,147.64 E 719,931.87 N				DATE STARTED 27/04/2023 DATE COMPLETED 27/04/2023				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 84.10				EXCAVATION METHOD 13t Tracked Excavator				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft to firm brown sandy clay with rootlets. Sand is fine to coarse.		0.20	83.90	 (Seepage)	AA198171	B	0.60-0.60	85	
	Firm greyish light brown very sandy gravelly CLAY with medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone.								110	
1.0	Firm to stiff grey/brown very sandy very gravelly CLAY with high cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone.		1.00	83.10		AA198172	B	1.50-1.50		
	Soft to firm grey/brown very sandy very gravelly CLAY with high cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are rounded to subangular of limestone. Boulders are subrounded.		1.80	82.30		AA198173	B	2.10-2.10		
2.0	Grey/brown sandy very clayey GRAVEL with high cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone (up to 400mm).		2.30	81.80		AA198174	B	2.80-2.80		
3.0	End of Trial Pit at 3.00m		3.00	81.10						
Groundwater Conditions Seepage at 2.40m										
Stability Slightly unstable from 1.90m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.70m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO.

TP/RO02

LOGGED BY IC

CO-ORDINATES

686,076.88 E
719,826.77 N

SHEET

Sheet 1 of 1

CLIENT

ENGINEER DOBA

GROUND LEVEL (m)

82.58

DATE STARTED

02/05/2023

DATE COMPLETED

02/05/2023

EXCAVATION

METHOD

13t Tracked
Excavator

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)		
						Sample Ref	Type	Depth				
0.0	TOPSOIL: Soft to firm light brown sandy clay with rootlets. Sand is fine to coarse.		0.15	82.43	 (See page)	AA198190	B	0.50-0.50	80	105		
	Firm light brown very sandy CLAY with occasional cobbles. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone.		0.60	81.98								
	Firm greyish brown sandy gravelly CLAY with occasional cobbles. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone.		1.20	81.38		AA198191	B	1.50-1.50				
1.0	Grey/brown slightly sandy very clayey GRAVEL with medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone (up to 300mm).		1.80	80.78								
2.0	Soft to firm brown slightly clayey very gravelly SAND with occasional cobbles, (possible sandy gravel). Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		2.20	80.38		AA198192	B	2.00-2.00				
	Grey/brown sandy clayey GRAVEL with medium cobble and low boulder content. Sand is fine to coarse. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		2.50	80.08								
	TP terminated due to major instability End of Trial Pit at 2.50m					AA198193	B	2.50-2.50				
3.0												

Groundwater Conditions

Seepage at 2.10m

Stability

Unstable from 0.40m

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.70m bgl. Pit backfilled with arisings.

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown		TRIAL PIT NO. TP/RO03			SHEET Sheet 1 of 1					
LOGGED BY IC		CO-ORDINATES 686,269.42 E 719,719.55 N			DATE STARTED 02/05/2023 DATE COMPLETED 02/05/2023					
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 81.59			EXCAVATION METHOD 13t Tracked Excavator					
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft to firm light brown sandy clay with rootlets. Sand is fine to coarse. Firm light brown sandy CLAY with occasional cobbles. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone. Firm brown mottled golden brown and grey sandy slightly gravelly CLAY with occasional cobbles and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone. Firm light brown sandy very gravelly CLAY with high cobble content and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone. TP terminated due to major instability and rapid water flow End of Trial Pit at 2.30m		0.15	81.44					90	
			0.50	81.09		AA198187	B	0.50-0.50		87
			0.80	80.79						
1.0					 (Seepage)	AA198188	B	1.50-1.50		
2.0					 (Rapid)	AA198189	B	2.10-2.10		
2.30			2.30	79.29						
3.0										
Groundwater Conditions Seepage at 1.50m; rapid water flow at 2.0m										
Stability Unstable from 1.00m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.70m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown		TRIAL PIT NO. TP/RO04 SHEET Sheet 1 of 1				LOGGED BY IC				
CO-ORDINATES 686,165.76 E 719,660.76 N		DATE STARTED 02/05/2023 DATE COMPLETED 02/05/2023				CLIENT ENGINEER DOBA				
GROUND LEVEL (m) 80.35		EXCAVATION METHOD 13t Tracked Excavator								
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft to firm light brown sandy clay with rootlets. Sand is fine to coarse. Firm light brown slightly sandy CLAY. Sand is fine to coarse. Firm yellowish brown very sandy gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		0.15	80.20		AA193200	B	0.50-0.50	85 65	
	0.30		80.05							
1.0	Soft to firm light brown sandy very gravelly CLAY with high cobble content and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		1.00	79.35						
	Grey/brown sandy very clayey GRAVEL with high cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		1.70	78.65						
2.0	TP terminated due to major instability and rapid water flow End of Trial Pit at 2.30m		2.30	78.05						
3.0										
Groundwater Conditions Rapid water flow at 1.80m										
Stability Unstable from 1.50m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.40m & 0.70m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO.

TP/RO05

SHEET

Sheet 1 of 1

LOGGED BY IC

CO-ORDINATES

686,384.21 E
719,792.15 N

DATE STARTED

27/04/2023

DATE COMPLETED

27/04/2023

CLIENT

ENGINEER DOBA

GROUND LEVEL (m)

84.68

EXCAVATION

METHOD

13t Tracked
Excavator

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (kPa)	Hand Penetrometer (kPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Firm brown sandy clay with rootlets. Sand is fine to coarse.		0.15	84.53		AA198237	B	0.50-0.50	90	110
	Firm brown sandy slightly gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		0.80	83.88		AA198238	B	1.20-1.20		
1.0	Firm yellowish brown sandy very gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone and mudstone.		1.50	83.18		AA198239	B	2.10-2.10		
2.0	Brownish grey sandy clayey GRAVEL with medium cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		2.90	81.78		AA198240	B	3.30-3.30		
3.0	Firm grey/brown sandy very gravelly CLAY with medium cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		3.60	81.08						
	End of Trial Pit at 3.60m									

Groundwater Conditions

Moderate flow at 2.30m

Stability

Slightly unstable from 1.50m

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.40m & 0.80m bgl. Pit backfilled with arisings.

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown		TRIAL PIT NO. TP/RO06				SHEET Sheet 1 of 1				
LOGGED BY IC		CO-ORDINATES 686,490.29 E 719,819.15 N				DATE STARTED 26/04/2023 DATE COMPLETED 26/04/2023				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 84.92				EXCAVATION METHOD 13t Tracked Excavator				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft to firm brown sandy clay with rootlets. Sand is fine to coarse. Firm yellowish brown sandy CLAY. Sand is fine to coarse.		0.15	84.77		AA198233	B	0.50-0.50	92	
	Firm to stiff greyish brown sandy slightly gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		0.70	84.22		AA198234	B	1.10-1.10	97	
1.0			1.50	83.42	 (Seepage)	AA198235	B	2.00-2.00		
2.0	Soft to firm light brown sandy very gravelly CLAY with medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone (up to 500mm).		2.50	82.42						
3.0	Grey/brown sandy very clayey GRAVEL with high cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone (up to 500mm).		3.30	81.62	 (Seepage)	AA198236	B	3.20-3.20		
	End of Trial Pit at 3.30m									
Groundwater Conditions Seepage at 2.0m and 3.0m										
Stability Slightly unstable from 1.50m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.70m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

		TRIAL PIT RECORD						REPORT NUMBER 24330						
CONTRACT Halverstown		TRIAL PIT NO. TP/RO07 SHEET Sheet 1 of 1												
LOGGED BY IC		CO-ORDINATES 686,613.61 E 719,733.59 N				DATE STARTED 26/04/2023 DATE COMPLETED 26/04/2023								
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 82.86				EXCAVATION METHOD 13t Tracked Excavator								
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)				
						Sample Ref	Type	Depth						
0.0	TOPSOIL: Firm brown sandy clay with roolets. Sand is fine to coarse. Firm brown sandy slightly gravelly CLAY with occasional cobbles. Sand is fine to medium. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Firm greyish brown sandy gravelly CLAY with occasional cobbles, frequent pockets of sand. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		0.15	82.71	 (Seepage)	AA198233	B	0.40-0.40	100					
	0.45		82.41	AA198234							B	0.70-0.70	79	
	1.20		81.66	AA198235							B	1.40-1.40		
1.0			1.80	81.06							AA198236	B	2.00-2.00	
2.0			2.50	80.36							 (Rapid)			
	3.30		79.56	AA198237								B	3.20-3.20	
	End of Trial Pit at 3.30m													
Groundwater Conditions Seepage at 1.80m; rapid water flow at 2.40														
Stability Slightly unstable from 1.10m														
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.70m bgl. Pit backfilled with arisings.														

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT	Halverstown

TRIAL PIT NO.
SHEET

TP/RO08

Sheet 1 of 1

LOGGED BY IC

CO-ORDINATES	686,448.20 E 719,589.83 N

DATE STARTED 27/04/2023

DATE COMPLETED 27/04/2023

CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 81.40

EXCAVATION METHOD	13t Tracked Excavator

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (kPa)	Hand Penetrometer (kPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Firm light brown sandy clay with rootlets. Sand is fine to coarse.		0.20	81.20						
	Firm greyish brown very sandy gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.					AA198167	B	0.60-0.60	112	
1.0									70	
	Grey/brown very sandy very clayey GRAVEL with high cobble content. Sand is fine to coarse. Gravel is fine to coarse rounded to angular. Cobbles are rounded to subangular of limestone.		1.30	80.10						
	Firm grey/brown sandy very gravelly CLAY with high cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		1.50	79.90		AA198168	B	1.40-1.40		
2.0										
					↓ 1 (see page)					
						AA198169	B	2.50-2.50		
3.0										
	Stiff to very stiff dark brown slightly sandy very gravelly CLAY with high cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone (up to 300mm).		2.90	78.50						
	End of Trial Pit at 3.30m		3.30	78.10		AA198170	B	3.30-3.30		

Groundwater Conditions

Seepage at 2.30m

Stability



Slightly unstable from 2.00m

General Remarks	

Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.40m & 0.80m bgl. Pit backfilled with arisings.

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown		TRIAL PIT NO. TP/RO09 SHEET Sheet 1 of 1								
LOGGED BY IC		CO-ORDINATES 686,263.95 E 719,467.48 N			DATE STARTED 28/04/2023 DATE COMPLETED 28/04/2023					
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 77.31			EXCAVATION METHOD 13t Tracked Excavator					
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Firm dark brown sandy clay with rootlets. Sand is fine to coarse.		0.15	77.16		AA198179	B	0.60-0.60	70	
	Firm dark brown sandy CLAY. Sand is fine to coarse.		0.30	77.01						
	Grey very sandy GRAVEL with medium cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		1.00	76.31						
1.0	Grey slightly gravelly silty SAND with rare cobbles of limestone.									
2.0						AA198180	B	1.50-1.50		
						AA198176	B	2.50-2.50		
3.0	TP terminated due to major instability End of Trial Pit at 2.80m		2.80	74.51						
Groundwater Conditions Dry										
Stability Unstable from 2.80m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.70m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown						TRIAL PIT NO. TP/RO10				
LOGGED BY IC						CO-ORDINATES 686,258.36 E 719,471.03 N				
CLIENT ENGINEER DOBA						GROUND LEVEL (m) 77.27				
						DATE STARTED 27/04/2023 DATE COMPLETED 27/04/2023				
						EXCAVATION METHOD 13t Tracked Excavator				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Firm brown sandy clay with rootlets. Sand is fine to coarse.									
	Firm greyish brown very sandy gravelly CLAY with medium cobble content, frequent pockets of sand. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		0.20	77.07		AA198163	B	0.60-0.60	72	
1.0	Soft to firm grey brown sandy very gravelly CLAY with high cobble content, frequent pockets of sand. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		1.00	76.27		AA198164	B	1.50-1.50	110	
	Firm grey brown sandy very gravelly CLAY with high cobble and medium boulder content, frequent pockets of sand. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		1.80	75.47		AA198165	B	2.50-2.50		
2.0	Stiff to very stiff dark brown sandy very gravelly CLAY with medium cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone (up to 300mm).		2.70	74.57		AA198166	B	3.50-3.50		
3.0	End of Trial Pit at 3.60m		3.60	73.67						
Groundwater Conditions Dry										
Stability Unstable from 0.40m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.40m & 0.90m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

TP/RO1 – 1 of 4



TP/RO1 – 2 of 4



TP/RO1 – 3 of 4



TP/RO1 – 4 of 4



TP/RO2 – 1 of 4



TP/RO2 – 2 of 4



TP/RO2 – 3 of 4



TP/RO2 – 4 of 4



TP/RO3 – 1 of 4



TP/RO3 – 2 of 4



TP/RO3 – 3 of 4



TP/RO3 – 4 of 4



TP/RO4 – 1 of 5



TP/RO4 – 2 of 5



TP/RO4 – 3 of 5



TP/RO4 – 4 of 5



TP/RO4 – 5 of 5



TP/RO5 – 1 of 4



TP/RO5 – 2 of 4



TP/RO5 – 3 of 4



TP/RO5 – 4 of 4



TP/RO6 – 1 of 4



TP/RO6 – 2 of 4



TP/RO6 – 3 of 4



TP/RO6 – 4 of 4



TP/R07 – 1 of 4



TP/R07 – 2 of 4



TP/R07 – 3 of 4



TP/R07 – 4 of 4



TP/RO8 – 1 of 4



TP/RO8 – 2 of 4



TP/RO8 – 3 of 4



TP/RO8 – 4 of 4



TP/RO9 – 1 of 5



TP/RO9 – 2 of 5



TP/RO9 – 3 of 5



TP/RO9 – 4 of 5



TP/RO9– 5 of 5



TP/RO10 – 1 of 4



TP/RO10 – 2 of 4



TP/RO10 – 3 of 4



TP/RO10 – 4 of 4



Appendix 2

Cable Percussion Borehole Records

		GEOTECHNICAL BORING RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						BOREHOLE NO. BH01 SHEET Sheet 1 of 1		
CO-ORDINATES 686,116.61 E 719,653.02 N			RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 3.10			DATE COMMENCED 03/11/2022 DATE COMPLETED 03/11/2022		
GROUND LEVEL (mOD) 80.04			SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY JL		
CLIENT ENGINEER DOBA								

Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	Soft to firm dark brown sandy gravelly silty CLAY									
1					AA184687	B	1.00-1.45		N = 10 (2, 2, 3, 2, 2, 3)	
	Firm to stiff dark brown sandy gravelly silty CLAY with cobbles and boulders		78.64	1.40						
2					AA184688	B	2.00-2.45		N = 17 (3, 3, 3, 4, 5, 5)	
3	End of Borehole at 3.10 m		76.94	3.10					N = 50/40 mm (25, 50)	
4										

HARD STRATA BORING/CHISELLING				WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
2.80	3.10	1.5		2.80	2.80	No	1.30	20	Moderate

INSTALLATION DETAILS					GROUNDWATER PROGRESS				
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments

REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) B - Bulk Disturbed LB - Large Bulk Disturbed Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample				

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

 GEOTECHNICAL BORING RECORD REPORT NUMBER 24330										
CONTRACT Halverstown						BOREHOLE NO. BH02 SHEET Sheet 1 of 1				
CO-ORDINATES 686,178.44 E 719,760.90 N			RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 1.80			DATE COMMENCED 03/11/2022 DATE COMPLETED 03/11/2022				
GROUND LEVEL (mOD) 81.86			SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY JL				
CLIENT ENGINEER DOBA										
Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	Firm dark brown sandy gravelly silty CLAY									
1					AA184689	B	1.00-1.45		N = 13 (2, 2, 3, 3, 3, 4)	
	Stiff light brown very sandy gravelly CLAY with cobbles and boulders		80.36	1.50						
			80.06	1.80						
	End of Borehole at 1.80 m									
2										
3										
4										
HARD STRATA BORING/CHISELLING					WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments	
1.50	1.80	1.5							No water strike	
					GROUNDWATER PROGRESS					
INSTALLATION DETAILS				Date	Hole Depth	Casing Depth	Depth to Water	Comments		
Date	Tip Depth	RZ Top	RZ Base	Type						
REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) B - Bulk Disturbed LB - Large Bulk Disturbed Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample					

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

 GEOTECHNICAL BORING RECORD										REPORT NUMBER 24330	
CONTRACT Halverstown							BOREHOLE NO. BH03 SHEET Sheet 1 of 1				
CO-ORDINATES 686,206.06 E 719,531.92 N				RIG TYPE Dando 2000			DATE COMMENCED 03/11/2022 DATE COMPLETED 04/11/2022				
GROUND LEVEL (mOD) 78.62				BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 3.80							
CLIENT ENGINEER DOBA				SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY JL				
Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details	
					Ref. Number	Sample Type	Depth (m)	Recovery			
0	Firm to stiff and stiff dark brown sandy gravelly silty CLAY										
1					AA184690	B	1.00-1.45		N = 23 (2, 3, 3, 5, 6, 9)		
	Stiff light brown very sandy gravelly CLAY		77.12	1.50							
2					AA184691	B	2.00-2.45		N = 35 (4, 6, 6, 8, 10, 11)		
3	Very stiff dark and light brown sandy gravelly silty CLAY with cobbles		75.52	3.10	AA184692	B	3.00-3.45		N = 48 (6, 7, 9, 10, 14, 15)		
	End of Borehole at 3.80 m		74.82	3.80							
4											
HARD STRATA BORING/CHISELLING					WATER STRIKE DETAILS						
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments		
3.50	3.80	1.5		2.70	2.70	No	0.60	20	Moderate		
					GROUNDWATER PROGRESS						
INSTALLATION DETAILS					Date	Hole Depth	Casing Depth	Depth to Water	Comments		
Date	Tip Depth	RZ Top	RZ Base	Type							
04-11-22	3.80	1.00	3.80	50mm SP							
REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) Sample B - Bulk Disturbed Sample LB - Large Bulk Disturbed Sample Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample						

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

		GEOTECHNICAL BORING RECORD						REPORT NUMBER 24330	
CONTRACT Halverstown							BOREHOLE NO. BH04 SHEET Sheet 1 of 1		
CO-ORDINATES 686,291.68 E 719,659.60 N				RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 2.80			DATE COMMENCED 04/11/2022 DATE COMPLETED 04/11/2022		
GROUND LEVEL (mOD) 81.06				SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY JL		
CLIENT ENGINEER DOBA									

Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	Firm dark brown sandy gravelly silty CLAY									
1					AA184693	B	1.00-1.45		N = 11 (2, 3, 3, 3, 2, 3)	
2	Firm to stiff and stiff dark and light brown sandy gravelly silty CLAY with cobbles and boulders		79.86	1.20						
					AA184694	B	2.00-2.45		N = 20 (3, 2, 4, 4, 5, 7)	
			78.26	2.80						
3	End of Borehole at 2.80 m									
4										

HARD STRATA BORING/CHISELLING				WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
2.60	2.80	1.5		1.60	1.60	No	0.60	20	Slow

INSTALLATION DETAILS					GROUNDWATER PROGRESS				
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments

REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) Sample B - Bulk Disturbed Sample LB - Large Bulk Disturbed Sample Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample				

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

		GEOTECHNICAL BORING RECORD					REPORT NUMBER 24330		
CONTRACT Halverstown						BOREHOLE NO. BH05 SHEET Sheet 1 of 1			
CO-ORDINATES 686,340.00 E 719,449.17 N			RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 3.60			DATE COMMENCED 24/10/2022 DATE COMPLETED 24/10/2022			
GROUND LEVEL (mOD) 77.88			SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY FC			
CLIENT ENGINEER DOBA									

Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	TOPSOIL		77.73	0.15						
	Brown sandy SILT/CLAY with occasional fine gravel		77.58	0.30						
	Dark brown sandy SILT/CLAY with some gravel and occasional cobbles									
			77.08	0.80						
1	Stiff to very stiff dark brown sandy silty gravelly CLAY with occasional cobbles				AA184670	B	1.00		N = 19 (2, 3, 4, 5, 6, 4)	
2					AA184671	B	2.00		N = 16 (3, 3, 4, 4, 3, 5)	
3					AA184672	B	3.00		N = 42 (4, 6, 6, 9, 11, 16)	
										
	Obstruction End of Borehole at 3.60 m		74.28	3.60						
4										



HARD STRATA BORING/CHISELLING				WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
3.40	3.60	1.5		2.80	2.80	No	1.50	20	Moderate

INSTALLATION DETAILS					GROUNDWATER PROGRESS				
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments

REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) Sample B - Bulk Disturbed Sample LB - Large Bulk Disturbed Sample Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample				

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

		GEOTECHNICAL BORING RECORD						REPORT NUMBER 24330	
CONTRACT Halverstown							BOREHOLE NO. BH06 SHEET Sheet 1 of 1		
CO-ORDINATES 686,418.25 E 719,599.10 N				RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 1.10			DATE COMMENCED 21/10/2022 DATE COMPLETED 21/10/2022		
GROUND LEVEL (mOD) 81.29				SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY FC		
CLIENT ENGINEER DOBA									

Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	TOPSOIL		81.09	0.20						
	Light brown sandy SILT/CLAY with occasional fine gravel									
1	Very stiff light brown sandy silty CLAY with occasional cobbles End of Borehole at 1.10 m		80.19	1.10	AA184669	B	1.00		N = 48/225 mm (8, 11, 17, 27, 4)	
2										
3										
4										

HARD STRATA BORING/CHISELLING				WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
0.90	1.10	1.5							No water strike

INSTALLATION DETAILS					GROUNDWATER PROGRESS				
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments

REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) B - Bulk Disturbed LB - Large Bulk Disturbed Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample				

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

		GEOTECHNICAL BORING RECORD						REPORT NUMBER 24330	
CONTRACT Halverstown							BOREHOLE NO. BH07 SHEET Sheet 1 of 1		
CO-ORDINATES 686,452.03 E 719,373.68 N				RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 2.80			DATE COMMENCED 21/10/2022 DATE COMPLETED 21/10/2022		
GROUND LEVEL (mOD) 77.94				SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY FC		
CLIENT ENGINEER DOBA									

Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	TOPSOIL		77.74	0.20					N = 7 (1, 1, 2, 2, 1, 2)	
	Brown sandy SILT/CLAY with occasional fine gravel		77.44	0.50						
1	Soft dark brown sandy SILT/CLAY with occasional cobbles									
2	Stiff dark brown sandy silty gravelly CLAY with some cobbles		76.24	1.70	AA184674	B	2.00		N = 29 (2, 4, 4, 6, 8, 11)	
3	Obstruction End of Borehole at 2.80 m		75.14	2.80						
4										

HARD STRATA BORING/CHISELLING				WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
2.60	2.80	1.5		1.30	1.30	No	0.90	20	Slow

INSTALLATION DETAILS					GROUNDWATER PROGRESS				
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments

REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) Sample B - Bulk Disturbed Sample LB - Large Bulk Disturbed Sample Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample				

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

		GEOTECHNICAL BORING RECORD						REPORT NUMBER 24330	
CONTRACT Halverstown							BOREHOLE NO. BH08 SHEET Sheet 1 of 1		
CO-ORDINATES 686,549.61 E 719,522.50 N				RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 1.30			DATE COMMENCED 21/10/2022 DATE COMPLETED 21/10/2022		
GROUND LEVEL (mOD) 81.03				SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY FC		
CLIENT ENGINEER DOBA									

Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	TOPSOIL		80.83	0.20	AA184668	B	1.00		N = 50/225 mm (8, 11, 17, 29, 4)	
	Light brown sandy SILT/CLAY with occasional fine gravel		80.63	0.40						
	Very stiff light brown sandy silty CLAY with occasional cobbles									
1	Obstruction End of Borehole at 1.30 m		79.73	1.30						
2										
3										
4										

HARD STRATA BORING/CHISELLING				WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
1.10	1.30	1.5							No water strike

INSTALLATION DETAILS					GROUNDWATER PROGRESS				
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments

REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) B - Bulk Disturbed LB - Large Bulk Disturbed Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample				

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

 GEOTECHNICAL BORING RECORD										REPORT NUMBER 24330	
CONTRACT Halverstown							BOREHOLE NO. BH09 SHEET Sheet 1 of 1				
CO-ORDINATES 686,290.64 E 719,822.45 N				RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 3.90			DATE COMMENCED 27/10/2022 DATE COMPLETED 27/10/2022				
GROUND LEVEL (mOD) 83.98				SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY FC				
CLIENT ENGINEER DOBA											
Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details	
					Ref. Number	Sample Type	Depth (m)	Recovery			
0	TOPSOIL		83.78	0.20							
	Brown sandy SILT/CLAY with occasional fine gravel		83.53	0.45							
	Firm to stiff mottled light/dark brown sandy silty CLAY with occasional cobbles										
1					AA184679	B	1.00		N = 14 (2, 2, 3, 4, 3, 4)		
2					AA184680	B	2.00		N = 15 (2, 3, 3, 4, 4, 4)		
3					AA184681	B	3.00		N = 24 (3, 4, 5, 6, 6, 7)		
4	Obstruction End of Borehole at 3.90 m		80.18	3.80							
HARD STRATA BORING/CHISELLING					WATER STRIKE DETAILS						
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments		
3.60	3.80	1.5							No water strike		
					GROUNDWATER PROGRESS						
INSTALLATION DETAILS				Date	Hole Depth	Casing Depth	Depth to Water	Comments			
Date	Tip Depth	RZ Top	RZ Base	Type							
REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) B - Bulk Disturbed LB - Large Bulk Disturbed Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample						

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

 GEOTECHNICAL BORING RECORD REPORT NUMBER 24330										
CONTRACT Halverstown						BOREHOLE NO. BH10 SHEET Sheet 1 of 1				
CO-ORDINATES 686,436.07 E 719,740.74 N			RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 1.80			DATE COMMENCED 27/11/2022 DATE COMPLETED 27/11/2022				
GROUND LEVEL (mOD) 84.79			SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY FC				
CLIENT ENGINEER DOBA										
Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	TOPSOIL		84.59	0.20	AA174678	B	1.00		N = 14 (2, 3, 3, 4, 3, 4)	
	Brown sandy SILT/CLAY with occasional fine gravel		84.39	0.40						
1	Firm dark brown sandy SILT/CLAY with some gravel and occasional cobbles									
	Obstruction End of Borehole at 1.80 m		82.99	1.80						
2										
3										
4										
HARD STRATA BORING/CHISELLING					WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments	
1.50	1.80	1.5							No water strike	
					GROUNDWATER PROGRESS					
INSTALLATION DETAILS				Date	Hole Depth	Casing Depth	Depth to Water	Comments		
Date	Tip Depth	RZ Top	RZ Base	Type						
27-10-22	1.80	1.00	1.80	50mm SP						
REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) B - Bulk Disturbed LB - Large Bulk Disturbed Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample					

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

 GEOTECHNICAL BORING RECORD REPORT NUMBER 24330										
CONTRACT Halverstown						BOREHOLE NO. BH11 SHEET Sheet 1 of 1				
CO-ORDINATES 686,586.06 E 719,791.67 N			RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 3.30			DATE COMMENCED 26/10/2022 DATE COMPLETED 26/10/2022				
GROUND LEVEL (mOD) 83.53			SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY FC				
CLIENT DOBA										
Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	TOPSOIL		83.38	0.15						
	Brown sandy SILT/CLAY with occasional fine gravel		83.23	0.30						
	Soft to firm dark brown sandy SILT/CLAY with some gravel and occasional cobbles									
1					AA184677	B	1.00		N = 10 (2, 2, 2, 3, 3, 2)	
2					AA184678	B	2.00		N = 20 (3, 3, 4, 5, 5, 6)	
	Stiff to very stiff light brown sandy sandy silty gravelly CLAY with some cobbles and occasional boulders		81.13	2.40						
3					AA184679	B	3.00		N = 50/150 mm (18, 7, 39, 11)	
	Obstruction End of Borehole at 3.30 m		80.03	3.50						
4										
HARD STRATA BORING/CHISELLING					WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments	
3.00	3.30	1.5							No water strike	
					GROUNDWATER PROGRESS					
INSTALLATION DETAILS				Date	Hole Depth	Casing Depth	Depth to Water	Comments		
Date	Tip Depth	RZ Top	RZ Base	Type						
REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) B - Bulk Disturbed LB - Large Bulk Disturbed Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample					

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23



GEOTECHNICAL BORING RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

BOREHOLE NO. BH12
SHEET Sheet 1 of 1CO-ORDINATES 686,747.60 E
719,716.71 N
GROUND LEVEL (mOD) 80.50RIG TYPE Dando 2000
BOREHOLE DIAMETER (mm) 200
BOREHOLE DEPTH (m) 2.40DATE COMMENCED 25/10/2022
DATE COMPLETED 25/10/2022CLIENT
ENGINEER DOBASPT HAMMER REF. NO.
ENERGY RATIO (%)BORED BY W.Cahill
PROCESSED BY FC

Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	TOPSOIL		80.30	0.20	AA184675	B	1.00		N = 10 (2, 2, 2, 3, 2, 3)	
	Dark brown sandy SILT/CLAY with occasional fine gravel		80.10	0.40						
	Soft to firm light brown sandy silty gravelly CLAY with occasional cobbles									
1										
	Very stiff light brown sandy silty gravelly CLAY with some cobbles		78.70	1.80	AA184676	B	2.00		N = 50/225 mm (8, 12, 16, 19, 15)	
2			78.10	2.40						
	Obstruction End of Borehole at 2.40 m									
3										
4										

HARD STRATA BORING/CHISELLING

WATER STRIKE DETAILS

From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
2.20	2.40	1.5		2.20	2.20	No	0.70	20	Moderate
GROUNDWATER PROGRESS									

INSTALLATION DETAILS

Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments
25-10-22	2.40	1.00	2.40	50mm SP					

REMARKS Very wet ground conditions. CAT scanned location and hand dug inspection pit carried out.

Sample Legend

D - Small Disturbed (tub)
B - Bulk Disturbed
LB - Large Bulk Disturbed
Env - Environmental Sample (Jar + Vial + Tub)
UT - Undisturbed 100mm Diameter Sample
P - Undisturbed Piston Sample
W - Water Sample

		GEOTECHNICAL BORING RECORD						REPORT NUMBER 24330	
CONTRACT Halverstown							BOREHOLE NO. BH13		
CO-ORDINATES 686,124.91 E 719,837.47 N							RIG TYPE Dando 2000		
GROUND LEVEL (mOD) 82.80							BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 2.70		
CLIENT ENGINEER DOBA							SPT HAMMER REF. NO. ENERGY RATIO (%)		
							DATE COMMENCED 01/11/2022 DATE COMPLETED 01/11/2022		
							BORED BY W.Cahill PROCESSED BY JL		

Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	Firm brown sandy gravelly silty CLAY									
1					AA184685	B	1.00-1.45		N = 13 (2, 2, 3, 3, 4, 3)	
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										
										

HARD STRATA BORING/CHISELLING				WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
2.40	2.70	1.5							No water strike

INSTALLATION DETAILS					GROUNDWATER PROGRESS				
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments
01-11-22	2.50	1.00	2.70	50mm SP					

REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) B - Bulk Disturbed LB - Large Bulk Disturbed Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample				

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

		GEOTECHNICAL BORING RECORD						REPORT NUMBER 24330	
CONTRACT Halverstown							BOREHOLE NO. BH14 SHEET Sheet 1 of 1		
CO-ORDINATES 686,152.24 E 719,976.74 N				RIG TYPE Dando 2000 BOREHOLE DIAMETER (mm) 200 BOREHOLE DEPTH (m) 3.90			DATE COMMENCED 28/10/2022 DATE COMPLETED 28/10/2022		
GROUND LEVEL (mOD) 84.27				SPT HAMMER REF. NO. ENERGY RATIO (%)			BORED BY W.Cahill PROCESSED BY FC		
CLIENT ENGINEER DOBA									

Depth (m)	Description	Legend	Elevation	Depth (m)	Samples				Field Test Results	Standpipe Details
					Ref. Number	Sample Type	Depth (m)	Recovery		
0	TOPSOIL		84.12	0.15						
	Brown sandy SILT/CLAY with occasional gravel									
	Soft to firm dark brown sandy silty gravelly CLAY with some cobbles		83.87	0.40						
1					AA184682	B	1.00		N = 3 (0, 1, 1, 0, 1, 1)	
2					AA184683	B	2.00		N = 15 (2, 2, 3, 4, 3, 5)	
3					AA184684	B	3.00		N = 19 (4, 4, 5, 3, 5, 6)	
4	Obstruction End of Borehole at 3.90 m		80.37	3.90						

HARD STRATA BORING/CHISELLING				WATER STRIKE DETAILS					
From (m)	To (m)	Time (h)	Comments	Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
3.70	3.90	1.5							No water strike

INSTALLATION DETAILS					GROUNDWATER PROGRESS				
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments

REMARKS CAT scanned location and hand dug inspection pit carried out.					Sample Legend D - Small Disturbed (tub) Sample B - Bulk Disturbed Sample LB - Large Bulk Disturbed Sample Env - Environmental Sample (Jar + Vial + Tub) UT - Undisturbed 100mm Diameter Sample P - Undisturbed Piston Sample W - Water Sample				

IGSL BH LOG 24330.GPJ IGSL.GDT 31/1/23

Appendix 3

Dynamic Probehole Records

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP01 SHEET Sheet 1 of 1		
CO-ORDINATES 686,043.01 E 719,643.63 N		HAMMER MASS (kg) 50				DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 78.58		INCREMENT SIZE (mm) 100				DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA		FALL HEIGHT (mm) 500				PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record					
								0	5	10	15	20	25
0.0						0.00	0						
0.10						0							
0.20						1							
0.30						7							
0.40						9							
0.50						11							
0.60						11							
0.70						10							
0.80						14							
0.90						18							
1.00						20							
1.10						12							
1.20						13							
1.30						12							
1.40						11							
1.50						13							
1.60						10							
1.70						8							
1.80						8							
1.90						8							
2.00						5							
2.10	4												
2.20	3												
2.30	3												
2.40	4												
2.50	4												
2.60	3												
2.70	4												
2.80	4												
2.90	5												
3.00	5												
3.10	8												
3.20	12												
3.30	16												
3.40	23												
3.50	25												
1.0	End of Probe at 3.60 m			74.98									
2.0													
3.0													
4.0													

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP03 SHEET Sheet 1 of 1		
CO-ORDINATES 686,108.07 E 719,656.12 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 79.95			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record					
								0	5	10	15	20	25
0.0						0.00	0						
0.10						0							
0.20						0							
0.30						0							
0.40						0							
0.50						2							
0.60						2							
0.70						3							
0.80						2							
0.90						6							
1.00						5							
1.10						5							
1.20						3							
1.30						5							
1.40						6							
1.50						10							
1.60						10							
1.70						11							
1.80						13							
1.90						17							
2.00						6							
2.10						3							
2.20						6							
2.30						10							
2.40						9							
2.50	8												
2.60	6												
2.70	7												
2.80	8												
2.90	6												
3.00	5												
3.10	4												
3.20	5												
3.30	8												
3.40	7												
3.50	14												
3.60	20												
3.70	25												
4.0	End of Probe at 3.80 m			76.15									

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

GSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL.GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP05 SHEET Sheet 1 of 1		
CO-ORDINATES 686,174.73 E 719,662.34 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 80.41			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record					
								0	5	10	15	20	25
0.0						0.00	1						
0.10						1							
0.20						1							
0.30						1							
0.40						1							
0.50						5							
0.60						6							
0.70						3							
0.80						3							
0.90						8							
1.00						7							
1.10						10							
1.20						9							
1.30						12							
1.40						9							
1.50						8							
1.60						8							
1.70						8							
1.80						9							
1.90						12							
2.00						12							
2.10	12												
2.20	13												
2.30	9												
2.40	4												
2.50	3												
2.60	4												
2.70	4												
2.80	5												
2.90	7												
3.00	11												
3.10	13												
3.20	12												
3.30	14												
3.40	22												
3.50	25												
	End of Probe at 3.60 m			76.81									
4.0													

GROUNDWATER OBSERVATIONS

REMARKS

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP06

SHEET Sheet 1 of 1

CO-ORDINATES 686,152.47 E
719,720.80 N

GROUND LEVEL (mOD) 81.09

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

DATE COMMENCED 13/10/2022

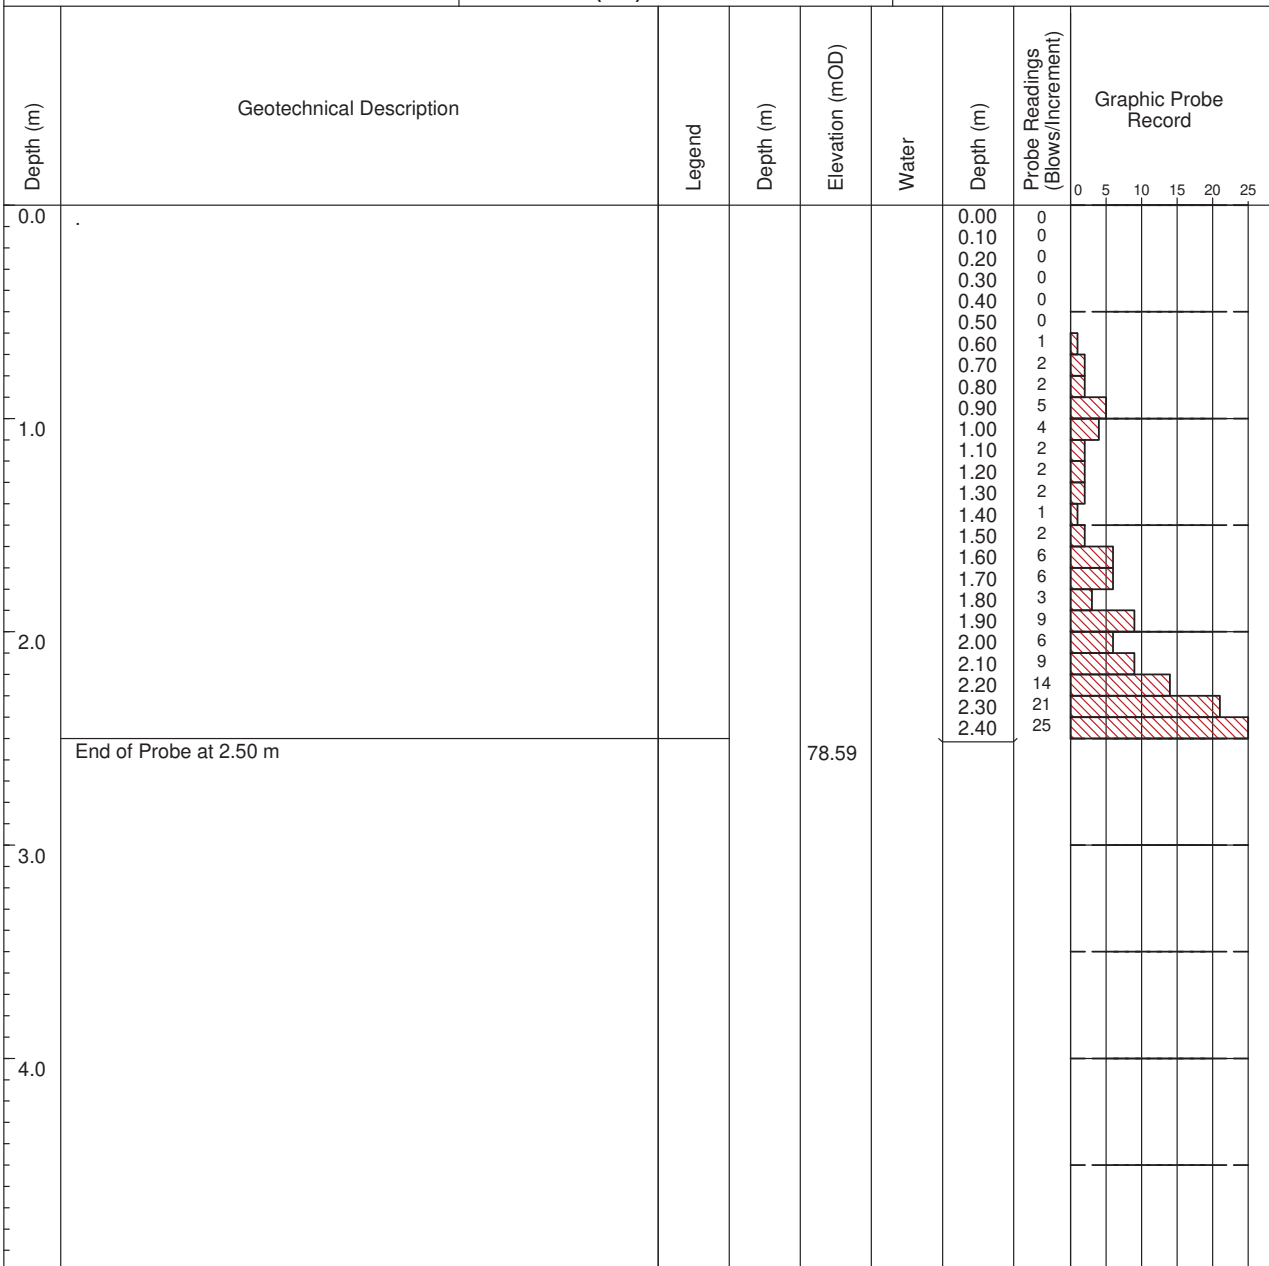
DATE COMPLETED 24/10/2022

CLIENT

ENGINEER DOBA

FALL HEIGHT (mm) 500

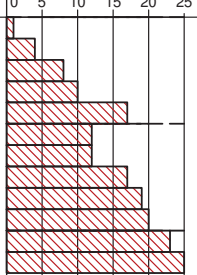
PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP07 SHEET Sheet 1 of 1		
CO-ORDINATES 686,209.81 E 719,726.09 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 81.20			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record				
0.0	End of Probe at 1.20 m		80.00			0.00	1					
												4
												8
												10
												17
												12
												17
												19
												20
												23
												25
1.0												
2.0												
3.0												
4.0												

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

GSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL.GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP09

SHEET Sheet 1 of 1

CO-ORDINATES 686,164.89 E
719,562.10 N

GROUND LEVEL (mOD) 79.00

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

DATE COMMENCED 13/10/2022

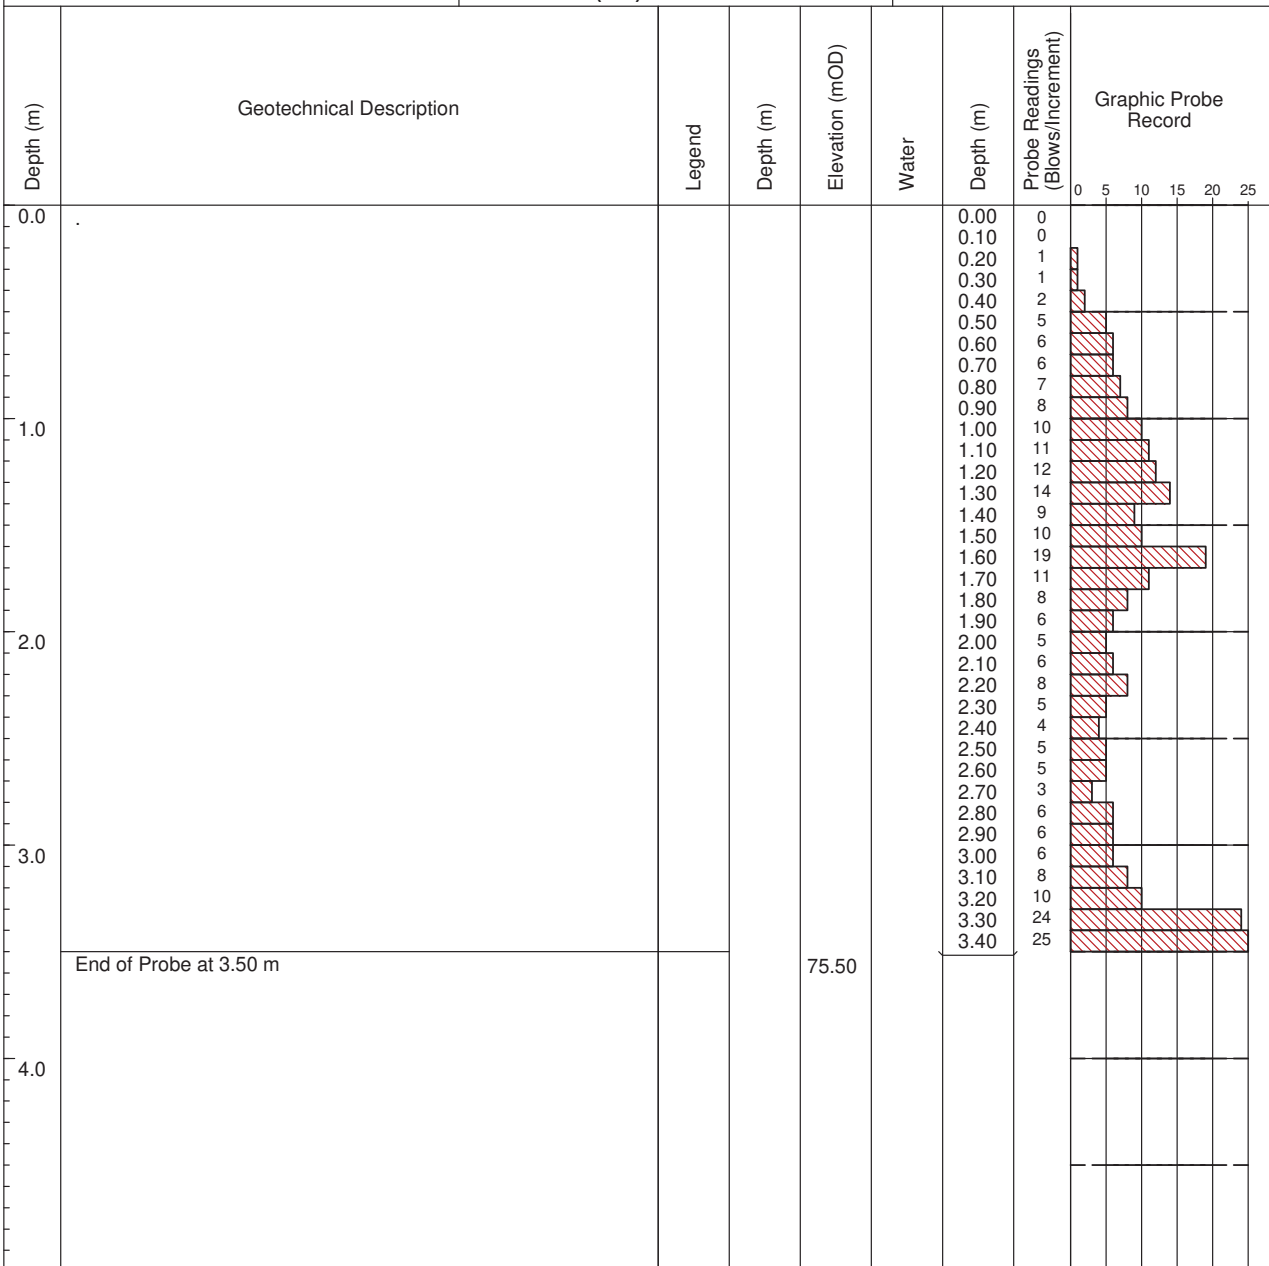
DATE COMPLETED 24/10/2022

CLIENT

ENGINEER DOBA

FALL HEIGHT (mm) 500

PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS



DYNAMIC PROBE RECORD

REPORT NUMBER
24330

CONTRACT Halverstown

CO-ORDINATES 686,274.54 E
719,641.63 N

GROUND LEVEL (mOD) 80.83

CLIENT ENGINEER DOBA

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

FALL HEIGHT (mm) 500

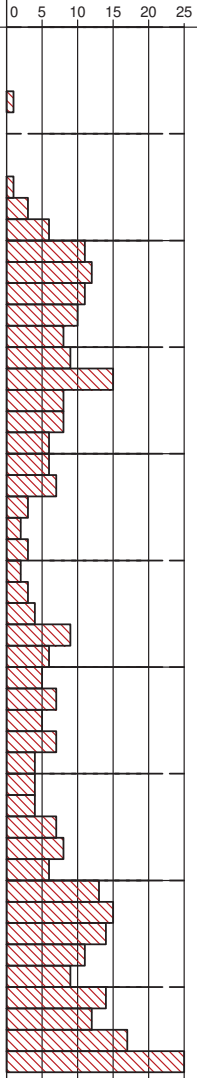
PROBE NO. DP14

SHEET Sheet 1 of 2

DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

PROBE TYPE DPH

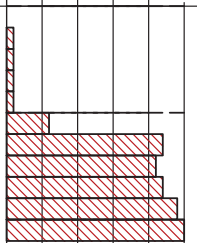
Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0						0.00	0	
0.10						0		
0.20						0		
0.30						1		
0.40						0		
0.50						0		
0.60						0		
0.70						1		
0.80						3		
0.90						6		
1.00						11		
1.10						12		
1.20						11		
1.30						10		
1.40						8		
1.50						9		
1.60						15		
1.70						8		
1.80						8		
1.90						6		
2.00	6							
2.10	7							
2.20	3							
2.30	2							
2.40	3							
2.50	2							
2.60	3							
2.70	4							
2.80	9							
2.90	6							
3.00	5							
3.10	7							
3.20	5							
3.30	7							
3.40	4							
3.50	4							
3.60	4							
3.70	7							
3.80	8							
3.90	6							
4.00	13							
4.10	15							
4.20	14							
4.30	11							
4.40	9							
4.50	14							
4.60	12							
4.70	17							
4.80	25							
End of Probe at 4.90 m								

GROUNDWATER OBSERVATIONS

REMARKS

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP15 SHEET Sheet 1 of 1		
CO-ORDINATES 686,256.18 E 719,704.87 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 81.30			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 1.10 m			80.20		0.00	0	
0.10						1		
0.20						1		
0.30						1		
0.40						1		
0.50						6		
0.60						22		
0.70						21		
0.80						22		
0.90						24		
1.00						25		
1.0								
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS

REMARKS

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP16

SHEET Sheet 1 of 1

CO-ORDINATES 686,327.65 E
719,646.84 N

GROUND LEVEL (mOD) 81.00

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

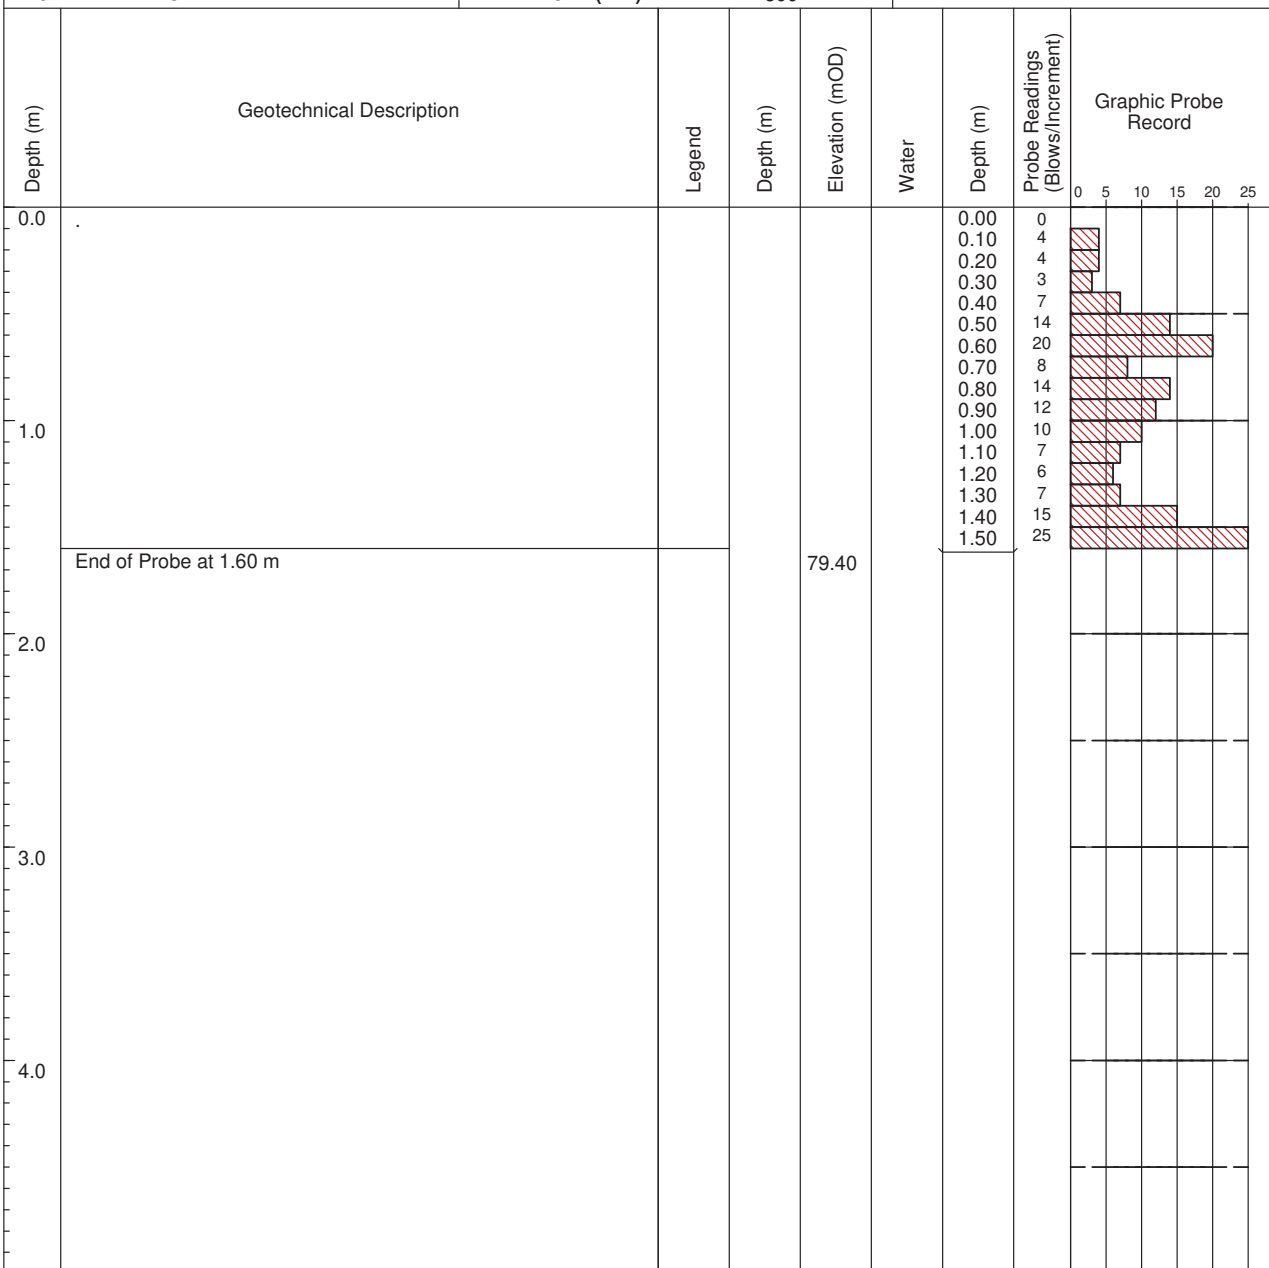
DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

CLIENT
ENGINEER DOBA

FALL HEIGHT (mm) 500

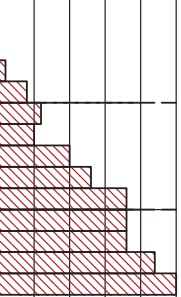
PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP17 SHEET Sheet 1 of 1		
CO-ORDINATES 686,289.55 E 719,484.59 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 78.26			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 1.40 m			76.86		0.00	0	
						0.10	0	
						0.20	0	
						0.30	1	
						0.40	4	
						0.50	6	
						0.60	5	
						0.70	10	
						0.80	13	
						0.90	18	
						1.00	18	
						1.10	18	
						1.20	22	
						1.30	25	
1.0								
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS	
REMARKS	



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

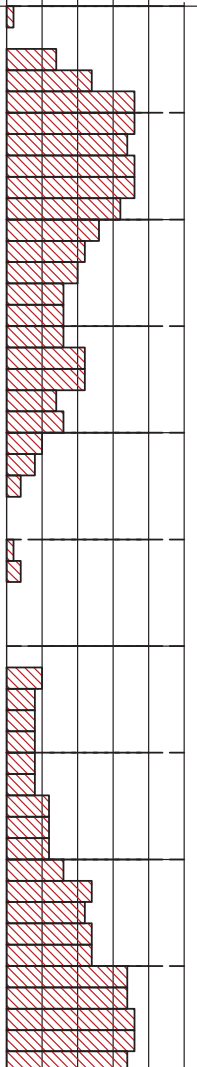
CONTRACT Halverstown			PROBE NO. DP18	
CO-ORDINATES 686,375.70 E 719,431.73 N			SHEET Sheet 2 of 2	
GROUND LEVEL (mOD) 77.94			DATE COMMENCED 13/10/2022	
CLIENT			DATE COMPLETED 24/10/2022	
ENGINEER DOBA			PROBE TYPE DPH	
HAMMER MASS (kg) 50				
INCREMENT SIZE (mm) 100				
FALL HEIGHT (mm) 500				

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record									
5.0				73.04				0	5	10	15	20	25				
6.0																	
7.0																	
8.0																	
9.0																	

GROUNDWATER OBSERVATIONS

REMARKS

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP19 SHEET Sheet 1 of 2		
CO-ORDINATES 686,354.17 E 719,487.04 N			HAMMER MASS (kg) 50 INCREMENT SIZE (mm) 100 FALL HEIGHT (mm) 500			DATE COMMENCED 13/10/2022 DATE COMPLETED 24/10/2022		
GROUND LEVEL (mOD) 79.01						PROBE TYPE DPH		
CLIENT ENGINEER DOBA								

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0						0.00	1	
0.10						0		
0.20						7		
0.30						12		
0.40						18		
0.50						18		
0.60						17		
0.70						18		
0.80						18		
0.90						16		
1.00						13		
1.10						11		
1.20						10		
1.30						8		
1.40						8		
1.50						8		
1.60						11		
1.70						11		
1.80						7		
2.0								
2.00	5							
2.10	4							
2.20	2							
2.30	0							
2.40	0							
2.50	1							
2.60	2							
2.70	0							
2.80	0							
3.0						2.90	0	
3.00						0		
3.10						5		
3.20						4		
3.30						4		
3.40						4		
3.50						4		
3.60						4		
3.70						6		
3.80						6		
4.0						3.90	6	
4.00						8		
4.10						12		
4.20						11		
4.30						12		
4.40						12		
4.50						17		
4.60						17		
4.70						18		
4.80						18		
						4.90	17	

GROUNDWATER OBSERVATIONS

REMARKS

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP19 SHEET Sheet 2 of 2		
CO-ORDINATES 686,354.17 E 719,487.04 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 79.01			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
5.0	. (continued)					5.00 5.10 5.20	18 18 25	
	End of Probe at 5.30 m			73.71				
6.0								
7.0								
8.0								
9.0								

GROUNDWATER OBSERVATIONS								
REMARKS								



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP20

SHEET Sheet 1 of 1

CO-ORDINATES 686,329.28 E
719,557.71 N

GROUND LEVEL (mOD) 80.10

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

FALL HEIGHT (mm) 500

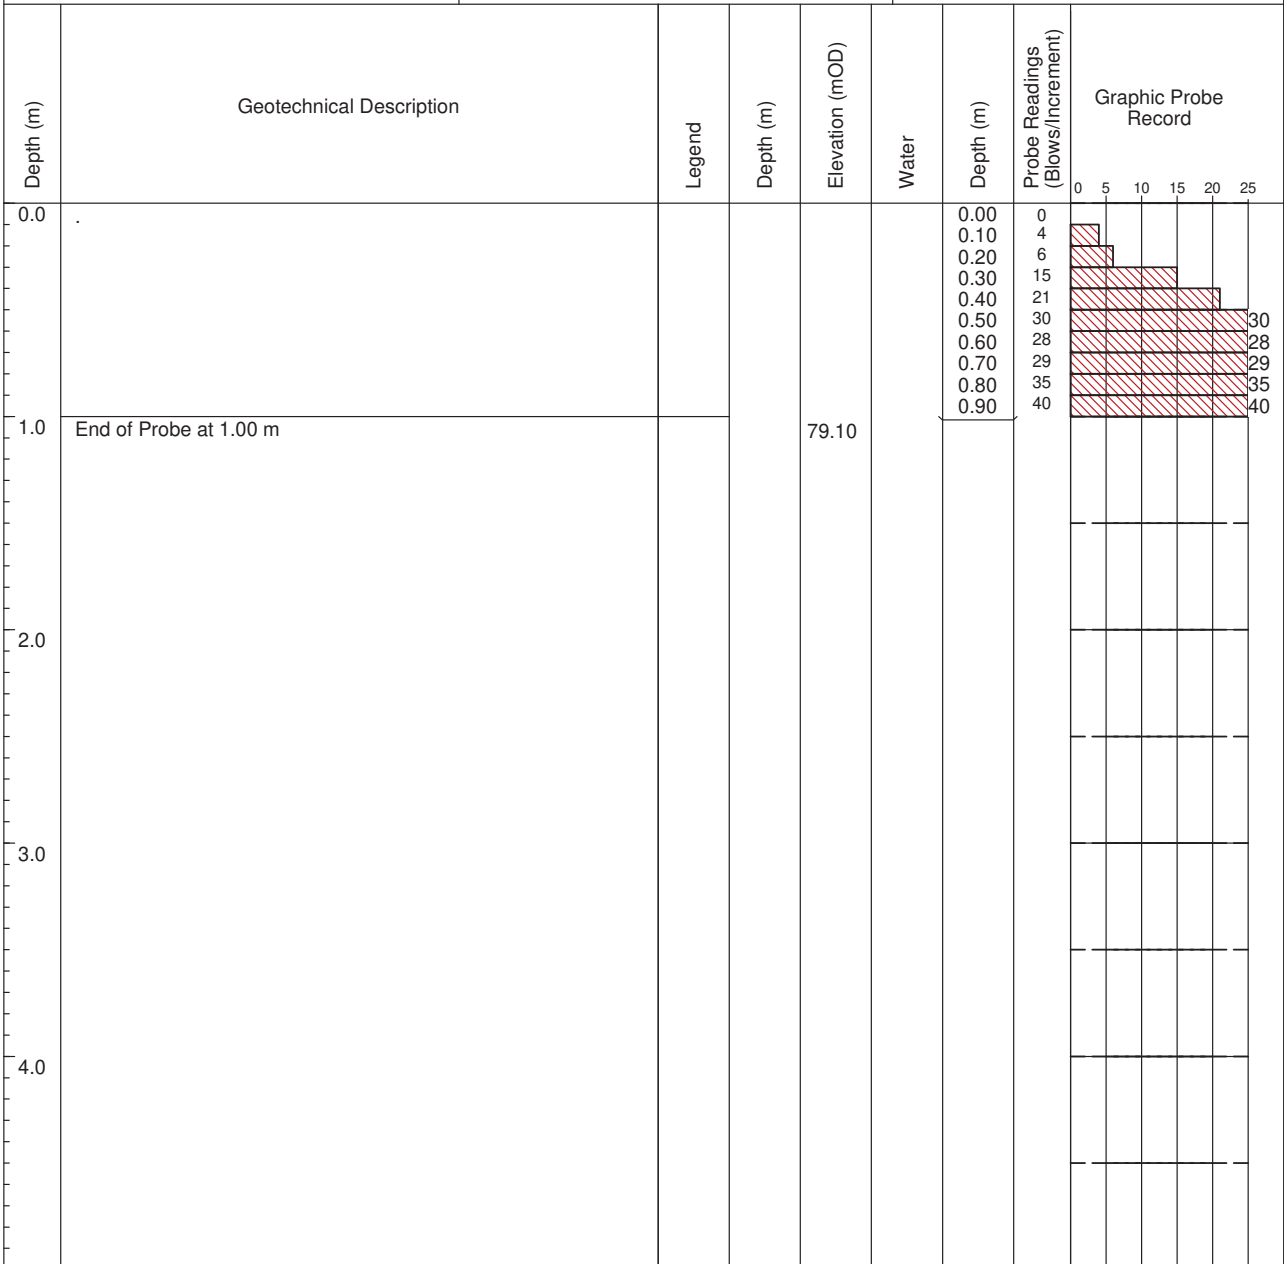
DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

CLIENT

ENGINEER DOBA

PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS



DYNAMIC PROBE RECORD

REPORT NUMBER
24330

CONTRACT Halverstown

CO-ORDINATES 686,398.41 E
719,564.25 N

GROUND LEVEL (mOD) 80.57

CLIENT ENGINEER DOBA

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

FALL HEIGHT (mm) 500

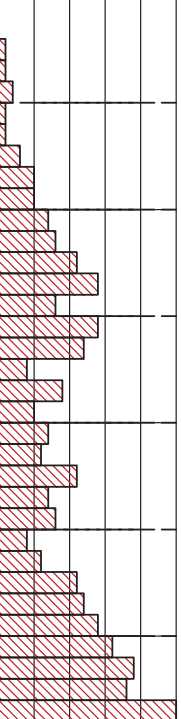
PROBE NO. DP22

SHEET Sheet 1 of 1

DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

PROBE TYPE DPH

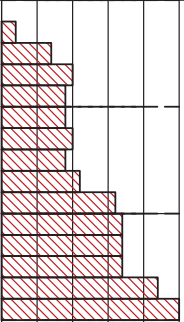
Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0						0.00	0	
						0.10	0	
						0.20	1	
						0.30	1	
						0.40	2	
						0.50	1	
						0.60	1	
						0.70	3	
						0.80	5	
						0.90	5	
						1.00	7	
						1.10	8	
						1.20	11	
						1.30	14	
						1.40	8	
						1.50	14	
						1.60	12	
						1.70	4	
						1.80	9	
						1.90	5	
						2.00	7	
						2.10	6	
						2.20	11	
						2.30	7	
						2.40	8	
						2.50	4	
						2.60	6	
						2.70	11	
						2.80	12	
						2.90	14	
						3.00	16	
						3.10	19	
						3.20	18	
						3.30	25	
1.0								
2.0								
3.0								
	End of Probe at 3.40 m			77.17				
4.0								

GROUNDWATER OBSERVATIONS

REMARKS

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP23 SHEET Sheet 1 of 1		
CO-ORDINATES 686,380.37 E 719,630.14 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 81.50			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 1.50 m			80.00		0.00	0	
						0.10	2	
						0.20	7	
						0.30	10	
						0.40	9	
						0.50	9	
						0.60	10	
						0.70	9	
						0.80	11	
						0.90	16	
1.0						17		
						1.10	17	
						1.20	17	
						1.30	22	
						1.40	25	
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS	
REMARKS	



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP24

SHEET Sheet 1 of 1

CO-ORDINATES 686,465.77 E
719,575.00 N

GROUND LEVEL (mOD) 81.35

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

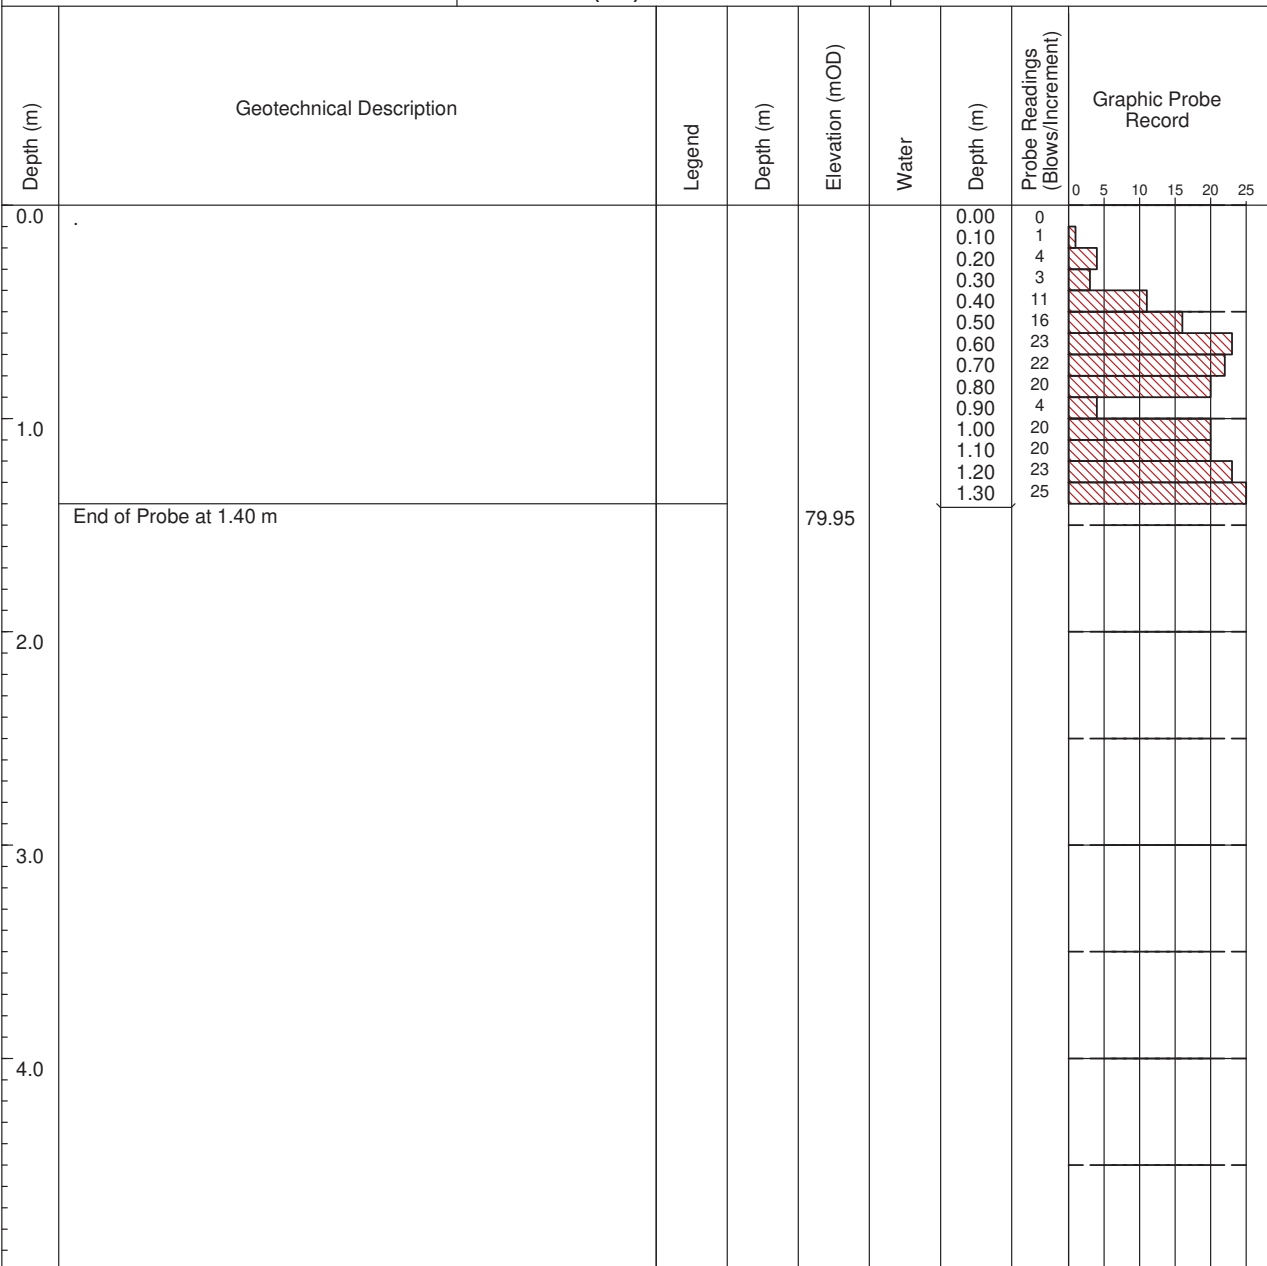
DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

CLIENT
ENGINEER DOBA

FALL HEIGHT (mm) 500

PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS

GSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL.GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP26

SHEET Sheet 2 of 2

CO-ORDINATES 686,498.38 E
719,350.64 N

GROUND LEVEL (mOD) 78.29

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

CLIENT

ENGINEER DOBA

FALL HEIGHT (mm) 500

PROBE TYPE DPH

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
5.0	. (continued)					5.00 5.10 5.20 5.30 5.40 5.50	14 16 13 10 17 25	
6.0	End of Probe at 5.60 m			72.69				
7.0								
8.0								
9.0								

GROUNDWATER OBSERVATIONS

REMARKS

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP27 SHEET Sheet 1 of 2		
CO-ORDINATES 686,478.95 E 719,416.85 N			HAMMER MASS (kg) 50 INCREMENT SIZE (mm) 100 FALL HEIGHT (mm) 500			DATE COMMENCED 13/10/2022 DATE COMPLETED 24/10/2022		
GROUND LEVEL (mOD) 78.88						PROBE TYPE DPH		
CLIENT ENGINEER DOBA								

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0						0.00	0	
0.10								
0.20								
0.30								
0.40								
0.50								
0.60								
0.70								
0.80								
0.90								
1.00								
1.10								
1.20								
1.30								
1.40								
1.50								
1.60								
1.70								
1.80								
1.90								
2.00								
2.10								
2.20								
2.30								
2.40								
2.50								
2.60								
2.70								
2.80								
2.90								
3.00								
3.10								
3.20								
3.30								
3.40								
3.50								
3.60								
3.70								
3.80								
3.90								
4.00								
4.10								
4.20								
4.30								
4.40								
4.50								
4.60								
4.70								
4.80								
4.90								

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP27

SHEET Sheet 2 of 2

CO-ORDINATES 686,478.95 E
719,416.85 N

GROUND LEVEL (mOD) 78.88

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

CLIENT
ENGINEER DOBA

FALL HEIGHT (mm) 500

PROBE TYPE DPH

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
5.0	. (continued)					5.00 5.10 5.20 5.30 5.40 5.50	11 10 10 12 22 25	
6.0	End of Probe at 5.60 m			73.28				
7.0								
8.0								
9.0								

GROUNDWATER OBSERVATIONS

REMARKS

GSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL.GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER
24330

CONTRACT Halverstown

CO-ORDINATES 686,521.92 E
719,484.32 N

GROUND LEVEL (mOD) 79.97

CLIENT ENGINEER DOBA

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

FALL HEIGHT (mm) 500

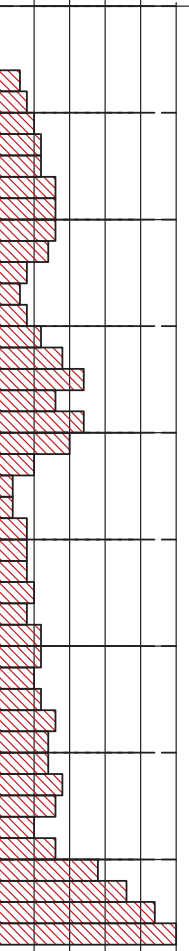
PROBE NO. DP30

SHEET Sheet 1 of 1

DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

PROBE TYPE DPH

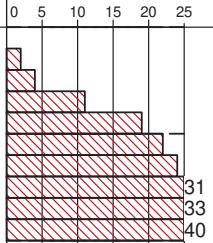
Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0						0.00	0	Graphic Probe Record 
						0.10	0	
						0.20	0	
						0.30	3	
						0.40	4	
						0.50	5	
						0.60	6	
						0.70	6	
						0.80	8	
						0.90	8	
						1.00	8	
						1.10	7	
						1.20	4	
						1.30	3	
						1.40	4	
						1.50	6	
						1.60	9	
						1.70	12	
						1.80	8	
						1.90	12	
1.0	2.00	10	End of Probe at 4.40 m					
	2.10	5						
	2.20	2						
	2.30	2						
	2.40	4						
	2.50	4						
	2.60	4						
	2.70	5						
	2.80	4						
	2.90	6						
	3.00	6						
	3.10	5						
	3.20	6						
	3.30	8						
	3.40	7						
	3.50	7						
	3.60	9						
	3.70	8						
	3.80	5						
	3.90	8						
	4.00	14						
	4.10	18						
	4.20	22						
	4.30	25						
2.0				75.57				
3.0								
4.0								

GROUNDWATER OBSERVATIONS

REMARKS

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP31 SHEET Sheet 1 of 1		
CO-ORDINATES 686,502.22 E 719,558.13 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 81.27			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 1.00 m			80.27		0.00	0	
0.10								
0.20								
0.30								
0.40								
0.50								
0.60								
0.70								
0.80								
0.90								
1.0								
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO.

DP33

SHEET

Sheet 1 of 1

CO-ORDINATES 686,261.46 E
719,795.33 N

GROUND LEVEL (mOD) 83.07

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

DATE COMMENCED 13/10/2022

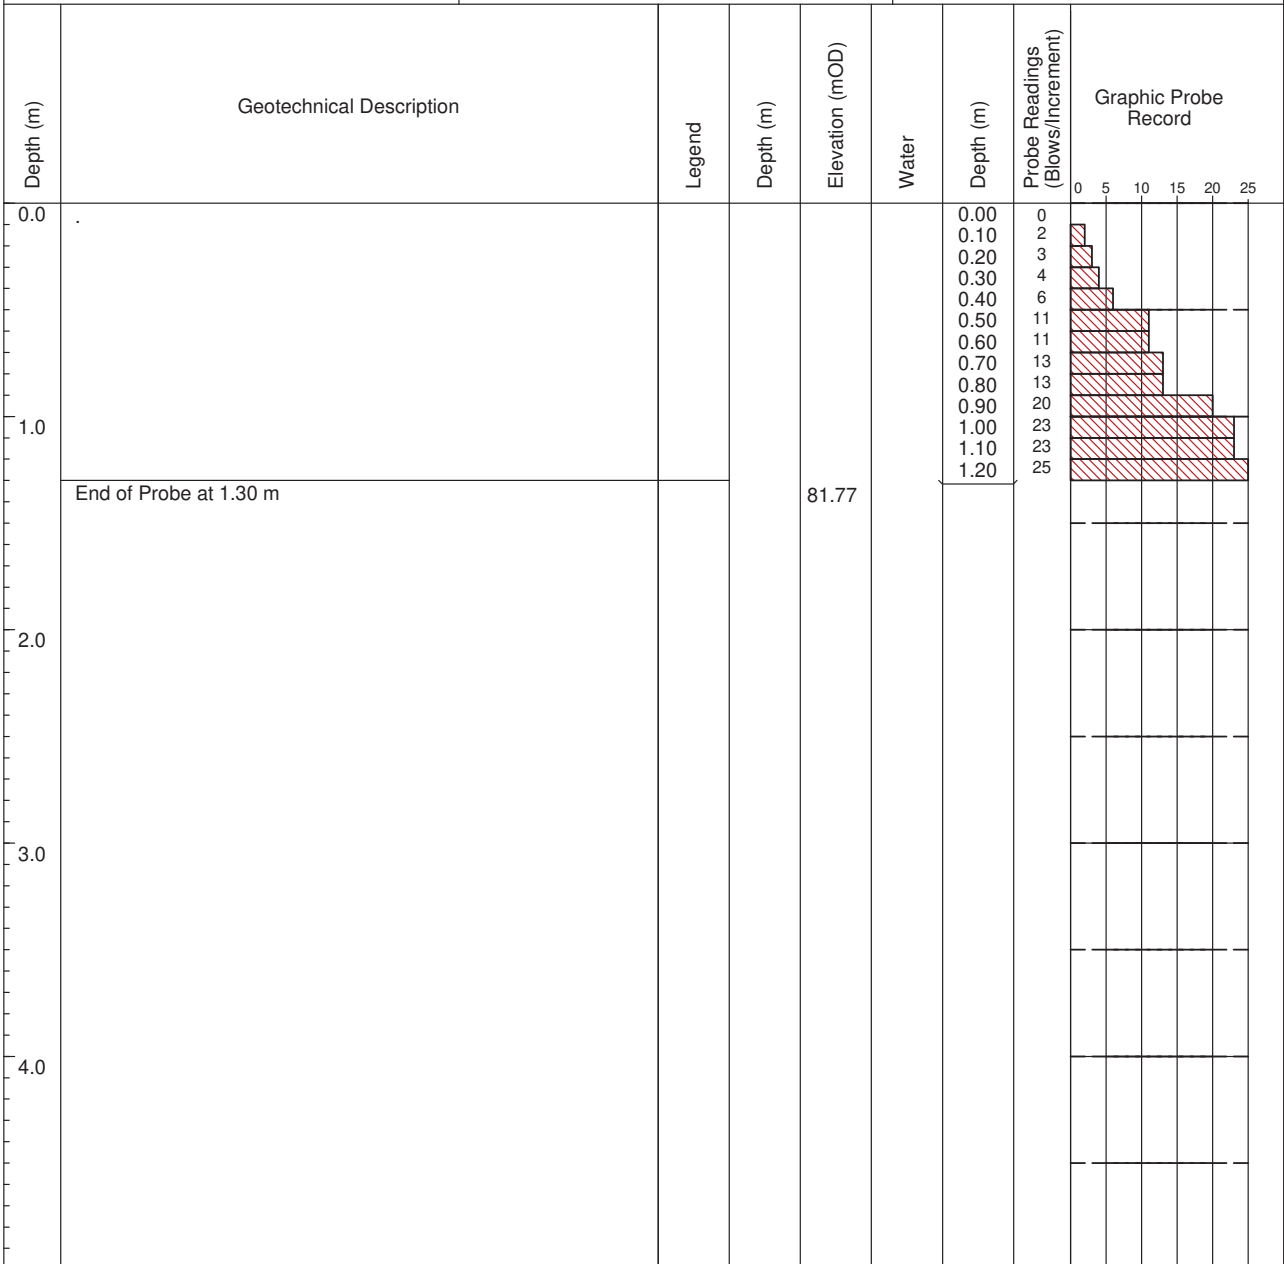
DATE COMPLETED 24/10/2022

CLIENT
ENGINEER DOBA

FALL HEIGHT (mm) 500

PROBE TYPE

DPH



GROUNDWATER OBSERVATIONS

REMARKS



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP34

SHEET Sheet 1 of 1

CO-ORDINATES 686,326.45 E
719,842.17 N

GROUND LEVEL (mOD) 84.72

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

DATE COMMENCED 13/10/2022

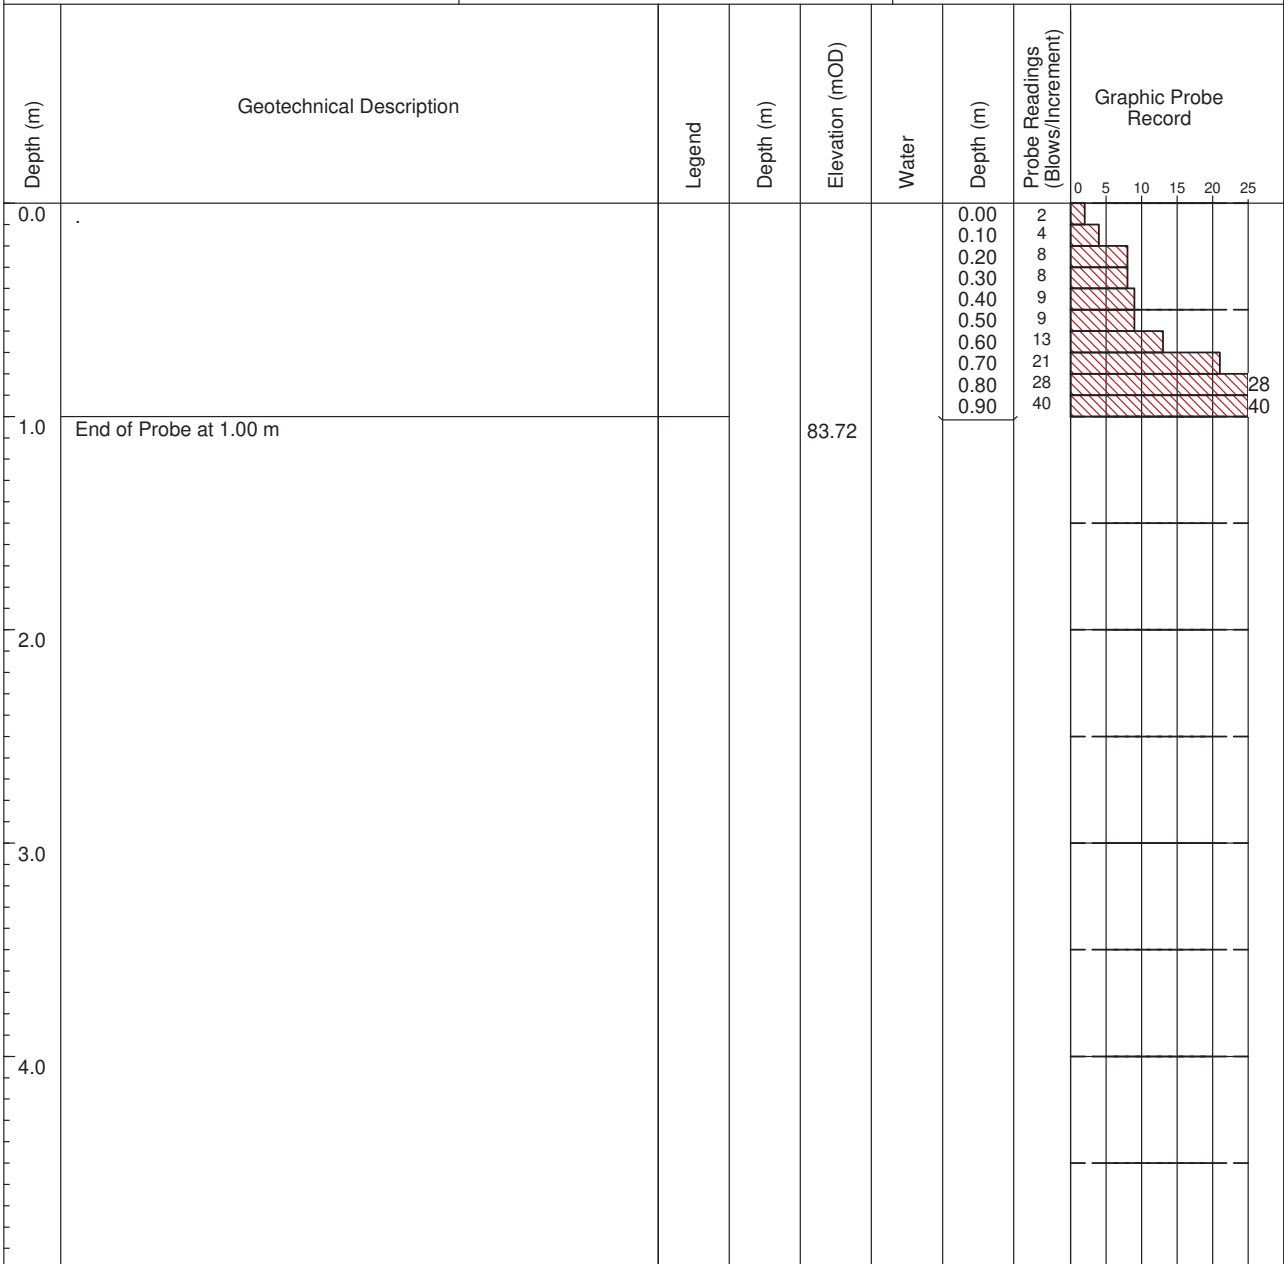
DATE COMPLETED 24/10/2022

CLIENT

ENGINEER DOBA

FALL HEIGHT (mm) 500

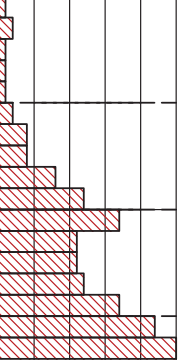
PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP35 SHEET Sheet 1 of 1		
CO-ORDINATES 686,324.99 E 719,813.24 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 84.32			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 1.70 m			82.62		0.00	1	
						0.10	2	
						0.20	1	
						0.30	1	
						0.40	1	
						0.50	2	
						0.60	4	
						0.70	4	
						0.80	8	
						0.90	12	
						1.00	17	
						1.10	11	
						1.20	11	
						1.30	12	
						1.40	17	
						1.50	22	
						1.60	25	
1.0								
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL.GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP37 SHEET Sheet 1 of 1		
CO-ORDINATES 686,384.86 E 719,834.91 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 85.22			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 1.20 m			84.02		0.00	0	
						0.10	0	
						0.20	1	
						0.30	0	
						0.40	0	
						0.50	0	
						0.60	1	
						0.70	6	
						0.80	16	
						0.90	19	
						1.00	22	
						1.10	25	
1.0								
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP38 SHEET Sheet 1 of 1		
CO-ORDINATES 686,399.34 E 719,770.79 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 84.73			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 1.30 m			83.43		0.00	1	
						0.10	0	
						0.20	0	
						0.30	0	
						0.40	1	
						0.50	0	
						0.60	4	
						0.70	8	
						0.80	10	
						0.90	9	
						1.00	13	
						1.10	19	
						1.20	25	
1.0								
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS	
REMARKS	



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP39

SHEET Sheet 1 of 1

CO-ORDINATES 686,441.39 E
719,786.19 N

DATE COMMENCED 13/10/2022

GROUND LEVEL (mOD) 85.33

DATE COMPLETED 24/10/2022

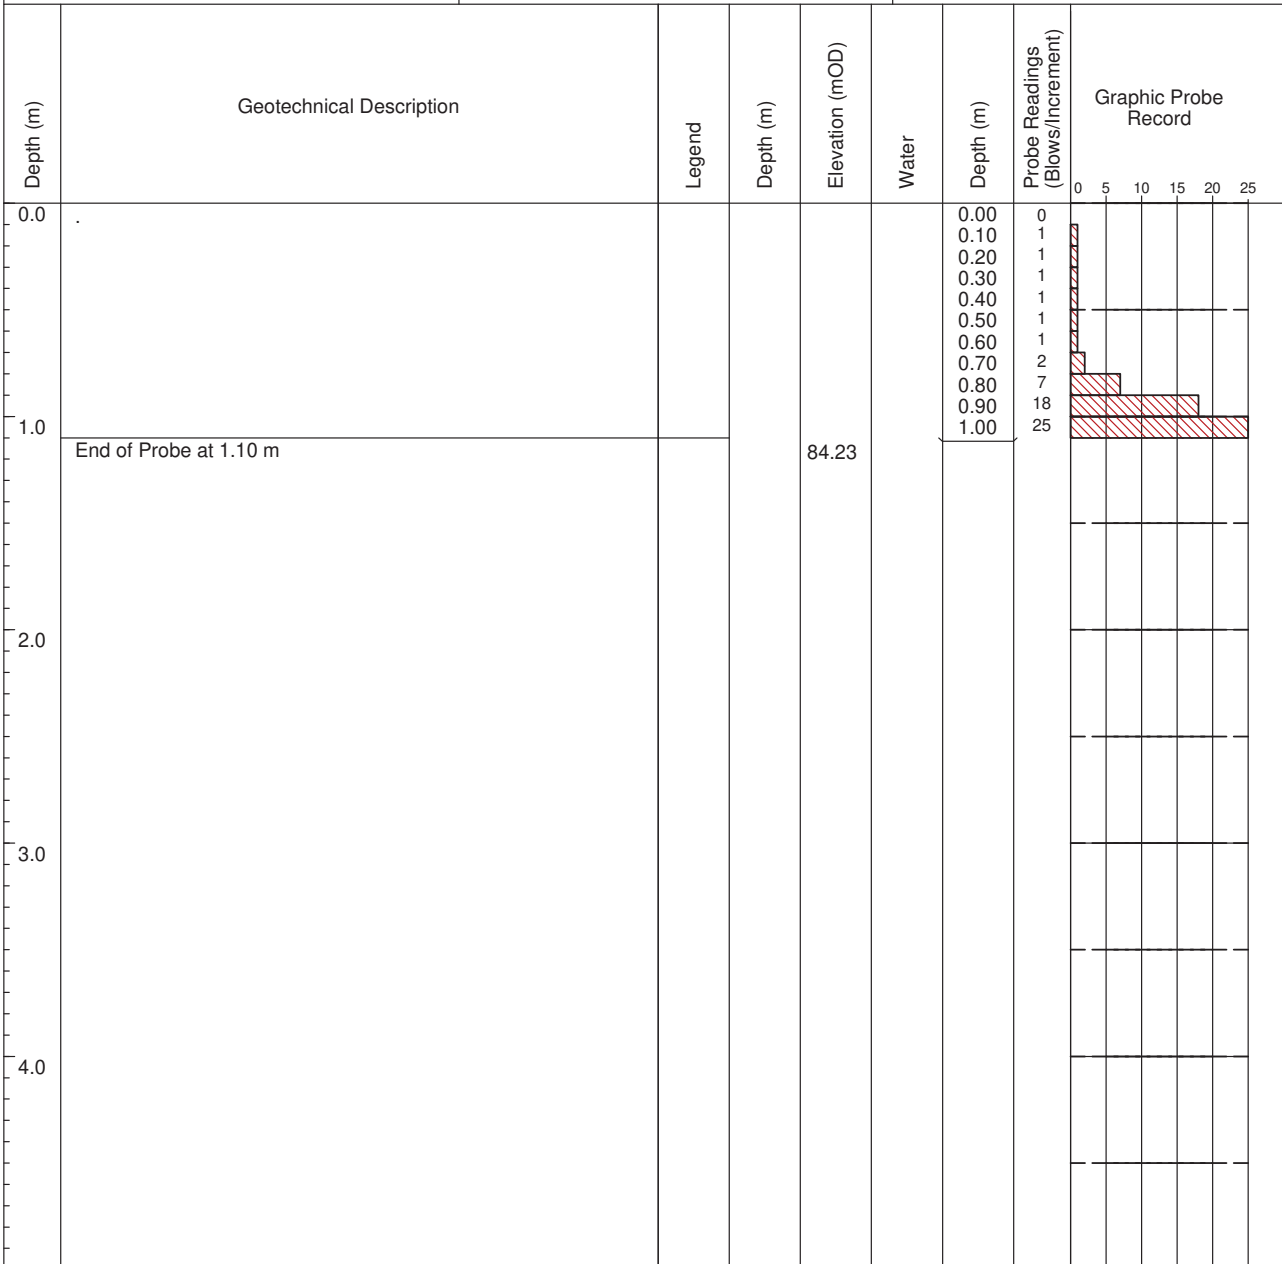
CLIENT
ENGINEER DOBA

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

FALL HEIGHT (mm) 500

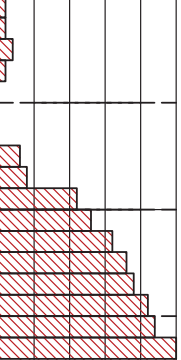
PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP40 SHEET Sheet 1 of 1		
CO-ORDINATES 686,405.91 E 719,704.42 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 83.51			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 1.70 m			81.81		0.00	1	
						0.10	1	
						0.20	2	
						0.30	1	
						0.40	0	
						0.50	0	
						0.60	0	
						0.70	3	
						0.80	4	
						0.90	11	
						1.00	13	
						1.10	16	
						1.20	18	
						1.30	19	
						1.40	21	
						1.50	22	
						1.60	25	
1.0								
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP41 SHEET Sheet 1 of 1		
CO-ORDINATES 686,583.47 E 719,752.70 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 83.73			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record					
								0	5	10	15	20	25
0.0						0.00	0						
0.10						0							
0.20						0							
0.30						0							
0.40						1							
0.50						1							
0.60						1							
0.70						2							
0.80						3							
0.90						5							
1.00						15							
1.10						12							
1.20						19							
1.30						18							
1.40						13							
1.50						5							
1.60						1							
1.70						11							
1.80						13							
1.90						13							
2.00	10												
2.10	11												
2.20	11												
2.30	9												
2.40	7												
2.50	9												
2.60	10												
2.70	22												
2.80	25												
3.0	End of Probe at 2.90 m			80.83									
4.0													

GROUNDWATER OBSERVATIONS

REMARKS

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP42

SHEET Sheet 1 of 1

CO-ORDINATES 686,612.89 E
719,835.08 N

GROUND LEVEL (mOD) 82.60

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

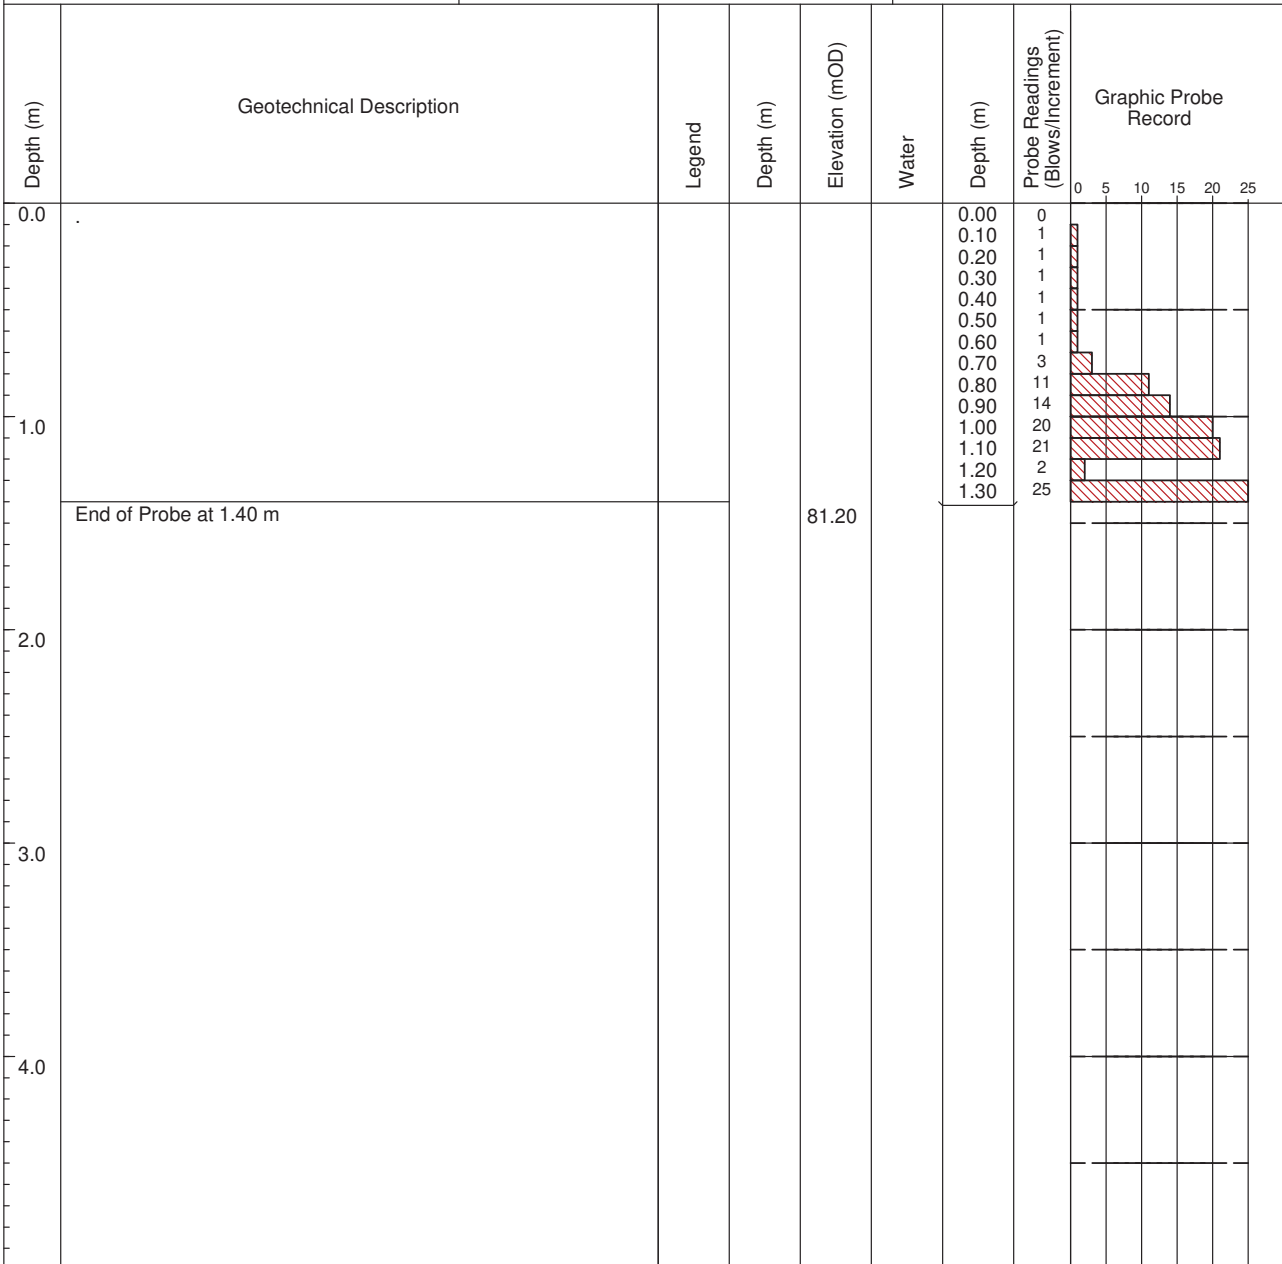
DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

CLIENT
ENGINEER DOBA

FALL HEIGHT (mm) 500

PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP44 SHEET Sheet 1 of 1		
CO-ORDINATES 686,689.29 E 719,801.45 N		HAMMER MASS (kg) 50				DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 80.29		INCREMENT SIZE (mm) 100				DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA		FALL HEIGHT (mm) 500				PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0						0.00	0	
0.10						0		
0.20						0		
0.30						8		
0.40						6		
0.50						6		
0.60						7		
0.70						4		
0.80						6		
0.90						5		
1.00						6		
1.10						6		
1.20						4		
1.30						7		
1.40						6		
1.50						4		
1.60						3		
1.70						4		
1.80						4		
1.90						4		
2.00	5							
2.10	6							
2.20	6							
2.30	6							
2.40	6							
2.50	6							
2.60	5							
2.70	5							
2.80	19							
2.90	19							
3.00	25							
End of Probe at 3.10 m				77.19				
4.0								

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP45

SHEET Sheet 1 of 1

CO-ORDINATES 686,651.20 E
719,711.31 N

DATE COMMENCED 13/10/2022

GROUND LEVEL (mOD) 81.80

DATE COMPLETED 24/10/2022

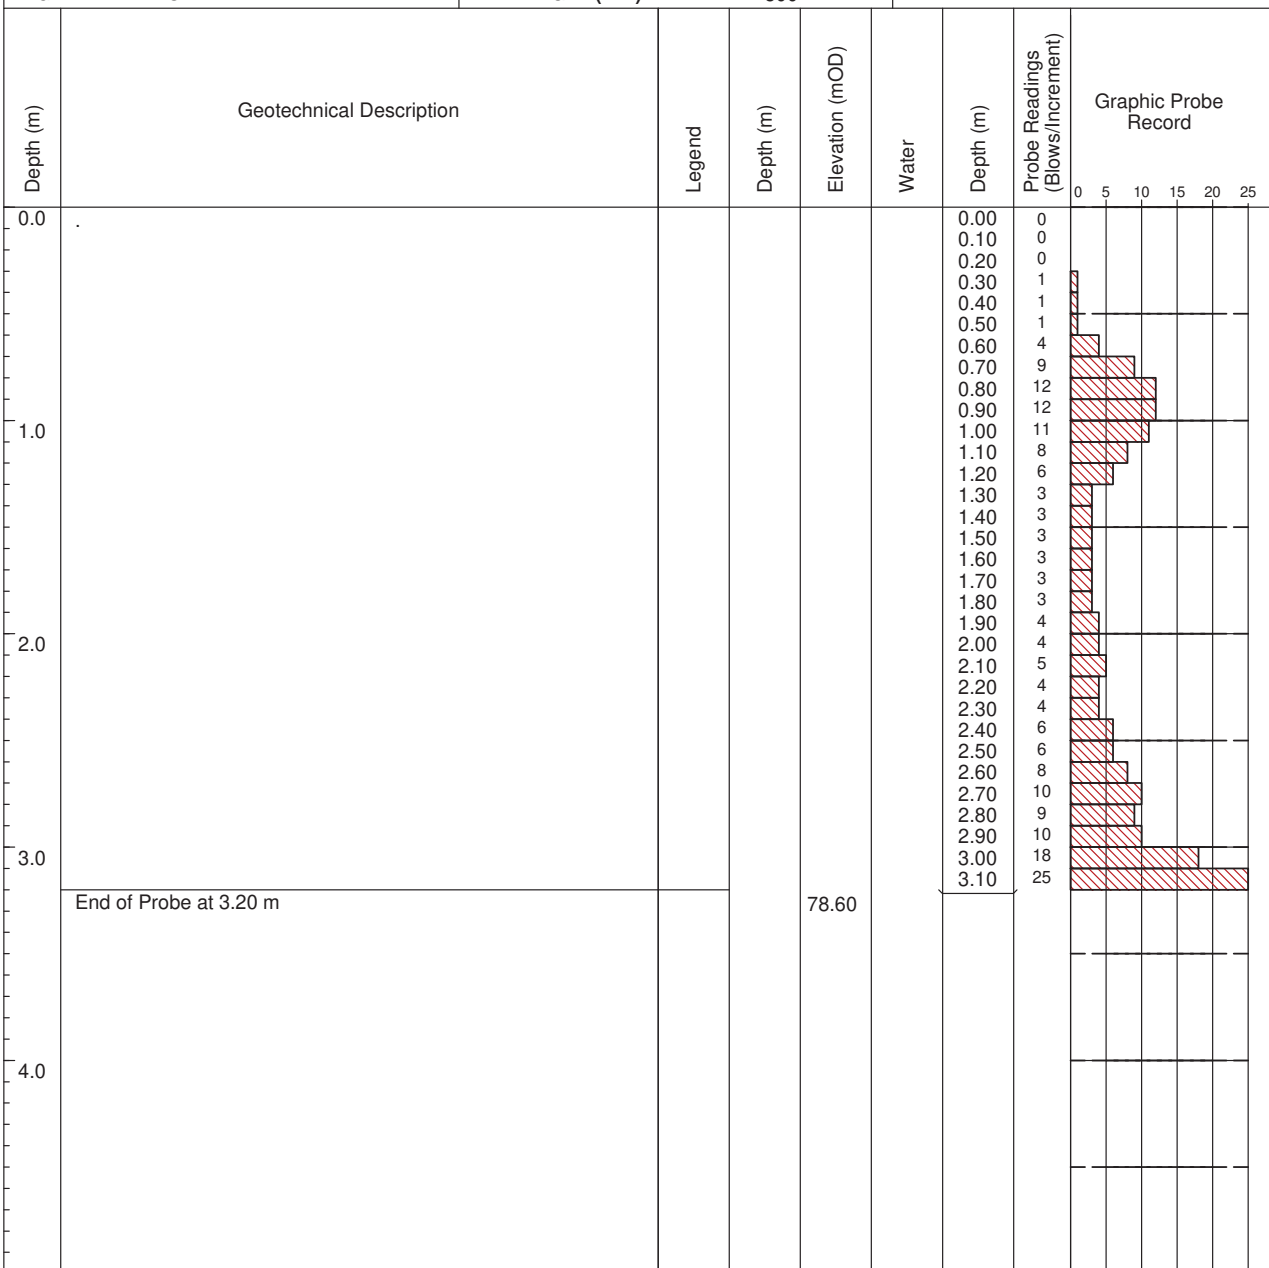
CLIENT
ENGINEER DOBA

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

FALL HEIGHT (mm) 500

PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP47

SHEET Sheet 1 of 1

CO-ORDINATES 686,765.22 E
719,769.16 N

GROUND LEVEL (mOD) 81.09

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

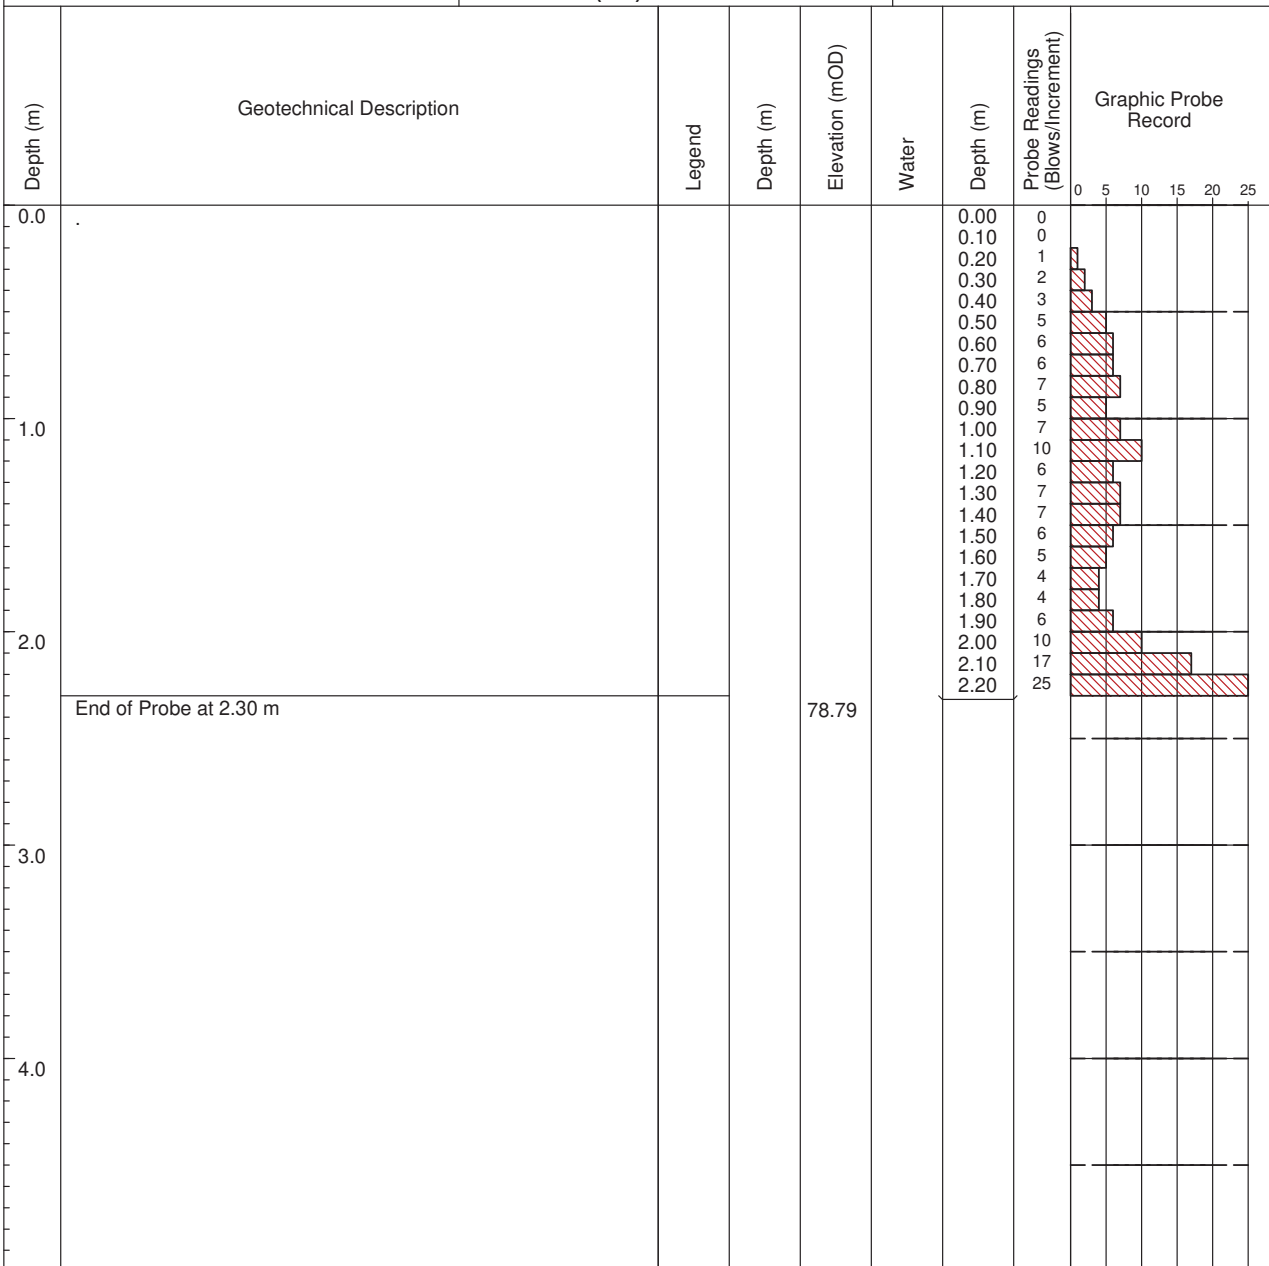
FALL HEIGHT (mm) 500

DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

CLIENT
ENGINEER DOBA

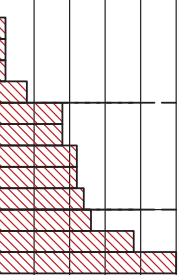
PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP49 SHEET Sheet 1 of 1		
CO-ORDINATES 686,106.77 E 719,990.16 N			HAMMER MASS (kg) 50			DATE COMMENCED 13/10/2022		
GROUND LEVEL (mOD) 83.74			INCREMENT SIZE (mm) 100			DATE COMPLETED 24/10/2022		
CLIENT ENGINEER DOBA			FALL HEIGHT (mm) 500			PROBE TYPE DPH		

Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 1.30 m			82.44		0.00	0	
1.0								
						1.10	19	
						1.20	25	
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS	
REMARKS	

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

		DYNAMIC PROBE RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						PROBE NO. DP51 SHEET Sheet 1 of 1		
CO-ORDINATES 686,092.79 E 719,923.60 N			HAMMER MASS (kg) 50 INCREMENT SIZE (mm) 100 FALL HEIGHT (mm) 500			DATE COMMENCED 13/10/2022 DATE COMPLETED 24/10/2022		
GROUND LEVEL (mOD) 83.59						PROBE TYPE DPH		
CLIENT ENGINEER DOBA								
Depth (m)	Geotechnical Description	Legend	Depth (m)	Elevation (mOD)	Water	Depth (m)	Probe Readings (Blows/Increment)	Graphic Probe Record
0.0	End of Probe at 2.30 m			81.29		0.00	0	
0.10						0		
0.20						0		
0.30						0		
0.40						1		
0.50						0		
0.60						0		
0.70						0		
0.80						1		
0.90						0		
1.00						0		
1.10						0		
1.20						1		
1.30						1		
1.40						5		
1.50						5		
1.60						11		
1.70	9							
1.80	10							
1.90	12							
2.00	10							
2.10	16							
2.20	25							
1.0								
2.0								
3.0								
4.0								

GROUNDWATER OBSERVATIONS

REMARKS

IGSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL_GDT 31/1/23

GSL DP LOG 100MM INCREMENTS 24330.GPJ IGSL.GDT 31/1/23



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP54

SHEET Sheet 1 of 1

CO-ORDINATES 686,072.66 E
719,843.36 N

DATE COMMENCED 13/10/2022

GROUND LEVEL (mOD) 82.74

DATE COMPLETED 24/10/2022

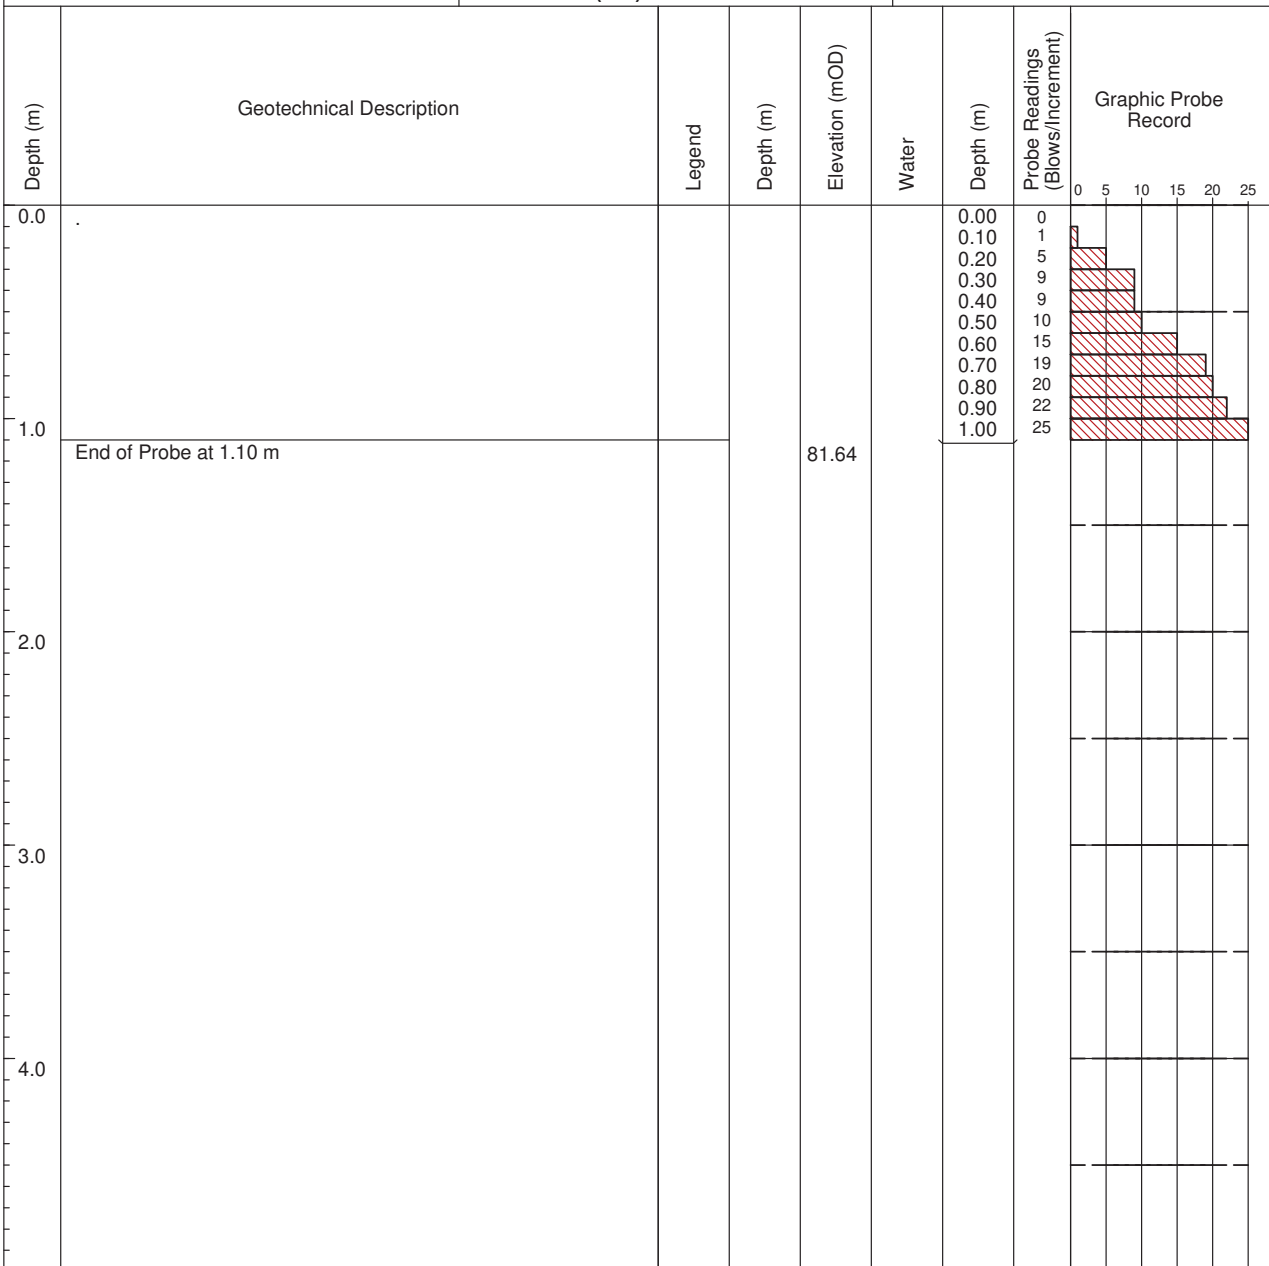
CLIENT
ENGINEER DOBA

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

FALL HEIGHT (mm) 500

PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS



DYNAMIC PROBE RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

PROBE NO. DP55

SHEET Sheet 1 of 1

CO-ORDINATES 686,165.55 E
719,844.59 N

GROUND LEVEL (mOD) 83.28

HAMMER MASS (kg) 50

INCREMENT SIZE (mm) 100

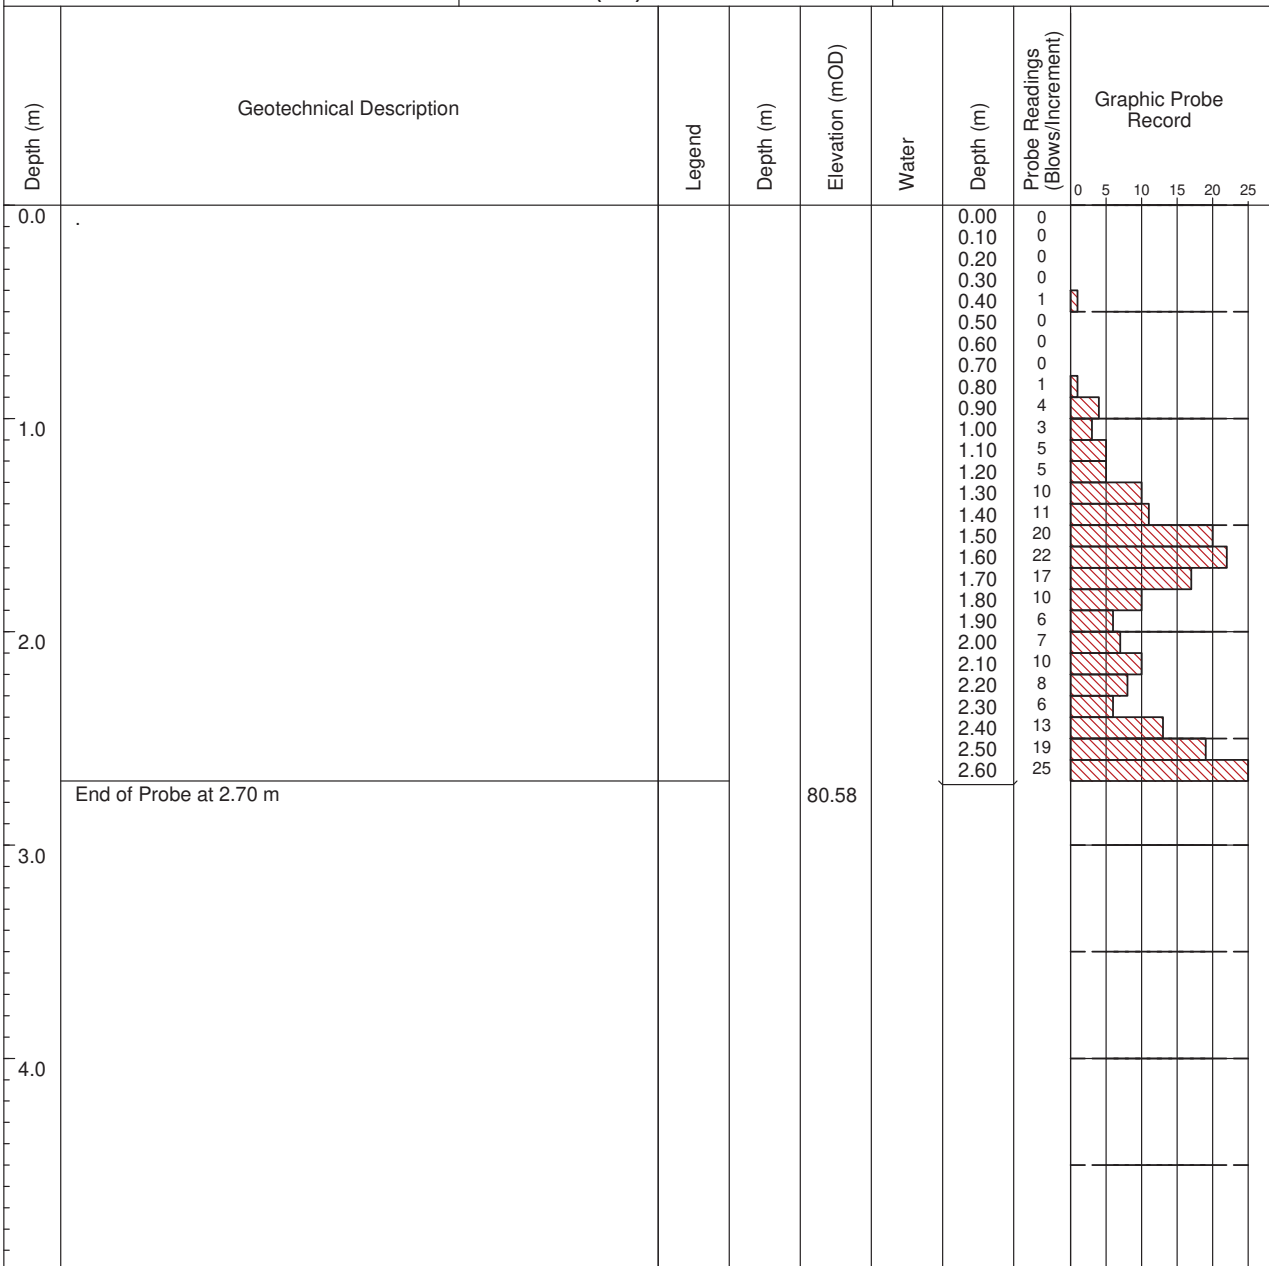
DATE COMMENCED 13/10/2022

DATE COMPLETED 24/10/2022

CLIENT
ENGINEER DOBA

FALL HEIGHT (mm) 500

PROBE TYPE DPH



GROUNDWATER OBSERVATIONS

REMARKS

Appendix 4**Plate Bearing Test Records and Photographs**

Plate Bearing Test Location	Easting	Northing	Ground Elevation (m OD)
PB01	686026.191	719628.483	77.374
PB02	686136.534	719561.308	78.464
PB03	686256.743	719477.368	77.388
PB04	686382.137	719393.367	77.658
PB05	686492.325	719325.948	77.892
PB06	686083.424	719690.995	80.212
PB07	686195.383	719648.688	80.35
PB08	686321.511	719577.541	80.422
PB09	686449.717	719504.272	79.958
PB10	686560.525	719440.269	79.465
PB11	686111.564	719816.693	82.453
PB12	686257.433	719770.027	82.442
PB13	686376.995	719691.499	82.736
PB14	686508.037	719616.149	82.784
PB15	686669.886	719527.151	82.074
PB16	686223.894	719890.232	84.622
PB17	686250.619	719960.215	85.033
PB18	686538.545	719817.48	84.393
PB19	686382.704	719872.799	85.448
PB20	686620.439	719708.606	82.783
PB21	686739.46	719661.977	80.75
PB22	686775.685	719756.63	81.147
PB23	686604.429	719849.736	82.676

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139820	Description of soil under test (natural soil, placed fill, sub-base) Light brownish grey gravelly silty SAND.	
Contract	24330 Halverstown		
Test No.	PBT01 (Load)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.60		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	18/10/2022		

Pressure / Settlement

Settlement (mm)	Pressure (kN/m²) - Upper Curve	Pressure (kN/m²) - Lower Curve
0.00	0	0
-1.00	10	5
-2.00	20	10
-3.00	35	15
-4.00	55	20
-5.00	80	25
-6.00	115	30

Gradient at 1.25 mm settlement intersection = 11		
Modulus of subgrade reaction = 7 MPa/m	Equivalent CBR value in accordance with NRA HD25-26/10	0.3 %
Correction factor applied = 0.64 as per HD 25-26/10		

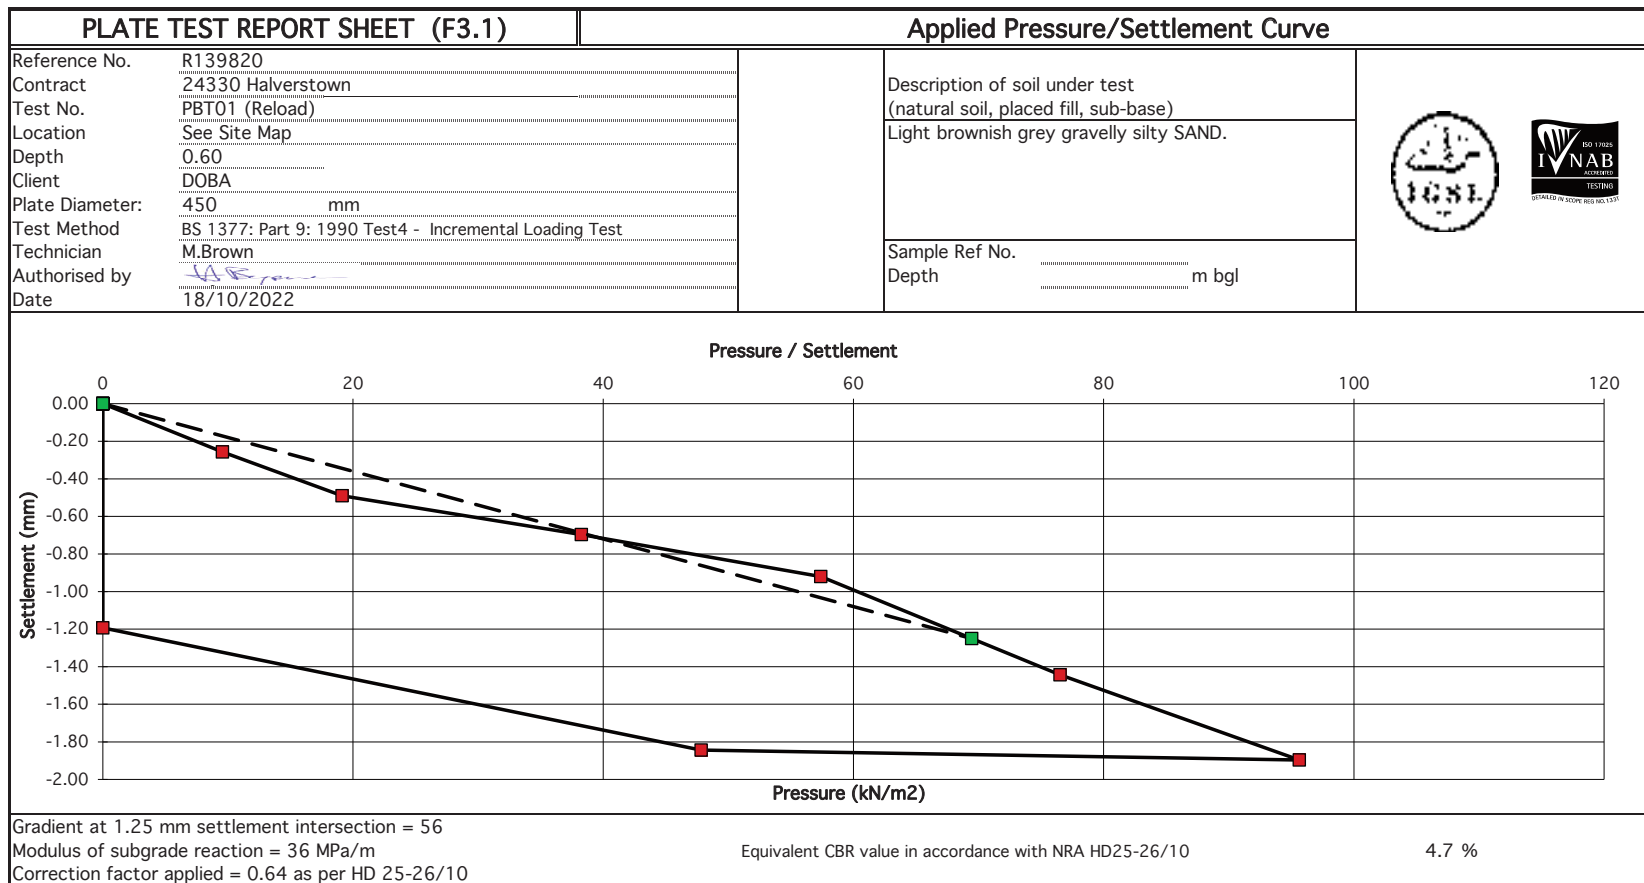
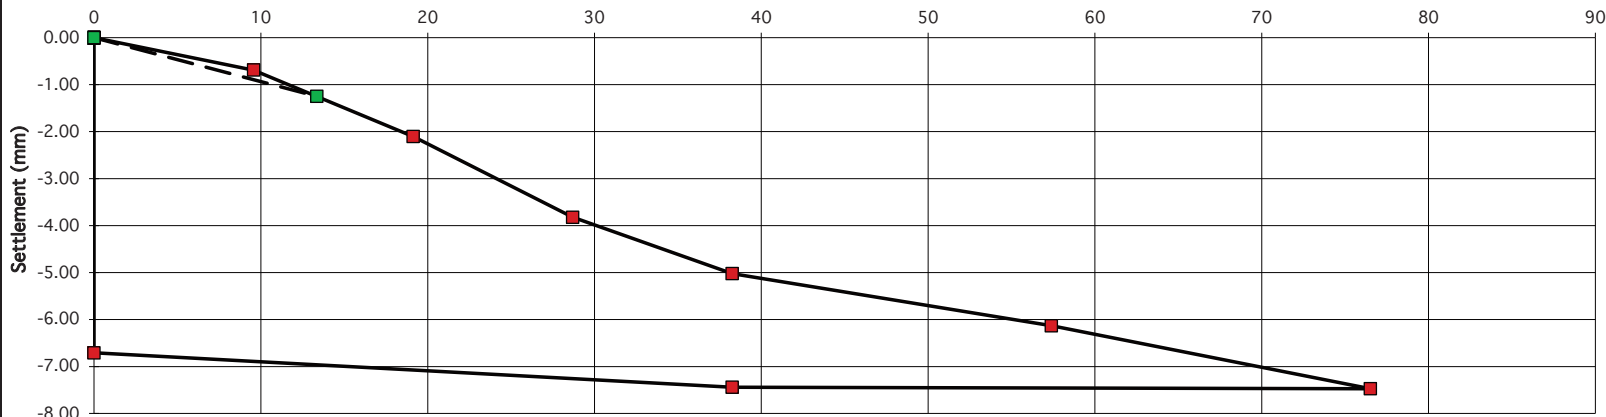


PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139821		Description of soil under test (natural soil, placed fill, sub-base)
Contract	24330 Halverstown		Grey mottled orange gravelly silty SAND
Test No.	PBT02(Load)		 
Location	See Site Map		
Depth	0.60		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____	
Authorised by		Depth _____ m bgl	
Date	19/10/2022		

Pressure / Settlement



Pressure (kN/m ²)	Settlement (mm) - Upper Series	Settlement (mm) - Lower Series
0	0.00	-6.75
10	-0.75	-6.85
20	-2.10	-7.00
30	-3.85	-7.20
40	-5.10	-7.30
60	-6.20	-7.35
85	-7.35	-7.35

Gradient at 1.25 mm settlement intersection = 11 Modulus of subgrade reaction = 7 MPa/m Correction factor applied = 0.64 as per HD 25-26/10	Equivalent CBR value in accordance with NRA HD25-26/10	0.3 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139821	Description of soil under test (natural soil, placed fill, sub-base) Grey mottled orange gravelly silty SAND	
Contract	24330 Halverstown		
Test No.	PBT02 (Reload)		
Location	See Site Map		
Depth	0.60		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____ Depth _____ m bgl	
Authorised by			
Date	19/10/2022		

Pressure / Settlement

Pressure (kN/m²)

Gradient at 1.25 mm settlement intersection = 21	Equivalent CBR value in accordance with NRA HD25-26/10	0.8 %
Modulus of subgrade reaction = 13 MPa/m		
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139822		Description of soil under test (natural soil, placed fill, sub-base)
Contract	24330 Halverstown		Grey mottled orange silty sandy CLAY.
Test No.	PBT03 (Load)		
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	19/10/2022	Sample Ref No. _____ Depth _____ m bgl	

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Upper Curve	Settlement (mm) - Lower Curve
0	0.00	-4.00
10	-0.50	-4.20
20	-1.20	-4.40
30	-1.80	-4.60
40	-2.50	-4.80
60	-3.50	-4.90
80	-4.20	-4.95
100	-4.80	-5.00
120	-5.20	-5.00

Gradient at 1.25 mm settlement intersection = 17

Modulus of subgrade reaction = 11 MPa/m

Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10

0.6 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139822	Description of soil under test (natural soil, placed fill, sub-base) Grey mottled orange silty sandy CLAY.	
Contract	24330 Halverstown		
Test No.	PBT03 (Reload)		
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____ Depth _____ m bgl	
Authorised by			
Date	19/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Dashed Line	Settlement (mm) - Solid Line 1	Settlement (mm) - Solid Line 2
0	0.00	0.00	-2.80
20	-0.50	-0.50	-3.00
40	-0.80	-0.80	-3.30
55	-	-1.30	-3.50
80	-	-2.80	-3.50
110	-	-3.50	-3.50

Gradient at 1.25 mm settlement intersection = 44
 Modulus of subgrade reaction = 29 MPa/m
 Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10

3.2 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139823	Description of soil under test (natural soil, placed fill, sub-base)	
Contract	24330 Halverstown		
Test No.	PBT04 (Load)	Grey gravelly silty CLAY with medium cobbles.	
Location	See Site Map		
Depth	0.40	Sample Ref No. _____	Depth _____ m bgl
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	04/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Upper Curve	Settlement (mm) - Lower Curve
0	0.00	-7.00
10	-1.00	-7.20
20	-2.50	-7.40
30	-4.00	-7.60
40	-5.00	-7.70
50	-5.50	-7.75
60	-6.00	-7.80
70	-6.50	-7.85
80	-7.00	-7.90
90	-7.50	-7.95
100	-8.00	-8.00

Gradient at 1.25 mm settlement intersection = 5		
Modulus of subgrade reaction = 3 MPa/m	Equivalent CBR value in accordance with NRA HD25-26/10	0.1 %
Correction factor applied = 0.64 as per HD 25-26/10		

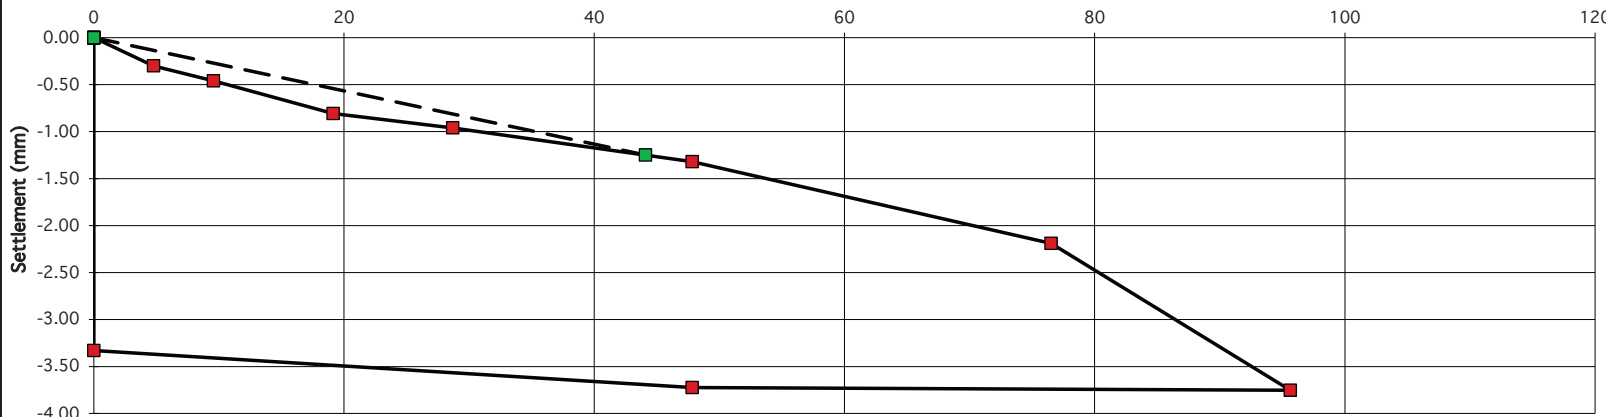
PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139823		Description of soil under test (natural soil, placed fill, sub-base) Grey gravelly silty CLAY with medium cobbles.
Contract	24330 Halverstown		
Test No.	PBT04 (Reload)	Sample Ref No. _____	Depth _____ m bgl
Location	See Site Map		
Depth	0.40	 	
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	04/10/2022		
Pressure / Settlement  Gradient at 1.25 mm settlement intersection = 35 Modulus of subgrade reaction = 23 MPa/m Correction factor applied = 0.64 as per HD 25-26/10 Equivalent CBR value in accordance with NRA HD25-26/10 2.2 %			

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139824	Description of soil under test (natural soil, placed fill, sub-base) Grey gravelly sandy CLAY	
Contract	24330 Halverstown		
Test No.	PBT05 (Load)		
Location	See Site Map		
Depth	0.40		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____ Depth _____ m bgl	
Authorised by			
Date	03/10/2022		

Pressure / Settlement

Pressure (kN/m2)

Gradient at 1.25 mm settlement intersection = 47	Equivalent CBR value in accordance with NRA HD25-26/10	3.5 %
Modulus of subgrade reaction = 30 MPa/m		
Correction factor applied = 0.64 as per HD 25-26/10		

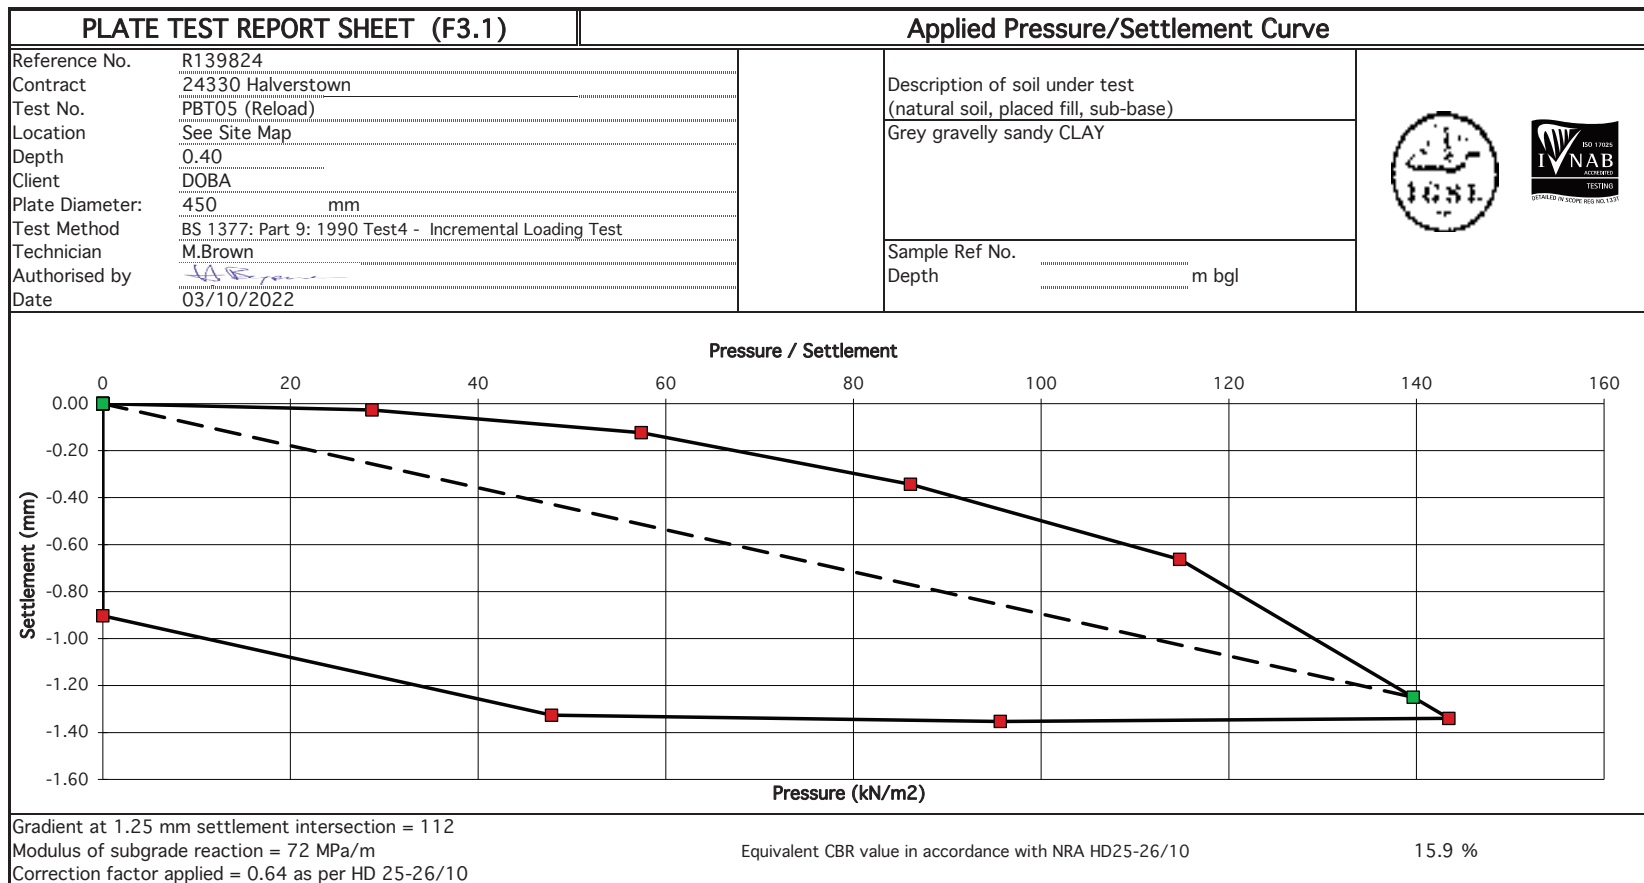
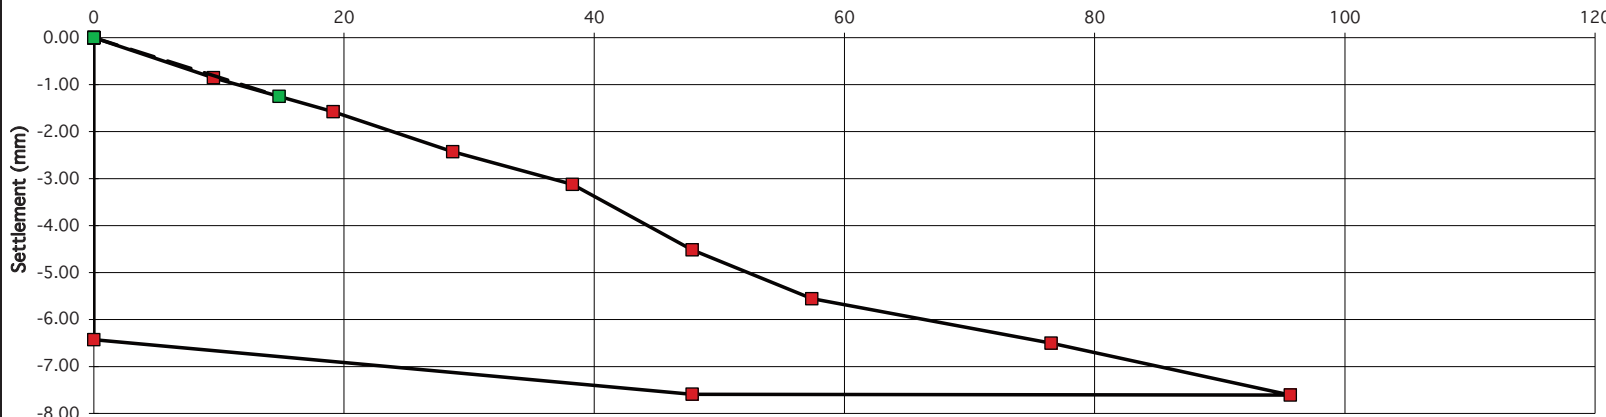


PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139825		Description of soil under test (natural soil, placed fill, sub-base)
Contract	24330 Halverstown		Grey sandy gravelly clayey SILT.
Test No.	PBT06 (Load)		 
Location	See Site Map		
Depth	0.40		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____	
Authorised by		Depth _____ m bgl	
Date	18/10/2022		

Pressure / Settlement



Pressure (kN/m ²)	Settlement (mm) - Upper Curve	Settlement (mm) - Lower Curve
0	0.00	-6.50
10	-1.00	
20	-1.50	
30	-2.50	
40	-3.20	-7.50
50	-4.50	
60	-5.50	
80	-6.50	
100	-7.50	-7.80

Gradient at 1.25 mm settlement intersection = 12

Modulus of subgrade reaction = 8 MPa/m

Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10

0.3 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139825	Description of soil under test (natural soil, placed fill, sub-base) Grey sandy gravelly clayey SILT.	
Contract	24330 Halverstown		
Test No.	PBT06 (Reload)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.40		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	18/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Solid Line	Settlement (mm) - Dashed Line
0	0.00	0.00
20	-0.50	-0.40
40	-0.80	-0.70
60	-1.20	-1.10
80	-2.00	-1.80
100	-3.50	-
120	-4.50	-

Gradient at 1.25 mm settlement intersection = 49	Equivalent CBR value in accordance with NRA HD25-26/10	3.8 %
Modulus of subgrade reaction = 31 MPa/m		
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139826	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy gravelly SILT.	
Contract	24330 Halverstown		
Test No.	PBT07 (Load)		
Location	See Site Map		
Depth	0.60		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____	Depth _____ m bgl
Authorised by			
Date	18/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2
0	0.00	-4.00
20	-1.25	-4.50
40	-2.50	-5.00
60	-3.75	-5.50
80	-5.00	-5.50
100	-6.25	-5.50
120	-7.50	-5.50

Gradient at 1.25 mm settlement intersection = 16 Modulus of subgrade reaction = 10 MPa/m Correction factor applied = 0.64 as per HD 25-26/10	Equivalent CBR value in accordance with NRA HD25-26/10	0.5 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139826	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy gravelly SILT.	
Contract	24330 Halverstown		
Test No.	PBT07 (Reload)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.60		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	18/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Solid Line	Settlement (mm) - Dashed Line
0	0.00	0.00
20	-0.8	-0.8
35	-1.3	-1.3
40	-1.4	-1.4
60	-1.8	
80	-2.4	
100	-3.5	
120	-4.6	

Gradient at 1.25 mm settlement intersection = 28 Modulus of subgrade reaction = 18 MPa/m Correction factor applied = 0.64 as per HD 25-26/10	Equivalent CBR value in accordance with NRA HD25-26/10	1.5 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139827	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy slightly gravelly silty CLAY.	
Contract	24330 Halverstown		
Test No.	PBT08 (Load)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	18/10/2022		

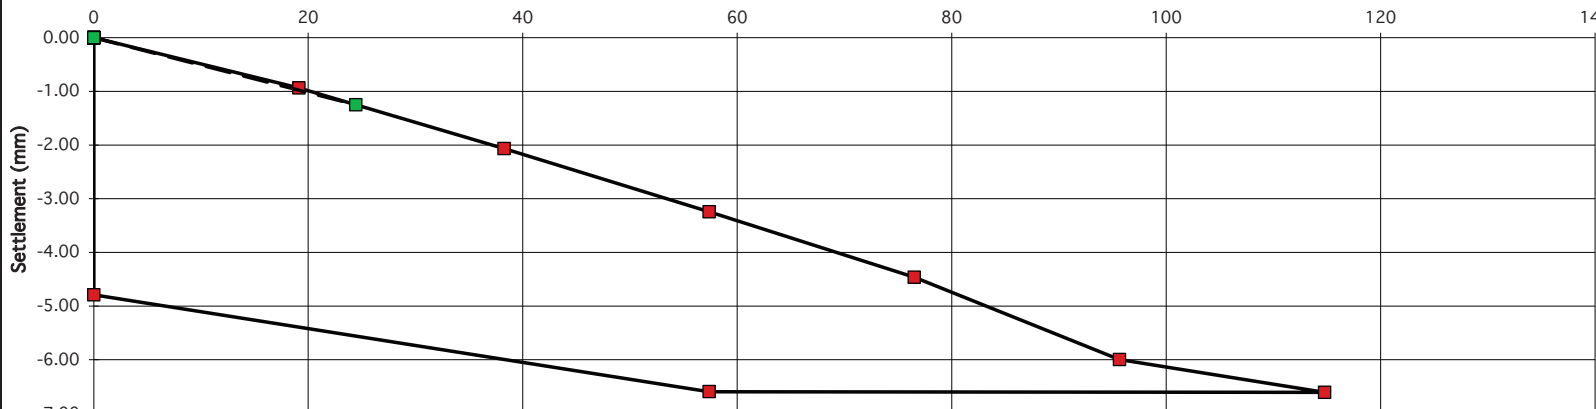
Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2
0	0.00	-6.00
10	-1.25	-6.50
20	-2.50	-7.00
30	-3.75	-7.50
40	-5.00	-8.00
60	-6.50	-8.00
80	-8.00	-8.00

Gradient at 1.25 mm settlement intersection = 8 Modulus of subgrade reaction = 5 MPa/m Correction factor applied = 0.64 as per HD 25-26/10	Equivalent CBR value in accordance with NRA HD25-26/10	0.2 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139827	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy slightly gravelly silty CLAY.	 
Contract	24330 Halverstown		
Test No.	PBT08 (Reload)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	18/10/2022		

Pressure / Settlement



Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2
0	0.00	-4.75
20	-1.00	-5.25
40	-2.00	-5.75
60	-3.25	-6.50
80	-4.50	-6.75
100	-6.00	-6.75
120	-6.75	-6.75

Gradient at 1.25 mm settlement intersection = 20
 Modulus of subgrade reaction = 13 MPa/m
 Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10 0.8 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve		
Reference No.	R139828	Description of soil under test (natural soil, placed fill, sub-base)	 	
Contract	24330 Halverstown	Grey gravelly sandy SILT		
Test No.	PBT09 (Load)			
Location	See Site Map			
Depth	0.40			
Client	DOBA			
Plate Diameter:	450 mm	Sample Ref No. _____	Depth _____ m bgl	
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test			
Technician	M.Brown			
Authorised by	<i>AS</i>			
Date	06/10/2022			

Pressure / Settlement

Pressure (kN/m²)	Settlement (mm) - Top Curve (Red)	Settlement (mm) - Bottom Curve (Green)
0	0.00	0.00
25	-0.50	-0.50
45	-1.20	-1.20
60	-2.00	-2.00
85	-3.80	-3.80
115	-5.20	-5.20
150	-6.50	-6.50

Gradient at 1.25 mm settlement intersection = 34	Equivalent CBR value in accordance with NRA HD25-26/10	2.0 %
Modulus of subgrade reaction = 22 MPa/m		
Correction factor applied = 0.64 as per HD 25-26/10		

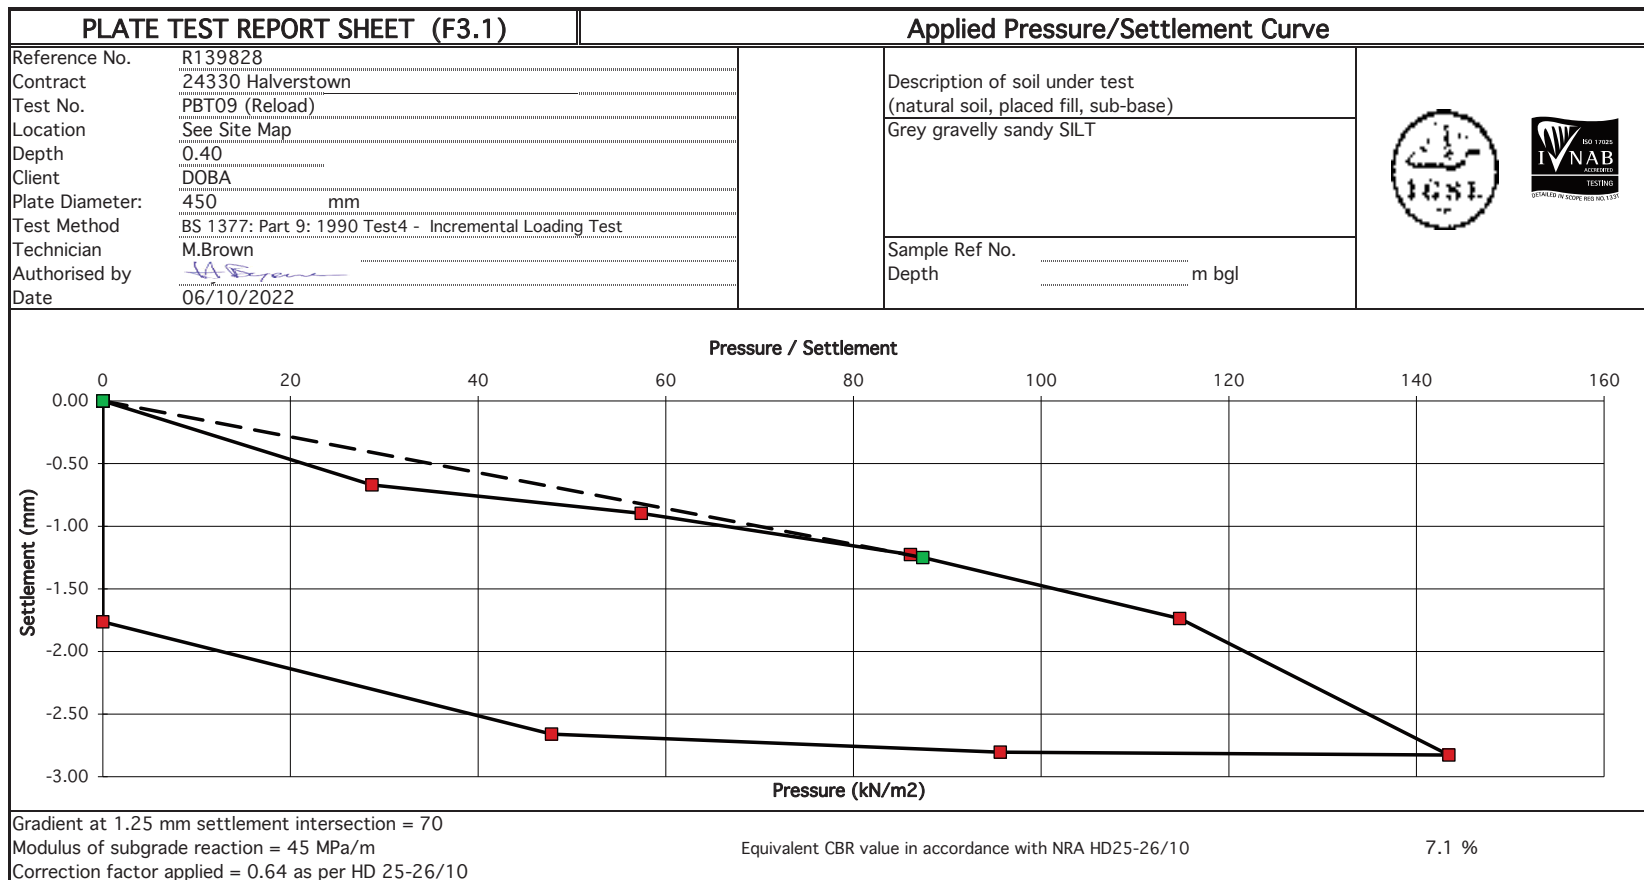


PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve		
Reference No.	R139829	Description of soil under test (natural soil, placed fill, sub-base)	 	
Contract	24330 Halverstown	Grey gravelly sandy SILT		
Test No.	PBT10 (Load)			
Location	See Site Map			
Depth	0.50			
Client	DOBA			
Plate Diameter:	450 mm	Sample Ref No. _____	Depth _____ m bgl	
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test			
Technician	M.Brown			
Authorised by	<i>AS</i>			
Date	06/10/2022			

Pressure / Settlement

Pressure (kN/m²)

Gradient at 1.25 mm settlement intersection = 40	Equivalent CBR value in accordance with NRA HD25-26/10	2.7 %
Modulus of subgrade reaction = 26 MPa/m		
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139829		Description of soil under test (natural soil, placed fill, sub-base)
Contract	24330 Halverstown		Grey gravelly sandy SILT
Test No.	PBT10 (Reload)		
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by	<i>AS</i>		
Date	06/10/2022		
		Sample Ref No. _____	Depth _____ m bgl

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Dashed Line	Settlement (mm) - Solid Line
0	0.00	-1.25
20	-0.50	-1.75
40	-1.00	-2.25
60	-1.20	-2.50
80	-1.50	-2.70
100	-2.00	-2.90
120	-2.50	-3.00
140	-3.00	-3.00
160	-3.00	-3.00

Gradient at 1.25 mm settlement intersection = 43

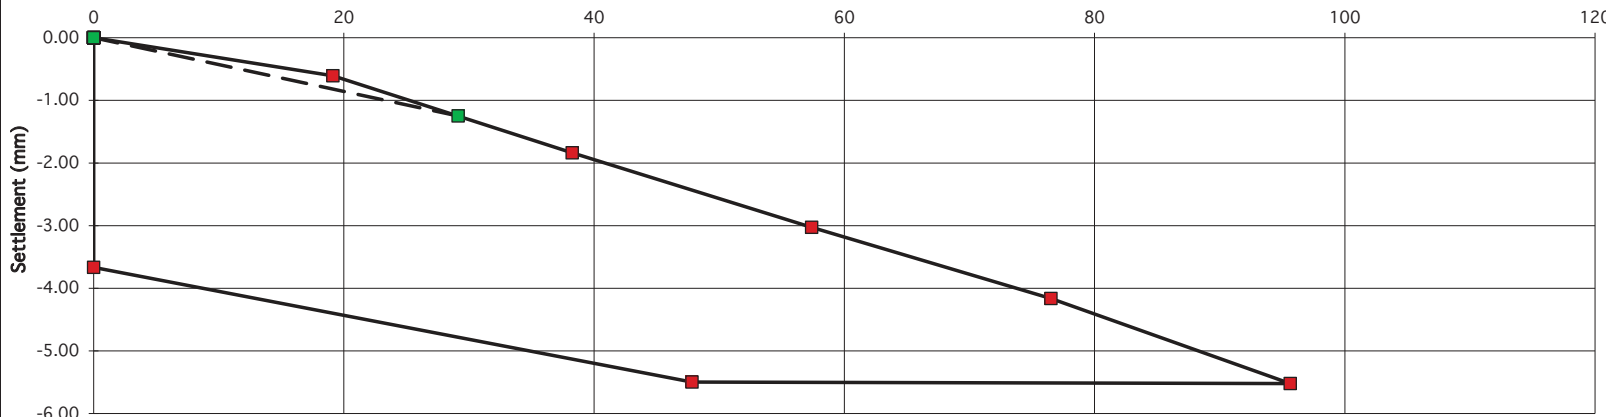
Modulus of subgrade reaction = 28 MPa/m

Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10

3.0 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No. R139830 Contract 24330 Halverstown Test No. PBT11 (Load) Location See Site Map Depth 0.50 Client DOBA Plate Diameter: 450 mm Test Method BS 1377: Part 9: 1990 Test4 - Incremental Loading Test Technician M.Brown Authorised by Date 17/10/2022		Description of soil under test (natural soil, placed fill, sub-base) Brown sandy silty CLAY. Sample Ref No. _____ Depth _____ m bgl	
Pressure / Settlement Pressure (kN/m2)			
Gradient at 1.25 mm settlement intersection = 9 Modulus of subgrade reaction = 6 MPa/m Correction factor applied = 0.64 as per HD 25-26/10			
		Equivalent CBR value in accordance with NRA HD25-26/10	0.2 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve																												
Reference No. R139830 Contract 24330 Halverstown Test No. PBT11 (Reload) Location See Site Map Depth 0.50 Client DOBA Plate Diameter: 450 mm Test Method BS 1377: Part 9: 1990 Test4 - Incremental Loading Test Technician M.Brown Authorised by  Date 17/10/2022		Description of soil under test (natural soil, placed fill, sub-base) Brown sandy silty CLAY. Sample Ref No. _____ Depth _____ m bgl	 																											
Pressure / Settlement  <table border="1" style="margin-top: 10px; width: 100%; font-size: small;"> <caption>Data points from Pressure/Settlement Curve</caption> <thead> <tr> <th>Pressure (kN/m²)</th> <th>Settlement (mm) - Series 1</th> <th>Settlement (mm) - Series 2</th> </tr> </thead> <tbody> <tr><td>0</td><td>0.00</td><td>-3.75</td></tr> <tr><td>20</td><td>-0.75</td><td></td></tr> <tr><td>30</td><td>-1.30</td><td></td></tr> <tr><td>40</td><td>-1.90</td><td></td></tr> <tr><td>50</td><td></td><td>-5.40</td></tr> <tr><td>60</td><td>-3.10</td><td></td></tr> <tr><td>80</td><td>-4.20</td><td></td></tr> <tr><td>100</td><td>-5.40</td><td></td></tr> </tbody> </table>				Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2	0	0.00	-3.75	20	-0.75		30	-1.30		40	-1.90		50		-5.40	60	-3.10		80	-4.20		100	-5.40	
Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2																												
0	0.00	-3.75																												
20	-0.75																													
30	-1.30																													
40	-1.90																													
50		-5.40																												
60	-3.10																													
80	-4.20																													
100	-5.40																													
Gradient at 1.25 mm settlement intersection = 23 Modulus of subgrade reaction = 15 MPa/m Correction factor applied = 0.64 as per HD 25-26/10																														
		Equivalent CBR value in accordance with NRA HD25-26/10	1.1 %																											

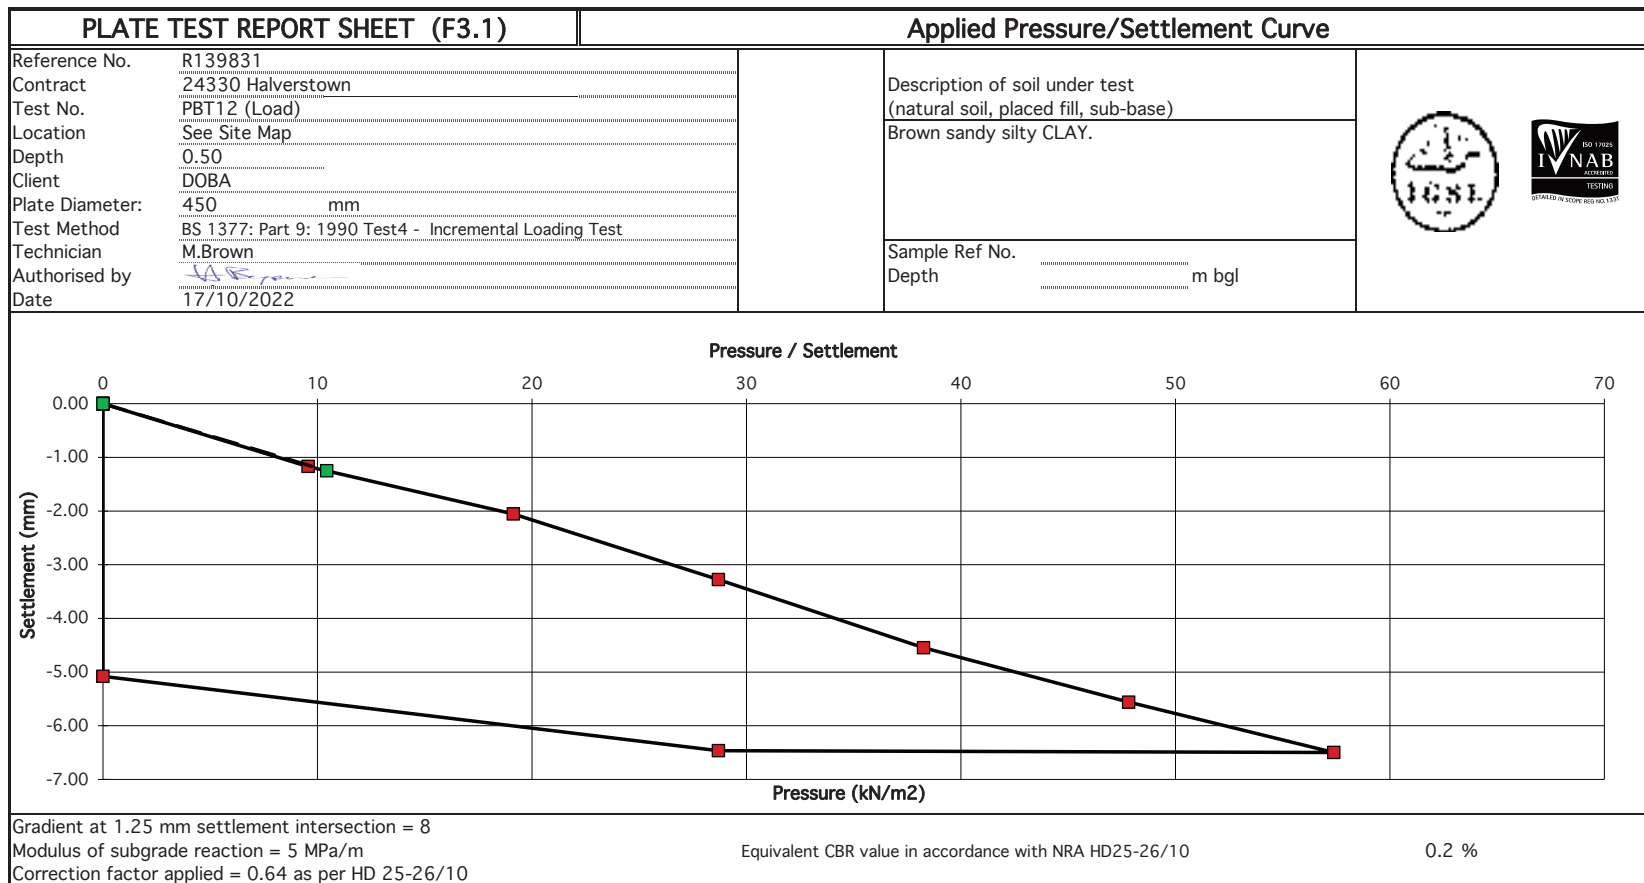
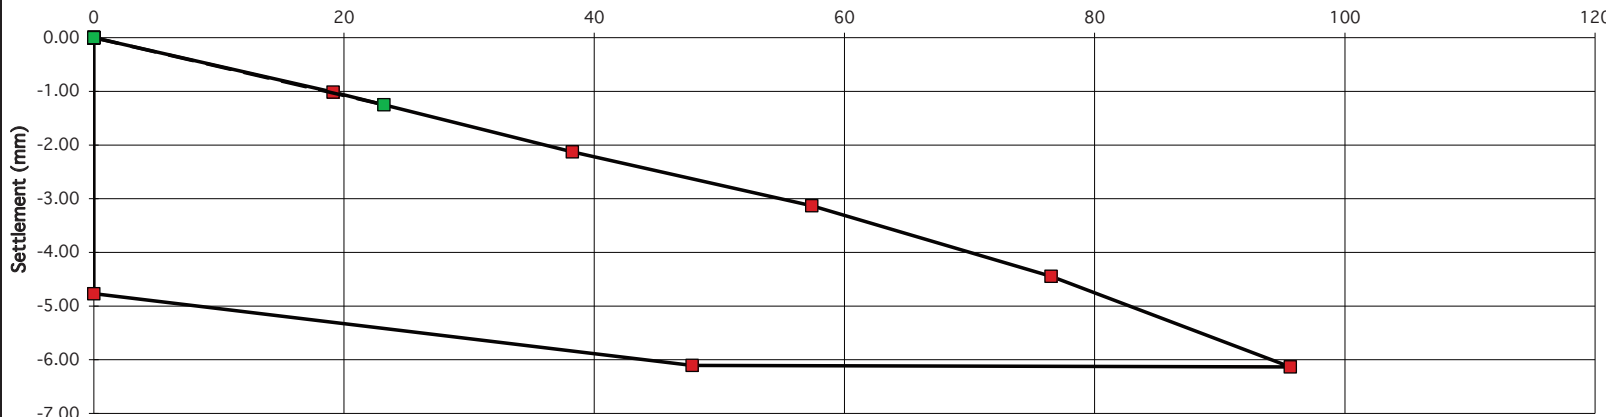


PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139831		Description of soil under test (natural soil, placed fill, sub-base)
Contract	24330 Halverstown		Brown sandy silty CLAY.
Test No.	PBT12 (Reload)		 
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____	
Authorised by		Depth _____ m bgl	
Date	17/10/2022		

Pressure / Settlement



Pressure (kN/m ²)	Settlement (mm) - Top Curve	Settlement (mm) - Bottom Curve
0	0.00	-4.50
20	-1.00	-5.00
40	-2.00	-6.00
60	-3.00	-6.00
80	-4.50	-6.00
100	-6.00	-6.00

Gradient at 1.25 mm settlement intersection = 19	Equivalent CBR value in accordance with NRA HD25-26/10	0.7 %
Modulus of subgrade reaction = 12 MPa/m		
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139832	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy silty CLAY.	
Contract	24330 Halverstown		
Test No.	PBT13 (Load)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	12/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2
0	0.00	-5.00
10	-0.80	-5.20
15	-1.20	-5.40
20	-1.60	-5.60
30	-2.20	-6.00
40	-3.60	-6.00
50	-5.00	-6.00
58	-6.00	-6.00

Gradient at 1.25 mm settlement intersection = 11
 Modulus of subgrade reaction = 7 MPa/m
 Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10

0.3 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139832	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy silty CLAY.	
Contract	24330 Halverstown		
Test No.	PBT13 (Reload)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	12/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Series 1 (0,0)	Settlement (mm) - Series 2 (-4.8)
0	0.00	-4.80
10	-0.80	-5.20
20	-1.50	-5.50
30	-2.20	-5.80
40	-2.80	-6.10
50	-3.30	-6.40
80	-4.80	-6.80
110	-6.50	-6.80

Gradient at 1.25 mm settlement intersection = 12		
Modulus of subgrade reaction = 8 MPa/m	Equivalent CBR value in accordance with NRA HD25-26/10	0.3 %
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139833	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy gravelly CLAY.	
Contract	24330 Halverstown		
Test No.	PBT14 (Load)		
Location	See Site Map		
Depth	0.40		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____	Depth _____ m bgl
Authorised by			
Date	12/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Upper Curve	Settlement (mm) - Lower Curve
0	0.00	-6.00
10	-1.00	-6.50
20	-2.20	-7.00
30	-3.50	-7.50
40	-4.80	-8.00
50	-5.80	-8.00
60	-6.50	-8.00
70	-7.50	-8.00
80	-8.00	-8.00

Gradient at 1.25 mm settlement intersection = 10

Modulus of subgrade reaction = 6 MPa/m

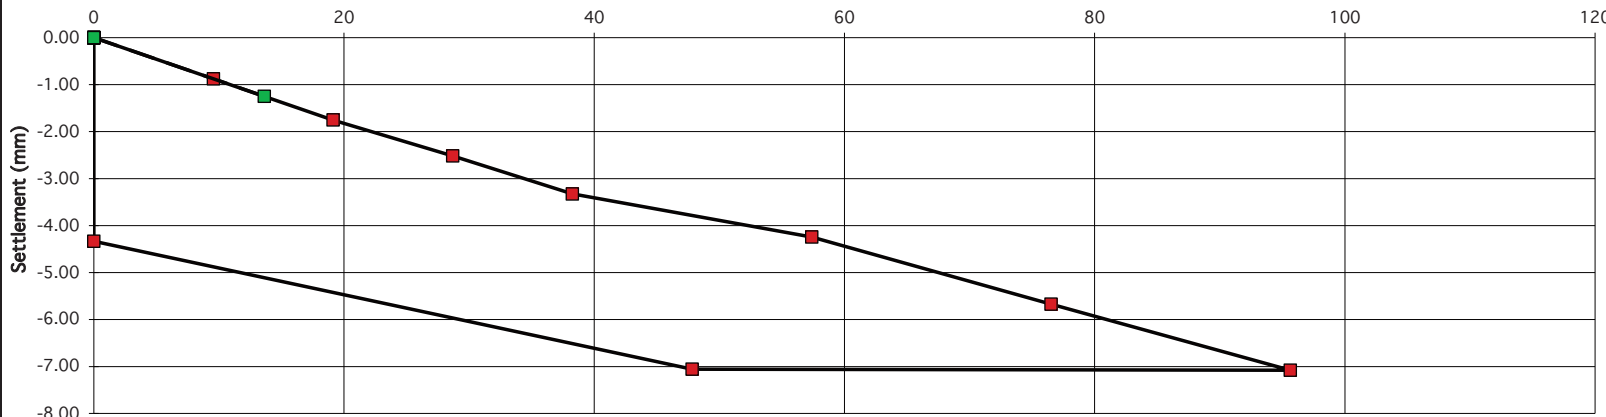
Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10

0.2 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139833		Description of soil under test (natural soil, placed fill, sub-base)
Contract	24330 Halverstown		Brown sandy gravelly CLAY.
Test No.	PBT14 (Reload)		 
Location	See Site Map		
Depth	0.40		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____	
Authorised by		Depth _____ m bgl	
Date	12/10/2022		

Pressure / Settlement



Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2
0	0.00	-4.50
10	-0.80	-5.20
20	-1.60	-5.90
30	-2.40	-6.60
40	-3.20	-7.20
50	-4.00	-7.20
60	-4.80	-7.20
70	-5.60	-7.20
80	-6.40	-7.20
90	-7.20	-7.20
100	-7.20	-7.20

Gradient at 1.25 mm settlement intersection = 11		
Modulus of subgrade reaction = 7 MPa/m	Equivalent CBR value in accordance with NRA HD25-26/10	0.3 %
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139834	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy gravelly CLAY.	
Contract	24330 Halverstown		
Test No.	PBT15 (Load)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	12/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Series 1 (0,0)	Settlement (mm) - Series 2 (-5.5,0)
0	0.00	-5.50
20	-1.25	-6.25
40	-2.50	-7.00
60	-3.75	-7.75
80	-5.00	-8.50
100	-6.25	-9.25
120	-7.50	-10.00

Gradient at 1.25 mm settlement intersection = 17		
Modulus of subgrade reaction = 11 MPa/m	Equivalent CBR value in accordance with NRA HD25-26/10	0.6 %
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139834	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy gravelly CLAY.	
Contract	24330 Halverstown		
Test No.	PBT15 (Reload)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	12/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Top Curve (Green)	Settlement (mm) - Bottom Curve (Red)
0	0.00	-2.50
20	-1.25	-3.25
40	-2.00	-4.00
60	-2.50	-4.50
80	-3.50	-4.50
100	-4.50	-4.50

Gradient at 1.25 mm settlement intersection = 17		
Modulus of subgrade reaction = 11 MPa/m	Equivalent CBR value in accordance with NRA HD25-26/10	0.6 %
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139835	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy gravelly CLAY.	
Contract	24330 Halverstown		
Test No.	PBT116 (Load)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.60		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	17/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Series 1 (0,0)	Settlement (mm) - Series 2 (-5,0)
0	0.00	-5.00
10	-1.25	-5.50
20	-2.50	-6.00
30	-3.75	-6.50
40	-5.00	-6.80
60	-6.25	-7.00
80	-7.50	-7.00

Gradient at 1.25 mm settlement intersection = 9
 Modulus of subgrade reaction = 6 MPa/m
 Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10 0.2 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139835	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy gravelly CLAY.	
Contract	24330 Halverstown		
Test No.	PBT16 (Reload)		
Location	See Site Map		
Depth	0.60		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____	Depth _____ m bgl
Authorised by			
Date	17/10/2022		

Pressure / Settlement

Gradient at 1.25 mm settlement intersection = 17	Equivalent CBR value in accordance with NRA HD25-26/10	0.6 %
Modulus of subgrade reaction = 11 MPa/m		
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139836	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy gravelly silty CLAY.	
Contract	24330 Halverstown		
Test No.	PBT17 (Load)		
Location	See Site Map		
Depth	0.40		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____ Depth _____ m bgl	
Authorised by			
Date	17/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2
0	0.00	-3.00
10	-0.50	-3.30
20	-1.00	-3.60
30	-1.25	-3.90
40	-2.10	-4.20
60	-2.80	-4.35
80	-3.50	-4.40
100	-4.20	-4.40

Gradient at 1.25 mm settlement intersection = 18 Modulus of subgrade reaction = 12 MPa/m Correction factor applied = 0.64 as per HD 25-26/10	Equivalent CBR value in accordance with NRA HD25-26/10	0.7 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139836	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy gravelly silty CLAY.	
Contract	24330 Halverstown		
Test No.	PBT17 (Reload)		
Location	See Site Map		
Depth	0.40		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____ Depth _____ m bgl	
Authorised by			
Date	17/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Curve 1 (Dashed)	Settlement (mm) - Curve 2 (Green Squares)	Settlement (mm) - Curve 3 (Red Squares)
0	0.00	0.00	0.00
20	-0.50	-0.75	-2.10
40	-1.00	-1.10	-3.40
60	-1.25	-1.40	-3.40
80	-1.50	-1.75	-3.40
100	-1.75	-2.40	-3.40
120	-2.00	-3.40	-3.40
140	-2.25	-3.40	-3.40

Gradient at 1.25 mm settlement intersection = 37
 Modulus of subgrade reaction = 24 MPa/m
 Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10

2.4 %

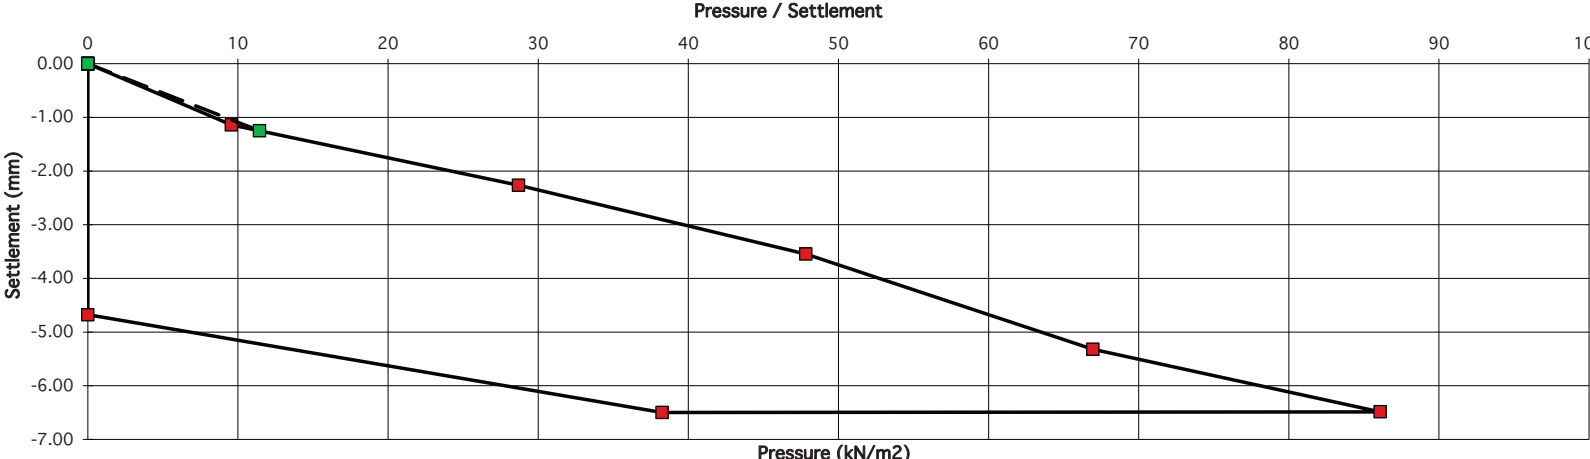
PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139837		Description of soil under test (natural soil, placed fill, sub-base) Brown sandy CLAY.
Contract	24330 Halverstown		
Test No.	PBT18 (Load)	Sample Ref No. _____ Depth _____ m bgl	
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown		
Authorised by			
Date	12/10/2022		
			
Gradient at 1.25 mm settlement intersection = 9 Modulus of subgrade reaction = 6 MPa/m Correction factor applied = 0.64 as per HD 25-26/10			
		Equivalent CBR value in accordance with NRA HD25-26/10 0.2 %	

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139837	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy CLAY.	
Contract	24330 Halverstown		
Test No.	PBT18 (Reload)		
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____	Depth _____ m bgl
Authorised by			
Date	12/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Top Curve	Settlement (mm) - Bottom Curve
0	0.00	-5.50
20	-1.20	-6.00
40	-2.20	-6.50
60	-2.80	-6.80
80	-3.80	-6.80
100	-5.20	-6.80
115	-6.80	-6.80

Gradient at 1.25 mm settlement intersection = 18

Modulus of subgrade reaction = 11 MPa/m

Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10

0.7 %

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139838	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy silty CLAY.	
Contract	24330 Halverstown		
Test No.	PBT19 (Load)		
Location	See Site Map		
Depth	0.60		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____ Depth _____ m bgl	
Authorised by			
Date	12/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2
0	0.00	-5.50
10	-1.00	-6.00
20	-1.50	-6.50
30	-2.00	-7.00
40	-3.00	-7.50
50	-4.50	-7.50
60	-6.00	-7.50
70	-7.50	-7.50
80	-7.50	-7.50
90	-7.50	-7.50
100	-7.50	-7.50
110	-7.50	-7.50
120	-7.50	-7.50

Gradient at 1.25 mm settlement intersection = 11		
Modulus of subgrade reaction = 7 MPa/m	Equivalent CBR value in accordance with NRA HD25-26/10	0.3 %
Correction factor applied = 0.64 as per HD 25-26/10		

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve																									
Reference No.	R139838	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy silty CLAY.																									
Contract	24330 Halverstown																										
Test No.	PBT19 (Reload)																										
Location	See Site Map																										
Depth	0.60																										
Client	DOBA																										
Plate Diameter:	450 mm																										
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test																										
Technician	M.Brown	Sample Ref No. _____	Depth _____ m bgl																								
Authorised by																											
Date	12/10/2022																										
Pressure / Settlement																											
<table border="1" style="margin-top: 10px; width: 100%; border-collapse: collapse;"> <caption>Approximate data points from the graph</caption> <thead> <tr> <th>Pressure (kN/m²)</th> <th>Settlement (mm) - Top Curve</th> <th>Settlement (mm) - Bottom Curve</th> </tr> </thead> <tbody> <tr><td>0</td><td>0.00</td><td>-4.00</td></tr> <tr><td>20</td><td>-1.00</td><td>-4.50</td></tr> <tr><td>40</td><td>-1.80</td><td>-5.00</td></tr> <tr><td>60</td><td>-2.60</td><td>-6.00</td></tr> <tr><td>80</td><td>-3.40</td><td>-6.00</td></tr> <tr><td>100</td><td>-4.80</td><td>-6.00</td></tr> <tr><td>120</td><td>-6.00</td><td>-6.00</td></tr> </tbody> </table>				Pressure (kN/m ²)	Settlement (mm) - Top Curve	Settlement (mm) - Bottom Curve	0	0.00	-4.00	20	-1.00	-4.50	40	-1.80	-5.00	60	-2.60	-6.00	80	-3.40	-6.00	100	-4.80	-6.00	120	-6.00	-6.00
Pressure (kN/m ²)	Settlement (mm) - Top Curve	Settlement (mm) - Bottom Curve																									
0	0.00	-4.00																									
20	-1.00	-4.50																									
40	-1.80	-5.00																									
60	-2.60	-6.00																									
80	-3.40	-6.00																									
100	-4.80	-6.00																									
120	-6.00	-6.00																									
Gradient at 1.25 mm settlement intersection = 20 Modulus of subgrade reaction = 13 MPa/m Correction factor applied = 0.64 as per HD 25-26/10																											
		Equivalent CBR value in accordance with NRA HD25-26/10																									
		0.8 %																									

PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139839	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy CLAY.	
Contract	24330 Halverstown		
Test No.	PBT20 (Load)		
Location	See Site Map		
Depth	0.40		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____	Depth _____ m bgl
Authorised by			
Date	14/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Dashed Line	Settlement (mm) - Solid Line 1	Settlement (mm) - Solid Line 2
0	0.00	0.00	-2.10
20	-0.50	-0.80	-2.50
40	-1.00	-1.40	-3.00
60	-1.50	-1.90	-3.40
80	-2.00	-2.30	-3.40
100	-2.50	-2.70	-3.40
120	-3.00	-3.10	-3.40

Gradient at 1.25 mm settlement intersection = 29
 Modulus of subgrade reaction = 18 MPa/m
 Correction factor applied = 0.64 as per HD 25-26/10

Equivalent CBR value in accordance with NRA HD25-26/10 1.5 %

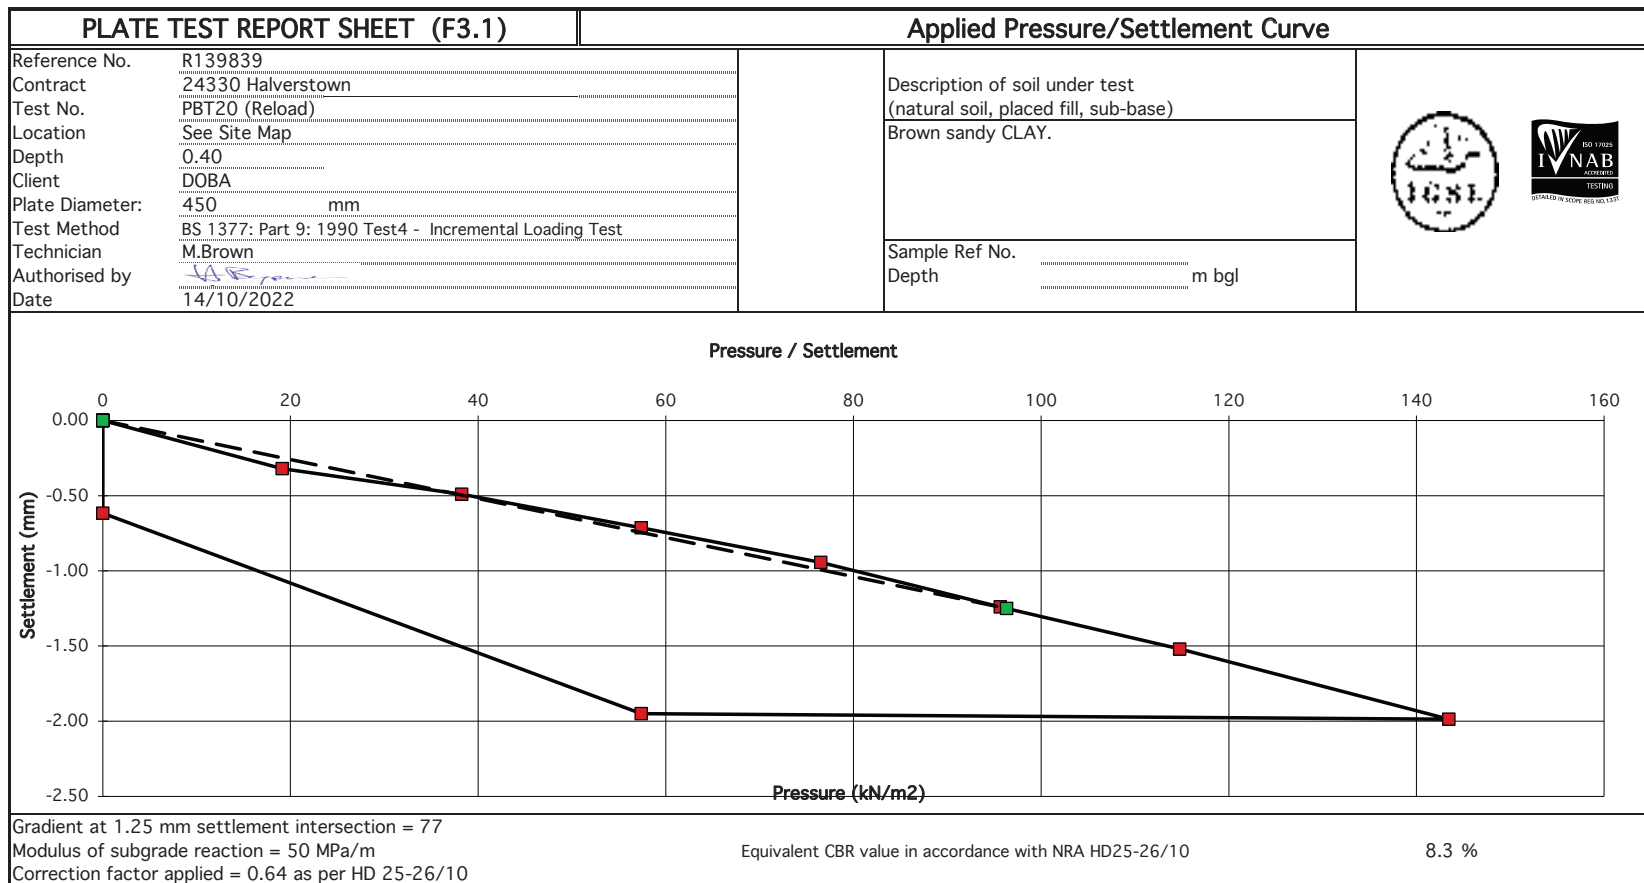
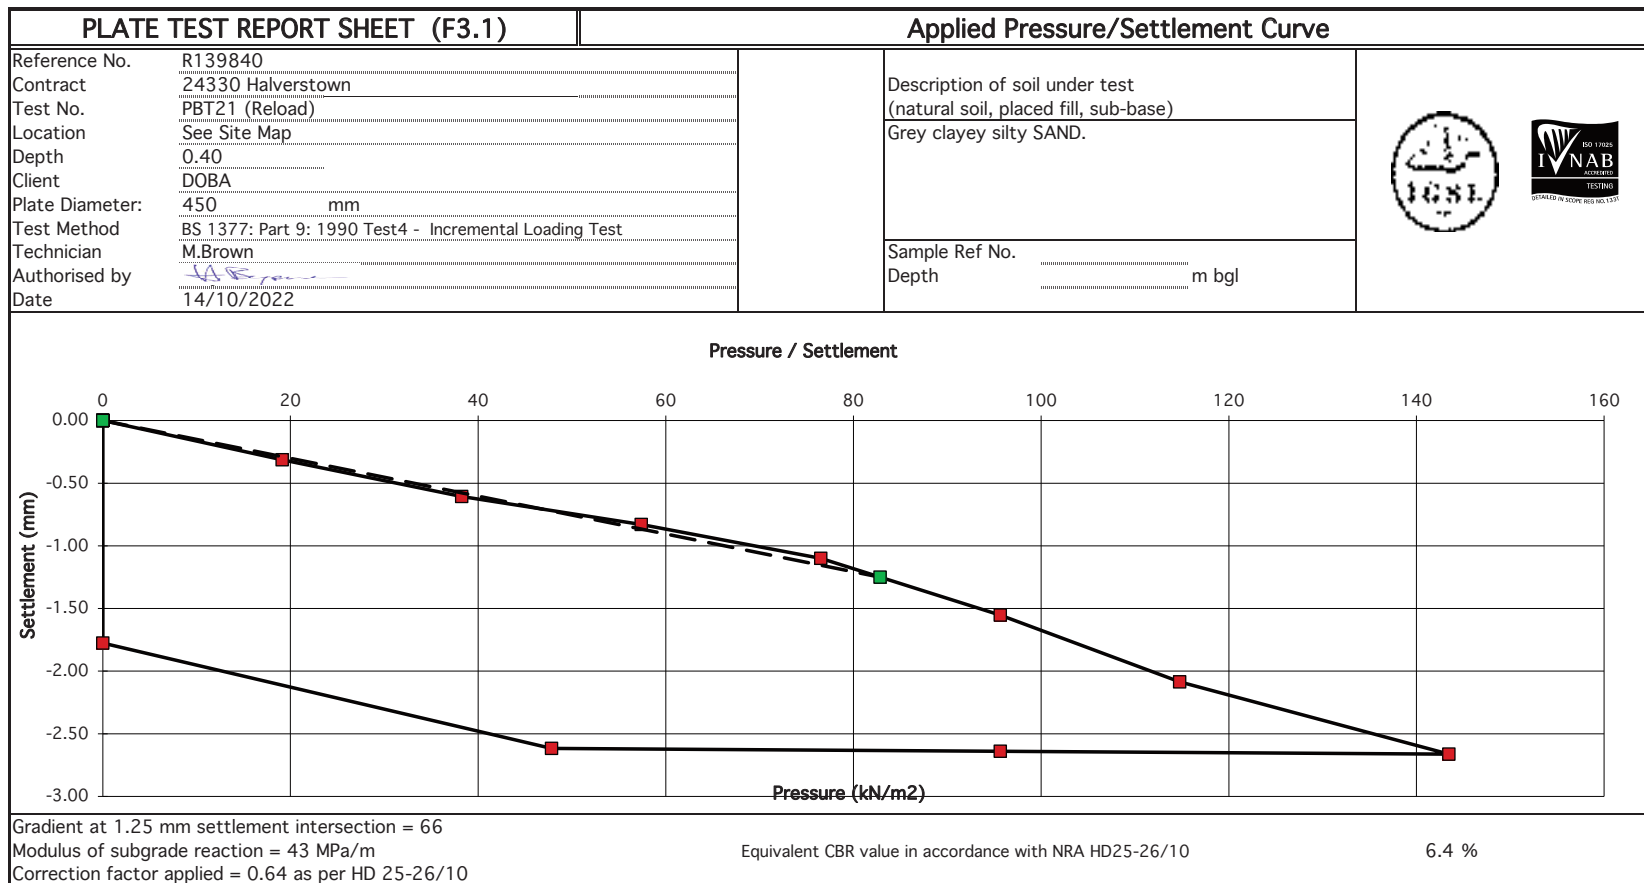
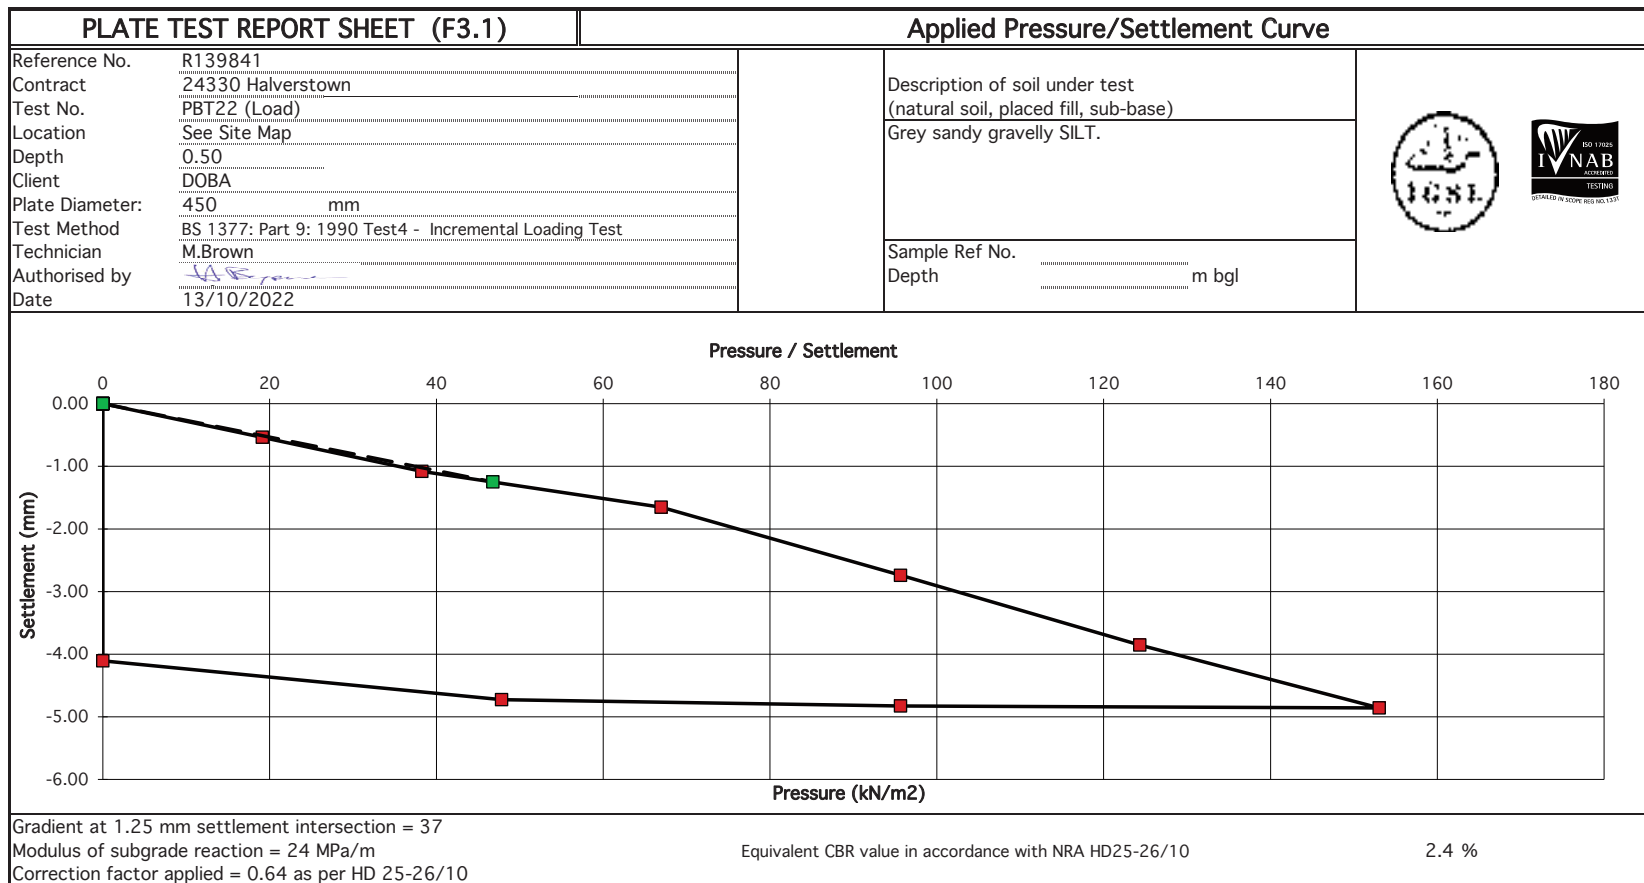


PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139840	Description of soil under test (natural soil, placed fill, sub-base) Grey clayey silty SAND.	
Contract	24330 Halverstown		
Test No.	PBT21 (Load)		
Location	See Site Map		
Depth	0.40		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____ Depth _____ m bgl	
Authorised by			
Date	14/10/2022		
Pressure / Settlement			
Gradient at 1.25 mm settlement intersection = 19 Modulus of subgrade reaction = 12 MPa/m Correction factor applied = 0.64 as per HD 25-26/10			
		Equivalent CBR value in accordance with NRA HD25-26/10 0.7 %	





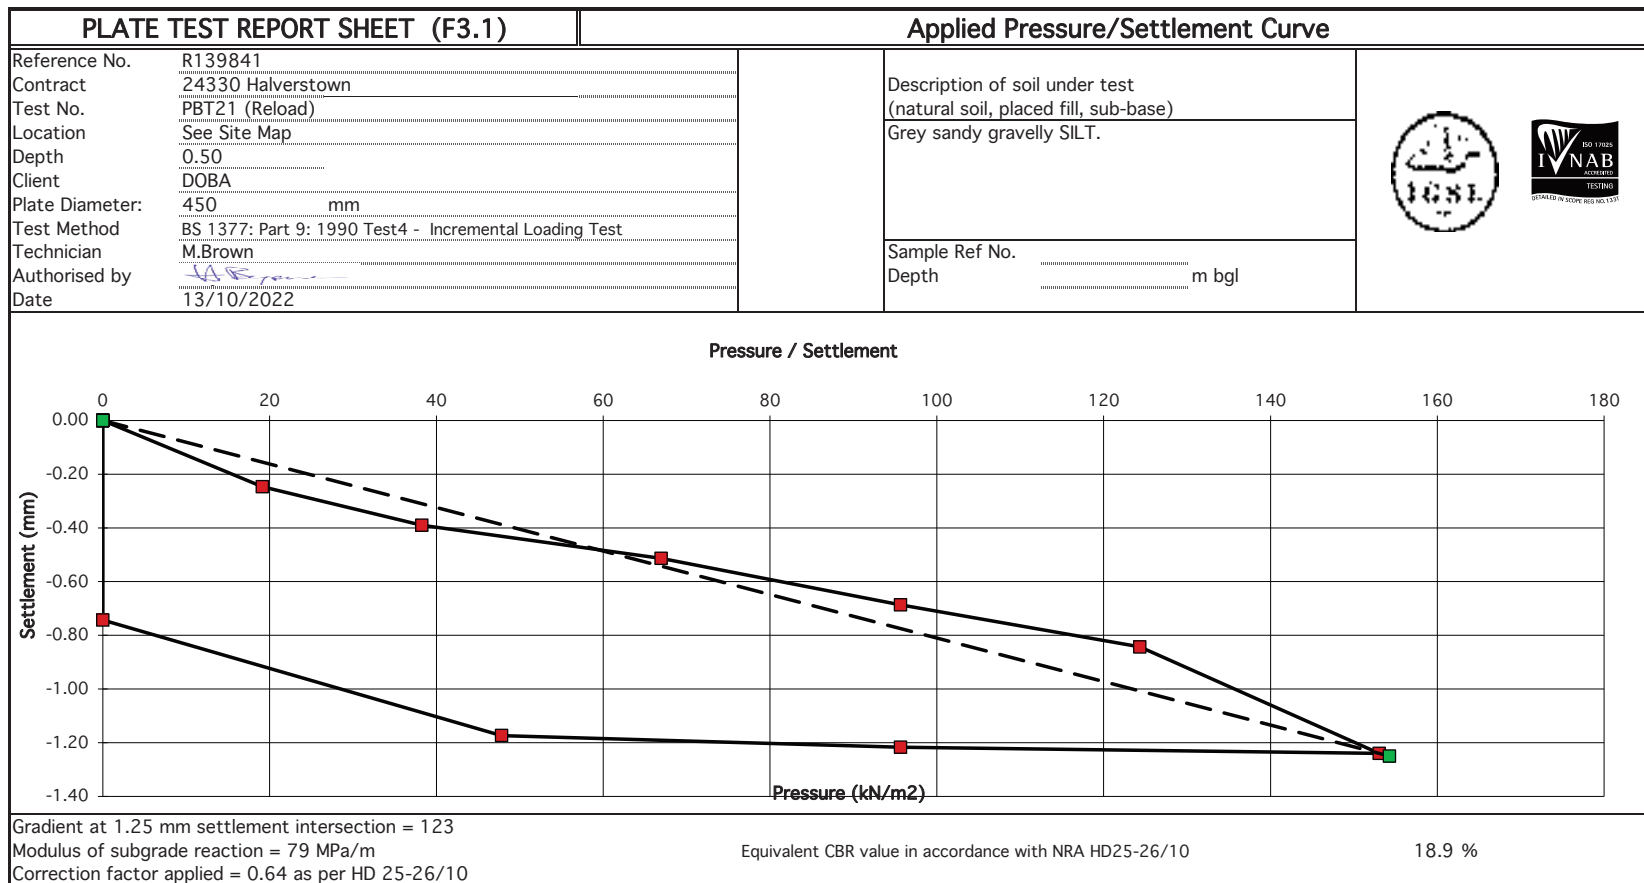
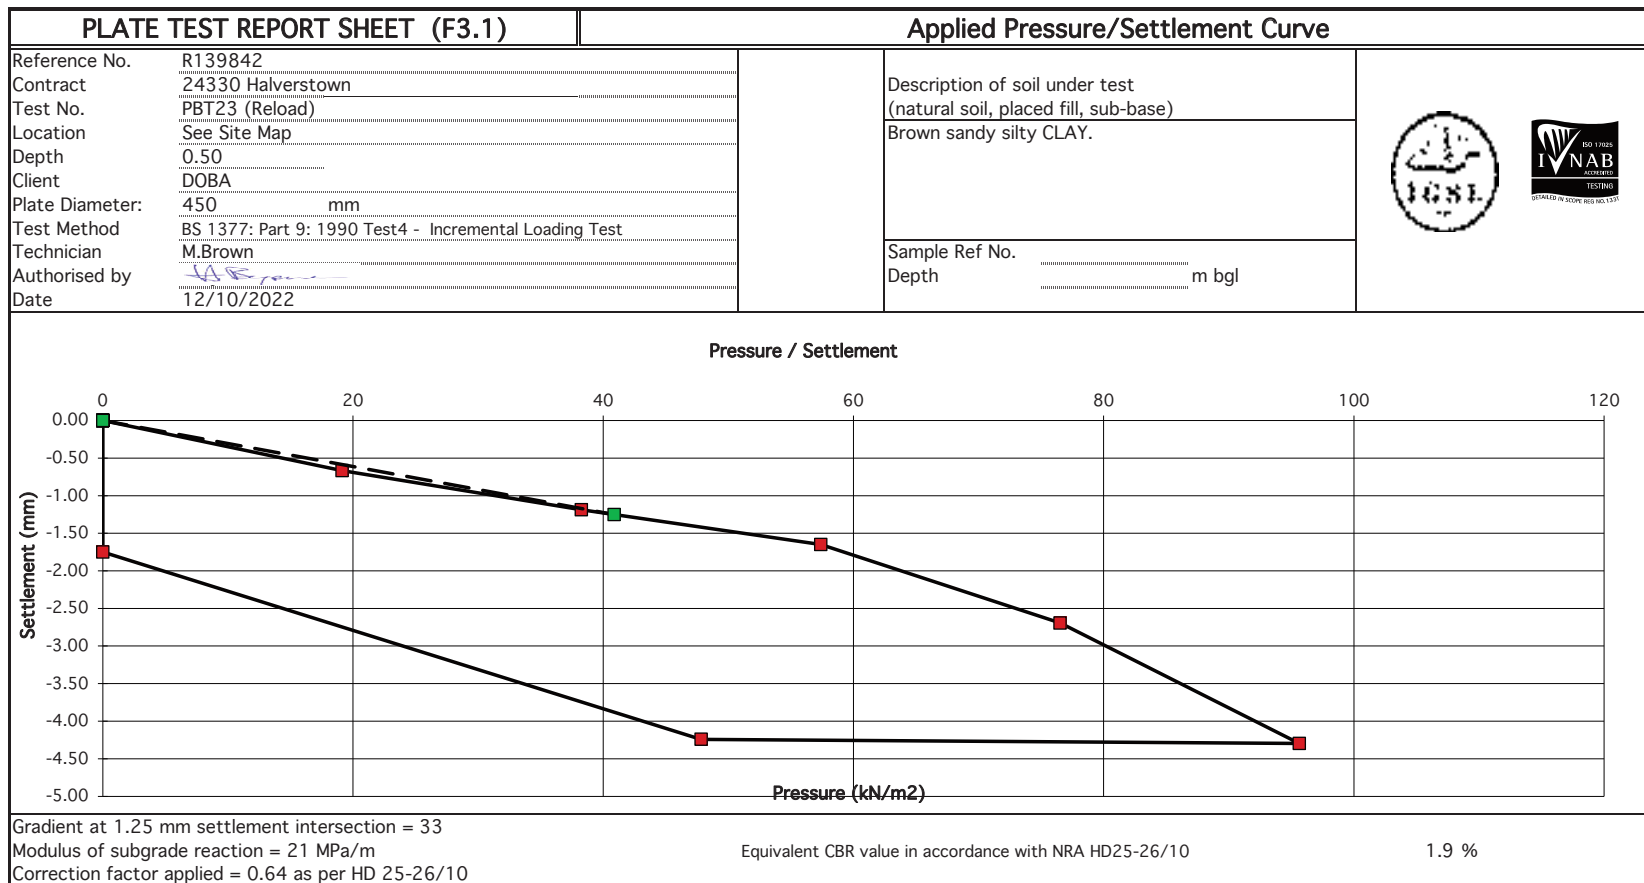


PLATE TEST REPORT SHEET (F3.1)		Applied Pressure/Settlement Curve	
Reference No.	R139842	Description of soil under test (natural soil, placed fill, sub-base) Brown sandy silty CLAY.	
Contract	24330 Halverstown		
Test No.	PBT23 (Load)		
Location	See Site Map		
Depth	0.50		
Client	DOBA		
Plate Diameter:	450 mm		
Test Method	BS 1377: Part 9: 1990 Test4 - Incremental Loading Test		
Technician	M.Brown	Sample Ref No. _____ Depth _____ m bgl	
Authorised by			
Date	12/10/2022		

Pressure / Settlement

Pressure (kN/m ²)	Settlement (mm) - Series 1	Settlement (mm) - Series 2
0	0.00	-4.00
20	-0.80	
30	-1.30	
40	-2.00	
50		-5.50
60	-3.10	
80	-4.20	
110	-5.50	-5.50

Gradient at 1.25 mm settlement intersection = 21 Modulus of subgrade reaction = 14 MPa/m Correction factor applied = 0.64 as per HD 25-26/10	Equivalent CBR value in accordance with NRA HD25-26/10	0.9 %



PB04 – 1 of 2



PB04 – 2 of 2



PB05 1 of 3



PB05 2 of 3



PB05 3 of 3



PB06 1 of 1



PB07 1 of 1



PB08 1 of 1



PB09 1 of 2



PB09 2 of 2



PB10 1 of 1



PB11 1 of 1



PB12 1 of 1



PB13 1 of 1



PB14 1 of 1



PB15 1 of 1



PB16 1 of 1



PB17 1 of 1



PB19 1 of 1



PB21 1 of 1



PB23 1 of 1



Appendix 5**Soakaway Test Records (to BRE365)**

Soakaway Test No.	Easting	Northing	Elevation (m OD)
SA01	686044.553	719690.913	79.582
SA02	686159.275	719597.49	79.558
SA03	686281.269	719515.46	79.22
SA04	686404	719434.018	78.346
SA05	686527.198	719353.119	78.611
SA06	686447.219	719668.69	83.453
SA07	686660.25	719566.88	82.861
SA08	686606.497	719388.773	78.995
SA09	686700.381	719648.213	81.639
SA10	686556.719	719845.828	83.877
SA11	686551.16	719788.98	84.239
SA12	686504.63	719684.437	84.324
SA13	686248.393	719737.264	81.662

Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown Contract No. 24330
 Test No. SA01
 Client DOBA
 Date: 20/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.40	TOPSOIL: Soft brown slightly gravelly sandy CLAY	Dry
0.40	1.60	Firm grey mottled orange very sandy gravelly SILT with silty sand horizons	

Notes: Samples:
 Test terminated at 30 minutes. No soakage recorded.

Field Data

Depth to Water (m)	Elapsed Time (min)
0.59	0.00
0.59	1.00
0.59	2.00
0.59	3.00
0.59	4.00
0.59	5.00
0.59	6.00
0.59	7.00
0.59	8.00
0.59	10.00
0.59	12.00
0.59	14.00
0.59	16.00
0.59	18.00
0.59	20.00
0.59	25.00
0.59	30.00

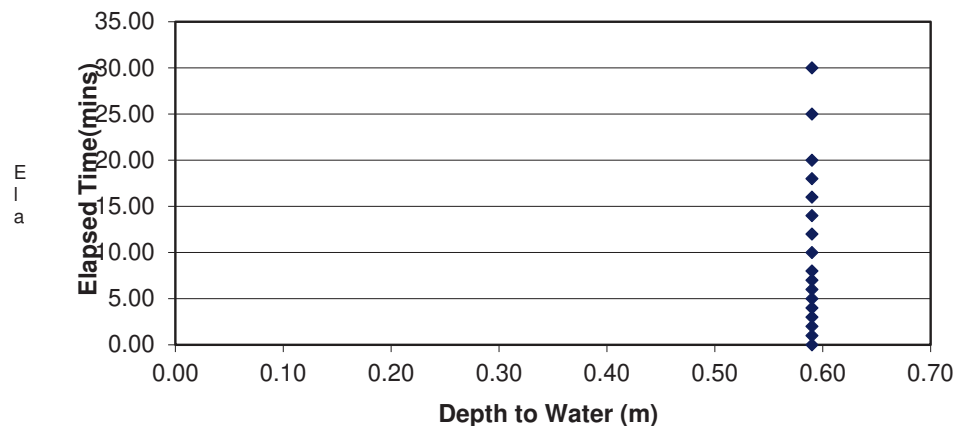
Field Test

Depth of Pit (D) 1.60 m
 Width of Pit (B) 0.40 m
 Length of Pit (L) 1.60 m
 Initial depth to Water = 0.59 m
 Final depth to water = 0.59 m
 Elapsed time (mins)= 30.00
 Top of permeable soil
 Base of permeable soil

Base area= 0.64 m²
 *Av. side area of permeable stratum over test period = 4.04 m²
 Total Exposed area = 4.68 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time
f= 0 m/min or 0 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown

Contract No.

24330

Test No. SA02

Client DOBA

Date: 20/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.30	TOPSOIL: Soft brown slightly gravelly sandy CLAY	Dry
0.30	1.50	Firm grey brown very sandy very gravelly CLAY with a low cobble content	

Notes:

Samples:

Field Data

Depth to Water (m)	Elapsed Time (min)
0.55	0.00
0.55	1.00
0.55	2.00
0.55	3.00
0.56	4.00
0.56	5.00
0.56	6.00
0.56	7.00
0.57	8.00
0.57	10.00
0.57	12.00
0.58	14.00
0.58	16.00
0.58	18.00
0.58	20.00
0.59	25.00
0.59	30.00
0.59	35.00
0.60	40.00
0.6	50.00
0.61	60.00

Field Test

Depth of Pit (D) 1.50 m
Width of Pit (B) 0.40 m
Length of Pit (L) 1.50 m

Initial depth to Water = 0.55 m
Final depth to water = 0.61 m
Elapsed time (mins)= 60.00

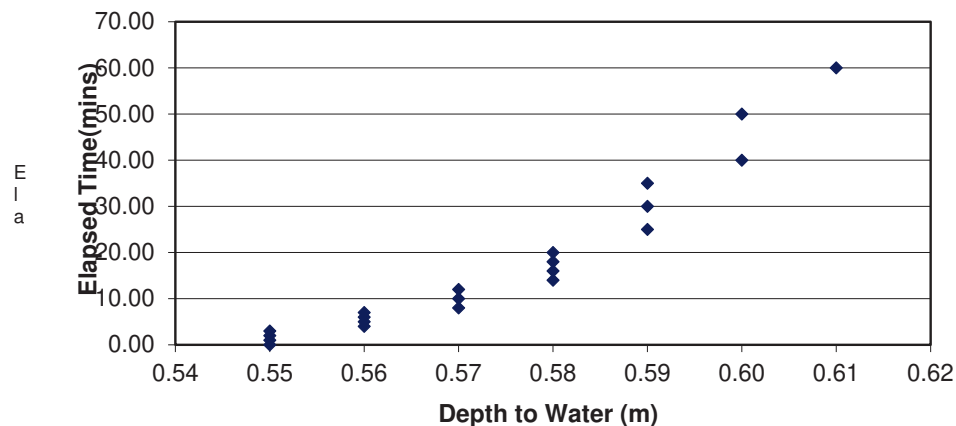
Top of permeable soil m
Base of permeable soil m

Base area= 0.6 m²
*Av. side area of permeable stratum over test pit 3.496 m²
Total Exposed area = 4.096 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0.00015 m/min or 2.441E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown

Contract No.

24330

Test No. SA03

Client DOBA

Date: 20/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.30	TOPSOIL: Soft brown slightly gravelly sandy CLAY	Dry
0.30	0.50	Firm brown sandy gravelly SILT	
0.50	1.70	Firm grey brown very sandy gravelly silty CLAY with a low cobble content	

Notes:

Samples:

Field Data

Depth to Water (m)	Elapsed Time (min)
1.00	0.00
1.00	1.00
1.00	2.00
1.00	3.00
1.00	4.00
1.00	5.00
1.00	6.00
1.00	7.00
1.00	8.00
1.00	10.00
1.00	12.00
1.00	14.00
1.00	16.00
1.00	18.00
1.00	20.00
1.00	25.00
1.00	30.00

Field Test

Depth of Pit (D) m
 Width of Pit (B) m
 Length of Pit (L) m

Initial depth to Water = m
 Final depth to water = m
 Elapsed time (mins)=

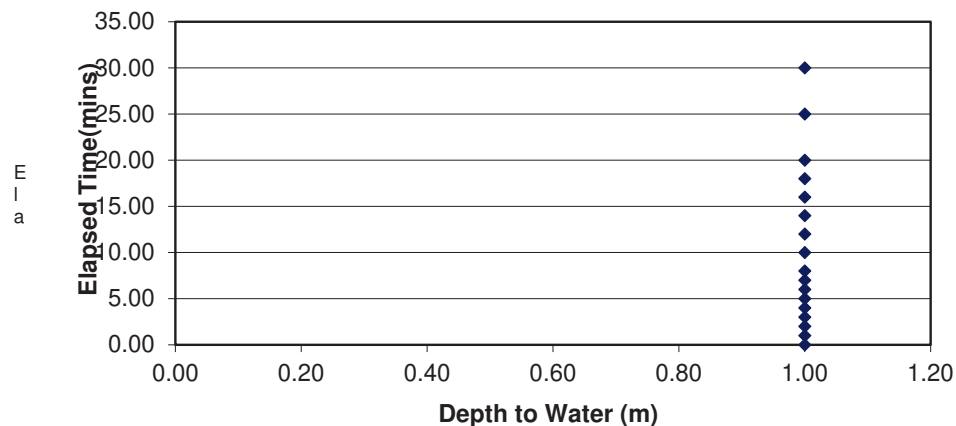
Top of permeable soil m
 Base of permeable soil m

Base area= m²
 *Av. side area of permeable stratum over test pit m²
 Total Exposed area = m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0 m/min or 0 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown

Contract No.

24330

Test No. SA04

Client DOBA

Date: 10/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.40	TOPSOIL: Soft brown slightly gravelly sandy CLAY	Dry
0.40	0.90	Grey silty gravelly SAND with low cobbles	
0.90	2.10	Firm to stiff light grey mottled orange slightly sandy gravelly SILT	

Notes:

Samples:

Field Data

Depth to Water (m)	Elapsed Time (min)
1.13	0.00
1.13	1.00
1.13	2.00
1.13	3.00
1.13	4.00
1.13	5.00
1.13	6.00
1.13	7.00
1.13	8.00
1.13	10.00
1.14	12.00
1.14	14.00
1.14	16.00
1.14	18.00
1.14	20.00
1.14	25.00
1.14	30.00
1.15	35.00
1.15	40.00
1.15	50.00
1.15	60.00

Field Test

Depth of Pit (D) 2.10 m
Width of Pit (B) 0.45 m
Length of Pit (L) 1.60 m

Initial depth to Water = 1.13 m
Final depth to water = 1.15 m
Elapsed time (mins)= 60.00

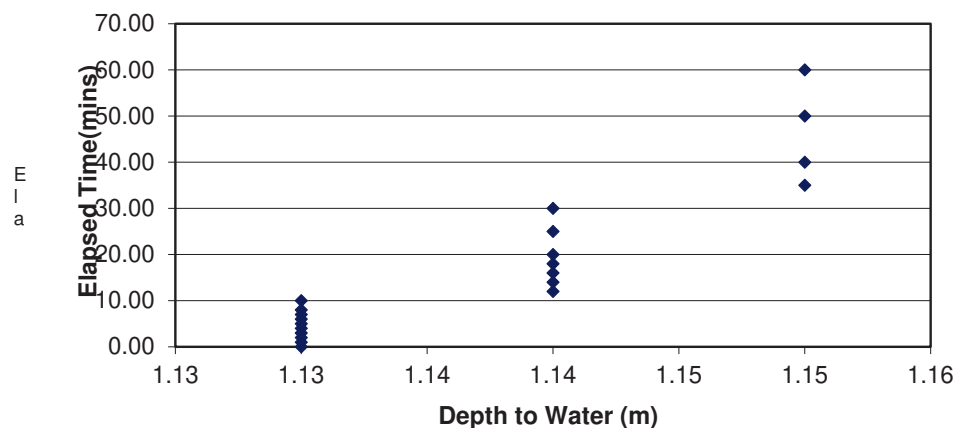
Top of permeable soil m
Base of permeable soil m

Base area= 0.72 m²
*Av. side area of permeable stratum over test pit 3.936 m²
Total Exposed area = 4.656 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 5.2E-05 m/min or 8.591E-07 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown

Contract No. 24330

Test No. SA05 A

Client DOBA

Date: 04/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.50	TOPSOIL: Soft brown slightly gravelly sandy CLAY with a low cobble content and rootlets	Moderate flow at 1.7
0.50	1.10	(Medium dense) Grey very gravelly SAND with a medium cobble content	
1.10	1.70	(Medium dense) Grey sandy GRAVEL with a medium to high cobble content	

Notes:

Side wall collapse throughout test.

Samples: AA185472

AA185473

Field Data

Depth to Water (m)	Elapsed Time (min)
1.10	0.00
1.10	1.00
1.11	2.00
1.11	3.00
1.12	4.00
1.13	5.00
1.14	6.00
1.14	7.00
1.14	8.00
1.15	10.00
1.15	12.00
1.16	14.00
1.16	16.00
1.16	18.00
1.17	20.00
1.18	25.00
1.19	30.00
1.19	35.00
1.20	40.00
1.2	50.00
1.2	60.00

Field Test

Depth of Pit (D) 1.70 m
Width of Pit (B) 0.60 m
Length of Pit (L) 2.20 m

Initial depth to Water = 1.10 m
Final depth to water = 1.20 m
Elapsed time (mins)= 60.00

Top of permeable soil
Base of permeable soil

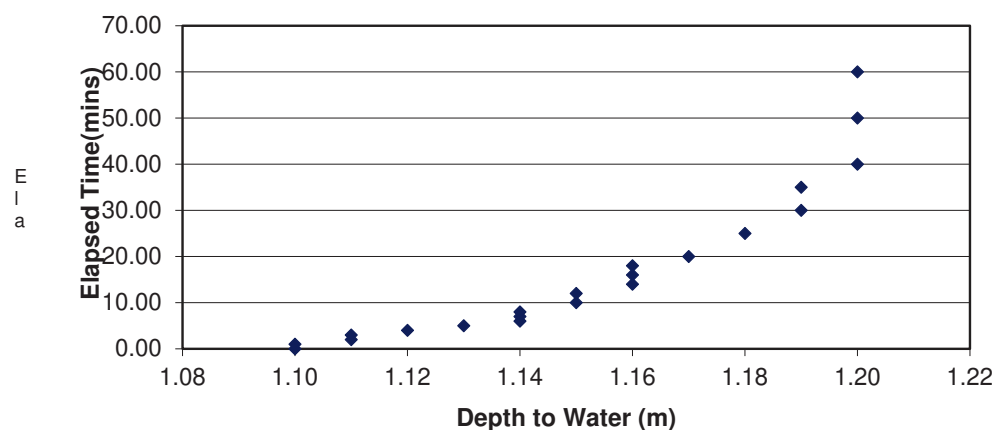
Base area= 1.32 m²
*Av. side area of permeable stratum over test period 3.08 m²
Total Exposed area = 4.4 m²

Infiltration rate (f) =

Volume of water used/unit exposed area / unit time

f= 0.0005 m/min or 8.333E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown Contract No. 24330
 Test No. SA05 B (Cycle 1)
 Client DOBA
 Date: 04/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.50	TOPSOIL: Soft brown slightly gravelly sandy CLAY with a low cobble content and rootlets	Dry
0.50	1.20	(Medium dense) Grey very gravelly silty SAND with a medium cobble content	

Notes: Side wall collapse throughout test
 Samples:

Field Data

Depth to Water (m)	Elapsed Time (min)
0.60	0.00
0.61	1.00
0.62	2.00
0.62	3.00
0.62	4.00
0.63	5.00
0.63	6.00
0.63	7.00
0.63	8.00
0.64	10.00
0.64	12.00
0.64	14.00
0.65	16.00
0.65	18.00
0.66	20.00
0.67	25.00
0.68	30.00
0.69	35.00
0.70	40.00
0.71	50.00
0.72	60.00

Field Test

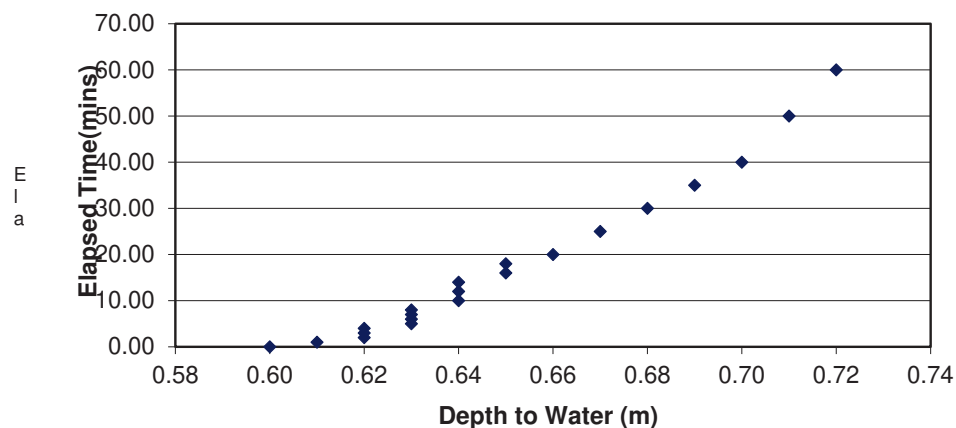
Depth of Pit (D) 1.20 m
 Width of Pit (B) 0.60 m
 Length of Pit (L) 1.50 m
 Initial depth to Water = 0.60 m
 Final depth to water = 0.72 m
 Elapsed time (mins)= 60.00
 Top of permeable soil
 Base of permeable soil

Base area= 0.9 m²
 *Av. side area of permeable stratum over test pe 2.268 m²
 Total Exposed area = 3.168 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0.00057 m/min or 9.47E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown Contract No. 24330
 Test No. SA05 B (Cycle 2)
 Client DOBA
 Date: 04/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.50	TOPSOIL: Soft brown slightly gravelly sandy CLAY with a low cobble content and rootlets	Dry
0.50	1.20	(Medium dense) Grey very gravelly silty SAND with a medium cobble content	

Notes: Side wall collapse throughout test. Samples:

Field Data

Depth to Water (m)	Elapsed Time (min)
0.50	0.00
0.50	1.00
0.51	2.00
0.51	3.00
0.51	4.00
0.52	5.00
0.52	6.00
0.52	7.00
0.52	8.00
0.53	10.00
0.53	12.00
0.53	14.00
0.54	16.00
0.54	18.00
0.55	20.00
0.57	25.00
0.57	30.00
0.58	35.00
0.59	40.00
0.59	50.00
0.6	60.00

Field Test

Depth of Pit (D) 1.20 m
 Width of Pit (B) 0.60 m
 Length of Pit (L) 1.50 m

Initial depth to Water = 0.50 m
 Final depth to water = 0.60 m
 Elapsed time (mins)= 60.00

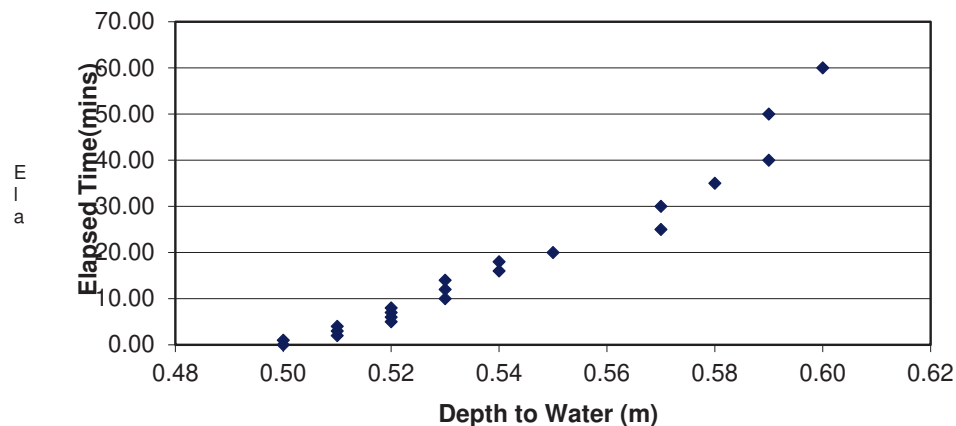
Top of permeable soil
 Base of permeable soil

Base area= 0.9 m²
 *Av. side area of permeable stratum over test period = 2.73 m²
 Total Exposed area = 3.63 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0.00041 m/min or 6.887E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown Contract No. 24330
 Test No. SA06 (Cycle 1)
 Client DOBA
 Date: 10/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.40	TOPSOIL: Soft brown sandy CLAY with rootlets	Dry
0.30	1.20	Firm brown sandy gravelly CLAY	
1.20	2.00	Grey brown gravelly silty SAND with a low cobble content	

Notes: Samples: AA181953
 AA181954

Field Data

Depth to Water (m)	Elapsed Time (min)
1.12	0.00
1.13	1.00
1.14	2.00
1.14	3.00
1.15	4.00
1.15	5.00
1.16	6.00
1.16	7.00
1.17	8.00
1.17	10.00
1.17	12.00
1.18	14.00
1.18	16.00
1.18	18.00
1.19	20.00
1.19	25.00
1.19	30.00
1.20	35.00
1.20	40.00
1.21	50.00
1.22	60.00

Field Test

Depth of Pit (D) 2.00 m
 Width of Pit (B) 0.45 m
 Length of Pit (L) 1.60 m

Initial depth to Water = 1.12 m
 Final depth to water = 1.22 m
 Elapsed time (mins)= 60.00

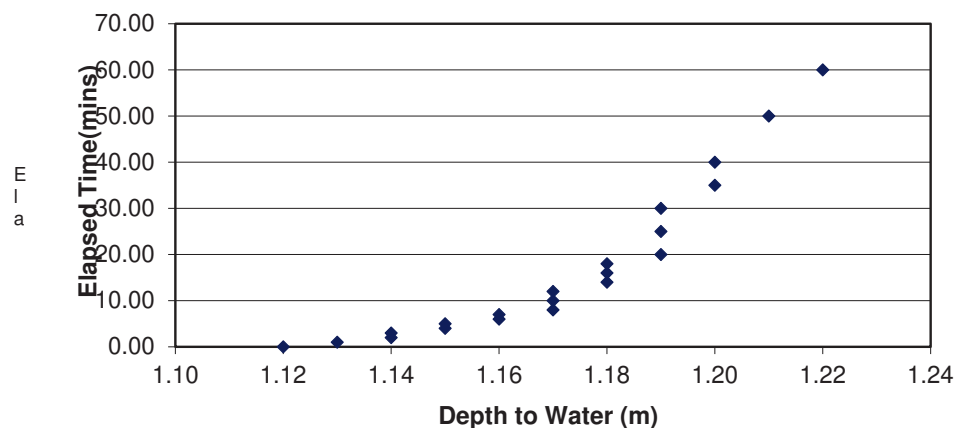
Top of permeable soil m
 Base of permeable soil m

Base area= 0.72 m²
 *Av. side area of permeable stratum over test pit 3.403 m²
 Total Exposed area = 4.123 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0.00029 m/min or 4.851E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown
 Test No. SA06 (Cycle 2)
 Client DOBA
 Date: 10/10/2022

Contract No. 24330

Summary of ground conditions

from	to	Description	Ground water
0.00	0.40	TOPSOIL: Soft brown sandy CLAY with rootlets	Dry
0.30	1.20	Firm brown sandy gravelly CLAY	
1.20	2.00	Grey brown gravelly silty SAND with a low cobble content	

Notes: Samples: AA181953
 AA181954

Field Data

Depth to Water (m)	Elapsed Time (min)
1.01	0.00
1.02	1.00
1.03	2.00
1.03	3.00
1.04	4.00
1.04	5.00
1.04	6.00
1.05	7.00
1.05	8.00
1.05	10.00
1.06	12.00
1.06	14.00
1.06	16.00
1.06	18.00
1.07	20.00
1.07	25.00
1.07	30.00
1.07	35.00
1.08	40.00
1.08	50.00
1.09	60.00

Field Test

Depth of Pit (D) 2.00 m
 Width of Pit (B) 0.45 m
 Length of Pit (L) 1.60 m

Initial depth to Water = 1.01 m
 Final depth to water = 1.09 m
 Elapsed time (mins)= 60.00

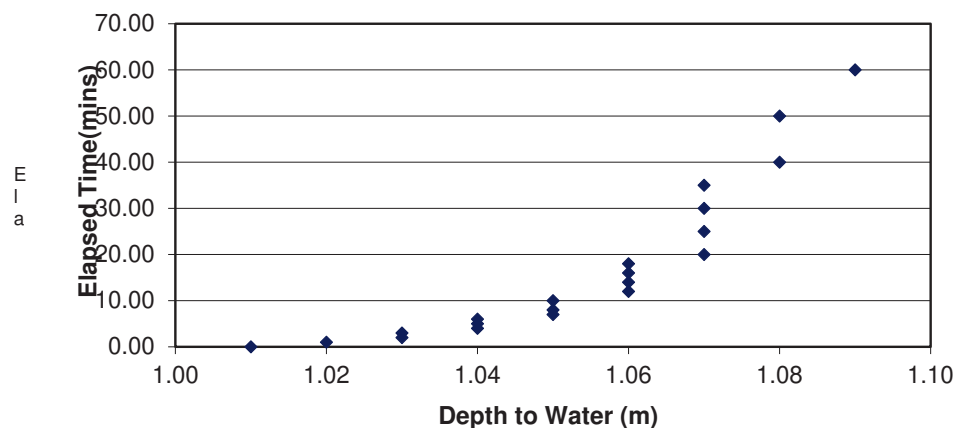
Top of permeable soil m
 Base of permeable soil m

Base area= 0.72 m²
 *Av. side area of permeable stratum over test pit 3.895 m²
 Total Exposed area = 4.615 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0.00021 m/min or 3.467E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown

Contract No.

24330

Test No. SA07

Client DOBA

Date: 11/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.40	TOPSOIL: Soft brown sandy CLAY with rootlets	Dry
0.40	1.00	Stiff brown grey sandy slightly gravelly silty CLAY	
1.00	2.20	Firm brown sandy gravelly CLAY with a medium cobble content and occasional boulders	

Notes:

Samples: AA185492

AA185493

Field Data

Depth to Water (m)	Elapsed Time (min)
1.17	0.00
1.17	1.00
1.17	2.00
1.17	3.00
1.17	4.00
1.18	5.00
1.18	6.00
1.18	7.00
1.18	8.00
1.18	10.00
1.18	12.00
1.18	14.00
1.18	16.00
1.19	18.00
1.19	20.00
1.19	25.00
1.19	30.00
1.20	35.00
1.20	40.00
1.2	50.00
1.21	60.00

Field Test

Depth of Pit (D)	2.20	m
Width of Pit (B)	0.45	m
Length of Pit (L)	1.40	m

Initial depth to Water =	1.17	m
Final depth to water =	1.21	m
Elapsed time (mins)=	60.00	

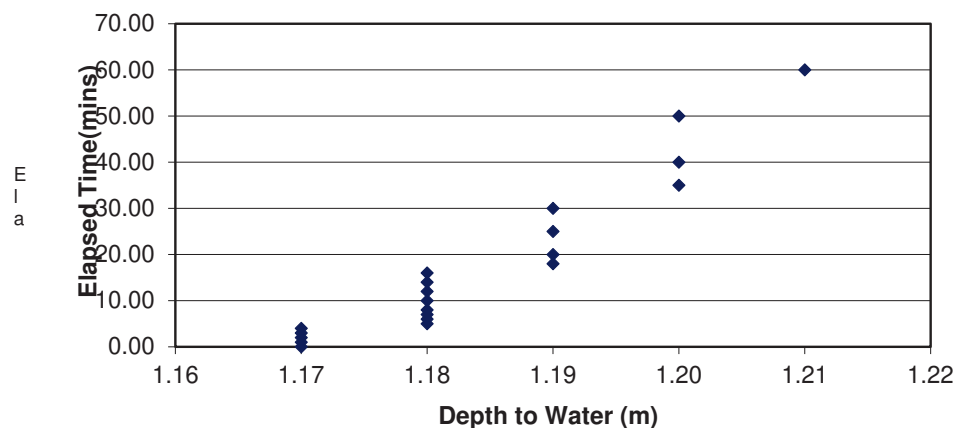
Top of permeable soil		m
Base of permeable soil		m

Base area=	0.63	m ²
*Av. side area of permeable stratum over test pit	3.737	m ²
Total Exposed area =	4.367	m ²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 9.6E-05 m/min or 1.603E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown Contract No. 24330
 Test No. SA08
 Client DOBA
 Date: 10/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.30	TOPSOIL: Soft dark brown very sandy slightly gravelly CLAY	Dry
0.30	0.80	Firm grey very sandy slightly gravelly SILT	
0.80	1.80	Firm to stiff light grey mottled orange slightly sandy gravelly SILT with a low cobble content	

Notes: Samples: AA181951
 Terminated after 30 minutes. No soakage recorded AA181952

Field Data

Depth to Water (m)	Elapsed Time (min)
1.20	0.00
1.20	1.00
1.20	2.00
1.20	3.00
1.20	4.00
1.20	5.00
1.20	6.00
1.20	7.00
1.20	8.00
1.20	10.00
1.20	12.00
1.20	14.00
1.20	16.00
1.20	18.00
1.20	20.00
1.20	25.00
1.20	30.00

Field Test

Depth of Pit (D) 2.10 m
 Width of Pit (B) 0.45 m
 Length of Pit (L) 1.60 m

Initial depth to Water = 1.20 m
 Final depth to water = 1.20 m
 Elapsed time (mins)= 30.00

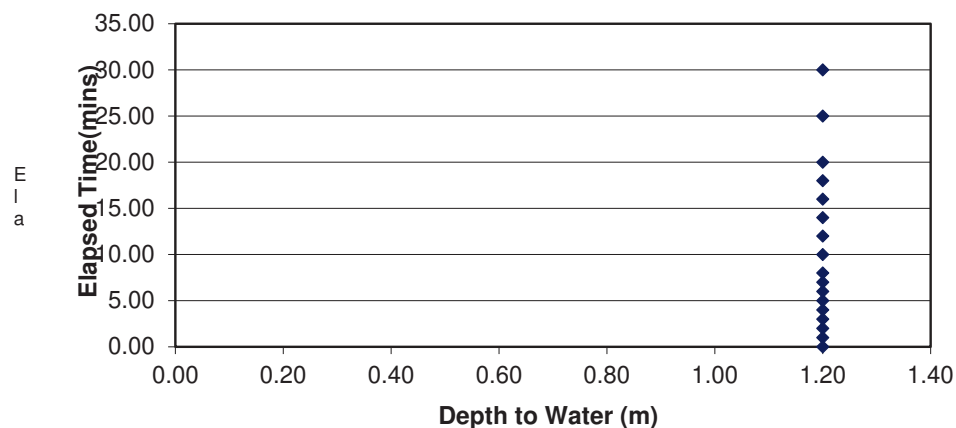
Top of permeable soil m
 Base of permeable soil m

Base area= 0.72 m²
 *Av. side area of permeable stratum over test period = 3.69 m²
 Total Exposed area = 4.41 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0 m/min or 0 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown
 Test No. SA09 (Cycle 1)
 Client DOBA
 Date: 11/10/2022

Contract No. 24330

Summary of ground conditions

from	to	Description	Ground water
0.00	0.30	TOPSOIL: Soft brown sandy CLAY with rootlets	Dry
0.30	0.80	Stiff grey mottled orange sandy slightly gravelly SILT	
0.80	1.80	Grey brown gravelly silty SAND with a low cobble content	
1.80	2.00	Stiff brown sandy gravelly SILT	

Notes: Samples: AA185494
 AA185495
 AA185496

Field Data

Depth to Water (m)	Elapsed Time (min)
1.22	0.00
1.22	1.00
1.22	2.00
1.23	3.00
1.23	4.00
1.23	5.00
1.24	6.00
1.24	7.00
1.24	8.00
1.25	10.00
1.25	12.00
1.25	14.00
1.25	16.00
1.26	18.00
1.26	20.00
1.27	25.00
1.27	30.00
1.28	35.00
1.29	40.00
1.3	50.00
1.3	60.00

Field Test

Depth of Pit (D) 2.00 m
 Width of Pit (B) 0.45 m
 Length of Pit (L) 1.50 m

Initial depth to Water = 1.22 m
 Final depth to water = 1.30 m
 Elapsed time (mins)= 60.00

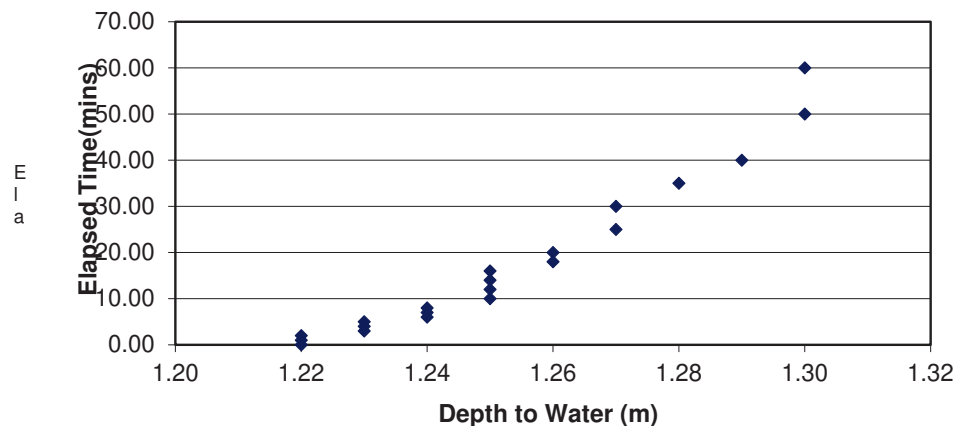
Top of permeable soil m
 Base of permeable soil m

Base area= 0.675 m²
 *Av. side area of permeable stratum over test pit = 2.886 m²
 Total Exposed area = 3.561 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0.00025 m/min or 4.212E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown Contract No. 24330
 Test No. SA09 (Cycle 2)
 Client DOBA
 Date: 11/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.30	TOPSOIL: Soft brown sandy CLAY with rootlets	Dry
0.30	0.80	Stiff grey mottled orange sandy slightly gravelly SILT	
0.80	1.80	Grey brown gravelly silty SAND with a low cobble content	
1.80	2.00	Stiff brown sandy gravelly SILT	

Notes: Samples: AA185494
 AA185495
 AA185496

Field Data

Depth to Water (m)	Elapsed Time (min)
0.90	0.00
0.90	1.00
0.90	2.00
0.91	3.00
0.91	4.00
0.92	5.00
0.92	6.00
0.92	7.00
0.93	8.00
0.93	10.00
0.93	12.00
0.93	14.00
0.94	16.00
0.94	18.00
0.94	20.00
0.95	25.00
0.95	30.00
0.96	35.00
0.96	40.00
0.97	50.00
0.97	60.00

Field Test

Depth of Pit (D) 2.00 m
 Width of Pit (B) 0.45 m
 Length of Pit (L) 1.50 m

Initial depth to Water = 0.90 m
 Final depth to water = 0.97 m
 Elapsed time (mins)= 60.00

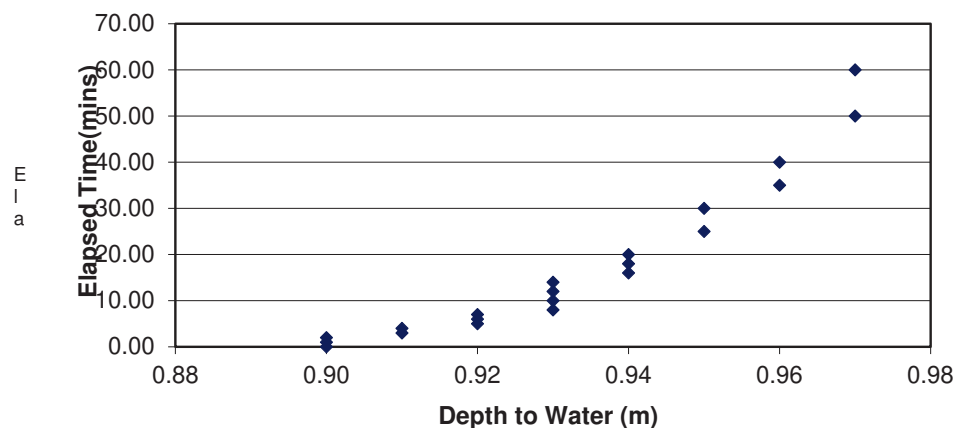
Top of permeable soil m
 Base of permeable soil m

Base area= 0.675 m²
 *Av. side area of permeable stratum over test pit 4.1535 m²
 Total Exposed area = 4.8285 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0.00016 m/min or 2.718E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown

Contract No. 24330

Test No. SA10

Client DOBA

Date: 14/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.30	TOPSOIL: Soft brown slightly gravelly sandy silty CLAY	Dry
0.30	0.80	Stiff brown slightly gravelly sandy silty CLAY with a medium cobble content	
1.00	1.60	Firm to stiff brown very sandy gravelly CLAY with a medium cobble content	

Notes:

Samples:

Field Data

Depth to Water (m)	Elapsed Time (min)
1.08	0.00
1.08	1.00
1.08	2.00
1.09	3.00
1.09	4.00
1.09	5.00
1.09	6.00
1.10	7.00
1.10	8.00
1.10	10.00
1.10	12.00
1.11	14.00
1.11	16.00
1.11	18.00
1.11	20.00
1.11	25.00
1.12	30.00
1.12	35.00
1.12	40.00
1.13	50.00
1.13	60.00

Field Test

Depth of Pit (D)	1.60	m
Width of Pit (B)	0.40	m
Length of Pit (L)	1.80	m

Initial depth to Water =	1.08	m
Final depth to water =	1.13	m
Elapsed time (mins)=	60.00	

Top of permeable soil		m
Base of permeable soil		m

Base area=	0.72	m ²
*Av. side area of permeable stratum over test period=	2.178	m ²
Total Exposed area =	2.898	m ²

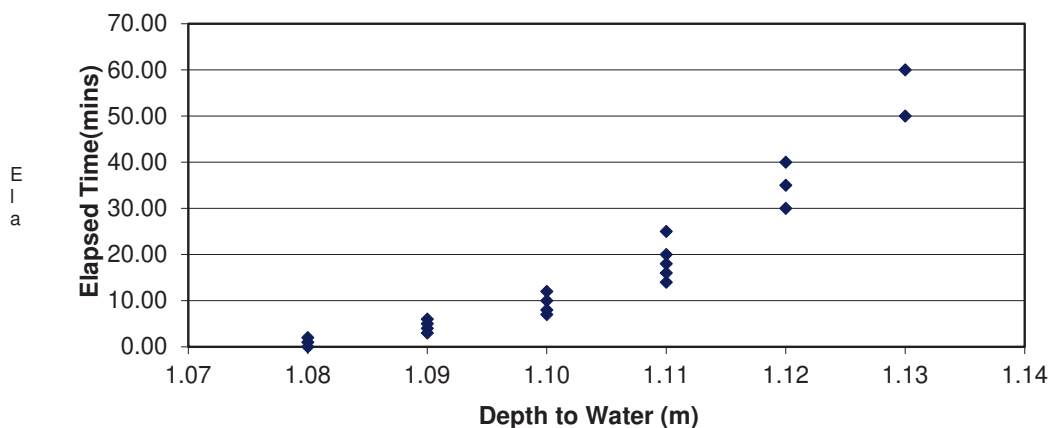
*Av. side area of permeable stratum over test period=

Infiltration rate (f) =

Volume of water used/unit exposed area / unit time

f= 0.000207039 m/min or 3.451E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown

Contract No.

24330

Test No. SA11

Client DOBA

Date: 14/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.40	TOPSOIL: Soft brown sandy gravelly CLAY	Dry
0.40	1.20	Firm brown sandy gravelly silty CLAY with a medium cobble content	
1.20	1.80	Firm brown very sandy gravelly CLAY with a medium cobble content	

Notes:

Samples:

Field Data

Field Test

Depth to Water (m)	Elapsed Time (min)
1.00	0.00
1.00	1.00
1.00	2.00
1.00	3.00
1.00	4.00
1.00	5.00
1.00	6.00
1.00	7.00
1.01	8.00
1.01	10.00
1.01	12.00
1.01	14.00
1.01	16.00
1.01	18.00
1.02	20.00
1.02	25.00
1.02	30.00
1.02	35.00
1.02	40.00
1.03	50.00
1.03	60.00

Depth of Pit (D) 1.80 m
Width of Pit (B) 0.40 m
Length of Pit (L) 1.60 m

Initial depth to Water = 1.00 m
Final depth to water = 1.03 m
Elapsed time (mins)= 60.00

Top of permeable soil
Base of permeable soil

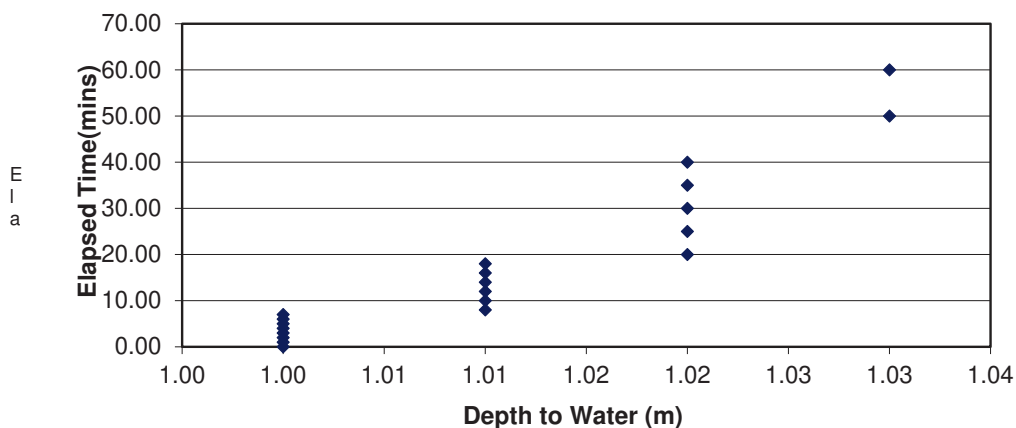
Base area= 0.64 m²
*Av. side area of permeable stratum over test period= 3.14 m²
Total Exposed area = 3.78 m²

Infiltration rate (f) =

Volume of water used/unit exposed area / unit time

f= 8.46561E-05 m/min or 1.411E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown Contract No. 24330
 Test No. SA12 (Cycle 1)
 Client DOBA
 Date: 10/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.40	TOPSOIL: Soft brown sandy CLAY with rootlets	Dry
0.40	1.20	Firm brown sandy silty CLAY	
1.10	2.20	Grey brown gravelly silty SAND with a medium cobble content	

Notes: Samples: AA181955
 AA181956

Field Data

Depth to Water (m)	Elapsed Time (min)
1.34	0.00
1.35	1.00
1.35	2.00
1.36	3.00
1.36	4.00
1.37	5.00
1.37	6.00
1.37	7.00
1.38	8.00
1.38	10.00
1.38	12.00
1.39	14.00
1.39	16.00
1.40	18.00
1.40	20.00
1.40	25.00
1.41	30.00
1.41	35.00
1.42	40.00
1.43	50.00
1.44	60.00

Field Test

Depth of Pit (D) 2.20 m
 Width of Pit (B) 0.45 m
 Length of Pit (L) 1.70 m

Initial depth to Water = 1.34 m
 Final depth to water = 1.44 m
 Elapsed time (mins)= 60.00

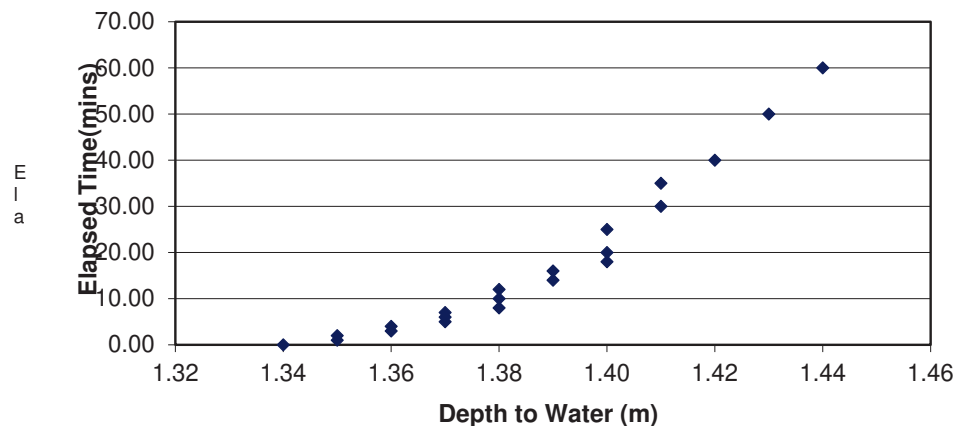
Top of permeable soil m
 Base of permeable soil m

Base area= 0.765 m²
 *Av. side area of permeable stratum over test pit 3.483 m²
 Total Exposed area = 4.248 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0.0003 m/min or 5.002E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown Contract No. 24330
 Test No. SA12 (Cycle 2)
 Client DOBA
 Date: 10/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.40	TOPSOIL: Soft brown sandy CLAY with rootlets	Dry
0.40	1.20	Firm brown sandy silty CLAY	
1.10	2.20	Grey brown gravelly silty SAND with a medium cobble content	

Notes: Samples: AA181955
AA181956

Field Data

Depth to Water (m)	Elapsed Time (min)
1.21	0.00
1.21	1.00
1.22	2.00
1.22	3.00
1.22	4.00
1.23	5.00
1.23	6.00
1.23	7.00
1.24	8.00
1.24	10.00
1.24	12.00
1.25	14.00
1.25	16.00
1.26	18.00
1.26	20.00
1.27	25.00
1.27	30.00
1.28	35.00
1.28	40.00
1.29	50.00
1.3	60.00

Field Test

Depth of Pit (D) 2.20 m
 Width of Pit (B) 0.45 m
 Length of Pit (L) 1.70 m

Initial depth to Water = 1.21 m
 Final depth to water = 1.30 m
 Elapsed time (mins)= 60.00

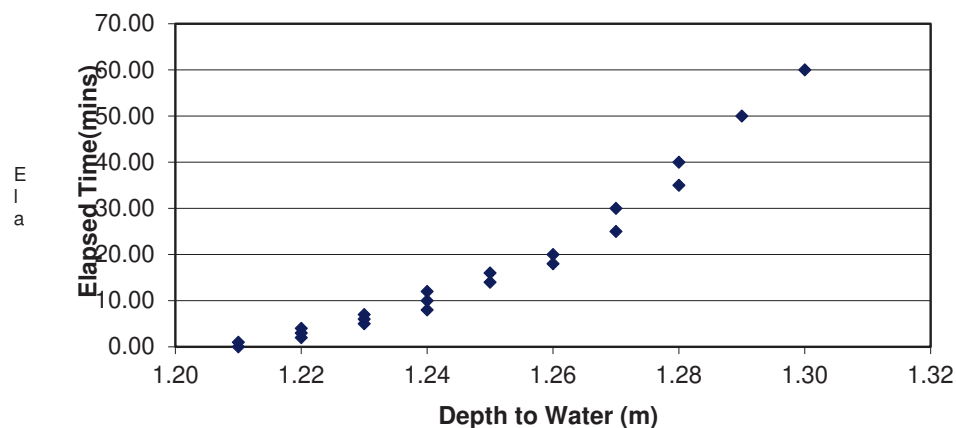
Top of permeable soil m
 Base of permeable soil m

Base area= 0.765 m²
 *Av. side area of permeable stratum over test pit 4.0635 m²
 Total Exposed area = 4.8285 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time

f= 0.00024 m/min or 3.961E-06 m/sec

Depth of water vs Elapsed Time (mins)



Soakaway Design f-value from field tests (F2C) IGSL

Contract: Halverstown

Contract No.

24330

Test No. SA13

Client DOBA

Date: 14/10/2022

Summary of ground conditions

from	to	Description	Ground water
0.00	0.30	TOPSOIL: Soft brown slightly gravelly sandy silty CLAY	Dry
0.30	0.80	Stiff brown slightly gravelly sandy CLAY	
0.80	1.60	Firm to stiff brown very sandy gravelly CLAY with a medium cobble content	

Notes:

Samples: AA181981

AA181982

Field Data

Depth to Water (m)	Elapsed Time (min)
0.85	0.00
0.85	1.00
0.85	2.00
0.85	3.00
0.86	4.00
0.86	5.00
0.86	6.00
0.87	7.00
0.87	8.00
0.87	10.00
0.88	12.00
0.88	14.00
0.88	16.00
0.88	18.00
0.89	20.00
0.89	25.00
0.89	30.00
0.90	35.00
0.90	40.00
0.91	50.00
0.92	60.00

Field Test

Depth of Pit (D) 1.60 m
Width of Pit (B) 0.40 m
Length of Pit (L) 1.70 m

Initial depth to Water = 0.85 m
Final depth to water = 0.92 m
Elapsed time (mins)= 60.00

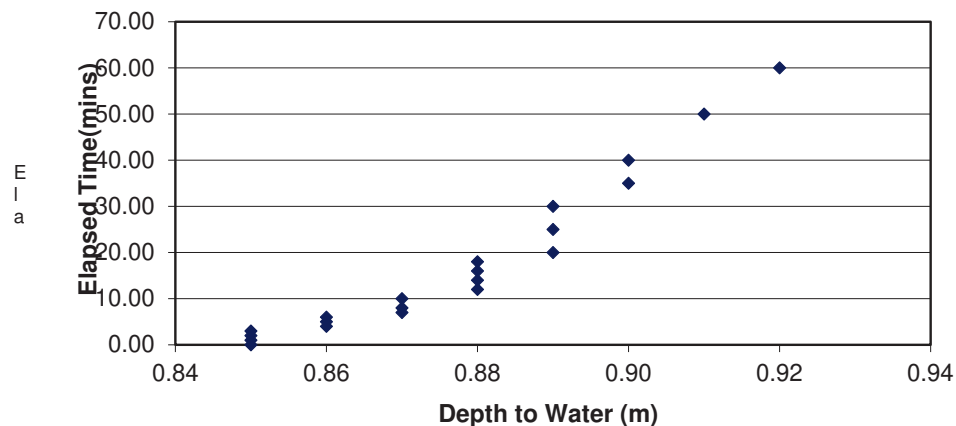
Top of permeable soil m
Base of permeable soil m


Base area= 0.68 m²
*Av. side area of permeable stratum over test pit 3.003 m²
Total Exposed area = 3.683 m²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time


f= 0.00022 m/min or 3.59E-06 m/sec

Depth of water vs Elapsed Time (mins)



		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown						TRIAL PIT NO. SATP01				
LOGGED BY MB						CO-ORDINATES 686,044.55 E 719,690.91 N				
CLIENT ENGINEER DOBA						GROUND LEVEL (m) 79.58				
						DATE STARTED 20/10/2022 DATE COMPLETED 20/10/2022				
						EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm grey mottled orange very sandy gravelly SILT with silty sand horizons. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.40	79.18						
1.0										
	End of Trial Pit at 1.60m		1.60	77.98						
2.0										
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings. Soakaway test carried out in pit.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown						TRIAL PIT NO. SATP02				
LOGGED BY MB		CO-ORDINATES 686,159.28 E 719,597.49 N				SHEET Sheet 1 of 1				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 79.56				DATE STARTED 20/10/2022 DATE COMPLETED 20/10/2022				
						EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm grey brown very sandy very gravelly CLAY with a low cobble content. Sand is medium to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.30	79.26						
1.0										
	End of Trial Pit at 1.50m		1.50	78.06						
2.0										
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings. Soakaway test carried out in pit.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT	Halverstown

TRIAL PIT NO.
SHEET

SATP03
Sheet 1 of

LOGGED BY MB

CO-ORDINATES	686,281.27 E 719,515.46 N

DATE STARTED	20/10/2022
DATE COMPLETED	20/10/2022

CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 79.22

EXCAVATION METHOD	7t Hitachi


[illegible]

Groundwater Conditions
Dry


Stability Good

General Remarks	

Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings. Soakaway test carried out in pit.

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown		TRIAL PIT NO. SATP04 SHEET Sheet 1 of 1								
LOGGED BY MB		CO-ORDINATES 686,404.00 E 719,434.02 N			DATE STARTED 10/10/2022 DATE COMPLETED 10/10/2022					
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 78.35			EXCAVATION METHOD 7t Hitachi					
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Grey silty gravelly SAND with low cobbles. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.40	77.95						
1.0	Firm to stiff light grey mottled orange slightly sandy gravelly SILT. Sand is fine to coarse. Gravel is fine to coarse subangular to subrounded.		0.90	77.45						
2.0	End of Trial Pit at 2.10m		2.10	76.25						
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings. Soakaway test carried out in pit.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD					REPORT NUMBER 24330				
CONTRACT Halverstown		TRIAL PIT NO. SATP05 SHEET Sheet 1 of 1			LOGGED BY MB			CO-ORDINATES 686,527.20 E 719,353.12 N		DATE STARTED 04/10/2022 DATE COMPLETED 04/10/2022	
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 78.61			EXCAVATION METHOD 7t Hitachi						
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)	
						Sample Ref	Type	Depth			
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY with a low cobble content and rootlets. Sand is fine to coarse. Gravel is fine to medium subrounded. Cobbles are subrounded to rounded of limestone										
	(Medium dense) Grey very gravelly SAND with a medium cobble content. Sand is medium to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone Side wall collapse from 0.70-1.70m		0.50	78.11		AA185472	B	0.70-0.80			
1.0	(Medium dense) Grey sandy GRAVEL with a medium to high cobble content. Sand is medium to coarse. Gravel is fine to coarse subrounded.		1.10	77.51		AA185473	B	1.40-1.50			
	End of Trial Pit at 1.70m		1.70	76.91	 (Moderate)						
2.0											
3.0											
Groundwater Conditions Moderate flow at 1.70m											
Stability Unstable, side wall collapse from 0.70m											
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings. Soakaway test carried out in pit.											

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown		TRIAL PIT NO. SATP06 SHEET Sheet 1 of 1								
LOGGED BY MB		CO-ORDINATES 686,447.22 E 719,668.69 N			DATE STARTED 10/10/2022 DATE COMPLETED 10/10/2022					
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 83.45			EXCAVATION METHOD 7t Hitachi					
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown sandy CLAY with rootlets. Sand is fine to coarse.									
	Firm brown sandy gravelly CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	83.15		AA181953	B	0.50-0.50		
1.0	Grey brown gravelly silty SAND with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subangular to subrounded. Cobbles are subrounded to rounded of limestone		1.20	82.25		AA181954	B	1.50-1.50		
2.0	End of Trial Pit at 2.00m		2.00	81.45						
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings. Soakaway test carried out in pit.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown		TRIAL PIT NO. SATP07	
LOGGED BY MB		SHEET Sheet 1 of 1	
CO-ORDINATES 686,660.25 E 719,566.88 N		DATE STARTED 11/10/2022	
GROUND LEVEL (m) 82.86		DATE COMPLETED 11/10/2022	
CLIENT ENGINEER DOBA		EXCAVATION METHOD 7t Hitachi	

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown sandy CLAY with rootlets. Sand is fine to coarse.									
	Firm to stiff brown grey sandy slightly gravelly silty CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.40	82.46		AA185492	B	0.50-0.60		
1.0	Firm to stiff brown sandy gravelly CLAY with a medium cobble content and low boulder content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone		1.00	81.86						
						AA185493	B	1.50-1.60		
2.0										
	End of Trial Pit at 2.20m		2.20	80.66						
3.0										


Groundwater Conditions
Dry

Stability
Good

General Remarks
Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings. Soakaway test carried out in pit.

		TRIAL PIT RECORD					REPORT NUMBER 24330				
CONTRACT Halverstown					TRIAL PIT NO. SATP08		SHEET Sheet 1 of 1				
LOGGED BY MB		CO-ORDINATES 686,606.50 E 719,388.77 N			DATE STARTED 10/10/2022		DATE COMPLETED 10/10/2022				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 79.00			EXCAVATION METHOD 7t Hitachi						
Depth (m)	Geotechnical Description		Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
							Sample Ref	Type	Depth		
	0.0	TOPSOIL: Soft dark brown very sandy slightly gravelly CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
		Firm grey very sandy slightly gravelly SILT. Sand is fine to coarse. Gravel is fine to coarse subrounded.			0.30	78.70		AA181951	B	0.50-0.50	
	1.0	Firm to stiff light grey mottled orange slightly sandy gravelly SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subangular to subrounded. Cobbles are subrounded to rounded of limestone			0.80	78.20					
	End of Trial Pit at 1.80m			1.80	77.20		AA181952	B	1.50-1.50		
2.0											
3.0											
Groundwater Conditions Dry											
Stability Good											
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings. Soakaway test carried out in pit.											


IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. SATP10		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,556.72 E 719,845.83 N			DATE STARTED 14/10/2022		DATE COMPLETED 14/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 83.88			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy silty CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Stiff brown slightly gravelly sandy silty CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.30	83.58						
	Firm to stiff brown very sandy gravelly CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.80	83.08						
1.0	End of Trial Pit at 1.60m		1.60	82.28						
2.0										
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD					REPORT NUMBER 24330							
CONTRACT Halverstown						TRIAL PIT NO. SATP11								
LOGGED BY MB						CO-ORDINATES 686,551.16 E 719,788.98 N								
CLIENT ENGINEER DOBA						GROUND LEVEL (m) 84.24								
						DATE STARTED 14/10/2022 DATE COMPLETED 14/10/2022								
						EXCAVATION METHOD 7t Hitachi								
Depth (m)	Geotechnical Description					Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
										Sample Ref	Type	Depth		
	0.0 TOPSOIL: Soft brown sandy gravelly CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.													
	Firm brown sandy gravelly silty CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.						0.40	83.84						
	1.0 Firm brown very sandy gravelly CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.						1.20	83.04						
2.0 End of Trial Pit at 1.80m						1.80	82.44							
Groundwater Conditions Dry														
Stability Good														
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings.														

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

		TRIAL PIT RECORD					REPORT NUMBER 24330			
CONTRACT Halverstown		TRIAL PIT NO. SATP12			SHEET Sheet 1 of 1					
LOGGED BY MB		CO-ORDINATES 686,504.63 E 719,684.44 N			DATE STARTED 10/10/2022 DATE COMPLETED 10/10/2022					
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 84.32			EXCAVATION METHOD 7t Hitachi					
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown sandy CLAY with rootlets. Sand is fine to coarse.									
	Firm brown sandy silty CLAY. Sand is fine to coarse.		0.40	83.92						
1.0						AA181955	B	0.70-0.70		
	Grey brown gravelly silty SAND with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subangular to subrounded. Cobbles are subrounded to rounded of limestone		1.20	83.12						
2.0						AA181956	B	1.60-1.70		
	End of Trial Pit at 2.20m		2.20	82.12						
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings. Soakaway test carried out in pit.										

IGSL TP LOG 24330.GPJ IGSL GDT 31/1/23

SA01 – 1 of 2



SA01 – 2 of 2



SA02 – 1 of 2



SA02 – 2 of 2



SA03 1 of 2



SA03 2 of 2



SA04 1 of 2



SA04 2 of 2



SA05 1 of 2



SA05 2 of 2



SA06 1 of 2



SA06 2 of 2



SA07 1 of 2



SA07 2 of 2



SA08 1 of 2



SA08 2 of 2



SA09 1 of 2



SA09 2 of 2



SA10 1 of 2



SA10 2 of 2



SA11 1 of 2



SA11 2 of 2



SA12 1 of 2



SA12 2 of 2



SA13 1 of 2



SA13 2 of 2



Appendix 5A

Soakaway Test Records (BRE SA)

Soakaway Design f -value from field tests (F2C) IGSL

Contract:	Halverstown	Contract No.	24330
Test No.	BRE SA01		
Client	DOBA		
Date:	28/04/2023		

Summary of ground conditions

from	to	Description	Ground water
0.00	0.15	TOPSOIL: Firm light brown sandy clay with rootlets.	water seepage at 2.8m
0.15	0.60	Firm light brown sandy slightly gravelly CLAY with occasional cobbles.	
0.60	1.00	Soft to firm brown slightly sandy gravelly CLAY with occ. cobbles.	
1.00	2.00	Firm to stiff brown gravelly CLAY with some cobbles, occ. boulders.	
2.00	2.40	Firm brown sandy very gravelly CLAY with many cobbles, some boulders.	
2.40	2.80	Grey sandy clayey GRAVEL with many cobbles and some boulders.	

Notes: For full strata description please see TP Logs.

Field Data

Depth to Water (m)	Elapsed Time (min)
2.47	0.00
2.47	1.00
2.47	2.00
2.47	3.00
2.48	4.00
2.48	5.00
2.48	6.00
2.48	7.00
2.48	8.00
2.48	9.00
2.48	10.00
2.49	12.00
2.49	14.00
2.49	16.00
2.49	18.00
2.49	20.00
2.49	25.00
2.49	30.00

Field Test

Depth of Pit (D)	2.80	m
Width of Pit (B)	0.70	m
Length of Pit (L)	2.20	m

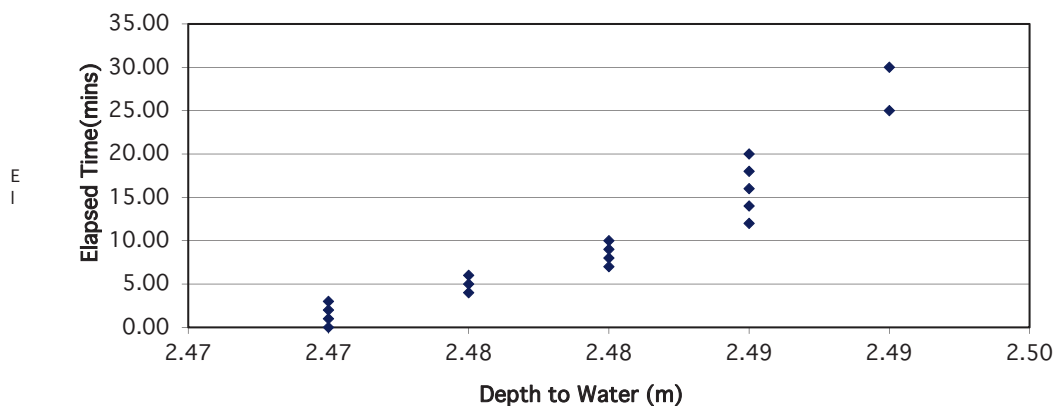
Initial depth to Water =	2.47	m
Final depth to water =	2.49	m
Elapsed time (mins)=	30.00	

Top of permeable soil		m
Base of permeable soil		m

Base area=	1.54	m ²
*Av. side area of permeable stratum over test period	1.856	m ²
Total Exposed area =	3.396	m ²

Infiltration rate (f) = Volume of water used/unit exposed area / unit time
f= 0.0003 m/min or 5.03861E-06 m/sec

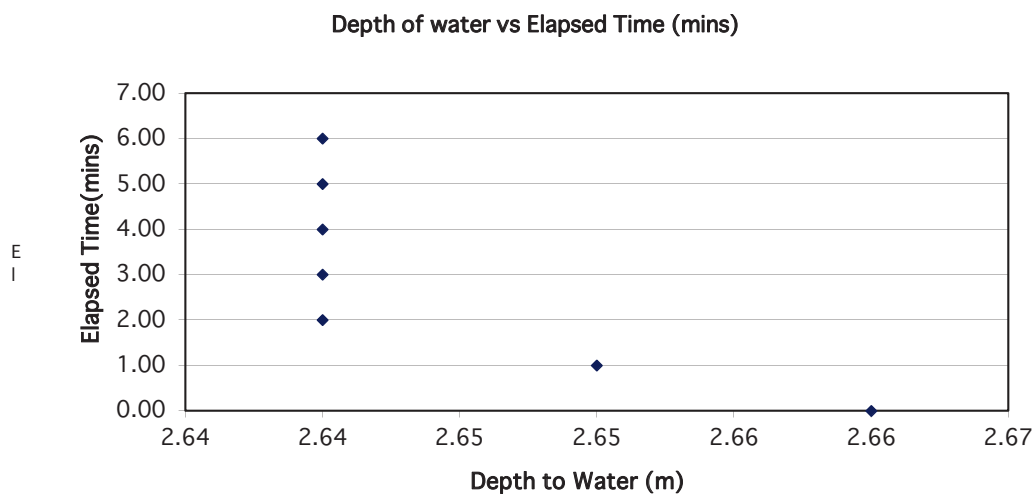
Depth of water vs Elapsed Time (mins)



Contract:	Halverstown	Contract No.	24330
Test No.	BRE SA06_A		
Client	DOBA		
Date:	26/04/2023		

from	to	Description	Ground water
0.00	0.10	TOPSOIL: Soft brown sandy clay.	water seepage at 2.5m
0.10	0.65	Firm brown sandy CLAY.	
0.65	1.40	Firm to stiff sandy gravelly CLAY with low cobble content.	
1.40	2.25	Firm brown sandy gravelly CLAY with some cobbles and rare boulders.	
2.25	3.10	Stiff grey slightly sandy very gravelly CLAY with some cobbles.	
3.10	3.30	Very stiff grey sandy gravelly CALY with some cobbles occ. boulders.	

Field Data		Field Test	
Depth to Water (m)	Elapsed Time (min)	Depth of Pit (D)	3.30 m
		Width of Pit (B)	0.70 m
		Length of Pit (L)	2.40 m
2.66	0.00	Initial depth to Water =	2.66 m
2.65	1.00	Final depth to water =	2.64 m
2.64	2.00	Elapsed time (mins)=	6.00
2.64	3.00		
2.64	4.00	Top of permeable soil	m
2.64	5.00	Base of permeable soil	m
2.64	6.00		
		Base area=	1.68 m ²
		*Av. side area of permeable stratum over test period =	4.03 m ²
		Total Exposed area =	5.71 m ²
		Infiltration rate (f) =	Volume of water used/unit exposed area / unit time
		f=	-0.001 m/min or -1.635E-05 m/sec

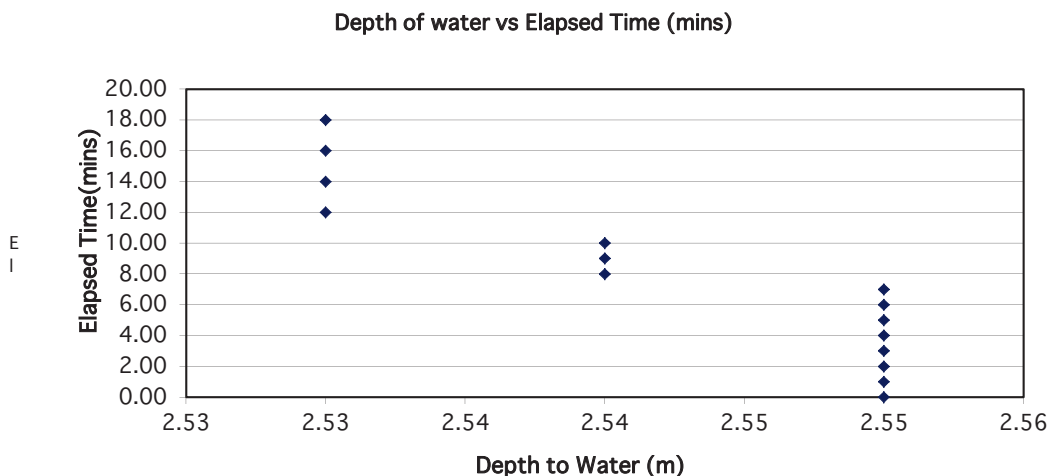


Contract:	Halverstown	Contract No.	24330
Test No.	BRE SA06_A1		
Client	DOBA		
Date:	26/04/2023		

from	to	Description	Ground water
0.00	0.10	TOPSOIL: Soft brown sandy clay.	water seepage at 2.5m
0.10	0.65	Firm brown sandy CLAY.	
0.65	1.40	Firm to stiff sandy gravelly CLAY with low cobble content.	
1.40	2.25	Firm brown sandy gravelly CLAY with some cobbles and rare boulders.	
2.25	3.10	Stiff grey slightly sandy very gravelly CLAY with some cobbles.	
3.10	3.30	Very stiff grey sandy gravelly CALY with some cobbles occ. boulders.	

Field Data	Field Test

Depth to Water (m)	Elapsed Time (min)			
2.55	0.00		Depth of Pit (D)	3.30 m
2.55	1.00		Width of Pit (B)	0.70 m
2.55	2.00		Length of Pit (L)	2.40 m
2.55	3.00			
2.55	4.00		Initial depth to Water =	2.55 m
2.55	5.00		Final depth to water =	2.53 m
2.55	6.00		Elapsed time (mins)=	18.00
2.55	7.00			
2.54	8.00		Top of permeable soil	
2.54	9.00		Base of permeable soil	
2.54	10.00			
2.53	12.00	*Av. side area of permeable stratum over test period	Base area=	1.68 m ²
2.53	14.00		Total Exposed area =	4.712 m ²
2.53	16.00			6.392 m ²
2.53	18.00			
		Infiltration rate (f) =	Volume of water used/unit exposed area / unit time	



		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown				TRIAL PIT NO. BRE SA01		SHEET Sheet 1 of 1				
LOGGED BY IC		CO-ORDINATES 686,287.89 E 719,888.50 N		DATE STARTED 28/04/2023		DATE COMPLETED 28/04/2023				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 84.73		EXCAVATION METHOD 13t Tracked Excavator						
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Firm light brown sandy clay with rootlets. Sand is fine to coarse.		0.15	84.58		AA198241	B	0.50-0.50	110	
	Firm light brown sandy slightly gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		0.60	84.13						
	Soft to firm orangish brown mottled black slightly sandy gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		1.00	83.73		AA198242	B	1.50-1.50	95	
1.0	Firm to stiff light brown slightly sandy gravelly CLAY with medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		2.00	82.73						
	Firm greyish brown sandy very gravelly CLAY with high cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		2.40	82.33		AA198243	B	2.50-2.50		
2.0	Brownish grey sandy clayey GRAVEL with high cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone (up to 500mm).		2.80	81.93						
	End of Trial Pit at 2.80m					AA198244	B	2.80-2.80		
3.0										
Groundwater Conditions Seepage at 2.80m										
Stability Unstable from 2.00m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.70m bgl. Soakaway test undertaken in pit (BRE SA01). Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown		TRIAL PIT NO. BRE SA02 SHEET Sheet 1 of 1								
LOGGED BY IC		CO-ORDINATES 686,134.44 E 719,803.48 N				DATE STARTED 28/04/2023 DATE COMPLETED 28/04/2023				
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 82.23				EXCAVATION METHOD 13t Tracked Excavator				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Firm light brown sandy clay with rootlets. Sand is fine to coarse.		0.15	82.08		AA198245	B	0.50-0.50	80	
	Firm light brown sandy slightly gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		0.50	81.73						
	Firm orangish brown sandy gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		1.30	80.93						
1.0	Firm to stiff light brown slightly sandy very gravelly CLAY with medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		2.60	79.63						
	TP terminated due to rapid water flow End of Trial Pit at 2.60m				 (Rapid)					
2.0										
3.0										
Groundwater Conditions Rapid water flow at 2.60m (rising 150mm after 14min)										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m bgl. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

		TRIAL PIT RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown		TRIAL PIT NO. BRE SA03 SHEET Sheet 1 of 1						
LOGGED BY IC		CO-ORDINATES 686,050.77 E 719,689.75 N			DATE STARTED 28/04/2023 DATE COMPLETED 28/04/2023			
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 79.68			EXCAVATION METHOD 13t Tracked Excavator			

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Firm brown sandy clay with rootlets. Sand is fine to coarse.		0.15	79.53	1 (Seepage) 2 (Rapid)	AA198249	B	0.50-0.50	87	
	Firm brown sandy slightly gravelly CLAY with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		0.30	79.38						
	Brownish grey very sandy GRAVEL with high cobble and medium boulder content, occasional pockets of clay. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone. (Possible gravelly sand).									
1.0	Firm yellowish grey sandy very gravelly CLAY with high cobble and medium boulder content, frequent pockets of sand. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		1.10	78.58						
										
2.0	Grey sandy clayey GRAVEL with high cobble and medium boulder content. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		2.00	77.68						
	TP terminated due to rapid water flow End of Trial Pit at 2.50m		2.50	77.18		AA198250	B	2.30-2.30		
3.0										

Groundwater Conditions
 Seepage at 1.40, rapid water flow at 2.40m (rising 150mm in 4min)

Stability
 Unstable, sidewall collapse from 0.40m

General Remarks
 Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.70m bgl. Pit backfilled with arisings.


IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

		TRIAL PIT RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown					TRIAL PIT NO. BRE SA04		SHEET Sheet 1 of 1	
LOGGED BY IC		CO-ORDINATES 686,270.92 E 719,493.31 N			DATE STARTED 28/04/2023		DATE COMPLETED 28/04/2023	
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 78.31			EXCAVATION METHOD 13t Tracked Excavator			

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Firm brown sandy clay with rootlets. Sand is fine to coarse. Firm brown sandy slightly gravelly CLAY. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Grey sandy slightly clayey GRAVEL with high cobble content, some pockets of clay. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone.		0.15	78.16	1  (Seepage)	AA198175	B	0.50-0.50	90 60	
			0.30	78.01						
1.0	Soft to firm dark grey slightly sandy very gravelly CLAY with high cobble content and occasional boulder. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone.		1.20	77.11		2  (Seepage)	AA198177	B		
2.0					3  (Seepage)	AA198178	B	2.50-2.50		
3.0	End of Trial Pit at 3.00m		3.00	75.31						

Groundwater Conditions Multiple seepages at 0.70m, 1.20m and 1.50m
Stability Unstable, sidewall collapse from 0.70m
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.70m bgl. Pit backfilled with arisings.

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

		TRIAL PIT RECORD						REPORT NUMBER 24330						
CONTRACT Halverstown		TRIAL PIT NO. BRE SA05 SHEET Sheet 1 of 1												
LOGGED BY IC		CO-ORDINATES 686,525.81 E 719,367.00 N				DATE STARTED 26/04/2023 DATE COMPLETED 26/04/2023								
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 78.84				EXCAVATION METHOD 13t Tracked Excavator								
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)				
						Sample Ref	Type	Depth						
0.0	TOPSOIL: Firm brown sandy clay with roolets. Sand is fine to coarse.		0.15	78.69	 (Moderate)	AA193198	B	0.70-0.70	68					
	Firm brown sandy slightly gravelly CLAY. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular.		0.40	78.44										
	Brownish grey slightly gravelly slightly clayey SAND with occasional cobbles. Sand is fine to coarse. Gravel is fine to coarse rounded to subangular. Cobbles are rounded to subangular of limestone		0.80	78.04										
1.0	Greyish brown SAND with occasional cobbles. Sand is fine to coarse. Cobbles are rounded to subangular of limestone.		1.70	77.14										
2.0	TP terminated due to major instability End of Trial Pit at 1.70m													
3.0														
Groundwater Conditions Moderate flow at 1.70m														
Stability Unstable from 0.60m														
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m bgl. Pit backfilled with arisings.														

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

		TRIAL PIT RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown		TRIAL PIT NO. BRE SA06			SHEET Sheet 1 of 1			
LOGGED BY IC		CO-ORDINATES 686,644.85 E 719,561.07 N			DATE STARTED 26/04/2023 DATE COMPLETED 26/04/2023			
CLIENT ENGINEER DOBA		GROUND LEVEL (m) 82.55			EXCAVATION METHOD 13t Tracked Excavator			

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown sandy clay with rootlets. Sand is fine to coarse. Firm brown sandy CLAY. Sand is fine to coarse.		0.10	82.45						
									78	
			0.65	81.90		AA198223	B	0.50-0.50		
	Firm to stiff sandy gravelly CLAY with low cobble content. Sand is fine to medium. Gravel is fine to medium subrounded to subangular.								97	
						AA198224	B	0.90-0.90		
1.0										
	Soft to firm light brown mottled golden brown and grey sandy gravelly CLAY with occasional pockets of sand, medium cobble content and rare boulders. Sand is fine to coarse. Gravel is fine to medium subrounded to subangular. Cobbles are rounded to subangular of limestone. Boulders are subrounded of limestone (up to 300mm).		1.40	81.15		AA198225	B	1.70-1.70		
2.0										
	Stiff occasionally very stiff grey slightly sandy very gravelly CLAY with medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded to subangular. Cobbles are rounded to subangular of limestone and mudstone.		2.25	80.30		AA198226	B	2.30-2.30		
										
3.0			3.10	79.45						
	Very stiff dark grey slightly sandy gravelly CLAY with medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subangular to angular. Cobbles are subangular of limestone. Boulder are subrounded of limestone (up to 500mm). End of Trial Pit at 3.30m		3.30	79.25		AA198227	B	3.20-3.20		
										


 (Seepage)

Groundwater Conditions
 Seepage at 2.50m

Stability
 Slightly unstable from 1.25m

General Remarks
 Pit footprint scanned using cable avoidance tool [CAT]. Shear vanes (set of three) carried out at 0.30m & 0.90m bgl. Soakaway tests (BRE SA01) carried out in pit. Pit backfilled with arisings.

IGSL TP LOG 24330.GPJ IGSL GDT 3/7/23

BRE SA01 – 1 of 5



BRE SA01 – 2 of 5



BRE SA01 – 3 of 5



BRE SA01 – 4 of 5



BRE SA01 – 5 of 5



BRE SA02 – 1 of 4



BRE SA02 – 2 of 4



BRE SA02 – 3 of 4



BRE SA02 – 4 of 4



BRE SA03 – 1 of 5



BRE SA03 – 2 of 5



BRE SA03 – 3 of 5



BRE SA03 – 4 of 5



BRE SA03 – 5 of 5



BRE SA04 – 1 of 4



BRE SA04 – 2 of 4



BRE SA04 – 3 of 4



BRE SA04 – 4 of 4



BRE SA05 – 1 of 5



BRE SA05 – 2 of 5



BRE SA05 – 3 of 5



BRE SA05 – 4 of 5



BRE SA05 – 5 of 5



BRE SA06 – 1 of 4



BRE SA06 – 2 of 4



BRE SA06 – 3 of 4



BRE SA06 – 4 of 4



Appendix 6
Resistivity Survey

6659d-005-Report

Halverstown Data Centre

Naas, Co. Kildare

Electrical Resistivity Testing

Report Status: Draft

MGX Project Number: 6659

MGX File Ref: 6659d-005.doc

21st of November 2022

Confidential Report To:

IGSL

Unit F
M7 Business Park
Newhall
Naas, Co. Kildare

**Report submitted by:
Minerex Geophysics Limited**

Unit F4, Maynooth Business Campus
Maynooth, Co. Kildare
Ireland
Tel.: 01-6510030
Fax.: 01-6510033
Email: info@mgx.ie

Issued by:

Hartmut Krahn (Senior Geophysicist)



Subsurface Geophysical Investigations

CONTENTS

1. INTRODUCTION.....	1
1.1 Background.....	1
1.2 Objectives.....	1
1.3 Site Description.....	1
1.4 Report	1
2. TESTING ON SITE	2
2.1 Methodology	2
2.2 Measurements.....	2
2.4 Site Work	3
3. RESULTS	4
4. REFERENCES	5

List of Tables, Maps and Figures:

Title	Pages	Document Reference
Table 1: VES Ground Resistivity Testing Results	4 x A4	6659d-Tab1.xls
Table 2: Soil Resistivity Testing Results	4 x A4	6659d-Tab2.xls
Map 1: Location Map	1 x A3	6659d_Map.dwg
Figure 1: Resistivity Testing using the Wenner Array	In Text	In Text

1. INTRODUCTION

1.1 Background

Minerex Geophysics Ltd. (MGX) carried out Resistivity Testing using the Wenner electrode configuration with two different methods for the Halverstown Data Center in Naas, Co. Kildare. The survey was commissioned by IGSL who are the main ground investigation contractor for the project. Eight deep vertical electrical sounding (VES) and 18 shallow soil resistivity (SR) tests were carried out. The coordinate system used on this site was Irish Transverse Mercator (ITM).

The test sequence was conducted as part of the overall ground investigation programme for the development of the data center. The purpose of the survey was to provide information to be used in the design and construction phases of the project.

These tests are conducted in order to increase the knowledge of the resistivity of the soil and rock and to assist with the design and installation of earthing systems and underground cabling systems. Soil resistivity depends on a number of factors like soil type, mineral content, temperature, moisture, salt content and compaction.

The methodology specified here encompasses onsite in-situ measurements and the presentation of the results, but does not include the design of the earthing or cabling system.

1.2 Objectives

The main objective of the geophysical survey was:

- To determine the electrical resistivity at a range of depths for each location

1.3 Site Description

The site is shown on Map 1 and the area consists of unused agricultural land.

1.4 Report

This report includes a location map of the resistivity testing locations and two tables of results. The client provided maps of the site and the digital versions were used as the background map in this report.

The indirect nature and the non-invasive survey methods must be taken into account when considering the results of this survey and Minerex Geophysics Limited, while using appropriate practice to execute the measurements and to present the data, give no guarantees in relation to the existing subsurface.

2. TESTING ON SITE

2.1 Methodology

The methodology consisted of using Vertical Electrical Sounding (VES) and Soil Resistivity (SR) in the Wenner electrode configuration at a range of electrode spacing agreed with the client prior to the fieldwork. The increase in the electrode spacing leads to an increase in the depth.

Two different electrical resistivity tests were used:

1 VES - Vertical Electrical Sounding – Deep

- Objective: Determine the resistivity for ground, soil and rock to a depth around 50m below ground level (bgl) and also as two tests in two directions (check for anisotropy).
- Purpose: This test is generally done to deliver values for the design of an earthing or grounding system
- Test Method: Four probe array in Wenner electrode configuration with expanding electrode spacing
- Spacings: 1, 2, 3, 4, 5, 7, 10, 15, 20, 30, 40 and 50m
- Directions: There are two tests done at each location in two orthogonal directions
- Instrument: Tigre Resistivity Meter (high power)
- Comment: This test includes the 'Soil Resistivity Test – Shallow' intrinsically

2 SR - Soil Resistivity Test – Shallow

- Objective: Determine the shallow soil around 1 – 3m bgl. In one direction
- Purpose: This test is generally done to deliver values for the design of the cable system
- Test Method: Four probe array in Wenner electrode configuration with three electrode spacings
- Spacings: 1, 2 and 3m
- Directions: The test is done in one direction
- Instrument: Tigre or Megger Resistivity Meter

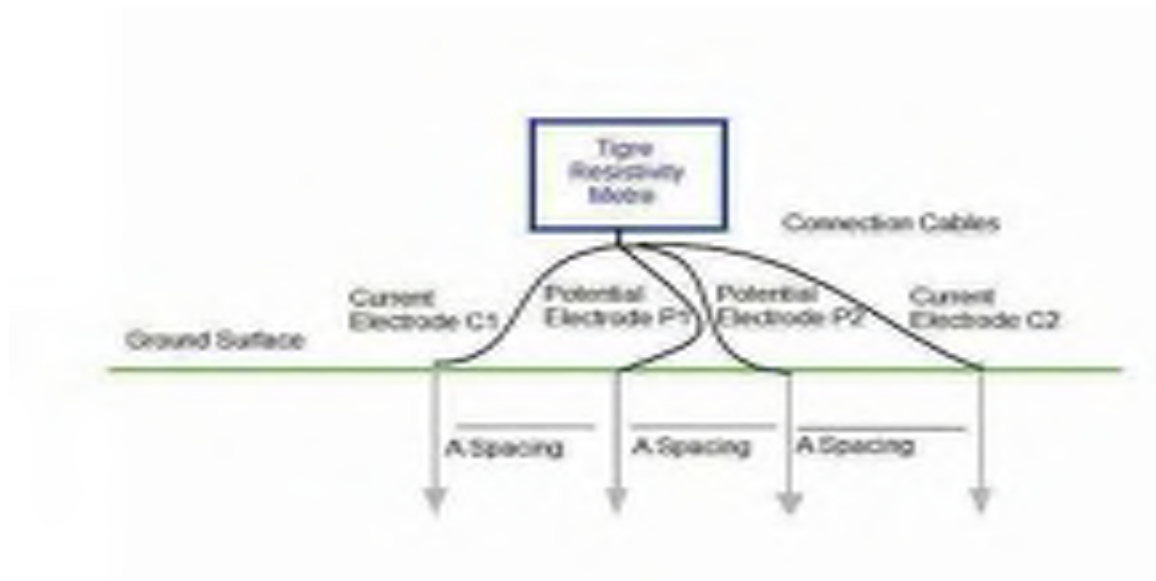
2.2 Measurements

Eight Vertical Electrical Soundings were conducted at four locations on the site.

All measurements were acquired in accordance with Minerex Geophysics Ltd. procedures, protocols, QC procedures and in compliance with appropriate IEEE and British Standards. The relevant IEEE standards are 81-1983 part 1 – Guide to Measuring Earth Resistivity, Ground Impedance, and Earth Surface Potentials of Ground Systems (ANSI/IEEE Std 81-1983) for the resistivity testing (IEEE 1983).

The Vertical Electrical Sounding (VES) and the soil resistivity (SR) was conducted using a Tigre Resistivity Meter with variable current input, a suite of four cables and four stainless steel electrodes. This 'four probe array' is called a Wenner Array as the spacing (A) between the four electrodes was the same for each measurement. At each electrode spacing, the test resistance in Ohms (Ω) was recorded in a detailed field sheet for later office-based computing of ground resistivities.

Figure 1: Resistivity Testing using the Wenner Array.



2.3 Testing Equipment

All equipment used was portable and intrinsically safe. The methods were non-destructive and non-intrusive. Only low voltage power requirements of 12 Volts or less were needed on site and were supplied by batteries. The following equipment was used:

- An ALLIED Tigre Resistivity Meter
- A suite of cables with 4 reels and distance marks for resistivity readings
- Stainless Steel Electrodes
- Measuring tapes
- Handheld GPS

Equipment checks and QC procedures were applied prior to the commencement of data acquisition.

2.4 Site Work

The data acquisition was carried out on the 9th – 10th of November 2022 in good weather conditions. Health and safety standards were adhered to at all times.

3. RESULTS

The recorded test resistance in Ω allows for the calculation of the resistivity value in Ωm for each individual electrode spacing.

The resistivity at a given electrode spacing was calculated using the following formula:

$$\rho = 2 \cdot \pi \cdot A \cdot R$$

Where;

ρ = Resistivity in Ωm

π = Pi = 3.141592

A = electrode spacing in m

R = Measured Resistance value in Ω

The survey results with electrode spacing, resistances and resistivities are displayed in Table 1 for the VES and in Table 2 for the SR.

The resistivity values recorded at given electrode spacing can be allocated to approximate depth values. For the Wenner array the average resistivity taken at a particular A-spacing is equal to the average resistivity for a depth range between the ground surface and the A-spacing. Therefore, the average resistivity value recorded in the last column of Table 1 and 2 corresponds to the depth range between 0m bgl and the value in the first column. The depth mentioned in this report is given for visualisation purpose but may change when using the resistivity values in the design of the earthing system.

4. REFERENCES

1. **IEEE, 1983.** ANSI/IEEE Std. 83-1983. IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and Earth Surface Potential of a Ground System. The Institute of Electrical and Electronics Engineers Inc.



Minerex Geophysics Limited Unit F4, Maynooth Business Campus Maynooth, Co. Kildare Tel: (0)1 6510030 Email: info@mgx.ie Web: www.mgx.ie	CLIENT	IGSL	SCALE: 1:3000 @ A3	LEGEND: ⊕ VES 1 Vertical Electrical Sounding in Wenner Electrode Configuration ○ SR 1 Soil Resistivity Testing in Wenner Electrode Configuration with A = 1, 2 and 3m
	PROJECT	Halverstown Data Centre Electrical Resistivity Testing	PROJECT: 6659	
	TITLE	Map 1: Location Map	DRAWN: JS	
			DATE: 11/11/2022	
			MGX FILE: 6659d_Map.dwg	
			STATUS: Draft	

Table 1: VES Ground Resistivity Testing Results

Location:	Direction:	ITM Coordinates East:	ITM Coordinates North:	Elevation:	Date:
VES 1A	SW-NE	686430.5	719396.9	78.3 mOD	09/11/2022
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	10.38	65
2	1	3	6	5.718	72
3	1.5	4.5	9	4.165	79
4	2	6	12	3.287	83
5	2.5	7.5	15	3.106	98
7	3.5	10.5	21	2.743	121
10	5	15	30	2.339	147
15	7.5	22.5	45	2.057	194
20	10	30	60	1.956	246
30	15	45	90	1.845	348
40	20	60	120	1.583	398
50	25	75	150	1.432	450

Table 1: VES Ground Resistivity Testing Results

Location:	Direction:	ITM Coordinates East:	ITM Coordinates North:	Elevation:	Date:
VES 1B	NW-SE	686430.5	719396.9	78.3 mOD	09/11/2022
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	11.79	74
2	1	3	6	5.254	66
3	1.5	4.5	9	4.215	79
4	2	6	12	3.66	92
5	2.5	7.5	15	3.106	98
7	3.5	10.5	21	2.622	115
10	5	15	30	2.339	147
15	7.5	22.5	45	2.198	207
20	10	30	60	2.148	270
30	15	45	90	1.95	368
40	20	60	120	1.625	408
50	25	75	150	1.411	443

Table 1: VES Ground Resistivity Testing Results

Location:	Direction:	ITM Coordinates East:	ITM Coordinates North:	Elevation:	Date:
VES 2A	SW-NE	686228.8	719577.5	79.8 mOD	09/11/2022
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	16.03	101
2	1	3	6	9.308	117
3	1.5	4.5	9	7.14	135
4	2	6	12	5.849	147
5	2.5	7.5	15	5.123	161
7	3.5	10.5	21	4.316	190
10	5	15	30	3.67	231
15	7.5	22.5	45	3.156	297
20	10	30	60	2.833	356
30	15	45	90	2.559	482
40	20	60	120	2.289	575
50	25	75	150	2.017	634

Table 1: VES Ground Resistivity Testing Results

Location:	Direction:	ITM Coordinates East:	ITM Coordinates North:	Elevation:	Date:
VES 2B	NW-SE	686228.8	719577.5	79.8 mOD	09/11/2022
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	16.74	105
2	1	3	6	9.368	118
3	1.5	4.5	9	7.21	136
4	2	6	12	5.899	148
5	2.5	7.5	15	5.123	161
7	3.5	10.5	21	4.235	186
10	5	15	30	3.66	230
15	7.5	22.5	45	2.874	271
20	10	30	60	2.561	322
30	15	45	90	2.208	416
40	20	60	120	1.919	482
50	25	75	150	1.734	545

Table 1: VES Ground Resistivity Testing Results

Location:	Direction:	ITM Coordinates East:	ITM Coordinates North:	Elevation:	Date:
VES 3A	NW-SE	686182.6	719887.4	84.1 mOD	09/11/2022
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	26.01	163
2	1	3	6	10.08	127
3	1.5	4.5	9	7.048	133
4	2	6	12	6.192	156
5	2.5	7.5	15	5.375	169
7	3.5	10.5	21	4.175	184
10	5	15	30	3.096	195
15	7.5	22.5	45	2.087	197
20	10	30	60	1.653	208
30	15	45	90	1.28	241
40	20	60	120	1.21	304
50	25	75	150	1.159	364

Table 1: VES Ground Resistivity Testing Results

Location:	Direction:	ITM Coordinates East:	ITM Coordinates North:	Elevation:	Date:
VES 3B	SW-NE	686182.6	719887.4	84.1 mOD	09/11/2022
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	25.29	159
2	1	3	6	10.38	130
3	1.5	4.5	9	6.815	128
4	2	6	12	5.546	139
5	2.5	7.5	15	4.921	155
7	3.5	10.5	21	4.134	182
10	5	15	30	3.136	197
15	7.5	22.5	45	2.168	204
20	10	30	60	1.593	200
30	15	45	90	1.23	232
40	20	60	120	1.149	289
50	25	75	150	1.139	358

Table 1: VES Ground Resistivity Testing Results

Location:	Direction:	ITM Coordinates East:	ITM Coordinates North:	Elevation:	Date:
VES 4A	S-N	686584.2	719775.4	83.7 mOD	10/11/2022
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	16.14	101
2	1	3	6	10.28	129
3	1.5	4.5	9	7.5	141
4	2	6	12	6.373	160
5	2.5	7.5	15	5.38	169
7	3.5	10.5	21	4.397	193
10	5	15	30	3.72	234
15	7.5	22.5	45	3.108	293
20	10	30	60	2.64	332
30	15	45	90	2.117	399
40	20	60	120	1.93	485
50	25	75	150	1.835	576

Table 1: VES Ground Resistivity Testing Results

Location:	Direction:	ITM Coordinates East:	ITM Coordinates North:	Elevation:	Date:
VES 4B	E-W	686584.2	719775.4	83.7 mOD	10/11/2022
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	17.44	110
2	1	3	6	10.8	136
3	1.5	4.5	9	7.957	150
4	2	6	12	6.55	165
5	2.5	7.5	15	5.677	178
7	3.5	10.5	21	4.42	194
10	5	15	30	3.64	229
15	7.5	22.5	45	3.065	289
20	10	30	60	2.62	329
30	15	45	90	2.218	418
40	20	60	120	1.936	487
50	25	75	150	1.79	562

Table 2: Soil Resistivity Testing Results

Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR1	77.3	686313.7	719440.5	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ωm)
1	0.5	1.5	3	9.328	59
2	1	3	6	5.506	69
3	1.5	4.5	9	4.044	76
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR2	80.2	686379.4	719542.2	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ωm)
1	0.5	1.5	3	17.54	110
2	1	3	6	7.866	99
3	1.5	4.5	9	5.748	108
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR3	80.2	686486.7	719502.1	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ωm)
1	0.5	1.5	3	18.35	115
2	1	3	6	9.681	122
3	1.5	4.5	9	6.363	120
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR4	80	686631.5	719449.5	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ωm)
1	0.5	1.5	3	15.02	94
2	1	3	6	9.293	117
3	1.5	4.5	9	6.595	124

Table 2: Soil Resistivity Testing Results

Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR5	79.1	686596.8	719360.7	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ωm)
1	0.5	1.5	3	13.21	83
2	1	3	6	6.686	84
3	1.5	4.5	9	4.366	82
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR6	77.8	686131.3	719548.2	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ωm)
1	0.5	1.5	3	20.27	127
2	1	3	6	11.69	147
3	1.5	4.5	9	8.531	161
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR7	79.3	686066.8	719650.2	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ωm)
1	0.5	1.5	3	17.74	111
2	1	3	6	11.88	149
3	1.5	4.5	9	8.884	167
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR8	81	686108.8	719712.6	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ωm)
1	0.5	1.5	3	15.93	100
2	1	3	6	9.651	121
3	1.5	4.5	9	7.362	139

Table 2: Soil Resistivity Testing Results

Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR9	83.2	686304.3	719778.6	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	24.7	155
2	1	3	6	12.2	153
3	1.5	4.5	9	8.632	163
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR10	85	686324.1	719911.2	09/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	21.73	137
2	1	3	6	11.39	143
3	1.5	4.5	9	9.389	177
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR11	82.9	686360.1	719707.1	10/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	14.11	89
2	1	3	6	9.681	122
3	1.5	4.5	9	7.311	138
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR12	83.7	686458.6	719674.4	10/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	18.48	116
2	1	3	6	9.82	123
3	1.5	4.5	9	6.9	130

Table 2: Soil Resistivity Testing Results

Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR13	83.7	686580.1	719629.3	10/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	16.08	101
2	1	3	6	9.03	113
3	1.5	4.5	9	6.04	114
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR14	82.2	686702.7	719592.2	10/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	13.71	86
2	1	3	6	8.219	103
3	1.5	4.5	9	6.287	119
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR15	85.1	686409.3	719906.7	10/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	13	82
2	1	3	6	7.64	96
3	1.5	4.5	9	6.353	120
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR16	84.8	686413.1	719754.8	10/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	26.2	165
2	1	3	6	13.4	168
3	1.5	4.5	9	8.85	167

Table 2: Soil Resistivity Testing Results

Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR17	80.6	686740.8	719669.9	10/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	15.02	94
2	1	3	6	8.54	107
3	1.5	4.5	9	6.13	116
Test Name:	Elevation:	ITM Coordinates East:	ITM Coordinates North:	Date:	Instrument:
SR18	80.6	686735.2	719782.1	10/11/2022	Tigre
Wenner Electrode Spacing a (m)	Inner Electrode P Distance to Centre (m)	Outer Electrode C Distance to Centre (m)	Total Distance (m)	Measured Resistance (Ω)	Apparent Resistivity (Ω m)
1	0.5	1.5	3	20.77	130
2	1	3	6	8.75	110
3	1.5	4.5	9	6.646	125


Appendix 7

Rotary Drillhole Logs & Photographs

		GEOTECHNICAL CORE LOG RECORD					REPORT NUMBER 24330						
CONTRACT Halverstown							DRILLHOLE NO RC01						
							SHEET Sheet 1 of 3						
CO-ORDINATES 686,380.19 E 719,855.77 N			RIG TYPE GEO-205				DATE DRILLED 16/05/2023						
GROUND LEVEL (mOD) 85.33			FLUSH Air/Mist				DATE LOGGED 17/05/2023						
CLIENT			INCLINATION (deg) -90				DRILLED BY IGSL -DH						
ENGINEER DOBA			CORE DIAMETER (mm)				LOGGED BY D. O'Shea						
Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)	
0					0 250 500			SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown, gravelly silty sandy CLAY with boulders				N = 13 (1, 2, 3, 3, 4, 3)	
1													
2													
3												N = 22 (3, 4, 3, 5, 6, 8)	
4													
5								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown, sandy gravelly CLAY with boulders	5.00	80.33		N = 49 (4, 6, 8, 11, 14, 16)	
6												N = 28 (3, 3, 5, 7, 7, 9)	
7													
8								SYMMETRIX DRILLING: No recovery, observed by driller as returns of damp grey/brown sandy, silty clayey GRAVEL	7.50	77.83		N = 16 (2, 3, 3, 3, 4, 6)	
9													
									9.60	75.73		N = 50 (4, 7, 10, 13, 12, 15)	
REMARKS								WATER STRIKE DETAILS					
Hole cased 0.00-14.80m								Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
								14.50	14.50	N/S			Seepage
								GROUNDWATER DETAILS					
INSTALLATION DETAILS								Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type									

IGSL RC Fl 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						DRILLHOLE NO RC01		
CO-ORDINATES 686,380.19 E 719,855.77 N						SHEET Sheet 2 of 3		
GROUND LEVEL (mOD) 85.33						RIG TYPE GEO-205 FLUSH Air/Mist		
CLIENT						INCLINATION (deg) -90		
ENGINEER DOBA						CORE DIAMETER (mm)		
DATE DRILLED 16/05/2023 DATE LOGGED 17/05/2023						DRILLED BY IGSL -DH LOGGED BY D. O'Shea		

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
10					0 250 500			SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey/brown clayey sandy coarse GRAVEL.	10.40	74.93		N = 65 (3, 5, 11, 14, 17, 23) N = 20/35 mm (7, 31, 20) N = 17/10 mm (33, 17)
11												
12												
13								Returns of brown, slightly sandy, clayey, medium to coarse GRAVEL with occasional cobble. Sand is fine to coarse, gravel is subangular.	14.80	70.53		
14												
15								SYMMETRIX DRILLING: No recovery, observed by driller as returns of possible weathered / dolomitised rock / crystalline calcite	16.30	69.03		
16												
17												
18												
19												

REMARKS						WATER STRIKE DETAILS					
Hole cased 0.00-14.80m						Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
						14.50	14.50	N/S			Seepage
						GROUNDWATER DETAILS					
INSTALLATION DETAILS						Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type							

IGSL RC FI 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD					REPORT NUMBER 24330						
CONTRACT Halverstown						DRILLHOLE NO RC01 SHEET Sheet 3 of 3							
CO-ORDINATES 686,380.19 E 719,855.77 N			RIG TYPE GEO-205 FLUSH Air/Mist			DATE DRILLED 16/05/2023 DATE LOGGED 17/05/2023							
GROUND LEVEL (mOD) 85.33			INCLINATION (deg) -90 CORE DIAMETER (mm)			DRILLED BY IGSL -DH LOGGED BY D. O'Shea							
CLIENT ENGINEER DOBA													
Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)	
20					0 250 500			SYMMETRIX DRILLING: No recovery, observed by driller as returns of possible weathered / dolomitised rock / crystalline calcite <i>(continued)</i>					
21													
22													
23													
24													
25									25.60	59.73			
26								End of Borehole at 25.60 m					
27													
28													
29													
REMARKS Hole cased 0.00-14.80m								WATER STRIKE DETAILS					
								Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
								14.50	14.50	N/S			Seepage
								GROUNDWATER DETAILS					
INSTALLATION DETAILS								Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type				17-05-23	25.60	14.80	3.50	Water level recorded 5 mins after end of drilling.	

IGSL RC FI 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						DRILLHOLE NO RC01A		
CO-ORDINATES 686,381.78 E 719,859.74 N						SHEET Sheet 1 of 3		
GROUND LEVEL (mOD) 85.33						RIG TYPE GEO-205 FLUSH Air/Mist		
CLIENT ENGINEER DOBA						INCLINATION (deg) -90 CORE DIAMETER (mm)		
DATE DRILLED 18/05/2023 DATE LOGGED 19/05/2023						DRILLED BY IGSL -DH LOGGED BY D. O'Shea		

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
0					0 250 500			SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown, gravelly silty sandy CLAY with boulders				
1												
2												
3												
4												
5								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown, sandy gravelly CLAY with boulders	5.00	80.33		
6												
7												
8								SYMMETRIX DRILLING: No recovery, observed by driller as returns of damp grey/brown sandy, silty clayey GRAVEL	7.50	77.83		
9												
								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey/brown gravelly sandy SILT.	9.60	75.73		

REMARKS						WATER STRIKE DETAILS					
Hole cased 0.00-17.10m						Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
						16.80	16.80	N/S			Seepage
						GROUNDWATER DETAILS					
INSTALLATION DETAILS						Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type							
19-05-23	19.60	5.00	19.60	50mm SP							

IGSL RC F1 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						DRILLHOLE NO RC01A		
CO-ORDINATES 686,381.78 E 719,859.74 N						SHEET Sheet 2 of 3		
GROUND LEVEL (mOD) 85.33						DATE DRILLED 18/05/2023 DATE LOGGED 19/05/2023		
CLIENT ENGINEER DOBA						RIG TYPE GEO-205 FLUSH Air/Mist INCLINATION (deg) -90 CORE DIAMETER (mm)		
DRILLED BY IGSL -DH LOGGED BY D. O'Shea								

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
10								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey/brown clayey sandy coarse GRAVEL.	10.40	74.93		
11												
12												
13												
14								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown, slightly clayey, sandy, GRAVEL with some boulders. Sand is fine to coarse, gravel is coarse.	14.80	70.53		N = 28/40 mm (10, 22, 28)
15												
16								Returns of orange/brown, sandy, gravelly CLAY to clayey GRAVEL. Sand is fine to coarse. Gravel is angular to subangular fine to coarse of highly weathered limestone / crystalline calcite. Possible calcite-filled fault.	17.10	68.23		N = 23/20 mm (16, 27, 23)
17												
18								SYMMETRIX DRILLING: No recovery, observed by driller as returns of possible weathered rock / dolomitised rock / crystalline calcite	18.70	66.63		N = 30/50 mm (13, 22, 30)
19												

REMARKS					WATER STRIKE DETAILS					
Hole cased 0.00-17.10m					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
					16.80	16.80	N/S			Seepage
					GROUNDWATER DETAILS					
INSTALLATION DETAILS					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type						
19-05-23	19.60	5.00	19.60	50mm SP						

IGSL RC FI 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD										REPORT NUMBER 24330	
CONTRACT Halverstown												DRILLHOLE NO RC01A	
CO-ORDINATES 686,381.78 E 719,859.74 N												SHEET Sheet 3 of 3	
GROUND LEVEL (mOD) 85.33												RIG TYPE GEO-205 FLUSH Air/Mist	
CLIENT												DATE DRILLED 18/05/2023	
ENGINEER DOBA												DATE LOGGED 19/05/2023	
INCLINATION (deg) -90												DRILLED BY IGSL -DH	
CORE DIAMETER (mm)												LOGGED BY D. O'Shea	
Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)	
20					0 250 500			SYMMETRIX DRILLING: No recovery, observed by driller as returns of possible weathered rock / dolomitised rock / crystalline calcite (<i>continued</i>)					
21													
22								End of Borehole at 22.00 m	22.00	63.33			
23													
24													
25													
26													
27													
28													
29													
REMARKS								WATER STRIKE DETAILS					
Hole cased 0.00-17.10m								Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
								16.80	16.80	N/S			Seepage
								GROUNDWATER DETAILS					
								Date	Hole Depth	Casing Depth	Depth to Water	Comments	
INSTALLATION DETAILS													
Date	Tip Depth	RZ Top	RZ Base	Type									
19-05-23	19.60	5.00	19.60	50mm SP	19-05-23	22.00	17.10	6.00	Water level recorded 5 mins after end of drilling.				

IGSL RC FI 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD					REPORT NUMBER 24330						
CONTRACT Halverstown						DRILLHOLE NO RC02							
						SHEET Sheet 1 of 2							
CO-ORDINATES 686,605.34 E 719,802.34 N			RIG TYPE GEO-205			DATE DRILLED 11/05/2023							
GROUND LEVEL (mOD) 82.92			FLUSH Air/Mist			DATE LOGGED 12/05/2023							
CLIENT			INCLINATION (deg) -90			DRILLED BY IGSL -DH							
ENGINEER DOBA			CORE DIAMETER (mm) 78			LOGGED BY D. O'Shea							
Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)	
0					0 250 500			SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy, clayey GRAVEL.					
1												N = 12 (1, 1, 2, 3, 3, 4)	
2												N = 21 (2, 3, 4, 5, 5, 7)	
3												N = 30 (3, 3, 5, 8, 9, 8)	
4												N = 44 (4, 5, 8, 11, 11, 14)	
5												N = 60/135 mm (7, 13, 28, 32)	
6												N = 33/45 mm (16, 27, 33)	
7													
8		0	0	0									
9													
REMARKS								WATER STRIKE DETAILS					
Hole cased 0.00-15.10m								Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
								11.80	11.80	N/S			Seepage
INSTALLATION DETAILS								GROUNDWATER DETAILS					
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments				
12-05-23	19.70	5.00	19.70	50mm SP									

IGSL RC FI 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD						REPORT NUMBER 24330	
CONTRACT Halverstown							DRILLHOLE NO RC02 SHEET Sheet 2 of 2		
CO-ORDINATES 686,605.34 E 719,802.34 N				RIG TYPE GEO-205 FLUSH Air/Mist			DATE DRILLED 11/05/2023 DATE LOGGED 12/05/2023		
GROUND LEVEL (mOD) 82.92				INCLINATION (deg) -90 CORE DIAMETER (mm) 78			DRILLED BY IGSL -DH LOGGED BY D. O'Shea		
CLIENT ENGINEER DOBA									

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
10								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy, clayey GRAVEL. (continued)				N = 60/125 mm (8, 14, 31, 29)
11												
12												N = 10/25 mm (15, 40, 10)
13												
14								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey/brown gravelly CLAY.	13.90	69.02		N = 50/60 mm (50, 50)
15	15.10							Strong to very strong, thickly to medium bedded, light blue/grey, sandy, fine grained LIMESTONE (possibly locally slightly dolomitised, stromatactitic structure with abundant calcite veining), slightly weathered.	15.10	67.82		
16		100	65	65				Discontinuities are medium to closely spaced, smooth to very locally rough, planar. Apertures are tight to locally moderately open, locally clay smeared (at 16.36m), calcite veined (1-10mm thick), and slight iron oxide staining. Dips are subhorizontal to locally 30°				
17	16.60											
18	17.35	100	73	73								
19	18.15	100	94	94								
	19	100	92	92								
	19.70							End of Borehole at 19.70 m	19.70	63.22		

REMARKS						WATER STRIKE DETAILS					
Hole cased 0.00-15.10m						Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
						11.80	11.80	N/S			Seepage
						GROUNDWATER DETAILS					
INSTALLATION DETAILS						Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type		12-05-23	19.70	15.10	3.40	Water level recorded 5 mins after end of drilling.	
12-05-23	19.70	5.00	19.70	50mm SP							

IGSL RC Fl 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD					REPORT NUMBER 24330		
CONTRACT Halverstown							DRILLHOLE NO RC03		
CO-ORDINATES 686,184.03 E 719,576.09 N							SHEET Sheet 2 of 2		
GROUND LEVEL (mOD) 79.37							RIG TYPE GEO-205 FLUSH Air/Mist		
CLIENT							DATE DRILLED 15/05/2023		
ENGINEER DOBA							DATE LOGGED 16/05/2023		
INCLINATION (deg) -90							DRILLED BY IGSL -DH		
CORE DIAMETER (mm) 78							LOGGED BY D. O'Shea		

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
10		100	67	59				Weak to strong, thickly to thinly bedded, light blue/grey, fine-grained, LIMESTONE (possibly locally slightly dolomitised, stromatactitic structure with abundant calcite veining), slightly weathered.				
11	11.30							Discontinuities are widely to closely spaced, smooth to very locally rough, planar. Apertures are tight to locally moderately open, locally clay smeared (at 9.38m), calcite veined (1-10mm thick), and slight iron oxide staining. Dips are subhorizontal to locally 30° and 45°. <i>(continued)</i>				
12		100	64	62								
13	12.60											
14	13.40	100	38	38								
	14.10	100	60	60				End of Borehole at 14.10 m	14.10	65.27		
15												
16												
17												
18												
19												

REMARKS					WATER STRIKE DETAILS					
Hole cased 0.00-8.80m					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
					5.90	5.90	6.40			Seepage
					GROUNDWATER DETAILS					
					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type	16-05-23	14.10	8.80	1.70	Water level recorded 5 mins after end of drilling.	
16-05-23	14.10	5.00	14.10	50mm SP						

IGSL RC FI 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						DRILLHOLE NO RC04		
CO-ORDINATES 686,446.74 E 719,398.98 N						SHEET Sheet 1 of 2		
GROUND LEVEL (mOD) 78.32						RIG TYPE GEO-205 FLUSH Air/Mist		
CLIENT						DATE DRILLED 09/05/2023		
ENGINEER DOBA						DATE LOGGED 10/05/2023		
INCLINATION (deg) -90						DRILLED BY IGSL -DH		
CORE DIAMETER (mm) 78						LOGGED BY D. O'Shea		

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
0					0 250 500			SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey/brown, sandy silty, clayey GRAVEL				
1												N = 9 (1, 1, 2, 2, 2, 3)
2												N = 16 (1, 2, 3, 4, 4, 5)
3												N = 33 (2, 5, 6, 8, 8, 11)
4												N = 54 (5, 6, 9, 13, 16, 16)
5												N = 52 (7, 13, 11, 11, 14, 16)
6	0	0	0									N = 62 (6, 6, 9, 12, 18, 23)
7												
8												
9												

REMARKS					WATER STRIKE DETAILS					
Hole cased 0.00-11.60m					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
					5.40	5.40	6.40			Seepage
					GROUNDWATER DETAILS					
INSTALLATION DETAILS					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type						
10-05-23	16.90	5.00	16.90	50mm SP						

IGSL RC FI 10M 24330.GPJ IGSL.GDT 7/7/23

		GEOTECHNICAL CORE LOG RECORD					REPORT NUMBER 24330		
CONTRACT Halverstown							DRILLHOLE NO RC04		
CO-ORDINATES 686,446.74 E 719,398.98 N							SHEET Sheet 2 of 2		
GROUND LEVEL (mOD) 78.32							RIG TYPE GEO-205 FLUSH Air/Mist		
CLIENT							DATE DRILLED 09/05/2023		
ENGINEER DOBA							DATE LOGGED 10/05/2023		
INCLINATION (deg) -90							DRILLED BY IGSL -DH		
CORE DIAMETER (mm) 78							LOGGED BY D. O'Shea		

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Spacing Log (mm)	Non-intact Zone	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
10								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey/brown, sandy silty, clayey GRAVEL (continued)	10.60	67.72		N = 50/90 mm (8, 18, 30, 20)
11								SYMMETRIX DRILLING: No recovery, observed by driller as returns of possible weathered rock.				
11.60									11.60	66.72		
12		100	30	30				Weak to very strong, thickly to thinly bedded, dark blue/grey, fine-grained LIMESTONE (interbedded calcisiltite and argillaceous layers), slightly weathered.				
12.60								Discontinuities are widely to closely spaced, smooth to very locally rough, planar. Apertures are tight to locally moderately open, locally clay smeared, calcite layered (at 15.12-15.26m), clay/gravel-filled (at 13.29-13.34m and 15.37-15.68m). Dips are subhorizontal to locally 30° and 45°.				
13		100	46	28								
13.10												
14		100	54	45								
14.10												
15		100	59	47								
15.60												
16		100	58	58								
16.90									16.90	61.42		
17								End of Borehole at 16.90 m				
18												
19												

REMARKS					WATER STRIKE DETAILS					
Hole cased 0.00-11.60m					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
					5.40	5.40	6.40			Seepage
					GROUNDWATER DETAILS					
INSTALLATION DETAILS					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type	10-05-23	16.90	11.60	3.50	Water level recorded 5 mins after end of drilling.	
10-05-23	16.90	5.00	16.90	50mm SP						

IGSL RC FI 10M 24330.GPJ IGSL.GDT 7/7/23

RC01 Box 1 of 1 – 14.80-16.30m



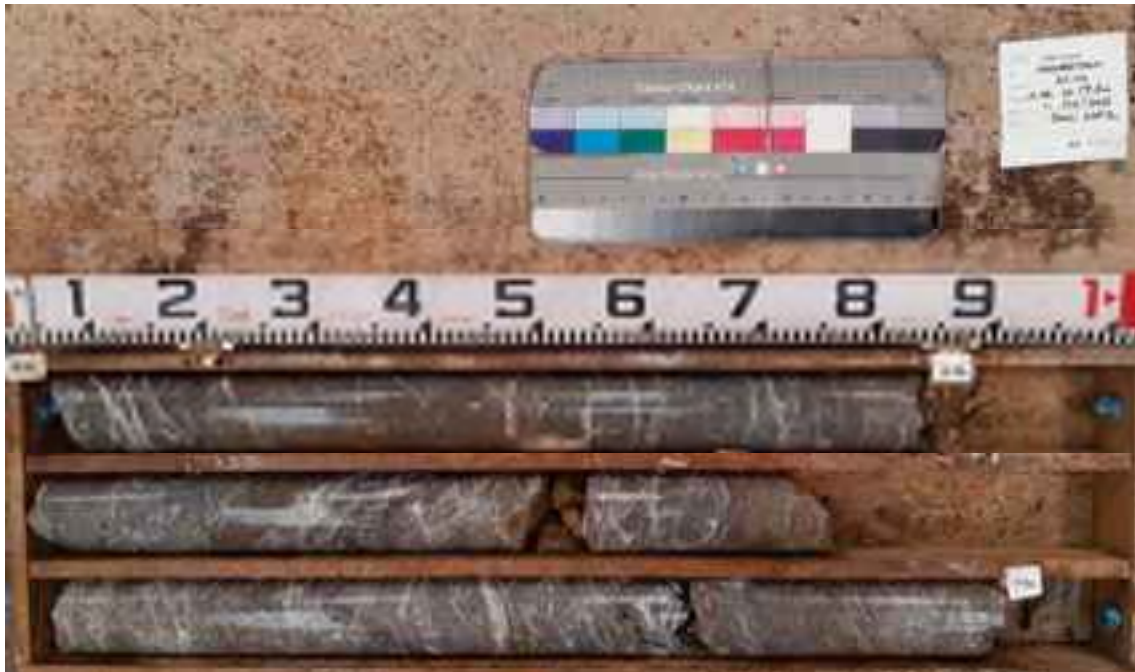
RC01A Box 1 of 1 – 17.30-18.70m



RC02 Box 1 of 2 – 15.10-17.35m



RC02 Box 2 of 2 – 17.35-19.70m



RC03 Box 1 of 3 – 8.80-11.30m



RC03 Box 2 of 3 – 11.30-13.40m



RC03 Box 3 of 3 – 13.40-14.10m



RC04 Box 1 of 2 – 11.60-14.10m



RC04 Box 2 of 2 – 14.10-16.90m



Appendix 8

Rotary Openhole Drilling Records

		OPEN HOLE DRILLING RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						DRILLHOLE NO TPRO-01 SHEET Sheet 1 of 1		
CO-ORDINATES 686,146.21 E 719,928.64 N			RIG TYPE GEO-205			DATE DRILLED 28/04/2023 DATE LOGGED 28/04/2023		
GROUND LEVEL (mOD) 84.06			INCLINATION (deg) -90 HOLE DIAMETER (mm) 78			DRILLED BY IGSL -DH		
CLIENT ENGINEER DOBA								

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
0									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY				
1		0	0	0									
1.50													N = 33 (19, 13, 11, 9, 8, 5)
2		0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown clayey sandy GRAVEL	2.20	81.86		
2.80									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY	2.80	81.26		N = 19 (7, 4, 3, 5, 6, 5)
3													
3.00									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown slightly clayey sandy GRAVEL	3.50	80.56		
4		0	0	0									
4.50									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY	4.30	79.76		N = 26 (4, 5, 7, 6, 6, 7)
5		0	0	0									
5.00									End of Borehole at 5.00 m	5.00	79.06		N = 28 (3, 6, 5, 6, 8, 9)

REMARKS					WATER STRIKE DETAILS					
Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.00m					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
					3.50	3.50	N/S			Seepage
					GROUNDWATER DETAILS					
INSTALLATION DETAILS					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type	28-04-23	5.00	5.00	4.90	Water level recorded 5 mins after end of drilling.	
28-04-23	5.00	1.00	5.00	50mm SP						

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

		OPEN HOLE DRILLING RECORD					REPORT NUMBER 24330		
CONTRACT Halverstown							DRILLHOLE NO TPRO-02		
CO-ORDINATES 686,088.11 E 719,822.59 N							SHEET Sheet 1 of 1		
GROUND LEVEL (mOD) 82.52							RIG TYPE GEO-205		
CLIENT							INCLINATION (deg) -90		
ENGINEER DOBA							HOLE DIAMETER (mm) 78		
DATE DRILLED 02/05/2023							DATE LOGGED 02/05/2023		
DRILLED BY IGSL -DH									

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
0									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY				
1		0	0	0									
1.50													N = 26 (2, 3, 5, 7, 6, 8)
2		0	0	0						2.50	80.02		
3									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty sandy gravelly CLAY				N = 21 (1, 3, 6, 4, 5, 6)
3.00		0	0	0						3.90	78.62		
4									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown clayey sandy GRAVEL				N = 31 (2, 3, 6, 7, 9, 9)
4.50		0	0	0						5.00	77.52		
5									End of Borehole at 5.00 m				N = 36 (3, 5, 8, 8, 9, 11)

REMARKS					WATER STRIKE DETAILS					
Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.00m					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
					4.40	4.40	N/S			Seepage
					GROUNDWATER DETAILS					
INSTALLATION DETAILS					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type	02-05-23	5.00	5.00	4.80	Water level recorded 5 mins after end of drilling.	
02-05-23	5.00	1.00	5.00	50mm SP						

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

 OPEN HOLE DRILLING RECORD REPORT NUMBER 24330														
CONTRACT Halverstown							DRILLHOLE NO TPRO-03 SHEET Sheet 1 of 1							
CO-ORDINATES 686,271.71 E 719,722.30 N				RIG TYPE GEO-205			DATE DRILLED 02/05/2023							
GROUND LEVEL (mOD) 81.63				INCLINATION (deg) -90			DATE LOGGED 02/05/2023							
CLIENT ENGINEER DOBA				HOLE DIAMETER (mm) 78			DRILLED BY IGSL -DH							
Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)	
0									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY					
1	1.50	0	0	0									N = 16 (1, 3, 3, 4, 5, 4)	
2		0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty sandy gravelly CLAY	2.20	79.43			
3	3.00												N = 16 (1, 1, 3, 2, 5, 6)	
4		0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY	3.60	78.03			
5	4.50								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty sandy gravelly CLAY	4.50	77.13		N = 31 (2, 3, 6, 7, 9, 9)	
	5.20	0	0	0					End of Borehole at 5.20 m	5.20	76.43		N = 36 (3, 5, 8, 8, 9, 11)	
REMARKS									WATER STRIKE DETAILS					
Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.20m									Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
														No water strike recorded
									GROUNDWATER DETAILS					
INSTALLATION DETAILS									Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type					02-05-23	5.20	5.20	Dry	Water level recorded 5 mins after end of drilling.	
02-05-23	5.20	1.00	5.20	50mm SP										

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

		OPEN HOLE DRILLING RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						DRILLHOLE NO TPRO-04 SHEET Sheet 1 of 1		
CO-ORDINATES 686,162.93 E 719,657.11 N			RIG TYPE GEO-205			DATE DRILLED 03/05/2023 DATE LOGGED 03/05/2023		
GROUND LEVEL (mOD) 80.28			INCLINATION (deg) -90			DRILLED BY IGSL -DH		
CLIENT ENGINEER DOBA			HOLE DIAMETER (mm) 78					

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
0							0 250 500		SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY				
1		0	0	0						1.30	78.98		N = 11 (2, 1, 2, 3, 3, 3)
	1.50								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty sandy gravelly CLAY	1.80	78.48		
2		0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY	2.40	77.88		N = 20 (3, 5, 3, 5, 6, 6)
	3.00								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty sandy gravelly CLAY	3.70	76.58		
4		0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of dark grey slightly clayey sandy GRAVEL	5.00	75.28		N = 44 (2, 6, 7, 11, 12, 14)
	4.50	0	0	0									N = 39 (5, 6, 9, 8, 9, 13)
5	5.00								End of Borehole at 5.00 m				

REMARKS					WATER STRIKE DETAILS					
Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.00m					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
					4.50	4.50	N/S			Seepage
					GROUNDWATER DETAILS					
INSTALLATION DETAILS					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type	03-05-23	5.00	5.00	4.70	Water level recorded 5 mins after end of drilling.	
03-05-23	5.00	1.00	5.00	50mm SP						

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

 OPEN HOLE DRILLING RECORD REPORT NUMBER 24330														
CONTRACT Halverstown							DRILLHOLE NO TPRO-05 SHEET Sheet 1 of 1							
CO-ORDINATES 686,383.86 E 719,788.02 N				RIG TYPE GEO-205			DATE DRILLED 05/05/2023 DATE LOGGED 05/05/2023							
GROUND LEVEL (mOD) 84.64				INCLINATION (deg) -90			DRILLED BY IGSL -DH							
CLIENT ENGINEER DOBA				HOLE DIAMETER (mm) 78										
Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)	
0									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty sandy gravelly CLAY					
1	1.50	0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown clayey sandy GRAVEL	1.60	83.04		N = 12 (1, 2, 3, 2, 4, 3)	
2		0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY	2.00	82.64			
3	3.00												N = 27 (2, 4, 5, 7, 7, 8)	
4	4.50	0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown clayey sandy GRAVEL	4.60	80.04		N = 47 (3, 6, 7, 9, 14, 17)	
5	5.10								End of Borehole at 5.10 m	5.10	79.54		N = 64 (5, 9, 11, 16, 17, 20)	
REMARKS									WATER STRIKE DETAILS					
Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.10m									Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
														No water strike recorded
									GROUNDWATER DETAILS					
INSTALLATION DETAILS									Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type					05-05-23	5.10	5.10	Dry	Water level recorded 5 mins after end of drilling.	
05-05-23	5.10	1.00	5.10	50mm SP										

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

 OPEN HOLE DRILLING RECORD REPORT NUMBER 24330															
CONTRACT Halverstown							DRILLHOLE NO TPRO-06								
CO-ORDINATES 686,487.53 E 719,815.50 N							SHEET Sheet 1 of 1								
GROUND LEVEL (mOD) 85.03							RIG TYPE GEO-205								
CLIENT							INCLINATION (deg) -90								
ENGINEER DOBA							HOLE DIAMETER (mm) 78								
DATE DRILLED 04/05/2023							DATE LOGGED 04/05/2023								
DRILLED BY IGSL -DH															
Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)		
0									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY						
1		0	0	0											
1.50													N = 15 (1, 2, 2, 4, 5, 4)		
2		0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty sandy gravelly CLAY	2.20	82.83				
3													N = 19 (2, 3, 3, 4, 5, 7)		
3.00															
4		0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty clayey sandy GRAVEL	3.70	81.33				
4.50									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown clayey sandy GRAVEL	4.10	80.93		N = 30 (2, 2, 5, 7, 8, 10)		
5		0	0	0											
5.00									End of Borehole at 5.00 m	5.00	80.03		N = 56 (4, 7, 13, 14, 14, 15)		
REMARKS										WATER STRIKE DETAILS					
Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.00m										Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
															No water strike recorded
										GROUNDWATER DETAILS					
INSTALLATION DETAILS										Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type						04-05-23	5.00	5.00	Dry	Water level recorded 5 mins after end of drilling.	

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

		OPEN HOLE DRILLING RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						DRILLHOLE NO TPRO-07 SHEET Sheet 1 of 1		
CO-ORDINATES 686,613.61 E 719,733.59 N				RIG TYPE GEO-205		DATE DRILLED 05/05/2023 DATE LOGGED 05/05/2023		
GROUND LEVEL (mOD) 82.86				INCLINATION (deg) -90		DRILLED BY IGSL -DH		
CLIENT ENGINEER DOBA				HOLE DIAMETER (mm) 78				

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
0							0 250 500		SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY				
1		0	0	0						1.30	81.56		N = 11 (1, 1, 2, 3, 3, 3)
2	1.50								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty sandy gravelly CLAY				
3		0	0	0						2.70	80.16		N = 25 (2, 4, 3, 5, 7, 10)
4	3.00								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY				
5		0	0	0						4.60	78.26		N = 34 (3, 5, 5, 8, 9, 12)
	4.50								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty clayey sandy GRAVEL				
	5.10								End of Borehole at 5.10 m	5.10	77.76		N = 56 (6, 7, 10, 13, 16, 17)

REMARKS Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.10m					WATER STRIKE DETAILS					
					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
										No water strike recorded
INSTALLATION DETAILS					GROUNDWATER DETAILS					
					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type	Date	Hole Depth	Casing Depth	Depth to Water	Comments	
05-05-23	5.10	1.00	5.10	50mm SP	05-05-23	5.10	5.10	Dry	Water level recorded 5 mins after end of drilling.	

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

 OPEN HOLE DRILLING RECORD REPORT NUMBER 24330														
CONTRACT Halverstown							DRILLHOLE NO TPRO-08 SHEET Sheet 1 of 1							
CO-ORDINATES 686,443.99 E 719,589.92 N				RIG TYPE GEO-205			DATE DRILLED 08/05/2023							
GROUND LEVEL (mOD) 81.40				INCLINATION (deg) -90			DATE LOGGED 08/05/2023							
CLIENT ENGINEER DOBA				HOLE DIAMETER (mm) 78			DRILLED BY IGSL -DH							
Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)	
0									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY					
1	1.50	0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown silty sandy gravelly CLAY	1.20	80.20		N = 13 (1, 1, 2, 3, 3, 5)	
2		0	0	0					SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY	2.40	79.00		N = 51 (2, 4, 7, 13, 15, 16)	
3	3.00								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey black gravelly CLAY	3.20	78.20		N = 59 (3, 7, 10, 12, 18, 19)	
4	4.50	0	0	0										
5	5.20								End of Borehole at 5.20 m	5.20	76.20		N = 34/40 mm (6, 15, 34)	
REMARKS									WATER STRIKE DETAILS					
Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.20m									Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
														No water strike recorded
									GROUNDWATER DETAILS					
INSTALLATION DETAILS									Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type					08-05-23	5.20	5.20	Dry	Water level recorded 5 mins after end of drilling.	

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

		OPEN HOLE DRILLING RECORD					REPORT NUMBER 24330	
CONTRACT Halverstown						DRILLHOLE NO TPRO-09 SHEET Sheet 1 of 1		
CO-ORDINATES 686,263.95 E 719,467.48 N				RIG TYPE GEO-205		DATE DRILLED 03/05/2023 DATE LOGGED 03/05/2023		
GROUND LEVEL (mOD) 77.31				INCLINATION (deg) -90 HOLE DIAMETER (mm) 78		DRILLED BY IGSL -DH		
CLIENT ENGINEER DOBA								

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
0									SYMMETRIX DRILLING: No recovery, observed by driller as returns of brown PEAT				
1		0	0	0						1.20	76.11		N = 7 (1, 0, 1, 1, 2, 3)
2	1.50								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey silty SAND (Blowing)				
3		0	0	0						3.40	73.91		N = 7 (0, 1, 0, 1, 2, 4)
4	3.00								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey silty gravelly SAND (Blowing)				
5		0	0	0						4.20	73.11		N = 41 (2, 3, 6, 11, 12, 12)
	4.50								SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey silty sandy GRAVEL				
		0	0	0						5.20	72.11		N = 39 (5, 6, 9, 8, 9, 13)
	5.20								End of Borehole at 5.20 m				

REMARKS					WATER STRIKE DETAILS					
Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.20m					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
					4.00	4.00	N/S			Seepage
					GROUNDWATER DETAILS					
INSTALLATION DETAILS					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type	03-05-23	5.20	5.20	4.80	Water level recorded 5 mins after end of drilling.	
03-05-23	5.20	1.00	5.20	50mm SP						

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

		OPEN HOLE DRILLING RECORD				REPORT NUMBER 24330	
CONTRACT Halverstown					DRILLHOLE NO TPRO-10 SHEET Sheet 1 of 1		
CO-ORDINATES 686,489.99 E 719,460.74 N			RIG TYPE GEO-205		DATE DRILLED 08/05/2023 DATE LOGGED 08/05/2023		
GROUND LEVEL (mOD) 79.60			INCLINATION (deg) -90 HOLE DIAMETER (mm) 78		DRILLED BY IGSL -DH		
CLIENT ENGINEER DOBA							

Downhole Depth (m)	Core Run Depth (m)	T.C.R.%	S.C.R.%	R.Q.D.%	Fracture Zones (m)	Fracture Spacing Min Avg Max (mm)	Fracture Spacing Log (mm)	Legend	Description	Depth (m)	Elevation	Standpipe Details	SPT (N Value)
0							0 250 500		SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey brown sandy gravelly CLAY				
1		0	0	0									
1.50													N = 16 (2, 3, 4, 4, 3, 5)
2		0	0	0						2.30	77.30		
									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey silty sandy CLAY	2.70	76.90		
3									SYMMETRIX DRILLING: No recovery, observed by driller as returns of grey black gravelly CLAY				N = 48 (4, 5, 8, 9, 14, 17)
3.00		0	0	0									
4													
4.50		0	0	0									N = 50/105 mm (6, 8, 22, 28)
5										5.10	74.50		
5.10									End of Borehole at 5.10 m				N = 25/25 mm (12, 25, 25)

REMARKS Rock and soil descriptions are based on examination of drilling returns. These samples can be heavily disturbed and fragmented, with a loss of fines. Typical fragments of 2 to 3 mm are recovered. Accurate descriptions are not, therefore, possible. Similarly, it is not possible to accurately assess soil stratification or rock condition/structure. Hole cased 0.00-5.10m					WATER STRIKE DETAILS					
					Water Strike	Casing Depth	Sealed At	Rise To	Time (min)	Comments
										No water strike recorded
INSTALLATION DETAILS					GROUNDWATER DETAILS					
					Date	Hole Depth	Casing Depth	Depth to Water	Comments	
Date	Tip Depth	RZ Top	RZ Base	Type	08-05-23	5.10	5.10	Dry	Water level recorded 5 mins after end of drilling.	

IGSL RC OPEN HOLE 24330.GPJ IGSLGDT 3/7/23

Appendix 9

Groundwater Monitoring

Groundwater Monitoring									
Site Location		Halverstown							
Project No.		24330							
Engineer		DOBA							
		Date of Reading							
		02/12/2022		19/12/2022		10/07/2023			
	Ground Elevation (m OD)	m bgl	m OD	m bgl	m OD	m bgl	m OD	m bgl	m OD
BH03	78.62	1.30	77.32	1.80	76.82	2.05	76.57		
BH10	84.79	Dry	-	Dry	-	Dry	-		
BH12	80.50	0.98	79.52	1.0	79.50	1.54	78.96		
BH13	82.80	2.20	80.6	2.38	80.42	Dry	-		
BH05	77.88	-	-	-	-	0.87	77.01		
RC01A	85.33	-	-	-	-	Dry*	-		
RC02	82.92	-	-	-	-	2.85	80.07		
RC03	79.37	-	-	-	-	3.33	76.04		
RC04	78.32	-	-	-	-	1.12	77.20		
TPRO-01	84.06	-	-	-	-	3.63	80.43		
TPRO-02	82.52	-	-	-	-	3.16	79.36		
TPRO-03	81.63	-	-	-	-	1.49	80.14		
TPRO-04	80.28	-	-	-	-	2.27	78.01		
TPRO-05	84.64	-	-	-	-	3.79	80.85		
TPRO-06	85.03	-	-	-	-	3.76	81.27		
TPRO-07	82.86	-	-	-	-	2.43	80.43		
TPRO-08	81.40	-	-	-	-	1.22	80.18		
TPRO-09	77.31	-	-	-	-	0.64	76.67		
TPRO-10	79.60	-	-	-	-	1.4	78.20		
COMMENTS	*RC01A found to be silted up to 5.0m bgl (10-07-23)								



Appendix 10

Gas Monitoring

Gas & Groundwater Monitoring					
Site Location	Halverstown				
Project No.	24330				
Date	19-Dec-22				
Engineer	DOBA				
Equipment	Geotech GA5000				
	Peak / Steady State Readings				
Location ID	BH10				
Time (sec)	10	30	60	90	Peak
Water Level (mbgl)	Dry				
Gas Flow (l/hr)	0.0	0.1	0.1	0.1	0.1
CH4 (%)	0.0	0.0	0.0	0.0	0
CO2 (%)	2.3	2.3	2.3	2.3	2.3
O2 (%)	15.9	15.5	15.5	15.4	15.9
CO (ppm)	0	0	0	0	0
H2S (ppm)	0	0	0	0	0
Balance (%)	82.1	82.2	82.3	81.8	82.3
Barometric Pressure (mba)	978				
Weather/Temp.	Wet, Windy, Rain/ 12°				
Location ID	BH12				
Time (sec)	10	30	60	90	Peak
Water Level (mbgl)	1.0m				
Gas Flow (l/hr)	0.0	0.1	0.1	0.1	0.1
CH4 (%)	0.0	0.0	0.0	0.0	0.0
CO2 (%)	1.1	1.1	1.1	1.1	1.1
O2 (%)	15.9	15.4	15.3	15.3	15.9
CO (ppm)	0.0	0.0	0.0	0.0	0.0
H2S (ppm)	0.0	0.0	0.0	0.0	0.0
Balance (%)	83.0	83.5	83.6	83.6	83.6
Barometric Pressure (mba)	978				
Weather/Temp.	Wet, Windy, Rain/ 12°				
Location ID	BH03				
Time (sec)	10	30	60	90	Peak
Water Level (mbgl)	1.80m				
Gas Flow (l/hr)	0.0	0.1	0.1	0.1	0.1
CH4 (%)	0.0	0.0	0.0	0.0	0.0
CO2 (%)	0.6	0.6	0.6	0.6	0.6
O2 (%)	20.6	15.9	15.6	15.6	20.6
CO (ppm)	0	0	0	0	0
H2S (ppm)	0	0	0	0	0
Balance (%)	78.8	83.4	83.8	83.8	83.8
Barometric Pressure (mba)	978				
Weather/Temp.	Wet, Windy, Rain/ 12°				
Comments					

Gas & Groundwater Monitoring						
Site Location	Halverstown					
Project No.	24330					
Date	19-Dec-22					
Engineer	DOBA					
Equipment	Geotech GA5000					
	Peak / Steady State Readings					
Location ID	BH13					
Time (sec)	30	60	90	120	180	Peak
Water Level (mbgl)	2.38m					
Gas Flow (l/hr)	0.1	0.1	0.1	0.1	0.1	0.1
CH4 (%)	0.0	0.0	0.0	0.0	0.0	0.0
CO2 (%)	0.6	0.8	0.8	0.8	0.8	0.8
O2 (%)	16.3	18.8	18.9	18.9	18.9	18.9
CO (ppm)	0.0	0.0	0.0	0.0	0.0	0.0
H2S (ppm)	0.0	0.0	0.0	0.0	0.0	0.0
Balance (%)	83.1	80.4	80.2	80.2	80.2	83.1
Barometric Pressure (mba)	978					
Weather/Temp.	Wet, Windy, Rain/ 12°					
Location ID						
Time (sec)	30	60	90	120	180	Peak
Water Level (mbgl)						
Gas Flow (l/hr)						
CH4 (%)						
CO2 (%)						
O2 (%)						
CO (ppm)						
H2S (ppm)						
Balance (%)						
Barometric Pressure (mba)						
Weather/Temp.						
Location ID						
Time (sec)	30	60	90	120	180	Peak
Water Level (mbgl)						
Gas Flow (l/hr)						
CH4 (%)						
CO2 (%)						
O2 (%)						
CO (ppm)						
H2S (ppm)						
Balance (%)						
Barometric Pressure (mba)						
Weather/Temp.						
Comments						



Appendix 11

Geotechnical Laboratory Results (Soil)

IGSL Ltd Materials Laboratory Unit J5, M7 Business Park Newhall, Naas Co. Kildare 045 846176				Test Report										
				Determination of Moisture Content, Liquid & Plastic Limits Tested in accordance with BS1377:Part 2:1990, clauses 3.2, 4.3, 4.4 & 5.3**										
Report No. R142005 Contract No. 24330 Contract Name: Halverstown , Naas - Proposed Data Centres Customer DOBA Samples Received: 24/01/23 Date Tested: 24/01/23														
BH/TP*	Sample No.	Depth* (m)	Lab. Ref	Sample Type*	Moisture Content %	Liquid Limit %	Plastic Limit %	Plasticity Index	% <425µm	Preparation	Liquid Limit Clause	Classification (BS5930)	Description	
BH01	AA184687	1.0	A22/7546	B	19	25	15	10	55	WS	4.4	C L	Brown sandy gravelly CLAY	
BH01	AA184688	2.0	A22/7547	B	8.6	22	NP	NP	58	WS	4.4		Brown slightly sandy, gravelly, SILT with some cobbles	
BH03	AA184690	1.0	A22/7548	B	13	27	NP	NP	69	WS	4.4		Brown sandy gravelly SILT	
BH03	AA184692	3.0	A22/7549	B	6.5	19	NP	NP	45	WS	4.4		Brown silty, sandy, GRAVEL with many cobbles	
BH04	AA184694	2.0	A22/7550	B	16	28	NP	NP	49	WS	4.4		Brown sandy gravelly SILT	
BH05	AA184670	1.0	A22/7551	B	11	23	NP	NP	44	WS	4.4		Brown sandy gravelly SILT	
BH05	AA184672	3.0	A22/7552	B	7.0	24	14	10	39	WS	4.4	C L	Grey/brown clayey, sandy, GRAVEL with many cobbles	
BH07	AA184673	1.0	A22/7553	B	51	36	NP	NP	89	WS	4.4		Brown sandy gravelly SILT	
BH07	AA184674	2.0	A22/7554	B	17	37	20	17	70	WS	4.4	C I	Brown slightly sandy, slightly gravelly, CLAY	
BH09	AA184679	1.0	A22/7555	B	14	29	16	13	66	WS	4.4	C L	Brown sandy gravelly CLAY	
BH11	AA184677	1.0	A22/7557	B	24	29	14	15	60	WS	4.4	C L	Brown sandy gravelly CLAY	
BH11	AA184679	3.0	A22/7558	B	13	25	13	12	64	WS	4.4	C L	Brown slightly sandy, gravelly, CLAY	
BH12	AA184675	1.0	A22/7559	B	18	29	16	13	59	WS	4.4	C L	Brown sandy gravelly CLAY	
BH13	AA184685	1.0	A22/7560	B	15	27	15	12	55	WS	4.4	C L	Brown sandy gravelly CLAY	
				Preparation: WS - Wet sieved AR - As received NP - Non plastic Liquid Limit 4.3 Cone Penetrometer definitive method Clause: 4.4 Cone Penetrometer one point method		Sample Type: B - Bulk Disturbed U - Undisturbed		Remarks: Results relate only to the specimen tested, in as received condition unless otherwise noted. NOTE: **These clauses have been superceded by EN 17892-1 and EN17892-12. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.						
IGSL Ltd Materials Laboratory				Persons authorized to approve reports H Byrne (Laboratory Manager)					Approved by		Date		Page	
											20/02/23		1 of 1	

IGSL Ltd Materials Laboratory Unit J5, M7 Business Park Newhall, Naas Co. Kildare 045 846176				Test Report											
				Determination of Moisture Content, Liquid & Plastic Limits Tested in accordance with BS1377:Part 2:1990, clauses 3.2, 4.3, 4.4 & 5.3**											
Report No. R142006 Contract No. 24330 Contract Name: Halverstown , Naas - Proposed Data Centres Customer DOBA Samples Received: 24/01/23 Date Tested: 24/01/23															
BH/TP*	Sample No.	Depth* (m)	Lab. Ref	Sample Type*	Moisture Content %	Liquid Limit %	Plastic Limit %	Plasticity Index	% <425µm	Preparation	Liquid Limit Clause	Classification (BS5930)	Description		
TP04	AA186982	0.6	A22/7562	B	12	24	14	10	79	WS	4.4	C L	Brown slightly sandy, slightly gravelly, CLAY		
TP12	AA185482	0.8	A22/7563	B	13	36	18	18	70	WS	4.4	C I	Brown slightly sandy, slightly gravelly, CLAY		
TP15	AA185479	1.5	A22/7565	B	13	27	16	11	69	WS	4.4	C L	Brown slightly sandy, slightly gravelly, CLAY		
TP16	AA185461	1.0	A22/7566	B	19	23	13	10	71	WS	4.4	C L	Mottled brown slightly sandy, slightly gravelly, CLAY		
TP19	AA185468	0.5	A22/7568	B	12	22	13	9	73	WS	4.4	C L	Mottled brown slightly sandy, slightly gravelly, CLAY		
TP22	AA185497	0.6	A22/7571	B	19	28	NP	NP	70	WS	4.4		Brown sandy gravelly SILT		
TP24	AA181961	1.5	A22/7574	B	17	31	17	14	77	WS	4.4	C L	Brown slightly sandy, slightly gravelly, CLAY		
TP26	AA181975	0.5	A22/7575	B	18	35	19	16	61	WS	4.4	C L	Brown slightly sandy, slightly gravelly, CLAY		
TP28	AA181969	0.6	A22/7576	B	25	35	18	17	78	WS	4.4	C L	Mottled brown slightly sandy, slightly gravelly, CLAY		
TP31	AA181992	0.5	A22/7578	B	17	31	17	14	74	WS	4.4	C L	Brown slightly sandy, slightly gravelly, CLAY		
TP33	AA181989	0.5	A22/7579	B	20	37	18	19	55	WS	4.4	C I	Brown slightly sandy, slightly gravelly, CLAY		
TP34	AA181986	0.5	A22/7580	B	19	34	18	16	62	WS	4.4	C L	Brown sandy gravelly CLAY		
Preparation: WS - Wet sieved AR - As received NP - Non plastic Liquid Limit 4.3 Cone Penetrometer definitive method Clause: 4.4 Cone Penetrometer one point method				Sample Type: B - Bulk Disturbed U - Undisturbed		Remarks: Results relate only to the specimen tested,in as received condition unless otherwise noted. NOTE: **These clauses have been superceded by EN 17892-1 and EN17892-12. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in fullwithout written approval from the Laboratory.									
IGSL Ltd Materials Laboratory				Persons authorized to approve reports H Byrne (Laboratory Manager)						Approved by		Date		Page	
												20/02/23		1 of 1	

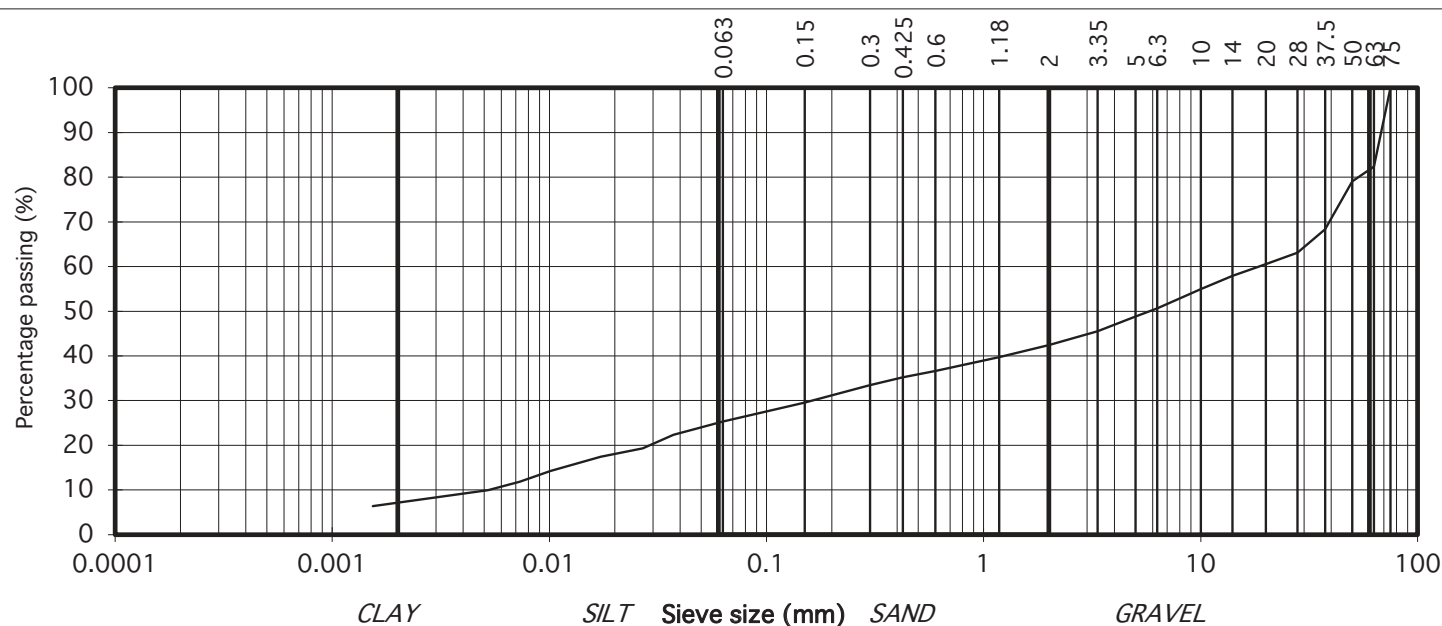
TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142643	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
			BH/TP No.	BH01			
			Sample No.*	AA184688	Lab. Sample No.	A22/7547	
			Sample Type:	B			
			Depth* (m)	2.00	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	26/01/2023	
			Description:	Brown slightly sandy, gravelly, SILT with some cobbles			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2 Sample size did not meet the requirements of BS1377			
75	100	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.				
63	82						
50	79						
37.5	68						
28	63						
20	61						
14	58						
10	55	GRAVEL					
6.3	51						
5	49						
3.35	46						
2	42						
1.18	40						
0.6	37						
0.425	35	SAND					
0.3	33						
0.15	30						
0.063	25						
0.037	22						
0.027	19						
0.017	17						
0.010	14	SILT/CLAY					
0.007	12						
0.005	10						
0.002	6						

Sieve Size (mm)	Percentage Passing (%)
0.075	0
0.15	0
0.3	0
0.6	0
1.18	0
2.0	0
3.35	0
5.0	0
6.3	0
10	0
14	0
20	0
28	0
37.5	0
50	0
63	82
75	100

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.



IGSL Ltd Materials Laboratory	Approved by:	Date:	Page no:
		15/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142644 <th rowspan="10"> Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory. </th>	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.
			Contract Name :	Halverstown , Naas 0 Proposed Data Centre Sites			
			BH/TP No.	BH03			
			Sample No.*	AA184692	Lab. Sample No.	A22/7549	
			Sample Type:	B			
			Depth* (m)	3.00	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	26/01/2023	
			Description:	Brown silty, sandy, GRAVEL with many cobbles			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2 Sample size did not meet the requirements of BS1377			
75	77	COBBLES					
63	70						
50	64						
37.5	64						
28	59						
20	54						
14	51						
10	48	GRAVEL					
6.3	44						
5	42						
3.35	40						
2	37						
1.18	34						
0.6	30						
0.425	29	SAND					
0.3	27						
0.15	23						
0.063	18	SILT/CLAY					

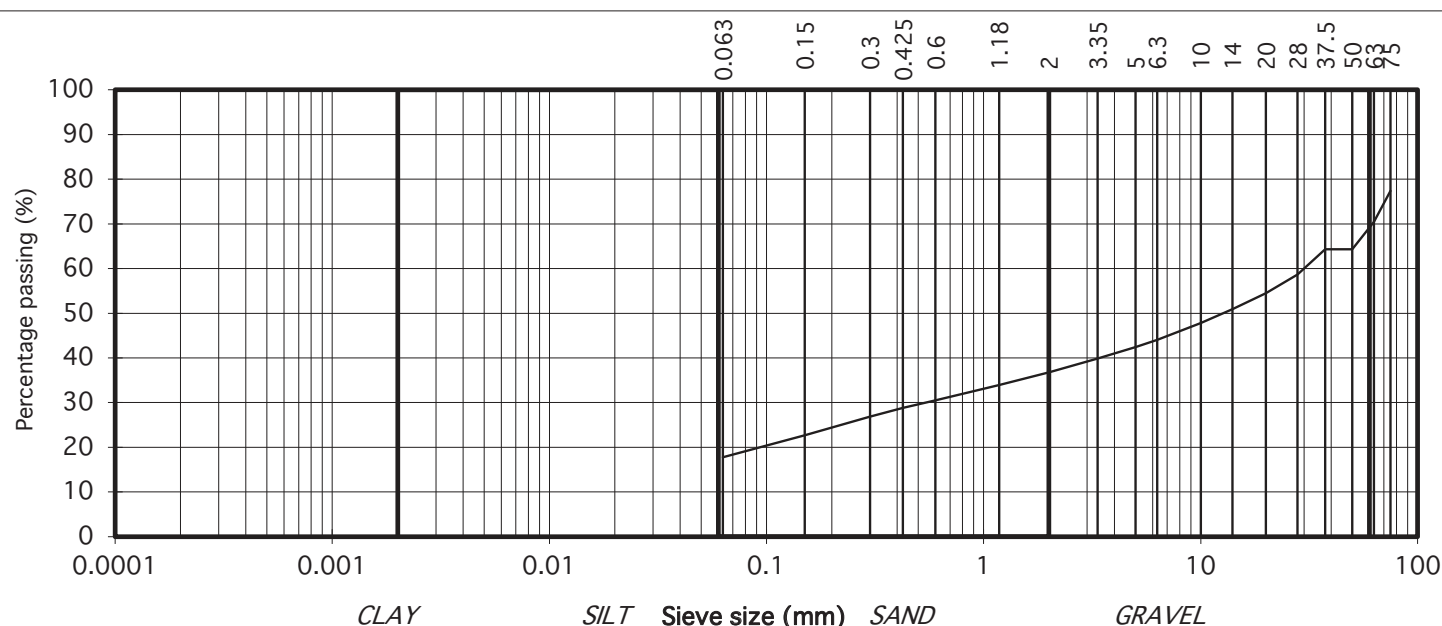
Percentage passing (%)

Sieve size (mm)

CLAY SILT SAND GRAVEL

Sieve Size (mm)	Percentage Passing (%)
0.063	18
0.15	23
0.3	27
0.425	29
0.6	30
1.18	34
2	37
3.35	40
5	42
6.3	44
10	48
14	51
20	54
28	59
37.5	64
50	64
75	77

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.



IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
<i>[Signature]</i>	15/02/23	1 of 1

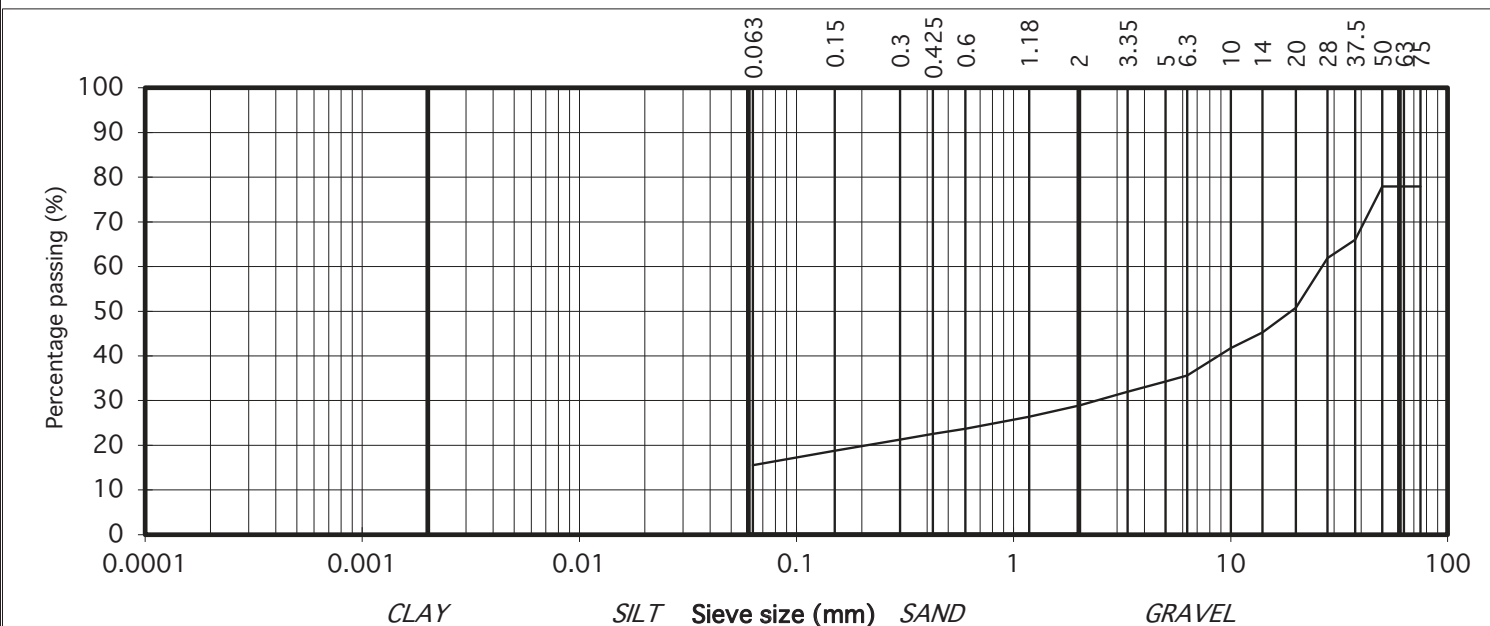
Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142645	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
			BH/TP No.	BH05			
			Sample No.*	AA184672	Lab. Sample No.	A22/7552	
			Sample Type:	B			
			Depth* (m)	3.00	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	24/01/2023	
			Description:	Grey/brown clayey, sandy, GRAVEL with many cobbles			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2 Sample size did not meet the requirements of BS1377			
75	78	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.				
63	78						
50	78						
37.5	66						
28	62						
20	51						
14	45						
10	42	GRAVEL					
6.3	36						
5	34						
3.35	32						
2	29						
1.18	26						
0.6	24						
0.425	23	SAND					
0.3	21						
0.15	19						
0.063	16	SILT/CLAY					

Sieve Size (mm)	Percentage Passing (%)
0.063	100
0.075	16
0.15	19
0.3	21
0.425	23
0.6	24
1.18	26
2	29
3.35	32
5	34
6.3	36
10	42
14	45
20	51
28	62
37.5	66
50	78
75	78



IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
<i>H Byrne</i>	15/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



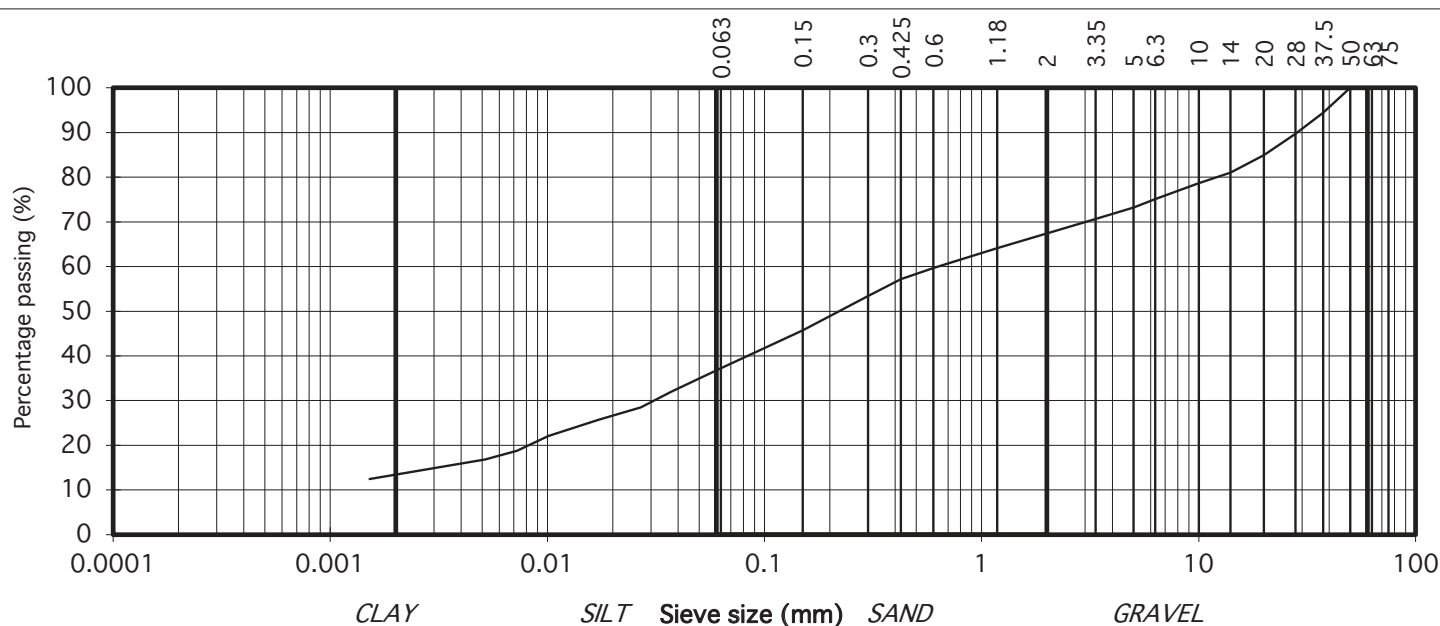
particle size	% passing		Contract No.	24330	Report No.	R142646	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
			BH/TP No.	BH07			
			Sample No.*	AA184674	Lab. Sample No.	A22/7554	
			Sample Type:	B			
			Depth* (m)	2.00	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	26/01/2023	
			Description:	Brown slightly sandy, slightly gravelly, CLAY			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .			
75	100	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.				
63	100						
50	100						
37.5	94						
28	90						
20	85						
14	81						
10	79						
6.3	75	GRAVEL					
5	73						
3.35	71						
2	67						
1.18	64						
0.6	60						
0.425	57						
0.3	53						
0.15	46	SAND					
0.063	37						
0.037	32						
0.027	28						
0.017	26						
0.010	22						
0.007	19						
0.005	17						
0.002	12	SILT/CLAY					

Percentage passing (%)

Sieve size (mm)

CLAY SILT SAND GRAVEL

Sieve Size (mm)	Percentage Passing (%)
0.075	12
0.15	15
0.3	20
0.6	25
1.18	30
2.5	35
5.0	40
10	45
20	55
40	65
75	75
150	85
300	95
600	100



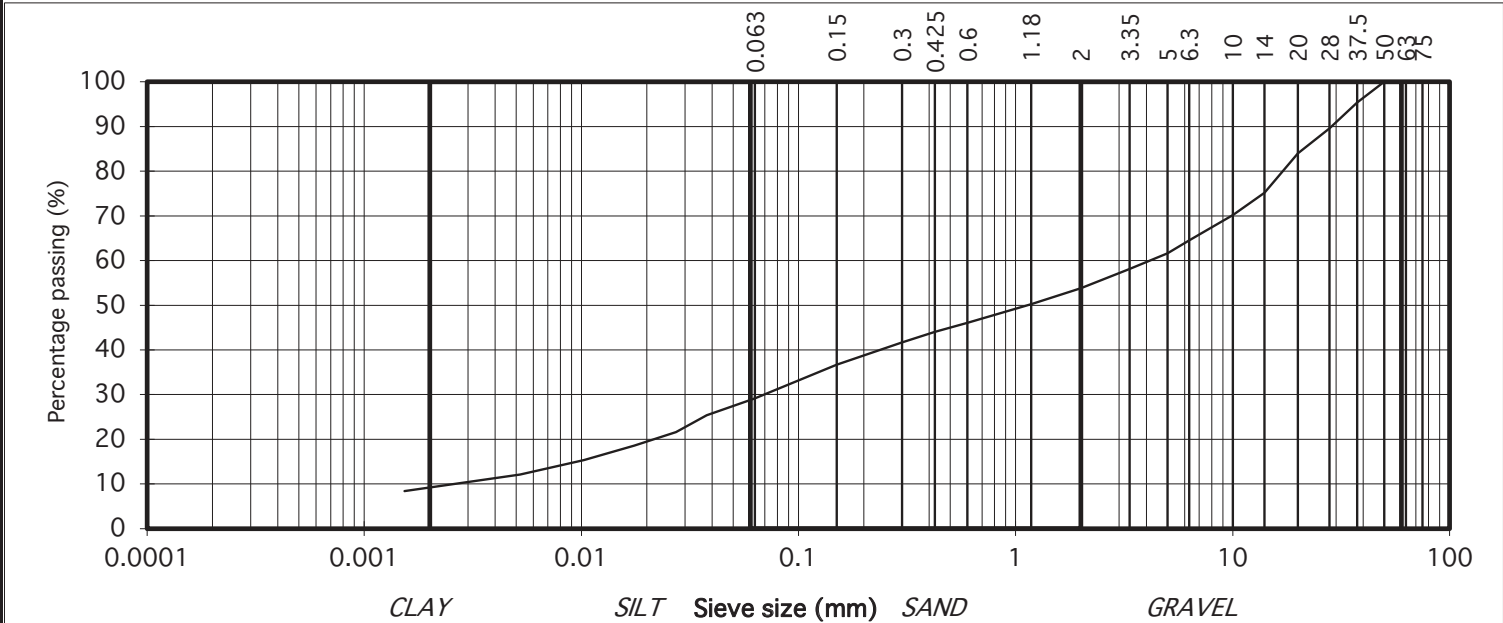
IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
<i>H Byrne</i>	20/02/23	1 of 1

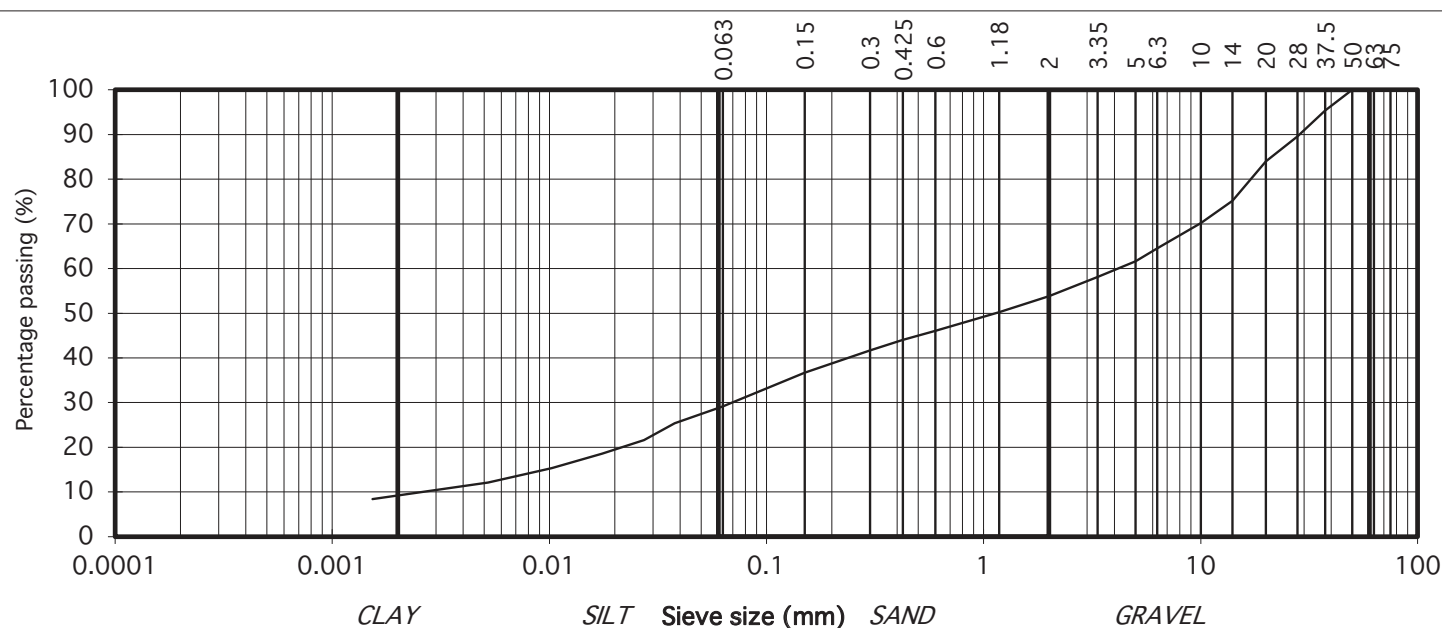
Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142647	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
			BH/TP No.	BH09			
			Sample No.*	AA184681	Lab. Sample No.	A22/7556	
			Sample Type:	B			
			Depth* (m)	3.00	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	24/01/2023	
			Description:	Brown slightly sandy, gravelly, SILT/CLAY			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .			
75	100	COBBLES					
63	100						
50	100						
37.5	95						
28	90						
20	84						
14	75						
10	70	GRAVEL					
6.3	64						
5	62						
3.35	58						
2	54						
1.18	50						
0.6	46						
0.425	44	SAND					
0.3	42						
0.15	37						
0.063	29						
0.038	25						
0.027	22	SILT/CLAY					
0.018	19						
0.010	15						
0.007	14						
0.005	12						
0.002	8						

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.



IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
<i>[Signature]</i>	20/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)

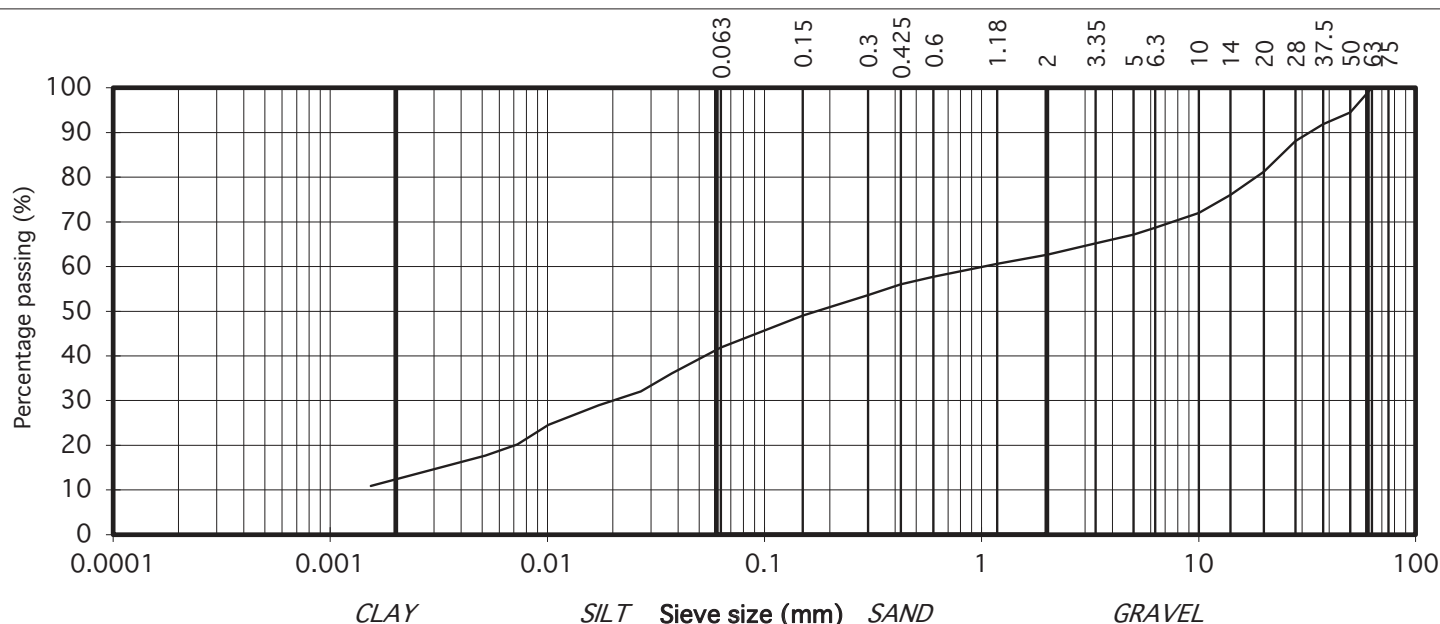


particle size	% passing		Contract No.	24330	Report No.	R142648 <th></th>		
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites				Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.
			BH/TP No.	BH11				
			Sample No.*	AA184673	Lab. Sample No.	A22/7558		
			Sample Type:	B				
			Depth* (m)	3.00	Customer:	DOBA		
75	100	COBBLES	Date Received	24/01/2023	Date Testing started	26/01/2023		
63	100		Description:	Brown slightly sandy, gravelly, CLAY				
50	94							
37.5	92							
28	88							
20	81	GRAVEL						
14	76							
10	72							
6.3	69							
5	67							
3.35	65	SAND						
2	63							
1.18	61							
0.6	58							
0.425	56							
0.3	54	SILT/CLAY						
0.15	49							
0.063	42							
0.037	36							
0.027	32							
0.017	29							
0.010	25							
0.007	20							
0.005	18							
0.002	11							

Remarks

Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .

Percentage passing (%)



IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
<i>H Byrne</i>	20/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

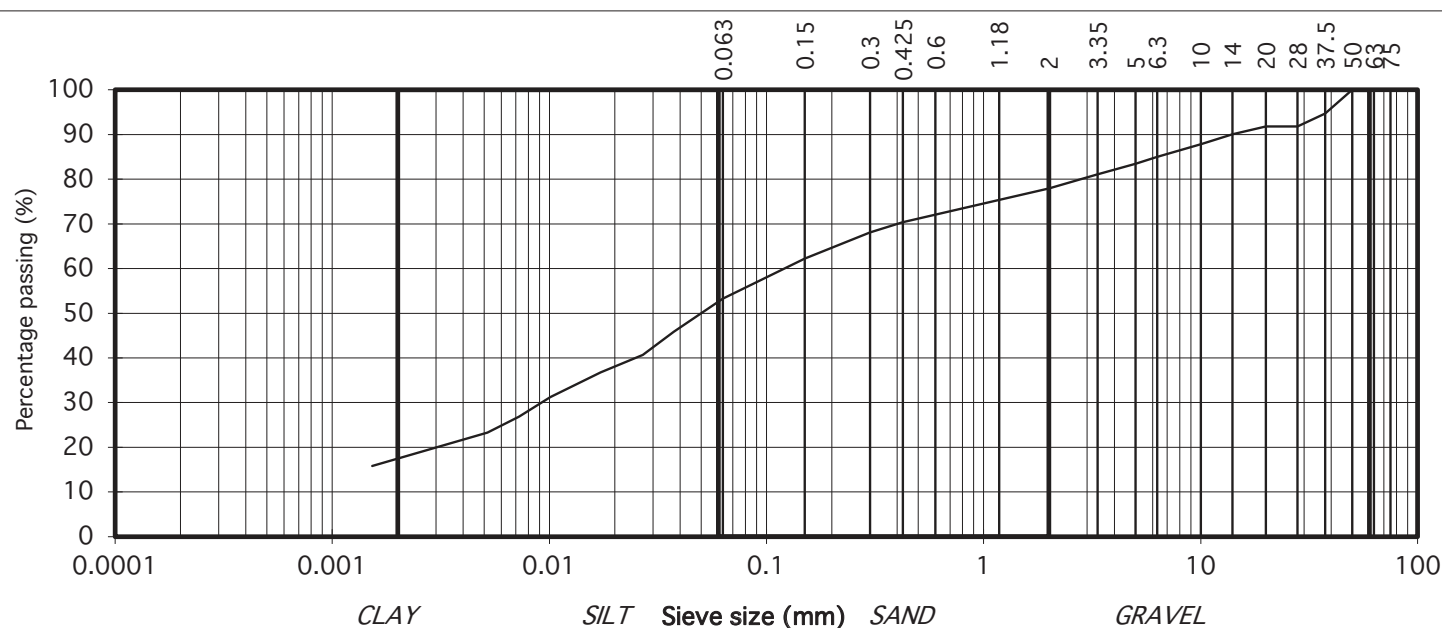
TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142649		
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites				Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.
			BH/TP No.	BH13				
			Sample No.*	AA184686	Lab. Sample No.	A22/7561		
			Sample Type:	B				
			Depth* (m)	2.00	Customer:	DOBA		
			Date Received	24/01/2023	Date Testing started	26/01/2023		
			Description:	Brown slightly sandy, slightly gravelly, SILT/CLAY				
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .				
75	100	COBBLES						
63	100							
50	100							
37.5	95							
28	92							
20	92							
14	90							
10	88							
6.3	85							
5	83							
3.35	81	GRAVEL						
2	78							
1.18	75							
0.6	72							
0.425	70							
0.3	68							
0.15	62							
0.063	53							
0.037	46							
0.027	41							
0.017	37	SAND						
0.010	31							
0.007	27							
0.005	23							
0.002	16							
		SILT/CLAY						

Sieve Size (mm)	Percentage Passing (%)
0.075	100
0.15	100
0.3	100
0.6	100
1.18	100
2.0	100
3.35	100
5.0	100
6.3	100
10	100
14	100
20	100
28	100
37.5	100
50	100
60	100
75	100
100	100

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.



IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
<i>H Byrne</i>	20/02/23	1 of 1

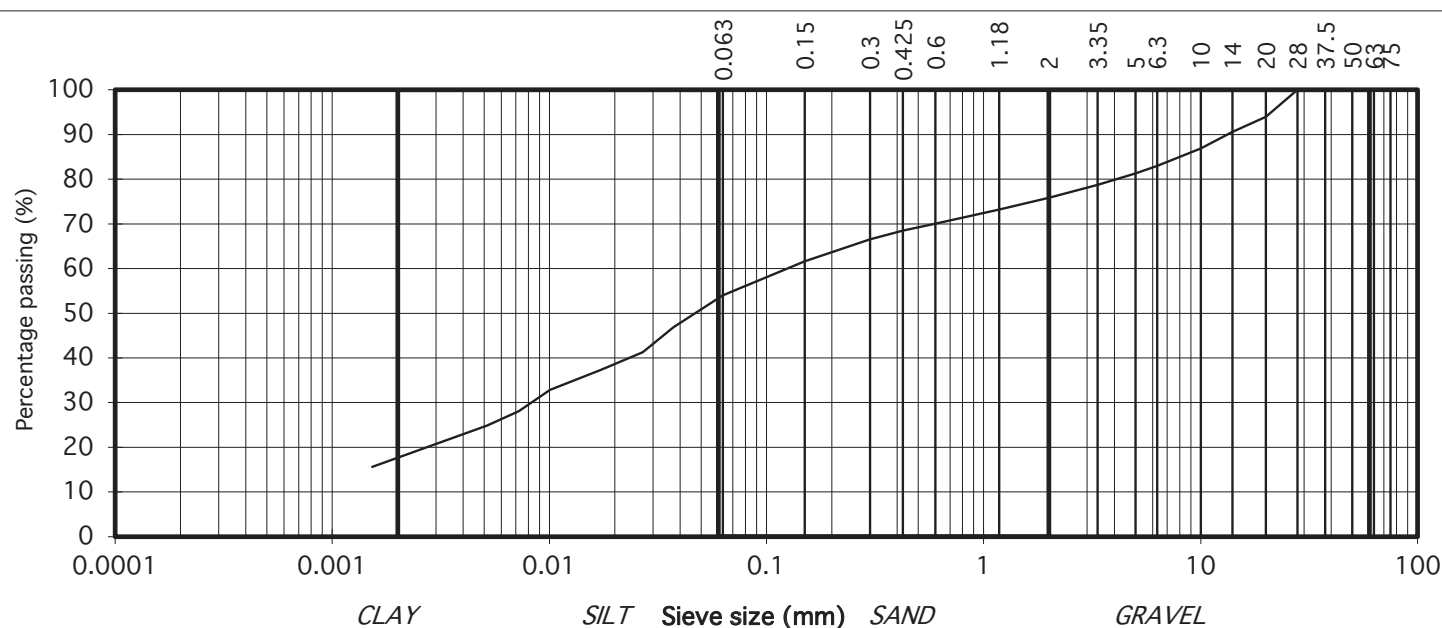
Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142650		
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites				Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.
			BH/TP No.	TP04				
			Sample No.*	AA186982	Lab. Sample No.	A22/7562		
			Sample Type:	B				
			Depth* (m)	0.60	Customer:	DOBA		
			Date Received	24/01/2023	Date Testing started	24/01/2023		
			Description:	Brown slightly sandy, slightly gravelly, CLAY				
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .				
75	100	COBBLES						
63	100							
50	100							
37.5	100							
28	100							
20	94							
14	91							
10	87							
6.3	83							
5	81							
3.35	79	GRAVEL						
2	76							
1.18	73							
0.6	70							
0.425	68							
0.3	67							
0.15	62							
0.063	54							
0.037	47							
0.027	41							
0.017	37	SAND						
0.010	33							
0.007	28							
0.005	25							
0.002	16							
		SILT/CLAY						

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.



IGSL Ltd Materials Laboratory

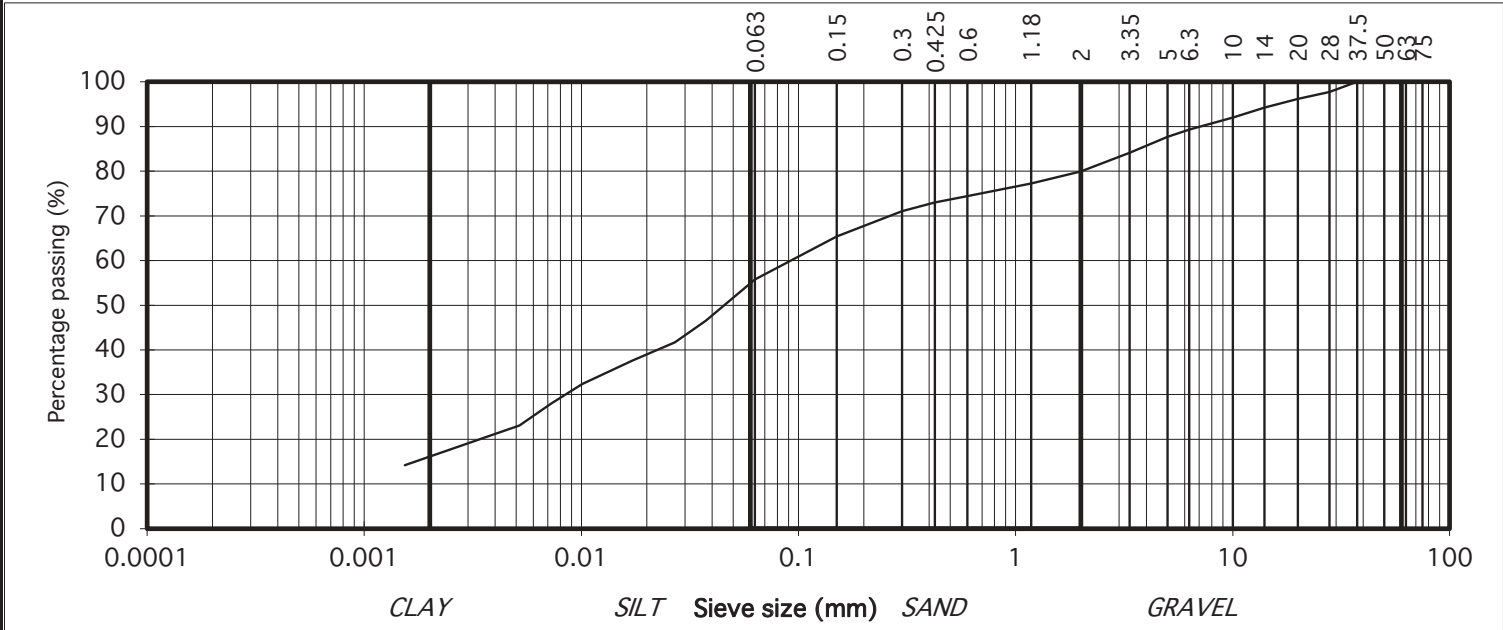
Approved by:	Date:	Page no:
<i>H Byrne</i>	20/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

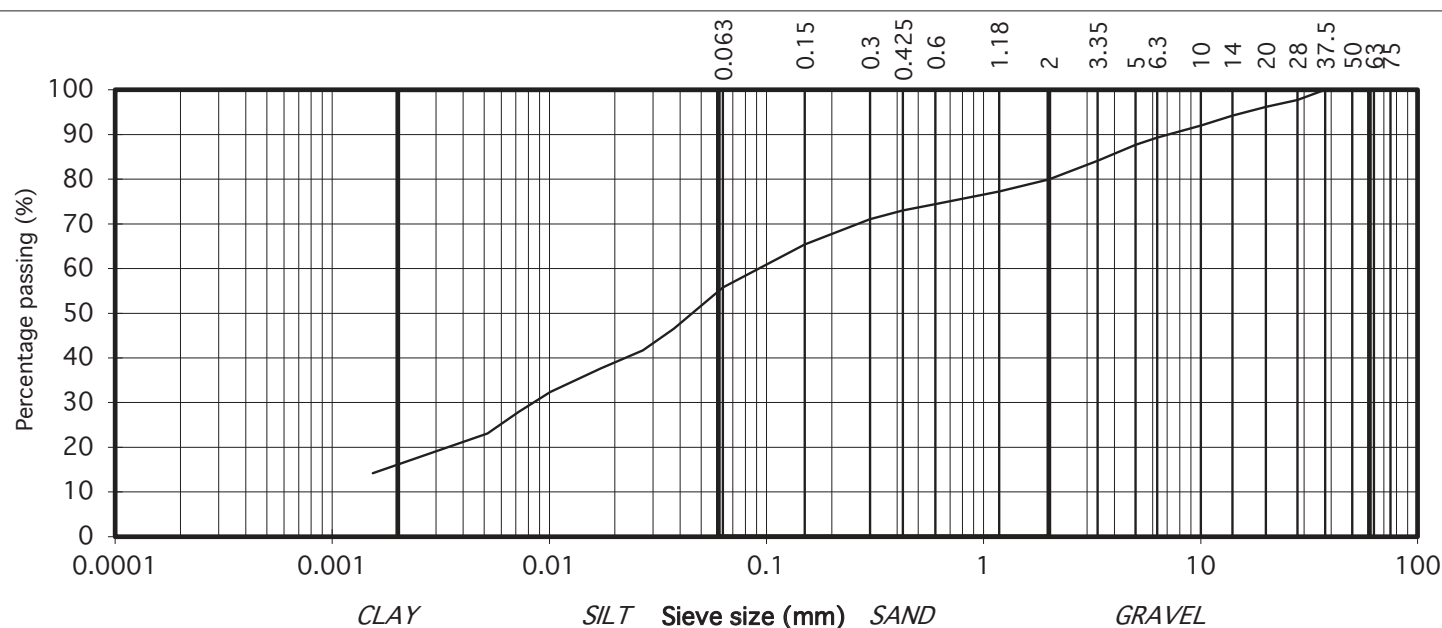
TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142651	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
			BH/TP No.	TP12			
			Sample No.*	AA185481	Lab. Sample No.	A22/7563	
			Sample Type:	B			
			Depth* (m)	0.50	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	24/01/2023	
			Description:	Brown slightly sandy, slightly gravelly, CLAY			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .			
75	100	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.				
63	100						
50	100						
37.5	100						
28	98						
20	96						
14	94						
10	92	GRAVEL					
6.3	89						
5	88						
3.35	84						
2	80						
1.18	77						
0.6	74						
0.425	73	SAND					
0.3	71						
0.15	65						
0.063	56						
0.037	47						
0.027	42						
0.017	38						
0.010	32	SILT/CLAY					
0.007	28						
0.005	23						
0.002	14						

100	93	93	50	37.5	28	20	14	10	6.3	5	3.35	2	1.18	0.6	0.425	0.3	0.15	0.063
																		
Percentage passing (%)																		
Sieve size (mm)																		
CLAY SILT SAND GRAVEL																		

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.



IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
<i>[Signature]</i>	20/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142652																				
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites																						
			AA185479	TP15																						
			Sample No.*	AA186982	Lab. Sample No.	A22/7565																				
			Sample Type:	B																						
			Depth* (m)	1.50	Customer:	DOBA																				
			Date Received	24/01/2023	Date Testing started	24/01/2023																				
			Description:	Brown slightly sandy, slightly gravelly, CLAY																						
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .																						
75	100	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.																							
63	100																									
50	100																									
37.5	100																									
28	99																									
20	98																									
14	96																									
10	94	GRAVEL																								
6.3	90																									
5	88																									
3.35	85																									
2	80																									
1.18	77																									
0.6	72																									
0.425	70	SAND																								
0.3	67																									
0.15	61																									
0.063	52																									
		SILT/CLAY						<table><tr><td>0.0001</td><td>0.001</td><td>0.01</td><td>0.1</td><td>1</td><td>10</td><td>100</td></tr><tr><td>CLAY</td><td></td><td>SILT</td><td>Sieve size (mm)</td><td>SAND</td><td></td><td>GRAVEL</td></tr></table>					0.0001	0.001	0.01	0.1	1	10	100	CLAY		SILT	Sieve size (mm)	SAND		GRAVEL
0.0001	0.001												0.01	0.1	1	10	100									
CLAY		SILT	Sieve size (mm)	SAND		GRAVEL																				

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.

IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
	21/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142653	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
			AA185479	TP16			
			Sample No.*	AA185481	Lab. Sample No.	A22/7566	
			Sample Type:	B			
			Depth* (m)	1.00	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	24/01/2023	
			Description:	Mottled brown slightly sandy, slightly gravelly, CLAY			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .			
75	100	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.				
63	100						
50	100						
37.5	100						
28	100						
20	100						
14	99						
10	97	GRAVEL					
6.3	95						
5	94						
3.35	93						
2	90						
1.18	88						
0.6	84						
0.425	82	SAND					
0.3	80						
0.15	73						
0.063	63						
		SILT/CLAY					

Percentage passing (%)

100

90

80

70

60

50

40

30

20

10

0

0.0001

0.001

0.01

0.1

1

10

100

CLAY

SILT

Sieve size (mm)

SAND

GRAVEL

0.063

0.15

0.3

0.425

0.6

1.18

2

3.35

5

6.3

10

14

20

28

37.5

50

75

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.

IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
	21/02/23	1 of 1

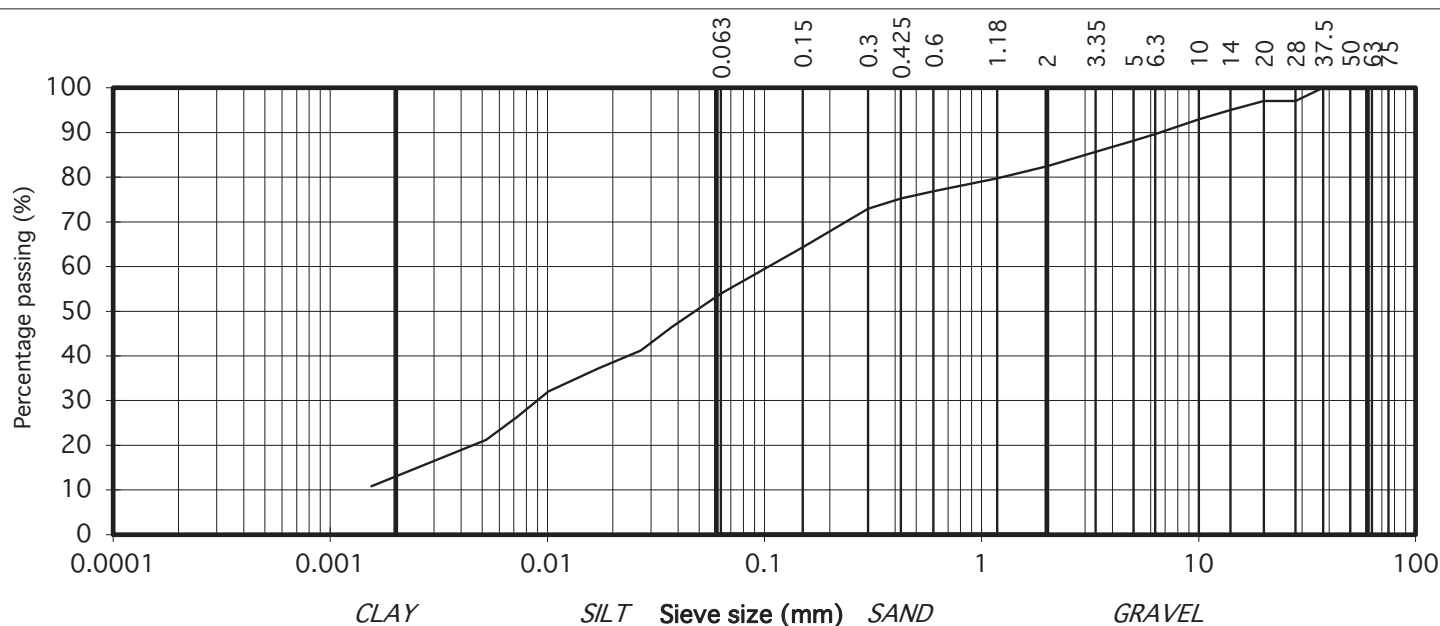
Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142654	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
75	100	COBBLES	AA185479	TP19			
63	100		Sample No.*	AA185468	Lab. Sample No.	A22/7568	
50	100		Sample Type:	B			
37.5	100		Depth* (m)	0.50	Customer:	DOBA	
28	97	GRAVEL	Date Received	24/01/2023	Date Testing started	24/01/2023	
20	97		Description:	Mottled brown slightly sandy, slightly gravelly, CLAY			
14	95						
10	93		Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .			
6.3	90						
5	88						
3.35	86	SAND					
2	82						
1.18	80						
0.6	77						
0.425	75	SILT/CLAY					
0.3	73						
0.15	64						
0.063	54						
0.037	46						
0.027	41						
0.017	37						
0.010	32						
0.007	26						
0.005	21						
0.002	11						

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.



IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
<i>[Signature]</i>	21/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



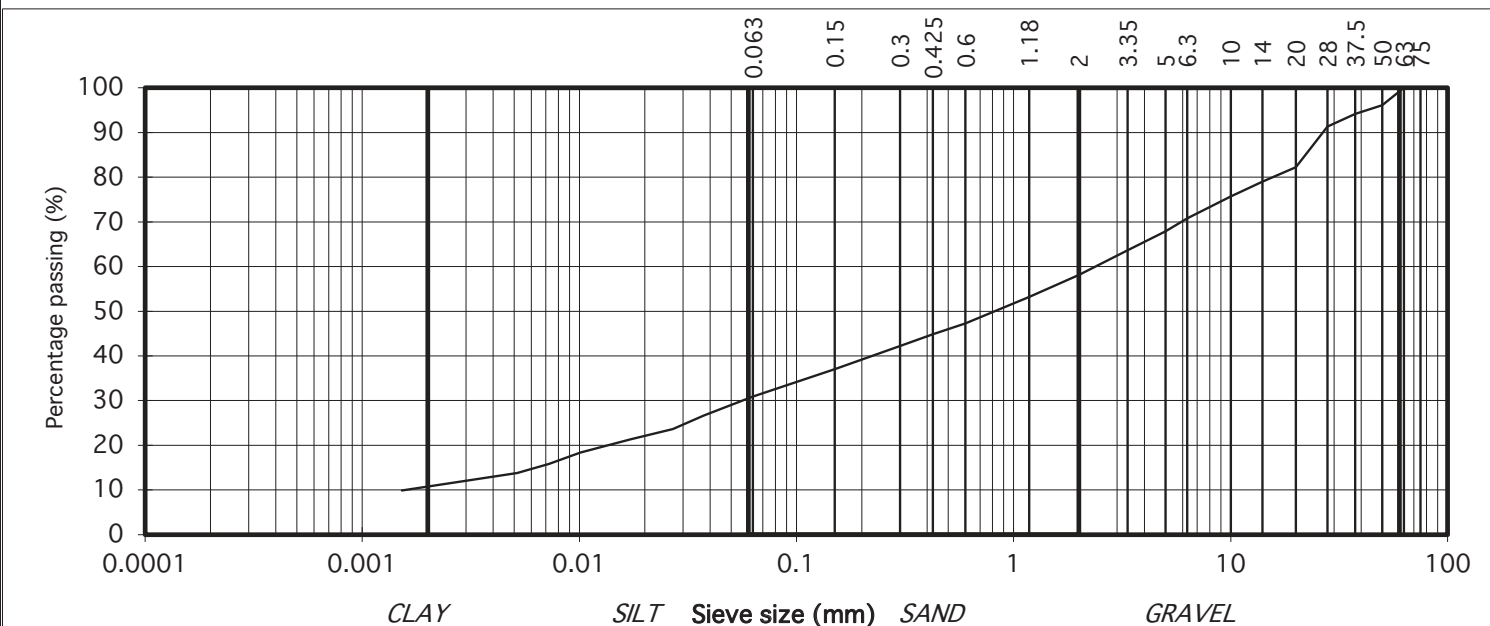
particle size	% passing		Contract No.	24330	Report No.	R142655	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
			AA185479	TP22			
			Sample No.*	AA185500	Lab. Sample No.	A22/7572	
			Sample Type:	B			
			Depth* (m)	2.40	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	24/01/2023	
			Description:	Brown slightly sandy, gravelly, SILT/CLAY			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .			
75	100	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.				
63	100						
50	96						
37.5	94						
28	91						
20	82						
14	79						
10	76						
6.3	71	GRAVEL					
5	68						
3.35	64						
2	58						
1.18	53						
0.6	47						
0.425	45						
0.3	42						
0.15	37	SAND					
0.063	31						
0.037	27						
0.027	24						
0.017	21						
0.010	18						
0.007	16						
0.005	14						
0.002	10	SILT/CLAY					

Percentage passing (%)

Sieve size (mm)

CLAY SILT SAND GRAVEL

Sieve Size (mm)	Percentage Passing (%)
0.075	10
0.15	15
0.3	20
0.6	25
1.18	30
2.5	35
5.0	40
10.0	45
20.0	50
40.0	60
75.0	70
150.0	80
300.0	90
600.0	95
75.0	100



IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
	21/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
(note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142656	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
			AA185479	TP24			
			Sample No.*	AA181981	Lab. Sample No.	A22/7574	
			Sample Type:	B			
			Depth* (m)	1.50	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	24/01/2023	
			Description:	Brown slightly sandy, slightly gravelly, CLAY			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .			
75	100	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.				
63	100						
50	100						
37.5	100						
28	100						
20	100						
14	99						
10	98	GRAVEL					
6.3	95						
5	93						
3.35	91						
2	88						
1.18	86						
0.6	83						
0.425	81	SAND					
0.3	79						
0.15	72						
0.063	64						
0.037	56	SILT/CLAY					
0.027	48						
0.018	39						
0.010	32						
0.007	26						
0.005	23						
0.002	12						

Sieve size (mm)	Percentage passing (%)
0.075	100
0.15	95
0.3	88
0.6	83
1.18	78
2	72
3.35	68
5	64
6.3	60
10	55
14	50
20	45
28	40
37.5	35
50	30
63	25
75	20
100	12

IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
	21/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142657	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
			AA185479	TP26			
			Sample No.*	AA181975	Lab. Sample No.	A22/7575	
			Sample Type:	B			
			Depth* (m)	0.50	Customer:	DOBA	
			Date Received	24/01/2023	Date Testing started	24/01/2023	
			Description:	Brown slightly sandy, slightly gravelly, CLAY			
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .			
75	100	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.				
63	100						
50	100						
37.5	100						
28	94						
20	91						
14	88						
10	85	GRAVEL					
6.3	81						
5	79						
3.35	75						
2	72						
1.18	69						
0.6	65						
0.425	63	SAND					
0.3	60						
0.15	53						
0.063	44						
0.038	37						
0.027	33						
0.017	27						
0.010	22	SILT/CLAY					
0.007	17						
0.005	15						
0.002	10						

100	90	80	70	60	50	40	30	20	10	0
0.0001	0.001	0.01	0.1	1	10	100				
CLAY			SILT	Sieve size (mm)	SAND	GRAVEL				

0.063	0.15	0.3	0.425	0.6	1.18	2	3.35	5	6.3	10	14	20	28	37.5	50	75

IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
	21/02/23	1 of 1

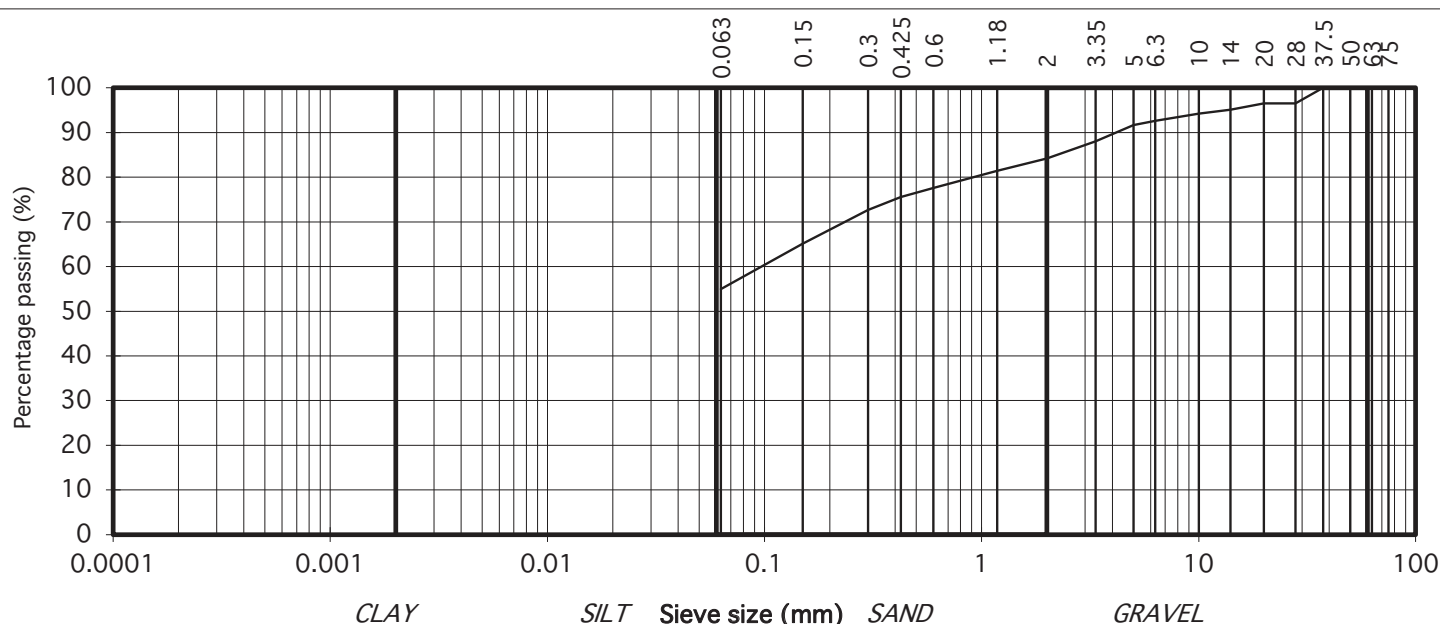
Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142658	
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites			
75	100	COBBLES	AA185479	TP28			
63	100		Sample No.*	AA181969	Lab. Sample No.	A22/7576	
50	100		Sample Type:	B			
37.5	100		Depth* (m)	0.60	Customer:	DOBA	
28	97		Date Received	24/01/2023	Date Testing started	24/01/2023	
20	97	GRAVEL	Description:	Mottled brown slightly sandy, slightly gravelly, CLAY			
14	95						
10	94		Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .			
6.3	93						
5	92						
3.35	88	SAND					
2	84						
1.18	81						
0.6	78						
0.425	76						
0.3	73	SILT/CLAY					
0.15	65						
0.063	55						

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.



IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
	21/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
 Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
 (note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142751																																			
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites																																					
			AA185479	TP31																																					
			Sample No.*	AA181992	Lab. Sample No.	A22/7578																																			
			Sample Type:	B																																					
			Depth* (m)	0.50	Customer:	DOBA																																			
			Date Received	24/01/2023	Date Testing started	24/01/2023																																			
			Description:	Brown slightly sandy, slightly gravelly, CLAY																																					
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .																																					
75	100	COBBLES	<table><tr><th>Sieve size (mm)</th><th>Percentage passing (%)</th></tr><tr><td>0.075</td><td>15</td></tr><tr><td>0.15</td><td>25</td></tr><tr><td>0.3</td><td>35</td></tr><tr><td>0.6</td><td>45</td></tr><tr><td>1.18</td><td>55</td></tr><tr><td>2</td><td>65</td></tr><tr><td>3.35</td><td>75</td></tr><tr><td>5</td><td>85</td></tr><tr><td>6.3</td><td>90</td></tr><tr><td>10</td><td>95</td></tr><tr><td>14</td><td>98</td></tr><tr><td>20</td><td>99</td></tr><tr><td>28</td><td>100</td></tr><tr><td>37.5</td><td>100</td></tr><tr><td>50</td><td>100</td></tr><tr><td>63</td><td>100</td></tr></table>					Sieve size (mm)	Percentage passing (%)	0.075	15	0.15	25	0.3	35	0.6	45	1.18	55	2	65	3.35	75	5	85	6.3	90	10	95	14	98	20	99	28	100	37.5	100	50	100	63	100
Sieve size (mm)	Percentage passing (%)																																								
0.075	15																																								
0.15	25																																								
0.3	35																																								
0.6	45																																								
1.18	55																																								
2	65																																								
3.35	75																																								
5	85																																								
6.3	90																																								
10	95																																								
14	98																																								
20	99																																								
28	100																																								
37.5	100																																								
50	100																																								
63	100																																								
63	100																																								
50	100																																								
37.5	100																																								
28	100																																								
20	98																																								
14	98																																								
10	96	GRAVEL																																							
6.3	93																																								
5	92																																								
3.35	90																																								
2	87																																								
1.18	84																																								
0.6	81																																								
0.425	79	SAND																																							
0.3	76																																								
0.15	68																																								
0.063	57																																								
0.038	48																																								
0.027	43																																								
0.017	38	SILT/CLAY																																							
0.010	32																																								
0.007	29																																								
0.005	26																																								
0.002	14																																								

Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation.
 This report shall not be reproduced except in full without the written approval of the Laboratory.

IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
	21/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

TEST REPORT
Determination of Particle Size Distribution
Tested in accordance with: BS1377:Part2:1990 , clause 9.2 & 9.5**
(note: Sedimentation stage not accredited)



particle size	% passing		Contract No.	24330	Report No.	R142659																																					
			Contract Name :	Halverstown , Naas , Proposed Data Centre Sites																																							
			AA185479	TP33																																							
			Sample No.*	AA181989	Lab. Sample No.	A22/7579																																					
			Sample Type:	B																																							
			Depth* (m)	0.50	Customer:	DOBA																																					
			Date Received	24/01/2023	Date Testing started	24/01/2023																																					
			Description:	Brown slightly sandy, slightly gravelly, CLAY																																							
			Remarks	Note: **Clause 9.2 and Clause 9.5 of BS1377:Part 2:1990 have been superseded by ISO17892-4:2016 .																																							
75	100	COBBLES	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory. <table><thead><tr><th>Sieve size (mm)</th><th>Percentage passing (%)</th></tr></thead><tbody><tr><td>0.063</td><td>100</td></tr><tr><td>0.15</td><td>100</td></tr><tr><td>0.3</td><td>100</td></tr><tr><td>0.425</td><td>100</td></tr><tr><td>0.6</td><td>100</td></tr><tr><td>1.18</td><td>100</td></tr><tr><td>2</td><td>100</td></tr><tr><td>3.35</td><td>100</td></tr><tr><td>5</td><td>100</td></tr><tr><td>6.3</td><td>100</td></tr><tr><td>10</td><td>100</td></tr><tr><td>14</td><td>100</td></tr><tr><td>20</td><td>100</td></tr><tr><td>28</td><td>100</td></tr><tr><td>37.5</td><td>100</td></tr><tr><td>50</td><td>100</td></tr><tr><td>93</td><td>100</td></tr></tbody></table>					Sieve size (mm)	Percentage passing (%)	0.063	100	0.15	100	0.3	100	0.425	100	0.6	100	1.18	100	2	100	3.35	100	5	100	6.3	100	10	100	14	100	20	100	28	100	37.5	100	50	100	93	100
Sieve size (mm)	Percentage passing (%)																																										
0.063	100																																										
0.15	100																																										
0.3	100																																										
0.425	100																																										
0.6	100																																										
1.18	100																																										
2	100																																										
3.35	100																																										
5	100																																										
6.3	100																																										
10	100																																										
14	100																																										
20	100																																										
28	100																																										
37.5	100																																										
50	100																																										
93	100																																										
63	100																																										
50	100																																										
37.5	100																																										
28	100																																										
20	99																																										
14	98																																										
10	95																																										
6.3	93																																										
5	92																																										
3.35	89																																										
2	86																																										
1.18	83																																										
0.6	80																																										
0.425	78																																										
0.3	76																																										
0.15	69																																										
0.063	60																																										

		GRAVEL	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
		SAND	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
		SILT/CLAY	Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
			Results relate only to the specimen tested in as received condition unless otherwise noted. * denotes Customer supplied information. Opinions and interpretations are outside the scope of accreditation. This report shall not be reproduced except in full without the written approval of the Laboratory.	Sieve size (mm)	Percentage passing (%)		-----------------	------------------------		0.063	100		0.15	100		0.3	100		0.425	100		0.6	100		1.18	100		2	100		3.35	100		5	100		6.3	100		10	100		14	100		20	100		28	100		37.5	100		50	100		93	100					
</																																																																

IGSL Ltd Materials Laboratory

Approved by:	Date:	Page no:
	21/02/23	1 of 1

Persons authorised to approve report: J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142007</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP04</td> </tr> <tr> <td>Sample No.*</td> <td>AA186982</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7562</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>14</td> </tr> <tr> <td>MCV:</td> <td>4.6</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY</td> </tr> </table>				Report No.	R142007	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP04	Sample No.*	AA186982	Depth* (m)	0.60	Sample Type:	B	Lab Sample No.	A22/7562	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	13	% Particles > 20mm (By dry mass):	14	MCV:	4.6	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY
Report No.	R142007																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP04																																								
Sample No.*	AA186982																																								
Depth* (m)	0.60																																								
Sample Type:	B																																								
Lab Sample No.	A22/7562																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	13																																								
% Particles > 20mm (By dry mass):	14																																								
MCV:	4.6																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142008</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP04</td> </tr> <tr> <td>Sample No.*</td> <td>AA186982</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7562</td> </tr> <tr> <td>Source* (if applicable)</td> <td>0</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>10</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>14</td> </tr> <tr> <td>MCV:</td> <td>7.2</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY - 1% Lime Added</td> </tr> </table>				Report No.	R142008	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP04	Sample No.*	AA186982	Depth* (m)	0.60	Sample Type:	B	Lab Sample No.	A22/7562	Source* (if applicable)	0	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	10	% Particles > 20mm (By dry mass):	14	MCV:	7.2	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1% Lime Added
Report No.	R142008																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP04																																								
Sample No.*	AA186982																																								
Depth* (m)	0.60																																								
Sample Type:	B																																								
Lab Sample No.	A22/7562																																								
Source* (if applicable)	0																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	10																																								
% Particles > 20mm (By dry mass):	14																																								
MCV:	7.2																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142685</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP04</td> </tr> <tr> <td>Sample No.*</td> <td>AA186982</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7562</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>08/02/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>14</td> </tr> <tr> <td>MCV:</td> <td>8.6</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY - 1% Lime/2% Cement</td> </tr> </table>				Report No.	R142685	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP04	Sample No.*	AA186982	Depth* (m)	0.60	Sample Type:	B	Lab Sample No.	A22/7562	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	08/02/23	Sample Cert:	Not Provided	Moisture Content (%):	14	% Particles > 20mm (By dry mass):	14	MCV:	8.6	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1% Lime/2% Cement
Report No.	R142685																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP04																																								
Sample No.*	AA186982																																								
Depth* (m)	0.60																																								
Sample Type:	B																																								
Lab Sample No.	A22/7562																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	08/02/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	14																																								
% Particles > 20mm (By dry mass):	14																																								
MCV:	8.6																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1% Lime/2% Cement																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/03/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142009</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP04</td> </tr> <tr> <td>Sample No.*</td> <td>AA186982</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7562</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>11</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>14</td> </tr> <tr> <td>MCV:</td> <td>13.6</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY - 3% Lime Added</td> </tr> </table>				Report No.	R142009	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP04	Sample No.*	AA186982	Depth* (m)	0.60	Sample Type:	B	Lab Sample No.	A22/7562	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	11	% Particles > 20mm (By dry mass):	14	MCV:	13.6	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 3% Lime Added
Report No.	R142009																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP04																																								
Sample No.*	AA186982																																								
Depth* (m)	0.60																																								
Sample Type:	B																																								
Lab Sample No.	A22/7562																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	11																																								
% Particles > 20mm (By dry mass):	14																																								
MCV:	13.6																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 3% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory		Approved by	Date	Page																																					
			01/02/23	1 of 1																																					

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142010</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP12</td> </tr> <tr> <td>Sample No.*</td> <td>AA185481</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7563</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>6.4</td> </tr> <tr> <td>MCV:</td> <td>6.0</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY</td> </tr> </table>				Report No.	R142010	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP12	Sample No.*	AA185481	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7563	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	13	% Particles > 20mm (By dry mass):	6.4	MCV:	6.0	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY
Report No.	R142010																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP12																																								
Sample No.*	AA185481																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7563																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	13																																								
% Particles > 20mm (By dry mass):	6.4																																								
MCV:	6.0																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142011</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP12</td> </tr> <tr> <td>Sample No.*</td> <td>AA185481</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7563</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>6.4</td> </tr> <tr> <td>MCV:</td> <td>8.0</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY - 1% Lime Added</td> </tr> </table>				Report No.	R142011	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP12	Sample No.*	AA185481	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7563	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	13	% Particles > 20mm (By dry mass):	6.4	MCV:	8.0	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1% Lime Added
Report No.	R142011																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP12																																								
Sample No.*	AA185481																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7563																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	13																																								
% Particles > 20mm (By dry mass):	6.4																																								
MCV:	8.0																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142686</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP12</td> </tr> <tr> <td>Sample No.*</td> <td>AA185481</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7563</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>6.4</td> </tr> <tr> <td>MCV:</td> <td>8.9</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY - 1%Lime / 2% Cement</td> </tr> </table>				Report No.	R142686	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP12	Sample No.*	AA185481	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7563	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	14	% Particles > 20mm (By dry mass):	6.4	MCV:	8.9	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1%Lime / 2% Cement
Report No.	R142686																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP12																																								
Sample No.*	AA185481																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7563																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	14																																								
% Particles > 20mm (By dry mass):	6.4																																								
MCV:	8.9																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1%Lime / 2% Cement																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/03/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142012</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP12</td> </tr> <tr> <td>Sample No.*</td> <td>AA185481</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7563</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>6.4</td> </tr> <tr> <td>MCV:</td> <td>11.7</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY - 3% Lime Added</td> </tr> </table>				Report No.	R142012	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP12	Sample No.*	AA185481	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7563	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	12	% Particles > 20mm (By dry mass):	6.4	MCV:	11.7	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 3% Lime Added
Report No.	R142012																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP12																																								
Sample No.*	AA185481																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7563																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	12																																								
% Particles > 20mm (By dry mass):	6.4																																								
MCV:	11.7																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 3% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142013</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP13</td> </tr> <tr> <td>Sample No.*</td> <td>AA185455</td> </tr> <tr> <td>Depth* (m)</td> <td>1.00</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7560</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>9.3</td> </tr> <tr> <td>MCV:</td> <td>8.8</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Grey/brown sandy gravelly SILT/CLAY</td> </tr> </table>				Report No.	R142013	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP13	Sample No.*	AA185455	Depth* (m)	1.00	Sample Type:	B	Lab Sample No.	A22/7560	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	12	% Particles > 20mm (By dry mass):	9.3	MCV:	8.8	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Grey/brown sandy gravelly SILT/CLAY
Report No.	R142013																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP13																																								
Sample No.*	AA185455																																								
Depth* (m)	1.00																																								
Sample Type:	B																																								
Lab Sample No.	A22/7560																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	12																																								
% Particles > 20mm (By dry mass):	9.3																																								
MCV:	8.8																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Grey/brown sandy gravelly SILT/CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142014</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP15</td> </tr> <tr> <td>Sample No.*</td> <td>AA185479</td> </tr> <tr> <td>Depth* (m)</td> <td>1.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7565</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>3.3</td> </tr> <tr> <td>MCV:</td> <td>7.1</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy, slightly gravelly, CLAY</td> </tr> </table>				Report No.	R142014	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP15	Sample No.*	AA185479	Depth* (m)	1.50	Sample Type:	B	Lab Sample No.	A22/7565	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	13	% Particles > 20mm (By dry mass):	3.3	MCV:	7.1	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy, slightly gravelly, CLAY
Report No.	R142014																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP15																																								
Sample No.*	AA185479																																								
Depth* (m)	1.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7565																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	13																																								
% Particles > 20mm (By dry mass):	3.3																																								
MCV:	7.1																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy, slightly gravelly, CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142015</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP16</td> </tr> <tr> <td>Sample No.*</td> <td>AA185461</td> </tr> <tr> <td>Depth* (m)</td> <td>1.00</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7566</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>24/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>12</td> </tr> <tr> <td>MCV:</td> <td>0.2</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Mottled brown slightly sandy, slightly gravelly, CLAY</td> </tr> </table>				Report No.	R142015	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP16	Sample No.*	AA185461	Depth* (m)	1.00	Sample Type:	B	Lab Sample No.	A22/7566	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	24/01/23	Sample Cert:	Not Provided	Moisture Content (%):	14	% Particles > 20mm (By dry mass):	12	MCV:	0.2	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Mottled brown slightly sandy, slightly gravelly, CLAY
Report No.	R142015																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP16																																								
Sample No.*	AA185461																																								
Depth* (m)	1.00																																								
Sample Type:	B																																								
Lab Sample No.	A22/7566																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	24/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	14																																								
% Particles > 20mm (By dry mass):	12																																								
MCV:	0.2																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Mottled brown slightly sandy, slightly gravelly, CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.			Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																						
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142687</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP18</td> </tr> <tr> <td>Sample No.*</td> <td>AA185468</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7567</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>9.2</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>14</td> </tr> <tr> <td>MCV:</td> <td>12.3</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Mottled brown sandy gravelly SILT/CLAY</td> </tr> </table>				Report No.	R142687	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP18	Sample No.*	AA185468	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7567	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	9.2	% Particles > 20mm (By dry mass):	14	MCV:	12.3	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Mottled brown sandy gravelly SILT/CLAY
Report No.	R142687																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP18																																								
Sample No.*	AA185468																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7567																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	9.2																																								
% Particles > 20mm (By dry mass):	14																																								
MCV:	12.3																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Mottled brown sandy gravelly SILT/CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/03/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142016</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP19</td> </tr> <tr> <td>Sample No.*</td> <td>AA185468</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7568</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>8.9</td> </tr> <tr> <td>MCV:</td> <td>8.2</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown sandy gravelly SILT/CLAY</td> </tr> </table>				Report No.	R142016	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP19	Sample No.*	AA185468	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7568	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	13	% Particles > 20mm (By dry mass):	8.9	MCV:	8.2	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown sandy gravelly SILT/CLAY
Report No.	R142016																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP19																																								
Sample No.*	AA185468																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7568																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	13																																								
% Particles > 20mm (By dry mass):	8.9																																								
MCV:	8.2																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown sandy gravelly SILT/CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142017</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP19</td> </tr> <tr> <td>Sample No.*</td> <td>AA185468</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7568</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>8.9</td> </tr> <tr> <td>MCV:</td> <td>11.2</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Mottled brown slightly sandy slightly gravelly CLAY - 1% Lime Added</td> </tr> </table>				Report No.	R142017	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP19	Sample No.*	AA185468	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7568	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	13	% Particles > 20mm (By dry mass):	8.9	MCV:	11.2	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Mottled brown slightly sandy slightly gravelly CLAY - 1% Lime Added
Report No.	R142017																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP19																																								
Sample No.*	AA185468																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7568																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	13																																								
% Particles > 20mm (By dry mass):	8.9																																								
MCV:	11.2																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Mottled brown slightly sandy slightly gravelly CLAY - 1% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.			Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																						
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142688</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP19</td> </tr> <tr> <td>Sample No.*</td> <td>AA185468</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7568</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>08/02/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>8.8</td> </tr> <tr> <td>MCV:</td> <td>11.5</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Mottled brown slightly sandy slightly gravelly CLAY - 1% Lime / 2% Cement</td> </tr> </table>				Report No.	R142688	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP19	Sample No.*	AA185468	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7568	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	08/02/23	Sample Cert:	Not Provided	Moisture Content (%):	12	% Particles > 20mm (By dry mass):	8.8	MCV:	11.5	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Mottled brown slightly sandy slightly gravelly CLAY - 1% Lime / 2% Cement
Report No.	R142688																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP19																																								
Sample No.*	AA185468																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7568																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	08/02/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	12																																								
% Particles > 20mm (By dry mass):	8.8																																								
MCV:	11.5																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Mottled brown slightly sandy slightly gravelly CLAY - 1% Lime / 2% Cement																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.			Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																						
IGSL Ltd Materials Laboratory	Approved by 		Date 01/03/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142018</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP19</td> </tr> <tr> <td>Sample No.*</td> <td>AA185468</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7568</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>25/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>8.9</td> </tr> <tr> <td>MCV:</td> <td>12.9</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Mottled brown slightly sandy slightly gravelly CLAY - 3% Lime Added</td> </tr> </table>				Report No.	R142018	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP19	Sample No.*	AA185468	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7568	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	25/01/23	Sample Cert:	Not Provided	Moisture Content (%):	12	% Particles > 20mm (By dry mass):	8.9	MCV:	12.9	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Mottled brown slightly sandy slightly gravelly CLAY - 3% Lime Added
Report No.	R142018																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP19																																								
Sample No.*	AA185468																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7568																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	25/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	12																																								
% Particles > 20mm (By dry mass):	8.9																																								
MCV:	12.9																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Mottled brown slightly sandy slightly gravelly CLAY - 3% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142019</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP20</td> </tr> <tr> <td>Sample No.*</td> <td>AA185488</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7569</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>18</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>10</td> </tr> <tr> <td>MCV:</td> <td>2.4</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Grey/brown sandy gravelly SILT/CLAY</td> </tr> </table>				Report No.	R142019	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP20	Sample No.*	AA185488	Depth* (m)	0.60	Sample Type:	B	Lab Sample No.	A22/7569	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	18	% Particles > 20mm (By dry mass):	10	MCV:	2.4	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Grey/brown sandy gravelly SILT/CLAY
Report No.	R142019																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP20																																								
Sample No.*	AA185488																																								
Depth* (m)	0.60																																								
Sample Type:	B																																								
Lab Sample No.	A22/7569																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	18																																								
% Particles > 20mm (By dry mass):	10																																								
MCV:	2.4																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Grey/brown sandy gravelly SILT/CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142020</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP21</td> </tr> <tr> <td>Sample No.*</td> <td>AA181983</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7570</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>20</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>3.5</td> </tr> <tr> <td>MCV:</td> <td>7.6</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown sandy gravelly SILT/CLAY</td> </tr> </table>				Report No.	R142020	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP21	Sample No.*	AA181983	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7570	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	20	% Particles > 20mm (By dry mass):	3.5	MCV:	7.6	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown sandy gravelly SILT/CLAY
Report No.	R142020																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP21																																								
Sample No.*	AA181983																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7570																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	20																																								
% Particles > 20mm (By dry mass):	3.5																																								
MCV:	7.6																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown sandy gravelly SILT/CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142021</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP22</td> </tr> <tr> <td>Sample No.*</td> <td>AA185497</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7571</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>20</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>7.0</td> </tr> <tr> <td>MCV:</td> <td>5.7</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown sandy gravelly SILT/CLAY</td> </tr> </table>				Report No.	R142021	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP22	Sample No.*	AA185497	Depth* (m)	0.60	Sample Type:	B	Lab Sample No.	A22/7571	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	20	% Particles > 20mm (By dry mass):	7.0	MCV:	5.7	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown sandy gravelly SILT/CLAY
Report No.	R142021																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP22																																								
Sample No.*	AA185497																																								
Depth* (m)	0.60																																								
Sample Type:	B																																								
Lab Sample No.	A22/7571																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	20																																								
% Particles > 20mm (By dry mass):	7.0																																								
MCV:	5.7																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown sandy gravelly SILT/CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R143243</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP24</td> </tr> <tr> <td>Sample No.*</td> <td>AA181960</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7573</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>15/02/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>8.6</td> </tr> <tr> <td>MCV:</td> <td>11.2</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown sandy gravelly SILT/CLAY</td> </tr> </table>				Report No.	R143243	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP24	Sample No.*	AA181960	Depth* (m)	0.60	Sample Type:	B	Lab Sample No.	A22/7573	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	15/02/23	Sample Cert:	Not Provided	Moisture Content (%):	14	% Particles > 20mm (By dry mass):	8.6	MCV:	11.2	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown sandy gravelly SILT/CLAY
Report No.	R143243																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP24																																								
Sample No.*	AA181960																																								
Depth* (m)	0.60																																								
Sample Type:	B																																								
Lab Sample No.	A22/7573																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	15/02/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	14																																								
% Particles > 20mm (By dry mass):	8.6																																								
MCV:	11.2																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown sandy gravelly SILT/CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/03/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142022</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP26</td> </tr> <tr> <td>Sample No.*</td> <td>AA181975</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7575</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>7.6</td> </tr> <tr> <td>MCV:</td> <td>6.4</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy, slightly gravelly, CLAY</td> </tr> </table>				Report No.	R142022	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP26	Sample No.*	AA181975	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7575	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	14	% Particles > 20mm (By dry mass):	7.6	MCV:	6.4	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy, slightly gravelly, CLAY
Report No.	R142022																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP26																																								
Sample No.*	AA181975																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7575																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	14																																								
% Particles > 20mm (By dry mass):	7.6																																								
MCV:	6.4																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy, slightly gravelly, CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142023</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP26</td> </tr> <tr> <td>Sample No.*</td> <td>AA181975</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7575</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>11</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>7.6</td> </tr> <tr> <td>MCV:</td> <td>8.4</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY - 1% Lime Added</td> </tr> </table>				Report No.	R142023	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP26	Sample No.*	AA181975	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7575	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	11	% Particles > 20mm (By dry mass):	7.6	MCV:	8.4	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1% Lime Added
Report No.	R142023																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP26																																								
Sample No.*	AA181975																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7575																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	11																																								
% Particles > 20mm (By dry mass):	7.6																																								
MCV:	8.4																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 1% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142689</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP26</td> </tr> <tr> <td>Sample No.*</td> <td>AA181975</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7575</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>10/02/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>7.6</td> </tr> <tr> <td>MCV:</td> <td>9.8</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy, slightly gravelly CLAY - 1% Lime / 2% Cement</td> </tr> </table>				Report No.	R142689	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP26	Sample No.*	AA181975	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7575	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	10/02/23	Sample Cert:	Not Provided	Moisture Content (%):	12	% Particles > 20mm (By dry mass):	7.6	MCV:	9.8	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy, slightly gravelly CLAY - 1% Lime / 2% Cement
Report No.	R142689																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP26																																								
Sample No.*	AA181975																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7575																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	10/02/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	12																																								
% Particles > 20mm (By dry mass):	7.6																																								
MCV:	9.8																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy, slightly gravelly CLAY - 1% Lime / 2% Cement																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.			Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																						
IGSL Ltd Materials Laboratory	Approved by 		Date 01/03/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142024</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP26</td> </tr> <tr> <td>Sample No.*</td> <td>AA181975</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7575</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>7.6</td> </tr> <tr> <td>MCV:</td> <td>11.9</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY - 3% Lime Added</td> </tr> </table>				Report No.	R142024	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP26	Sample No.*	AA181975	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7575	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	12	% Particles > 20mm (By dry mass):	7.6	MCV:	11.9	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 3% Lime Added
Report No.	R142024																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP26																																								
Sample No.*	AA181975																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7575																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	12																																								
% Particles > 20mm (By dry mass):	7.6																																								
MCV:	11.9																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY - 3% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.			Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																						
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142025</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP28</td> </tr> <tr> <td>Sample No.*</td> <td>AA181969</td> </tr> <tr> <td>Depth* (m)</td> <td>0.70</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7576</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>25</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>3.4</td> </tr> <tr> <td>MCV:</td> <td>2.8</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Mottled brown slightly sandy, slightly gravelly, CLAY</td> </tr> </table>				Report No.	R142025	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP28	Sample No.*	AA181969	Depth* (m)	0.70	Sample Type:	B	Lab Sample No.	A22/7576	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	25	% Particles > 20mm (By dry mass):	3.4	MCV:	2.8	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Mottled brown slightly sandy, slightly gravelly, CLAY
Report No.	R142025																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP28																																								
Sample No.*	AA181969																																								
Depth* (m)	0.70																																								
Sample Type:	B																																								
Lab Sample No.	A22/7576																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	25																																								
% Particles > 20mm (By dry mass):	3.4																																								
MCV:	2.8																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Mottled brown slightly sandy, slightly gravelly, CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.			Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																						
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142494</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP29</td> </tr> <tr> <td>Sample No.*</td> <td>AA181986</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7577</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>9.9</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>12</td> </tr> <tr> <td>MCV:</td> <td>16</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown sandy gravelly SILT/CLAY</td> </tr> </table>				Report No.	R142494	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP29	Sample No.*	AA181986	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7577	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	9.9	% Particles > 20mm (By dry mass):	12	MCV:	16	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown sandy gravelly SILT/CLAY
Report No.	R142494																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP29																																								
Sample No.*	AA181986																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7577																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	9.9																																								
% Particles > 20mm (By dry mass):	12																																								
MCV:	16																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown sandy gravelly SILT/CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142495</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP31</td> </tr> <tr> <td>Sample No.*</td> <td>AA181992</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7578</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>11</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>7.2</td> </tr> <tr> <td>MCV:</td> <td>12.7</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly CLAY</td> </tr> </table>				Report No.	R142495	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP31	Sample No.*	AA181992	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7578	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	11	% Particles > 20mm (By dry mass):	7.2	MCV:	12.7	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly CLAY
Report No.	R142495																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP31																																								
Sample No.*	AA181992																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7578																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	11																																								
% Particles > 20mm (By dry mass):	7.2																																								
MCV:	12.7																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

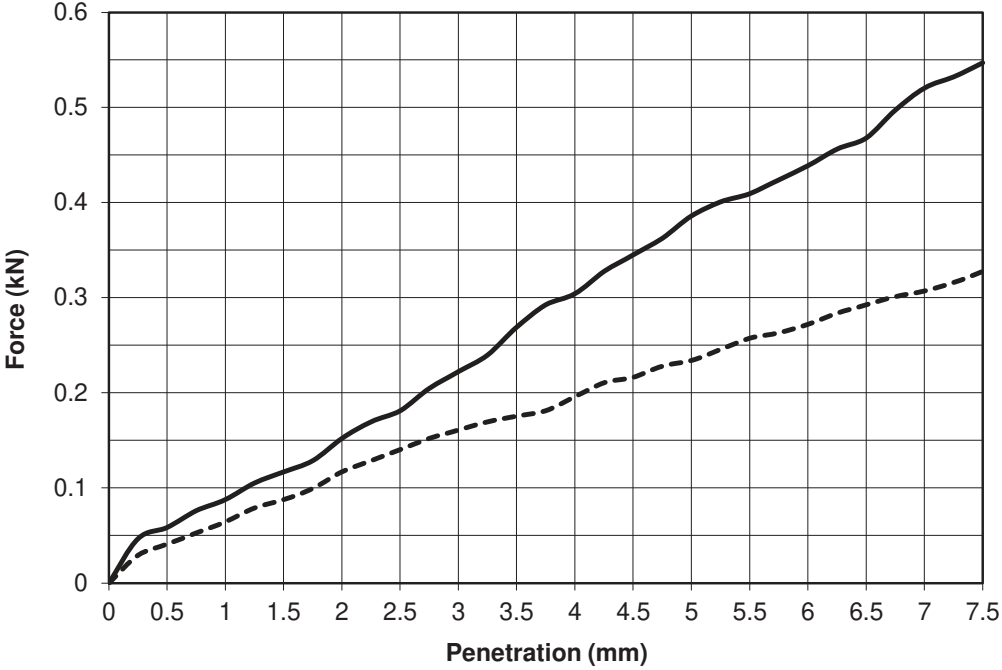
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142496</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP31</td> </tr> <tr> <td>Sample No.*</td> <td>AA181992</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7578</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>9.5</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>7.2</td> </tr> <tr> <td>MCV:</td> <td>15.4</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly SILT/CLAY - 1% Lime Added</td> </tr> </table>				Report No.	R142496	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP31	Sample No.*	AA181992	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7578	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	9.5	% Particles > 20mm (By dry mass):	7.2	MCV:	15.4	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly SILT/CLAY - 1% Lime Added
Report No.	R142496																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP31																																								
Sample No.*	AA181992																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7578																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	9.5																																								
% Particles > 20mm (By dry mass):	7.2																																								
MCV:	15.4																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly SILT/CLAY - 1% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.			Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																						
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142690</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP31</td> </tr> <tr> <td>Sample No.*</td> <td>AA181992</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7578</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>08/02/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>10</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>7.2</td> </tr> <tr> <td>MCV:</td> <td>15.4</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly SILT/CLAY - 1% Lime / 2% Cement</td> </tr> </table>				Report No.	R142690	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP31	Sample No.*	AA181992	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7578	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	08/02/23	Sample Cert:	Not Provided	Moisture Content (%):	10	% Particles > 20mm (By dry mass):	7.2	MCV:	15.4	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly SILT/CLAY - 1% Lime / 2% Cement
Report No.	R142690																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP31																																								
Sample No.*	AA181992																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7578																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	08/02/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	10																																								
% Particles > 20mm (By dry mass):	7.2																																								
MCV:	15.4																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly SILT/CLAY - 1% Lime / 2% Cement																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.			Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																						
IGSL Ltd Materials Laboratory	Approved by		Date																																						
			Page																																						
		01/03/23	1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142497</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP31</td> </tr> <tr> <td>Sample No.*</td> <td>AA181992</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7578</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>26/01/23</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>9.2</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>7.2</td> </tr> <tr> <td>MCV:</td> <td>16.1</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy slightly gravelly SILT/CLAY - 3% Lime Added</td> </tr> </table>				Report No.	R142497	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP31	Sample No.*	AA181992	Depth* (m)	0.50	Sample Type:	B	Lab Sample No.	A22/7578	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	26/01/23	Sample Cert:	Not Provided	Moisture Content (%):	9.2	% Particles > 20mm (By dry mass):	7.2	MCV:	16.1	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy slightly gravelly SILT/CLAY - 3% Lime Added
Report No.	R142497																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP31																																								
Sample No.*	AA181992																																								
Depth* (m)	0.50																																								
Sample Type:	B																																								
Lab Sample No.	A22/7578																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	26/01/23																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	9.2																																								
% Particles > 20mm (By dry mass):	7.2																																								
MCV:	16.1																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy slightly gravelly SILT/CLAY - 3% Lime Added																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

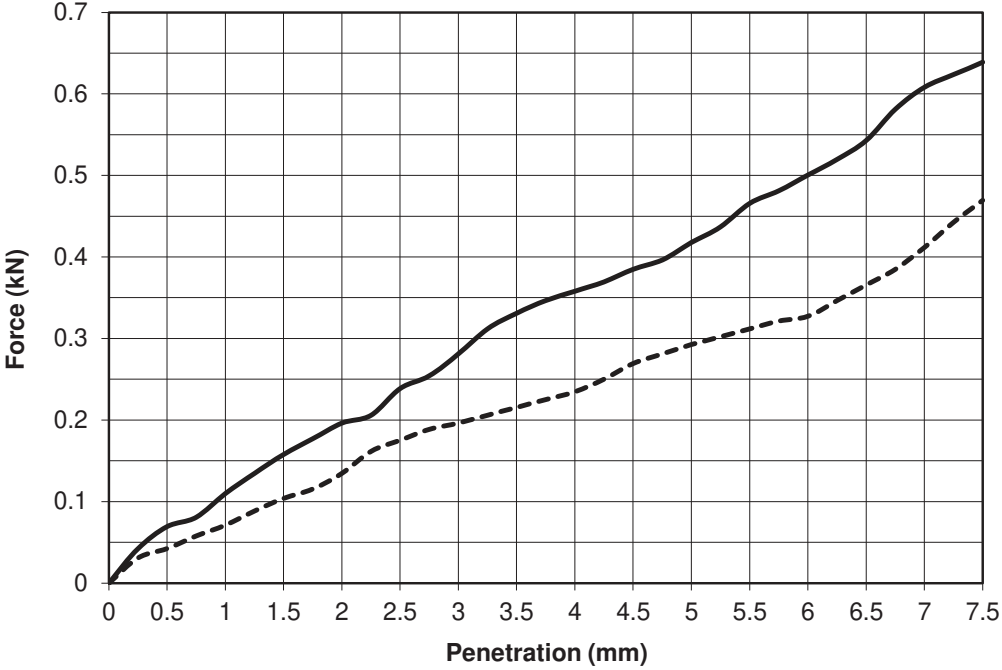
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142498</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP33</td> </tr> <tr> <td>Sample No.*</td> <td>AA181989</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7579</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>24/01/22</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>21</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>2.7</td> </tr> <tr> <td>MCV:</td> <td>6.9</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown slightly sandy, slightly gravelly, CLAY</td> </tr> </table>				Report No.	R142498	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP33	Sample No.*	AA181989	Depth* (m)	0.60	Sample Type:	B	Lab Sample No.	A22/7579	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	24/01/22	Sample Cert:	Not Provided	Moisture Content (%):	21	% Particles > 20mm (By dry mass):	2.7	MCV:	6.9	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown slightly sandy, slightly gravelly, CLAY
Report No.	R142498																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP33																																								
Sample No.*	AA181989																																								
Depth* (m)	0.60																																								
Sample Type:	B																																								
Lab Sample No.	A22/7579																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	24/01/22																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	21																																								
% Particles > 20mm (By dry mass):	2.7																																								
MCV:	6.9																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown slightly sandy, slightly gravelly, CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co. Kildare 045 899324	Test Report																																								
	Determination of Moisture Condition Value at Natural Moisture Content																																								
	Tested in accordance with BS1377:Part 4:1990, clause 5.4																																								
<table border="0" style="width: 100%;"> <tr> <td style="width: 50%;">Report No.</td> <td style="width: 50%;">R142499</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> </tr> <tr> <td>Contract Name:</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Customer:</td> <td>DOBA</td> </tr> <tr> <td>BH/TP*</td> <td>TP34</td> </tr> <tr> <td>Sample No.*</td> <td>AA181986</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> </tr> <tr> <td>Sample Type:</td> <td>B</td> </tr> <tr> <td>Lab Sample No.</td> <td>A22/7580</td> </tr> <tr> <td>Source* (if applicable)</td> <td>N/A</td> </tr> <tr> <td>Material Type* (if applicable):</td> <td>B</td> </tr> <tr> <td>Sample Received:</td> <td>24/01/23</td> </tr> <tr> <td>Date Tested:</td> <td>24/01/22</td> </tr> <tr> <td>Sample Cert:</td> <td>Not Provided</td> </tr> <tr> <td>Moisture Content (%):</td> <td>19</td> </tr> <tr> <td>% Particles > 20mm (By dry mass):</td> <td>5.0</td> </tr> <tr> <td>MCV:</td> <td>6.8</td> </tr> <tr> <td>Interpretation of Plot:</td> <td>Steepest Straight Line</td> </tr> <tr> <td>Description of Soil:</td> <td>Brown sandy gravelly CLAY</td> </tr> </table>				Report No.	R142499	Contract No.	24330	Contract Name:	Halverstown , Naas - Proposed Data Centres	Customer:	DOBA	BH/TP*	TP34	Sample No.*	AA181986	Depth* (m)	0.60	Sample Type:	B	Lab Sample No.	A22/7580	Source* (if applicable)	N/A	Material Type* (if applicable):	B	Sample Received:	24/01/23	Date Tested:	24/01/22	Sample Cert:	Not Provided	Moisture Content (%):	19	% Particles > 20mm (By dry mass):	5.0	MCV:	6.8	Interpretation of Plot:	Steepest Straight Line	Description of Soil:	Brown sandy gravelly CLAY
Report No.	R142499																																								
Contract No.	24330																																								
Contract Name:	Halverstown , Naas - Proposed Data Centres																																								
Customer:	DOBA																																								
BH/TP*	TP34																																								
Sample No.*	AA181986																																								
Depth* (m)	0.60																																								
Sample Type:	B																																								
Lab Sample No.	A22/7580																																								
Source* (if applicable)	N/A																																								
Material Type* (if applicable):	B																																								
Sample Received:	24/01/23																																								
Date Tested:	24/01/22																																								
Sample Cert:	Not Provided																																								
Moisture Content (%):	19																																								
% Particles > 20mm (By dry mass):	5.0																																								
MCV:	6.8																																								
Interpretation of Plot:	Steepest Straight Line																																								
Description of Soil:	Brown sandy gravelly CLAY																																								
Results relate only to the specimen tested, in as received condition unless otherwise noted. Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information. This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorised to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																							
IGSL Ltd Materials Laboratory	Approved by 		Date 01/02/23																																						
			Page 1 of 1																																						

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142500</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>06/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP04</td> <td>Sample No.*</td> <td>AA186982 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7562</td> </tr> </table>			Report No.	R142500	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	06/01/23	BH/TP No.*	TP04	Sample No.*	AA186982 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7562				
Report No.	R142500	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	06/01/23																							
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7562																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>15</td> <td>Bulk Density (Mg/m³):</td> <td>2.13</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.85</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: Unsoaked				Moisture Content (%):	15	Bulk Density (Mg/m ³):	2.13	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.85	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	15	Bulk Density (Mg/m ³):	2.13																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.85																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>1.9</td> <td>1.2</td> </tr> <tr> <td>Moisture Content %</td> <td>15</td> <td>15</td> </tr> </table>			Test Result	Top	Base	CBR %	1.9	1.2	Moisture Content %	15	15															
Test Result	Top	Base																								
CBR %	1.9	1.2																								
Moisture Content %	15	15																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 60%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 20%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">31/01/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		31/01/23	1 of 1																		
Approved by	Date	Page No.																								
	31/01/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R145770	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	01/02/23
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7563



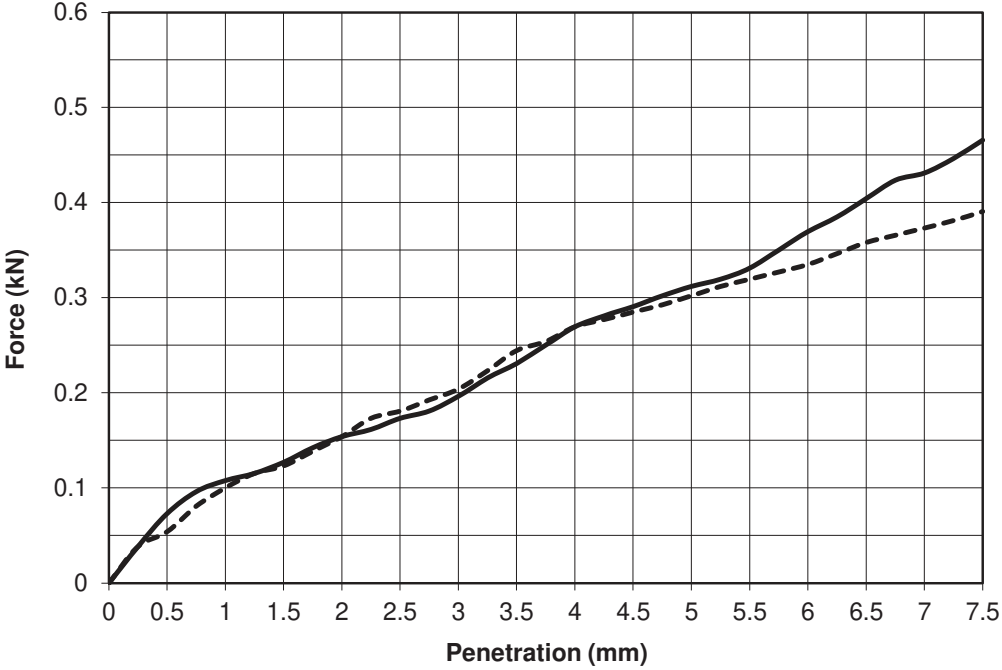
Key: ————— Top - - - - - Base

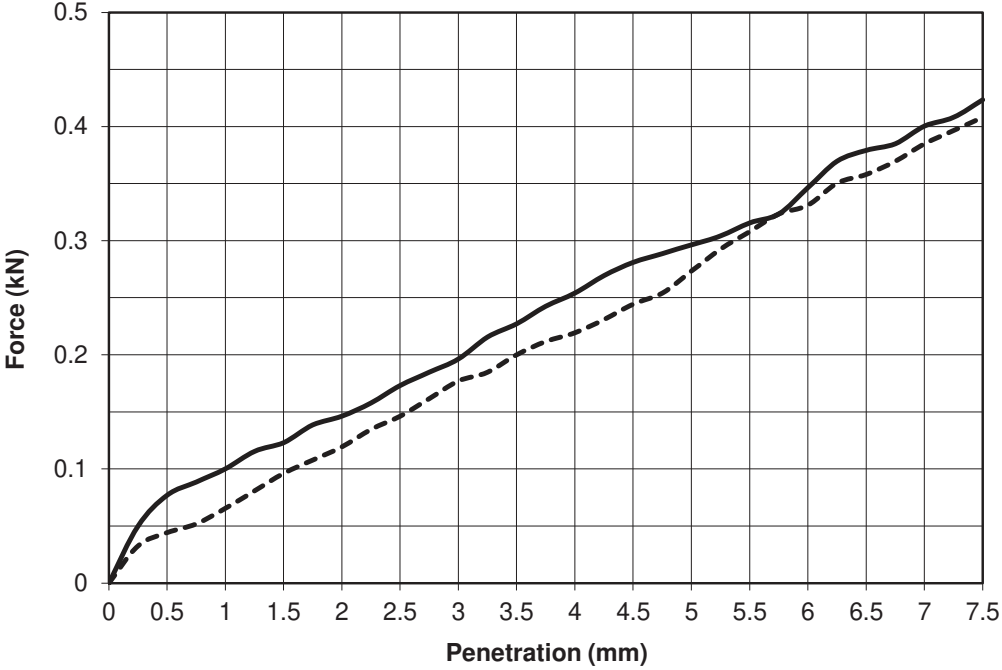
Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition:		Unsoaked	
Moisture Content (%):	17	Bulk Density (Mg/m ³):	2.15
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.84
% Material >20mm:	3.9		
Method of compaction: Static Compaction Method 2			

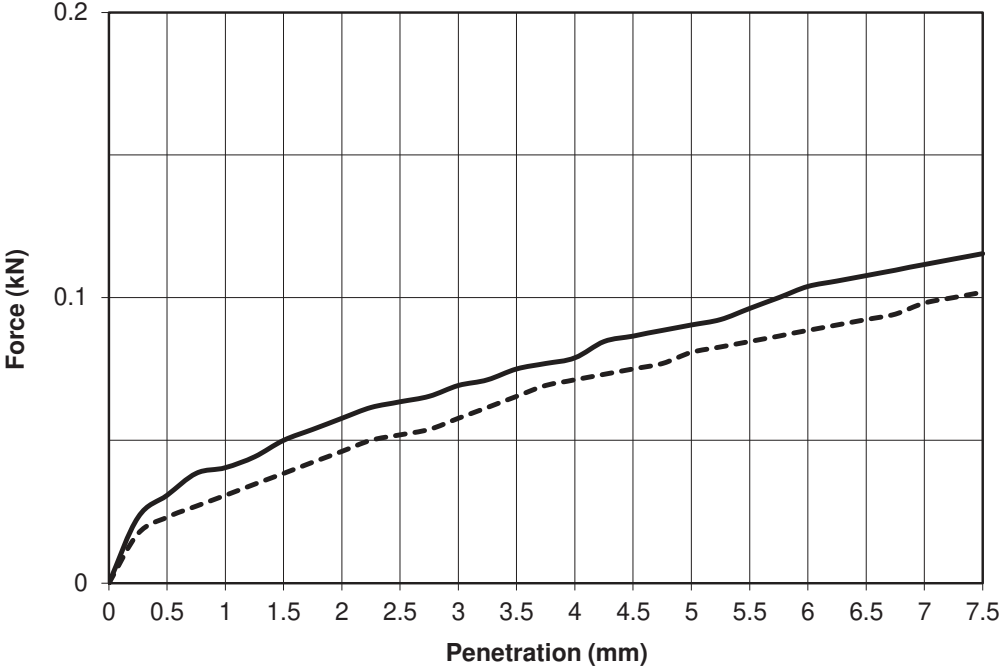
Test Result	Top	Base
CBR %	2.1	1.7
Moisture Content %	17	17

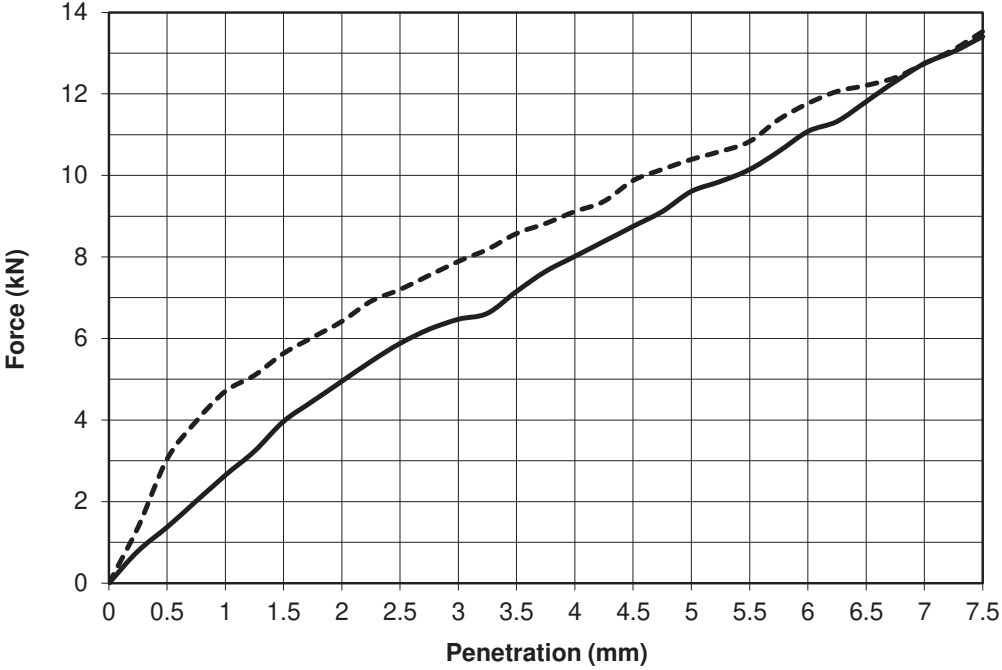
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142501</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>25/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP13</td> <td>Sample No.*</td> <td>AA185455 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>1.00</td> <td>Lab sample No.</td> <td>A22/7564</td> </tr> </table>			Report No.	R142501	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	25/01/23	BH/TP No.*	TP13	Sample No.*	AA185455 Type: B	Depth* (m)	1.00	Lab sample No.	A22/7564				
Report No.	R142501	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	25/01/23																							
BH/TP No.*	TP13	Sample No.*	AA185455 Type: B																							
Depth* (m)	1.00	Lab sample No.	A22/7564																							
 Force (kN) 0.6 0.5 0.4 0.3 0.2 0.1 0 0 0.5 1 1.5 2 2.5 3 3.5 4 4.5 5 5.5 6 6.5 7 7.5 Penetration (mm) Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown sandy gravelly SILT/CLAY</td> </tr> <tr> <td colspan="2">Initial Condition:</td> <td colspan="2">Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.20</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.95</td> </tr> <tr> <td>% Material >20mm:</td> <td>8.4</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown sandy gravelly SILT/CLAY				Initial Condition:		Unsoaked		Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.20	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95	% Material >20mm:	8.4			Method of compaction: Static Compaction Method 2			
Description: Mottled brown sandy gravelly SILT/CLAY																										
Initial Condition:		Unsoaked																								
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.20																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95																							
% Material >20mm:	8.4																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>1.6</td> <td>1.5</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	1.6	1.5	Moisture Content %	13	13															
Test Result	Top	Base																								
CBR %	1.6	1.5																								
Moisture Content %	13	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">31/01/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		31/01/23	1 of 1																		
Approved by	Date	Page No.																								
	31/01/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142502</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>26/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP15</td> <td>Sample No.*</td> <td>AA185479 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>1.50</td> <td>Lab sample No.</td> <td>A22/7565</td> </tr> </table>			Report No.	R142502	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	26/01/23	BH/TP No.*	TP15	Sample No.*	AA185479 Type: B	Depth* (m)	1.50	Lab sample No.	A22/7565				
Report No.	R142502	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	26/01/23																							
BH/TP No.*	TP15	Sample No.*	AA185479 Type: B																							
Depth* (m)	1.50	Lab sample No.	A22/7565																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy, slightly gravelly, CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.20</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.95</td> </tr> <tr> <td>% Material >20mm:</td> <td>2.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy, slightly gravelly, CLAY				Initial Condition: Unsoaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.20	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95	% Material >20mm:	2.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy, slightly gravelly, CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.20																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95																							
% Material >20mm:	2.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>1.5</td> <td>1.4</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	1.5	1.4	Moisture Content %	13	13															
Test Result	Top	Base																								
CBR %	1.5	1.4																								
Moisture Content %	13	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">31/01/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		31/01/23	1 of 1																		
Approved by	Date	Page No.																								
	31/01/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142503</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>24/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP16</td> <td>Sample No.*</td> <td>AA185461 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>1.00</td> <td>Lab sample No.</td> <td>A22/7566</td> </tr> </table>			Report No.	R142503	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	24/01/23	BH/TP No.*	TP16	Sample No.*	AA185461 Type: B	Depth* (m)	1.00	Lab sample No.	A22/7566				
Report No.	R142503	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	24/01/23																							
BH/TP No.*	TP16	Sample No.*	AA185461 Type: B																							
Depth* (m)	1.00	Lab sample No.	A22/7566																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy, slightly gravelly, CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.20</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.92</td> </tr> <tr> <td>% Material >20mm:</td> <td>11</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy, slightly gravelly, CLAY				Initial Condition: Unsoaked				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.20	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92	% Material >20mm:	11			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy, slightly gravelly, CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.20																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92																							
% Material >20mm:	11																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <td style="width: 30%;">Test Result</td> <td style="width: 35%;">Top</td> <td style="width: 35%;">Base</td> </tr> <tr> <td>CBR %</td> <td>0.5</td> <td>0.4</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>14</td> </tr> </table>			Test Result	Top	Base	CBR %	0.5	0.4	Moisture Content %	14	14															
Test Result	Top	Base																								
CBR %	0.5	0.4																								
Moisture Content %	14	14																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border-bottom: 1px solid black;">Date</td> <td style="width: 50%; border-bottom: 1px solid black;">Page No.</td> </tr> <tr> <td style="text-align: center;">31/01/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	31/01/23	1 of 1																				
Date	Page No.																									
31/01/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142504</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>24/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP18</td> <td>Sample No.*</td> <td>AA185484 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7567</td> </tr> </table>			Report No.	R142504	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	24/01/23	BH/TP No.*	TP18	Sample No.*	AA185484 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7567				
Report No.	R142504	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	24/01/23																							
BH/TP No.*	TP18	Sample No.*	AA185484 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7567																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown sandy gravelly SILT/CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>10</td> <td>Bulk Density (Mg/m³):</td> <td>2.10</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.92</td> </tr> <tr> <td>% Material >20mm:</td> <td>13</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown sandy gravelly SILT/CLAY				Initial Condition: Unsoaked				Moisture Content (%):	10	Bulk Density (Mg/m ³):	2.10	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92	% Material >20mm:	13			Method of compaction: Static Compaction Method 2			
Description: Mottled brown sandy gravelly SILT/CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	10	Bulk Density (Mg/m ³):	2.10																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92																							
% Material >20mm:	13																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <td style="width: 30%;">Test Result</td> <td style="width: 35%;">Top</td> <td style="width: 35%;">Base</td> </tr> <tr> <td>CBR %</td> <td>48</td> <td>54</td> </tr> <tr> <td>Moisture Content %</td> <td>10</td> <td>9.3</td> </tr> </table>			Test Result	Top	Base	CBR %	48	54	Moisture Content %	10	9.3															
Test Result	Top	Base																								
CBR %	48	54																								
Moisture Content %	10	9.3																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">31/01/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		31/01/23	1 of 1																		
Approved by	Date	Page No.																								
	31/01/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R145760	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	18/02/23
BH/TP No.*	TP19	Sample No.*	AA185468 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7568

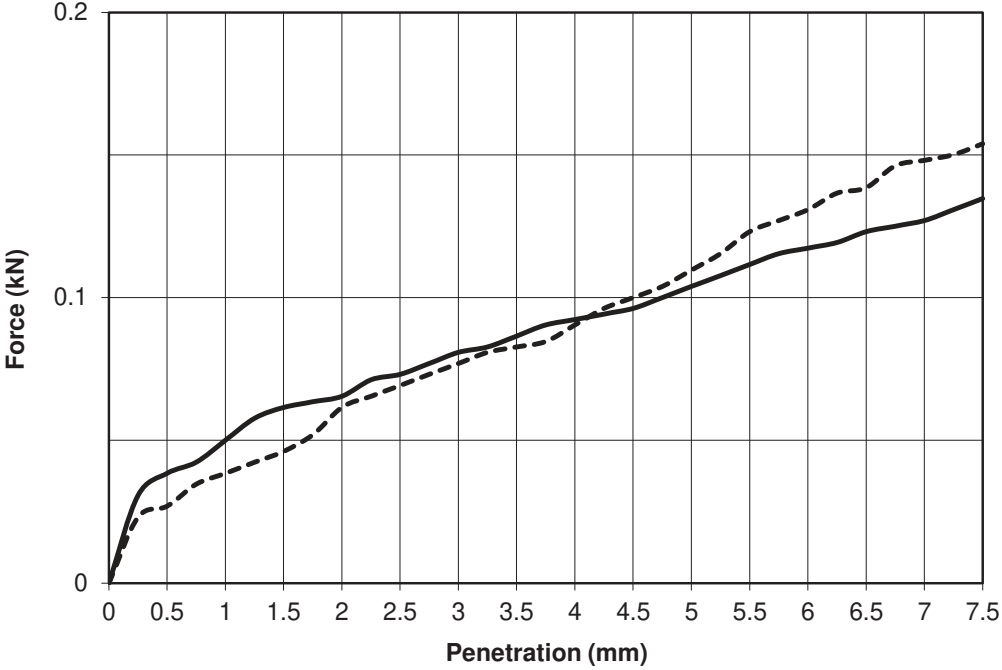
Key: ————— Top - - - - - Base

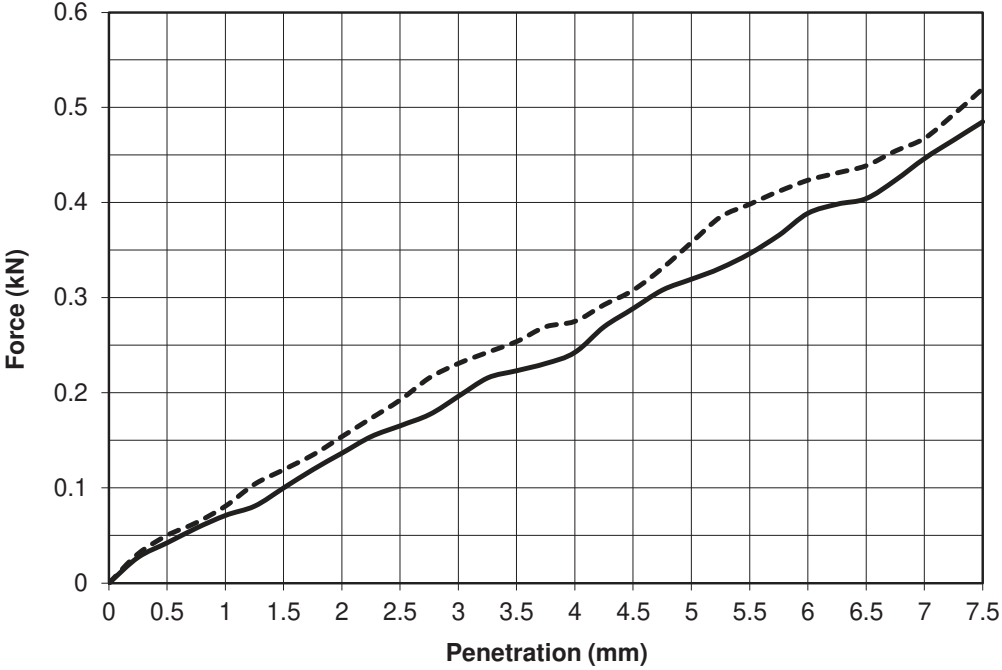
Description: Brown sandy gravelly SILT/CLAY			
Initial Condition:		Unsoaked	
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.17
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92
% Material >20mm:	6.4		
Method of compaction: Static Compaction Method 2			

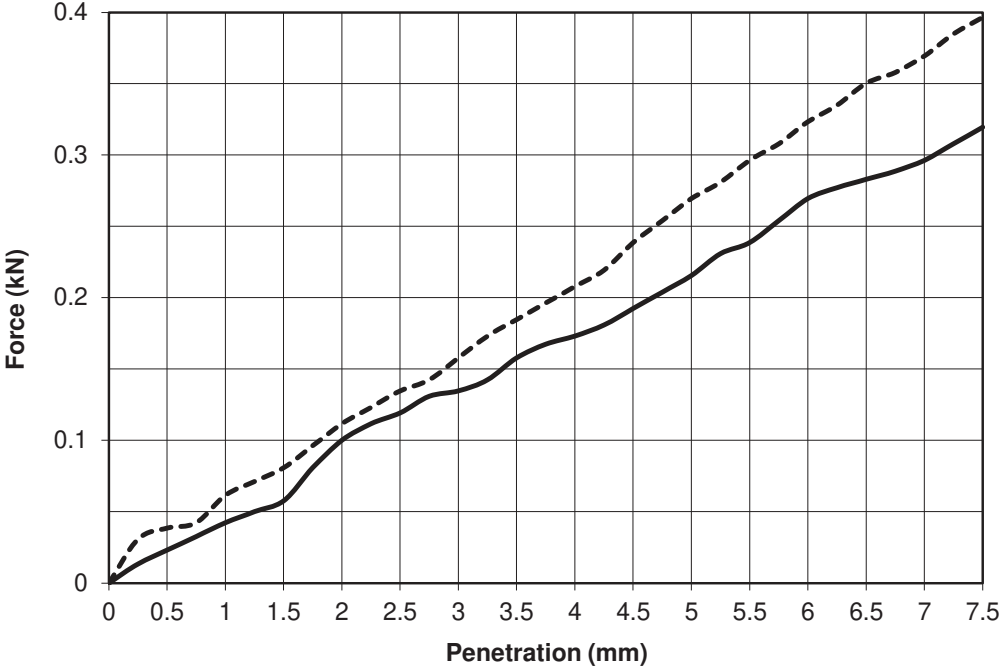
Test Result	Top	Base
CBR %	8	10
Moisture Content %	13	13

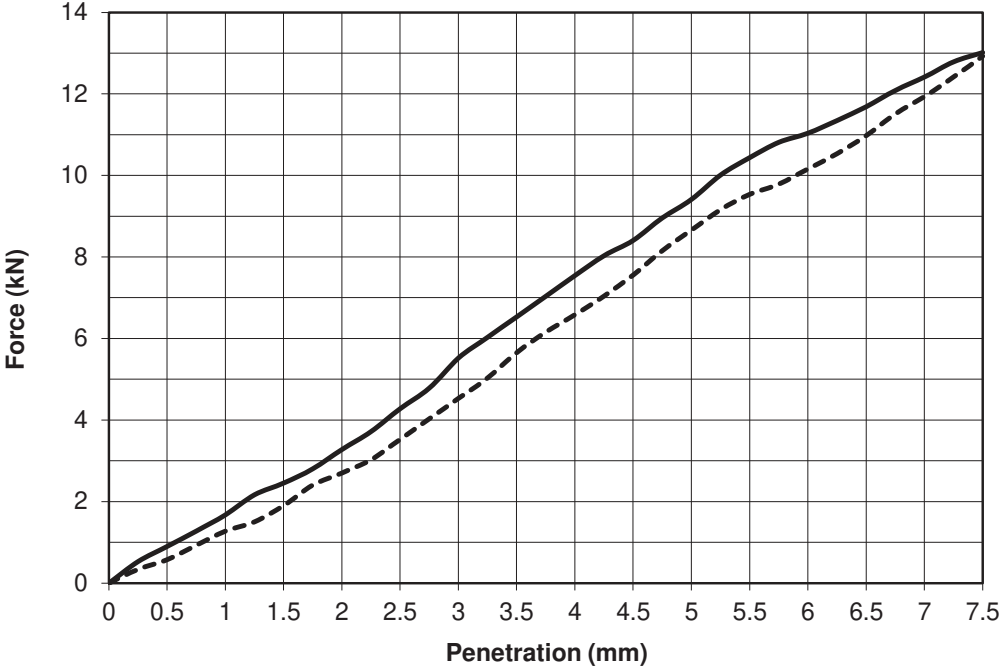
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

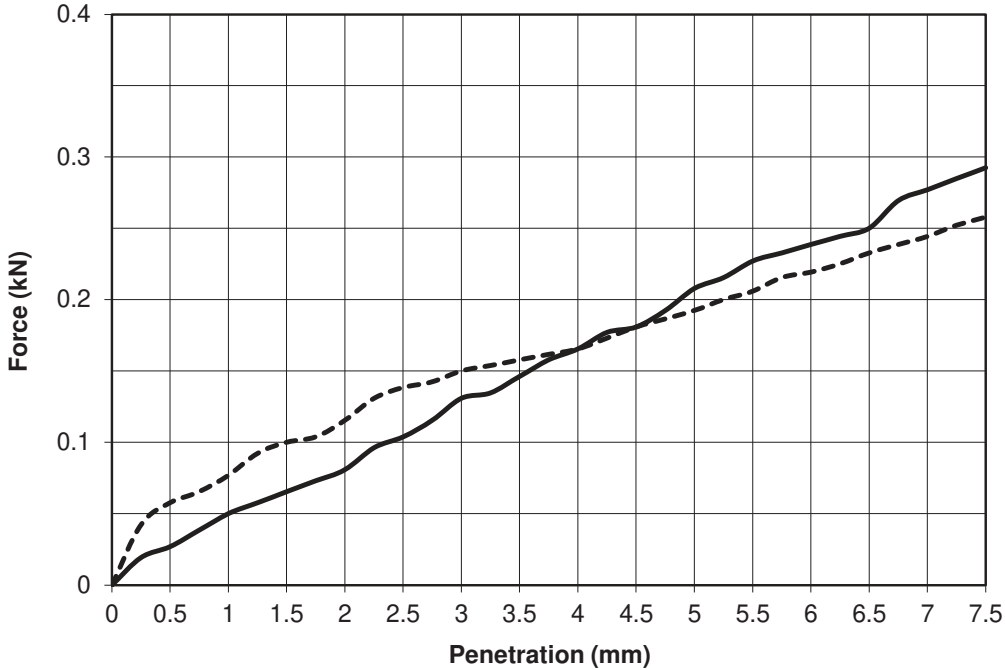
IGSL Ltd Materials Laboratory	Approved by 	Date 24/02/23	Page No. 1 of 1

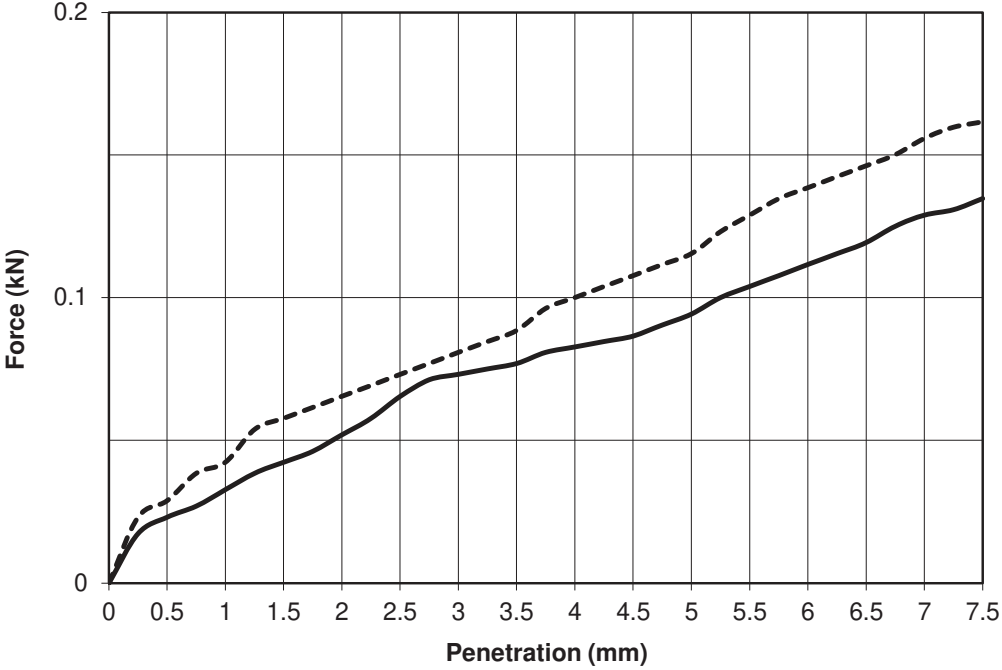
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142505</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>26/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP20</td> <td>Sample No.*</td> <td>AA185488 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>1.00</td> <td>Lab sample No.</td> <td>A22/7569</td> </tr> </table>			Report No.	R142505	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	26/01/23	BH/TP No.*	TP20	Sample No.*	AA185488 Type: B	Depth* (m)	1.00	Lab sample No.	A22/7569				
Report No.	R142505	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	26/01/23																							
BH/TP No.*	TP20	Sample No.*	AA185488 Type: B																							
Depth* (m)	1.00	Lab sample No.	A22/7569																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown sandy slightly gravelly SILT/CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>19</td> <td>Bulk Density (Mg/m³):</td> <td>2.08</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.75</td> </tr> <tr> <td>% Material >20mm:</td> <td>12</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown sandy slightly gravelly SILT/CLAY				Initial Condition: Unsoaked				Moisture Content (%):	19	Bulk Density (Mg/m ³):	2.08	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.75	% Material >20mm:	12			Method of compaction: Static Compaction Method 2			
Description: Mottled brown sandy slightly gravelly SILT/CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	19	Bulk Density (Mg/m ³):	2.08																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.75																							
% Material >20mm:	12																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>0.6</td> <td>0.6</td> </tr> <tr> <td>Moisture Content %</td> <td>19</td> <td>18</td> </tr> </table>			Test Result	Top	Base	CBR %	0.6	0.6	Moisture Content %	19	18															
Test Result	Top	Base																								
CBR %	0.6	0.6																								
Moisture Content %	19	18																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">31/01/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		31/01/23	1 of 1																		
Approved by	Date	Page No.																								
	31/01/23	1 of 1																								

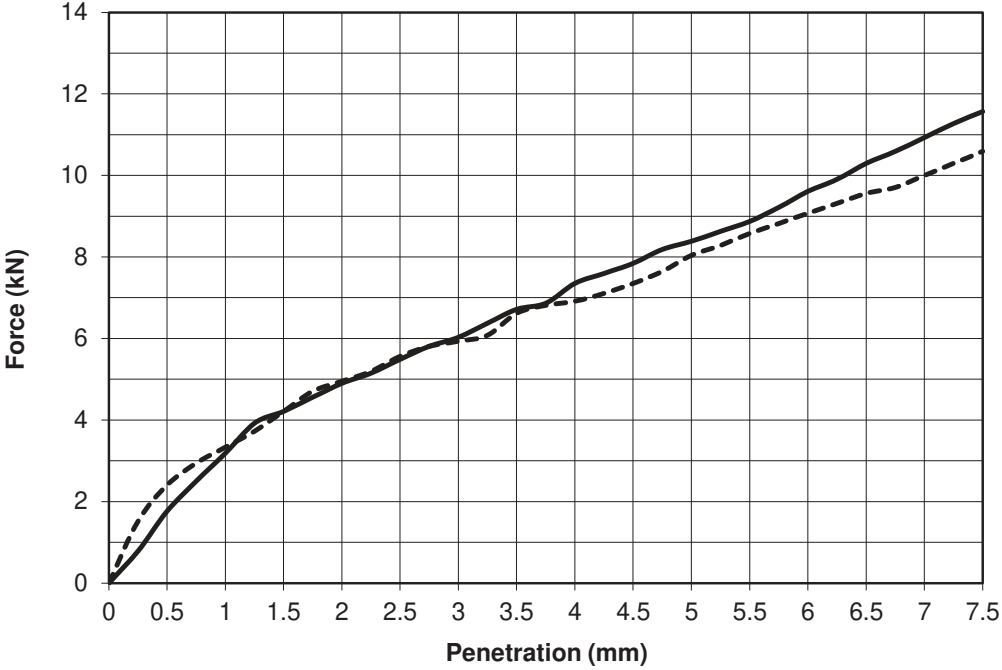
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142506</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>26/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP21</td> <td>Sample No.*</td> <td>AA181983 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7570</td> </tr> </table>			Report No.	R142506	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	26/01/23	BH/TP No.*	TP21	Sample No.*	AA181983 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7570				
Report No.	R142506	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	26/01/23																							
BH/TP No.*	TP21	Sample No.*	AA181983 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7570																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Orange/brown slightly sandy slightly gravelly SILT/CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>20</td> <td>Bulk Density (Mg/m³):</td> <td>2.02</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.69</td> </tr> <tr> <td>% Material >20mm:</td> <td>36</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Orange/brown slightly sandy slightly gravelly SILT/CLAY				Initial Condition: Unsoaked				Moisture Content (%):	20	Bulk Density (Mg/m ³):	2.02	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.69	% Material >20mm:	36			Method of compaction: Static Compaction Method 2			
Description: Orange/brown slightly sandy slightly gravelly SILT/CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	20	Bulk Density (Mg/m ³):	2.02																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.69																							
% Material >20mm:	36																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>1.6</td> <td>1.8</td> </tr> <tr> <td>Moisture Content %</td> <td>20</td> <td>20</td> </tr> </table>			Test Result	Top	Base	CBR %	1.6	1.8	Moisture Content %	20	20															
Test Result	Top	Base																								
CBR %	1.6	1.8																								
Moisture Content %	20	20																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border: none;">Date</td> <td style="width: 50%; border: none;">Page No.</td> </tr> <tr> <td style="border: 1px solid black; text-align: center;">01/02/23</td> <td style="border: 1px solid black; text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	01/02/23	1 of 1																				
Date	Page No.																									
01/02/23	1 of 1																									

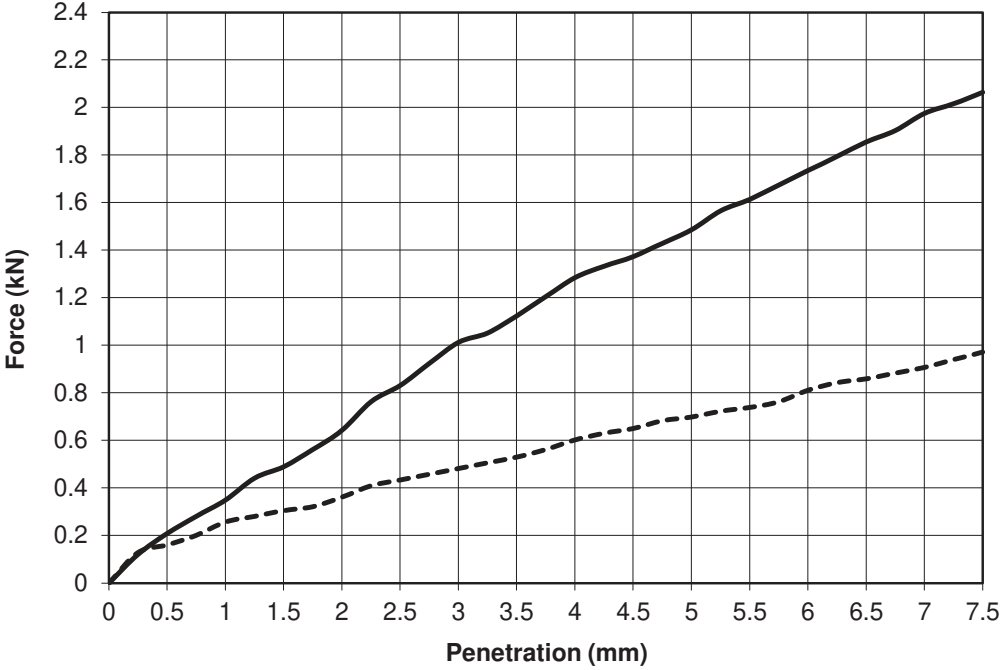
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																				
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142507</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>26/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP22</td> <td>Sample No.*</td> <td>AA185497 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7571</td> </tr> </table>			Report No.	R142507	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	26/01/23	BH/TP No.*	TP22	Sample No.*	AA185497 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7571
Report No.	R142507	Contract	Halverstown , Naas - Proposed Data Centres																			
Contract No.	24330	Customer	DOBA																			
Date received	24/01/23	Date Tested	26/01/23																			
BH/TP No.*	TP22	Sample No.*	AA185497 Type: B																			
Depth* (m)	0.60	Lab sample No.	A22/7571																			
																						
Key: ————— Top - - - - - Base																						
Description: Brown sandy gravelly SILT/CLAY																						
Initial Condition: Unsoaked																						
Moisture Content (%): 20 Bulk Density (Mg/m ³): 1.99																						
Surcharge (kg): 4 Dry Density (Mg/m ³): 1.65																						
% Material >20mm: 5.9																						
Method of compaction: Static Compaction Method 2																						
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>1.1</td> <td>1.4</td> </tr> <tr> <td>Moisture Content %</td> <td>20</td> <td>20</td> </tr> </table>			Test Result	Top	Base	CBR %	1.1	1.4	Moisture Content %	20	20											
Test Result	Top	Base																				
CBR %	1.1	1.4																				
Moisture Content %	20	20																				
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																				
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">01/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		01/02/23	1 of 1														
Approved by	Date	Page No.																				
	01/02/23	1 of 1																				

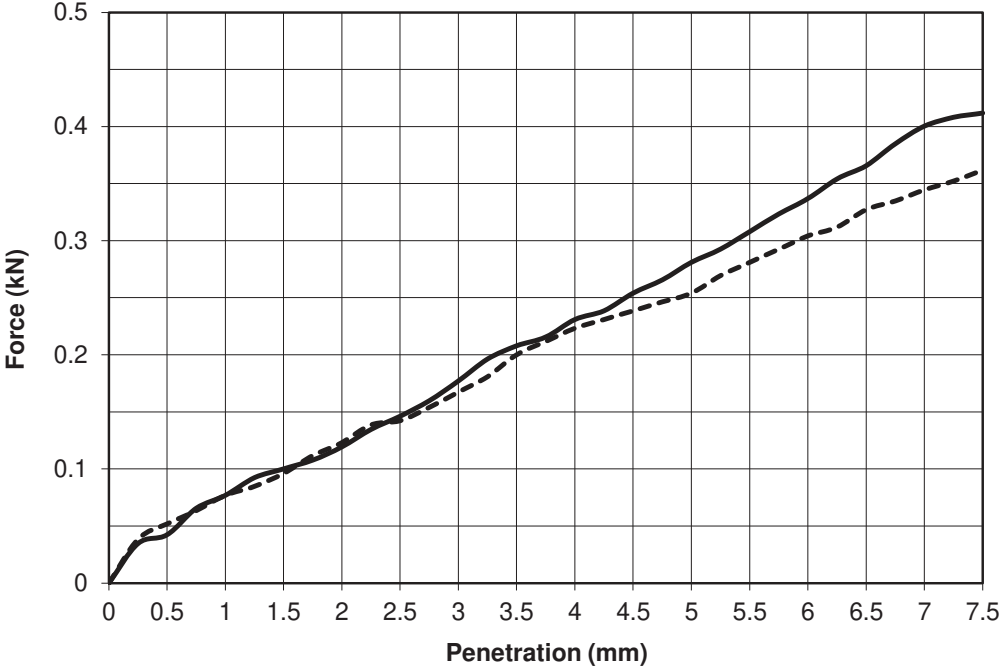
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143188</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>15/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP24</td> <td>Sample No.*</td> <td>AA181960 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7573</td> </tr> </table>			Report No.	R143188	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	15/02/23	BH/TP No.*	TP24	Sample No.*	AA181960 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7573				
Report No.	R143188	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	15/02/23																							
BH/TP No.*	TP24	Sample No.*	AA181960 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7573																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown sandy gravelly SILT/CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.21</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.95</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown sandy gravelly SILT/CLAY				Initial Condition: Unsoaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.21	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Brown sandy gravelly SILT/CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.21																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>47</td> <td>43</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	47	43	Moisture Content %	13	13															
Test Result	Top	Base																								
CBR %	47	43																								
Moisture Content %	13	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">27/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		27/02/23	1 of 1																		
Approved by	Date	Page No.																								
	27/02/23	1 of 1																								

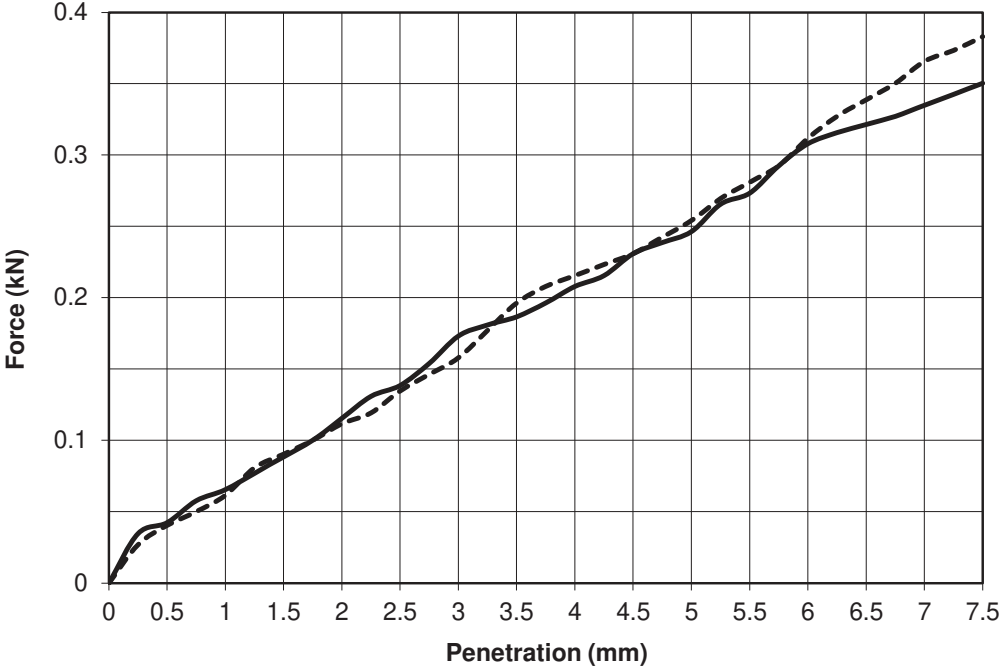
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142508</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>26/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP26</td> <td>Sample No.*</td> <td>AA181975 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7575</td> </tr> </table>			Report No.	R142508	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	26/01/23	BH/TP No.*	TP26	Sample No.*	AA181975 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7575				
Report No.	R142508	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	26/01/23																							
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7575																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly SILT/CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.19</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.93</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly SILT/CLAY				Initial Condition: Unsoaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.19	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly SILT/CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.19																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>1.0</td> <td>1.1</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	1.0	1.1	Moisture Content %	13	13															
Test Result	Top	Base																								
CBR %	1.0	1.1																								
Moisture Content %	13	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">01/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		01/02/23	1 of 1																		
Approved by	Date	Page No.																								
	01/02/23	1 of 1																								

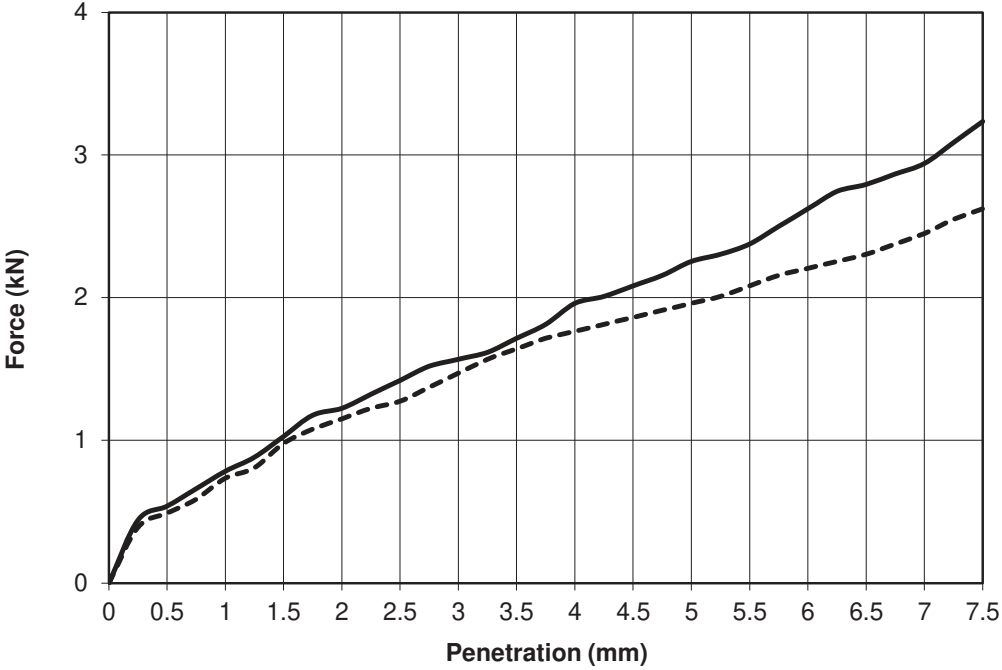
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142509</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>24/01/24</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP28</td> <td>Sample No.*</td> <td>AA181969 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7576</td> </tr> </table>			Report No.	R142509	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	24/01/24	BH/TP No.*	TP28	Sample No.*	AA181969 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7576				
Report No.	R142509	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	24/01/24																							
BH/TP No.*	TP28	Sample No.*	AA181969 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7576																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy, slightly gravelly, CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>26</td> <td>Bulk Density (Mg/m³):</td> <td>1.95</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.55</td> </tr> <tr> <td>% Material >20mm:</td> <td>2.8</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy, slightly gravelly, CLAY				Initial Condition: Unsoaked				Moisture Content (%):	26	Bulk Density (Mg/m ³):	1.95	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.55	% Material >20mm:	2.8			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy, slightly gravelly, CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	26	Bulk Density (Mg/m ³):	1.95																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.55																							
% Material >20mm:	2.8																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>0.5</td> <td>0.6</td> </tr> <tr> <td>Moisture Content %</td> <td>26</td> <td>26</td> </tr> </table>			Test Result	Top	Base	CBR %	0.5	0.6	Moisture Content %	26	26															
Test Result	Top	Base																								
CBR %	0.5	0.6																								
Moisture Content %	26	26																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Date</td> <td style="width: 50%;">Page No.</td> </tr> <tr> <td>01/02/23</td> <td>1 of 1</td> </tr> </table>	Date	Page No.	01/02/23	1 of 1																				
Date	Page No.																									
01/02/23	1 of 1																									

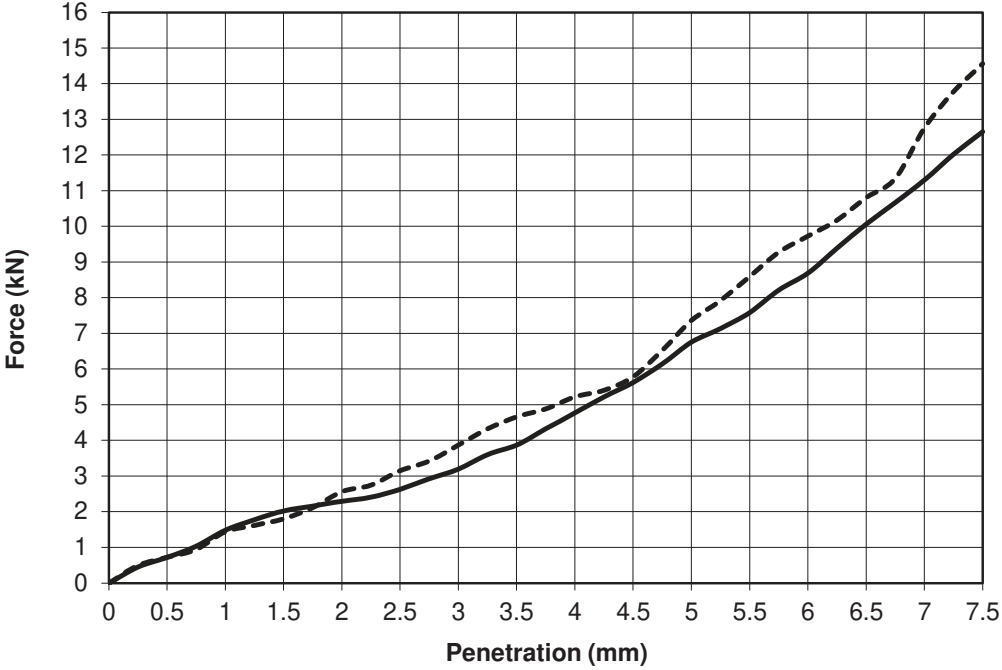
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142510</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>26/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP29</td> <td>Sample No.*</td> <td>AA181986 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7577</td> </tr> </table>			Report No.	R142510	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	26/01/23	BH/TP No.*	TP29	Sample No.*	AA181986 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7577				
Report No.	R142510	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	26/01/23																							
BH/TP No.*	TP29	Sample No.*	AA181986 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7577																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown sandy gravelly SILT/CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>9</td> <td>Bulk Density (Mg/m³):</td> <td>2.07</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.89</td> </tr> <tr> <td>% Material >20mm:</td> <td>11</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown sandy gravelly SILT/CLAY				Initial Condition: Unsoaked				Moisture Content (%):	9	Bulk Density (Mg/m ³):	2.07	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89	% Material >20mm:	11			Method of compaction: Static Compaction Method 2			
Description: Brown sandy gravelly SILT/CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	9	Bulk Density (Mg/m ³):	2.07																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89																							
% Material >20mm:	11																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>42</td> <td>42</td> </tr> <tr> <td>Moisture Content %</td> <td>9.2</td> <td>9.3</td> </tr> </table>			Test Result	Top	Base	CBR %	42	42	Moisture Content %	9.2	9.3															
Test Result	Top	Base																								
CBR %	42	42																								
Moisture Content %	9.2	9.3																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">01/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		01/02/23	1 of 1																		
Approved by	Date	Page No.																								
	01/02/23	1 of 1																								

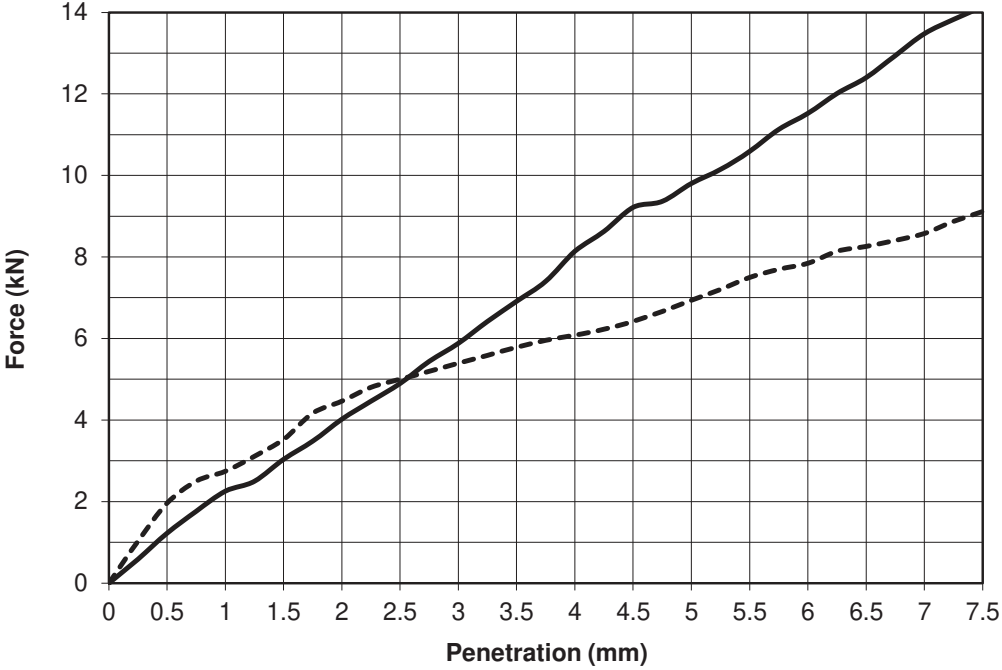
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R145766</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>18/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP31</td> <td>Sample No.*</td> <td>AA181992 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7578</td> </tr> </table>			Report No.	R145766	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	18/02/23	BH/TP No.*	TP31	Sample No.*	AA181992 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7578				
Report No.	R145766	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	18/02/23																							
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7578																							
 Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy, slightly gravelly, CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.92</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy, slightly gravelly, CLAY				Initial Condition: Unsoaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92	% Material >20mm:	6.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy, slightly gravelly, CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92																							
% Material >20mm:	6.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>7.4</td> <td>3.5</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	7.4	3.5	Moisture Content %	13	13															
Test Result	Top	Base																								
CBR %	7.4	3.5																								
Moisture Content %	13	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">27/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		27/02/23	1 of 1																		
Approved by	Date	Page No.																								
	27/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142511</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>24/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP33</td> <td>Sample No.*</td> <td>AA181989 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7579</td> </tr> </table>			Report No.	R142511	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	24/01/23	BH/TP No.*	TP33	Sample No.*	AA181989 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7579				
Report No.	R142511	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	24/01/23																							
BH/TP No.*	TP33	Sample No.*	AA181989 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7579																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy, slightly gravelly, CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>21</td> <td>Bulk Density (Mg/m³):</td> <td>2.02</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.67</td> </tr> <tr> <td>% Material >20mm:</td> <td>2.2</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy, slightly gravelly, CLAY				Initial Condition: Unsoaked				Moisture Content (%):	21	Bulk Density (Mg/m ³):	2.02	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.67	% Material >20mm:	2.2			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy, slightly gravelly, CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	21	Bulk Density (Mg/m ³):	2.02																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.67																							
% Material >20mm:	2.2																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>1.4</td> <td>1.3</td> </tr> <tr> <td>Moisture Content %</td> <td>21</td> <td>21</td> </tr> </table>			Test Result	Top	Base	CBR %	1.4	1.3	Moisture Content %	21	21															
Test Result	Top	Base																								
CBR %	1.4	1.3																								
Moisture Content %	21	21																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Date</td> <td style="width: 50%;">Page No.</td> </tr> <tr> <td>01/02/23</td> <td>1 of 1</td> </tr> </table>	Date	Page No.	01/02/23	1 of 1																				
Date	Page No.																									
01/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142512</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>24/01/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP34</td> <td>Sample No.*</td> <td>AA181986 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7580</td> </tr> </table>			Report No.	R142512	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	24/01/23	BH/TP No.*	TP34	Sample No.*	AA181986 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7580				
Report No.	R142512	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	24/01/23																							
BH/TP No.*	TP34	Sample No.*	AA181986 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7580																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown sandy slightly gravelly SILT/CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>20</td> <td>Bulk Density (Mg/m³):</td> <td>2.04</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.70</td> </tr> <tr> <td>% Material >20mm:</td> <td>4.2</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown sandy slightly gravelly SILT/CLAY				Initial Condition: Unsoaked				Moisture Content (%):	20	Bulk Density (Mg/m ³):	2.04	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.70	% Material >20mm:	4.2			Method of compaction: Static Compaction Method 2			
Description: Brown sandy slightly gravelly SILT/CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	20	Bulk Density (Mg/m ³):	2.04																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.70																							
% Material >20mm:	4.2																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>1.2</td> <td>1.3</td> </tr> <tr> <td>Moisture Content %</td> <td>20</td> <td>20</td> </tr> </table>			Test Result	Top	Base	CBR %	1.2	1.3	Moisture Content %	20	20															
Test Result	Top	Base																								
CBR %	1.2	1.3																								
Moisture Content %	20	20																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">01/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		01/02/23	1 of 1																		
Approved by	Date	Page No.																								
	01/02/23	1 of 1																								

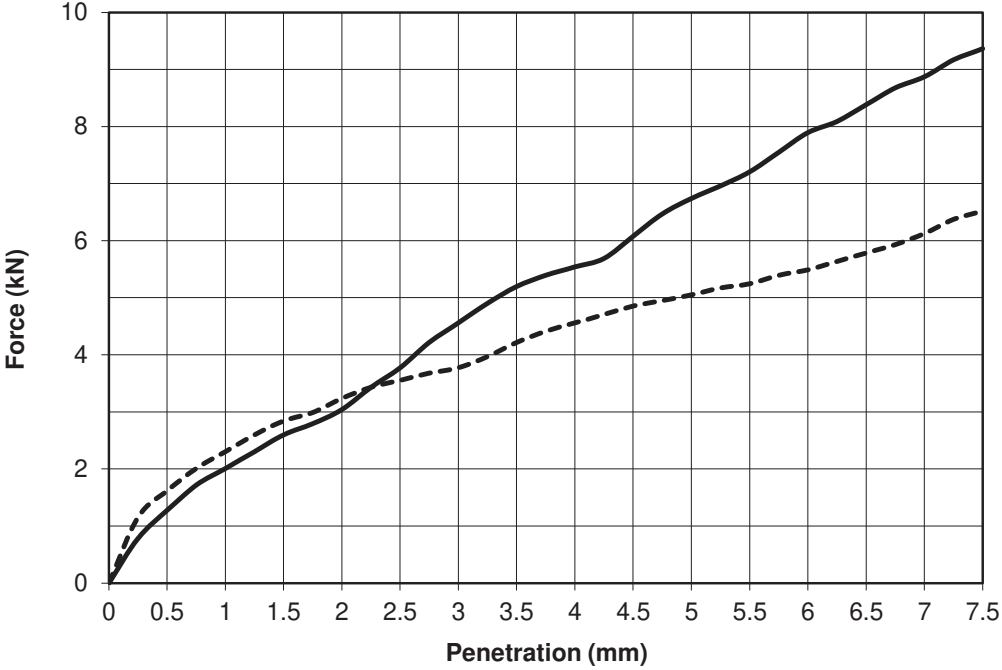
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R145768</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>18/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP04</td> <td>Sample No.*</td> <td>AA186982 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7562</td> </tr> </table>			Report No.	R145768	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	18/02/23	BH/TP No.*	TP04	Sample No.*	AA186982 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7562				
Report No.	R145768	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	18/02/23																							
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7562																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime/ 3 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.19</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.91</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime/ 3 Days Soaked				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.19	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.91	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime/ 3 Days Soaked																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.19																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.91																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>11</td> <td>10</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>15</td> </tr> </table>			Test Result	Top	Base	CBR %	11	10	Moisture Content %	14	15															
Test Result	Top	Base																								
CBR %	11	10																								
Moisture Content %	14	15																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R145769</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>18/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP04</td> <td>Sample No.*</td> <td>AA186982 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7562</td> </tr> </table>			Report No.	R145769	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	18/02/23	BH/TP No.*	TP04	Sample No.*	AA186982 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7562				
Report No.	R145769	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	18/02/23																							
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7562																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime/ 5 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.16</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.93</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime/ 5 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.16	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime/ 5 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.16																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>34</td> <td>37</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	34	37	Moisture Content %	12	12															
Test Result	Top	Base																								
CBR %	34	37																								
Moisture Content %	12	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																																	
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143174</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>18/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP04</td> <td>Sample No.*</td> <td>AA186982 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7562</td> </tr> </table>			Report No.	R143174	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	18/02/23	BH/TP No.*	TP04	Sample No.*	AA186982 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7562													
Report No.	R143174	Contract	Halverstown , Naas - Proposed Data Centres																																
Contract No.	24330	Customer	DOBA																																
Date received	24/01/23	Date Tested	18/02/23																																
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B																																
Depth* (m)	0.60	Lab sample No.	A22/7562																																
																																			
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime/ 7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.94</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table> <table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <td style="width: 30%;">Test Result</td> <td style="width: 35%;">Top</td> <td style="width: 35%;">Base</td> </tr> <tr> <td>CBR %</td> <td>49</td> <td>38</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>12</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime/ 7 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94	% Material >20mm:	14			Method of compaction: Static Compaction Method 2				Test Result	Top	Base	CBR %	49	38	Moisture Content %	12	12
Description: Mottled brown slightly sandy slightly gravelly CLAY																																			
Initial Condition: 1% Lime/ 7 Days Soaked																																			
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.17																																
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94																																
% Material >20mm:	14																																		
Method of compaction: Static Compaction Method 2																																			
Test Result	Top	Base																																	
CBR %	49	38																																	
Moisture Content %	12	12																																	
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																	
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																											
Approved by	Date	Page No.																																	
	24/02/23	1 of 1																																	

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142662	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	01/02/23
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B
Depth* (m)	0.60	Lab sample No.	A22/7562



Key: ————— Top - - - - - Base

Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 2% Lime/3 Days Soaked			
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.16
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92
% Material >20mm:	14		
Method of compaction: Static Compaction Method 2			

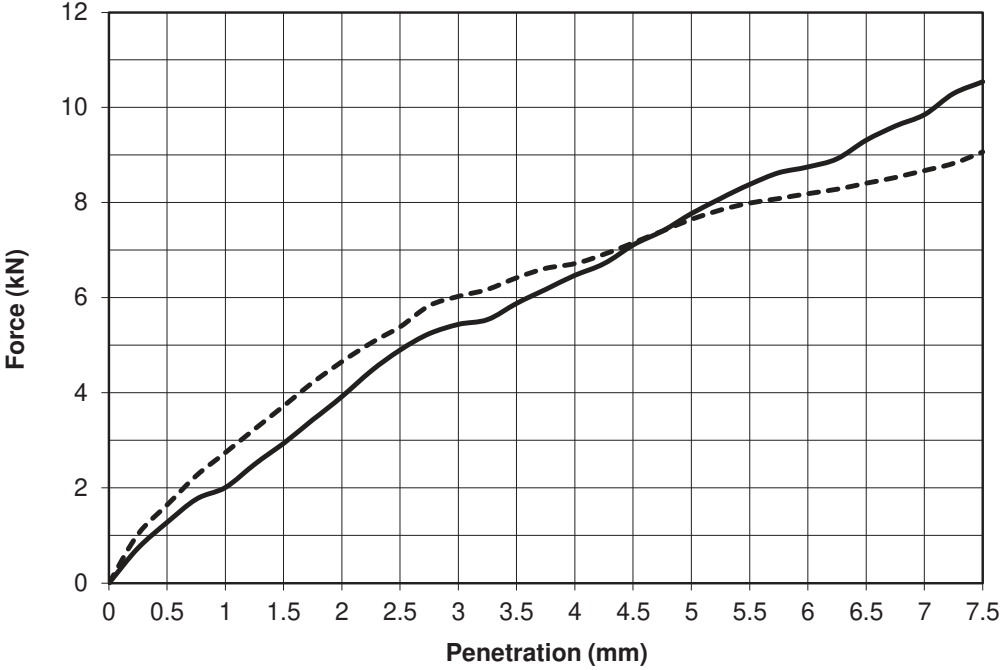
Test Result	Top	Base
CBR %	34	27
Moisture Content %	13	13

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142752	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	16/02/23
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B
Depth* (m)	0.60	Lab sample No.	A22/7562



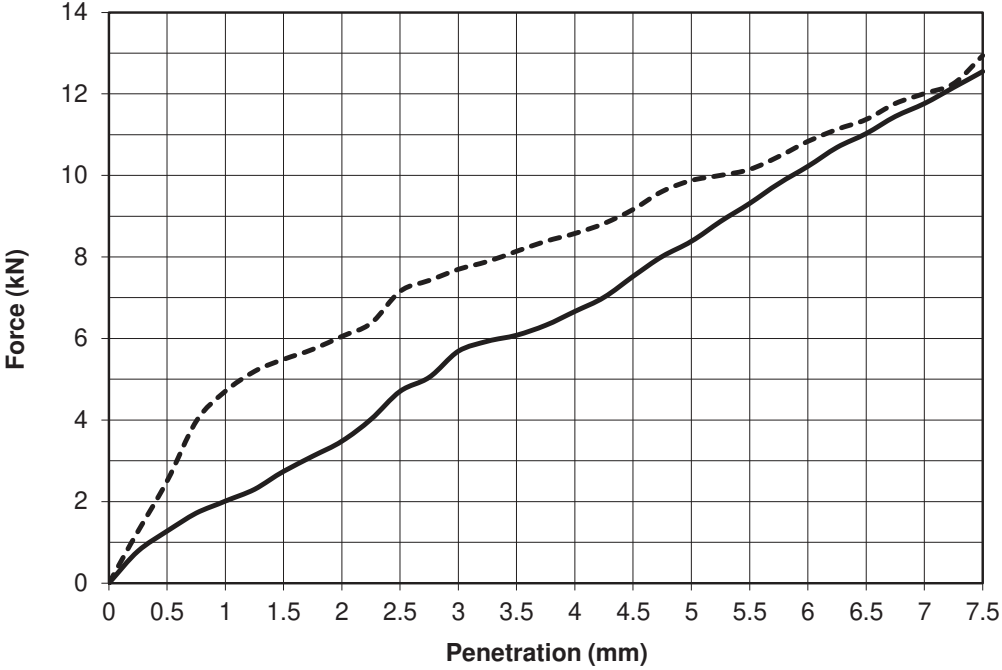
Key: ————— Top - - - - - Base

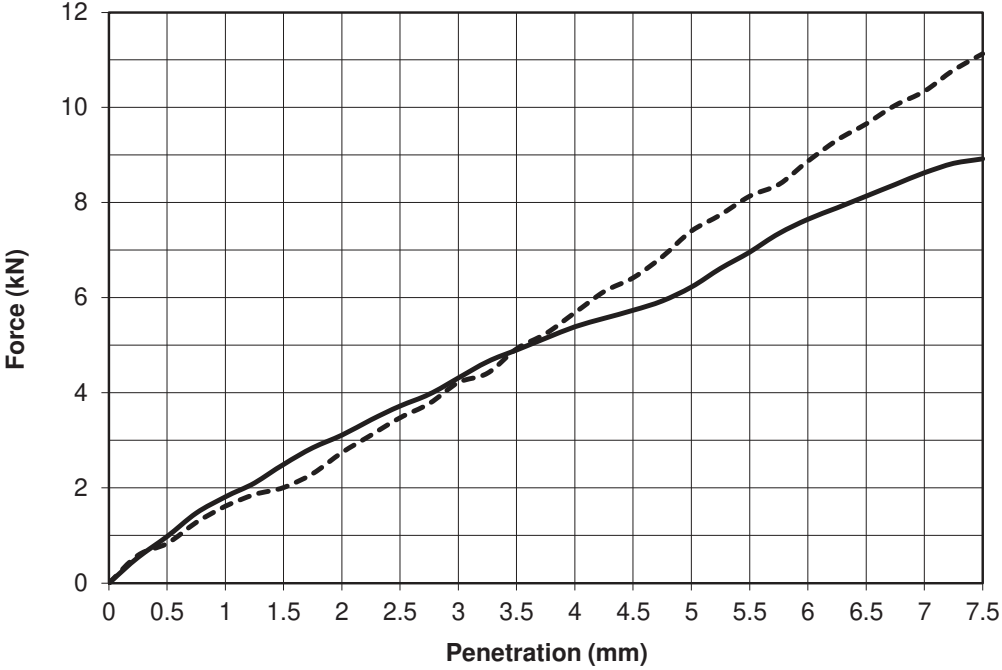
Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 2% Lime/5 Day Soaked			
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.16
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90
% Material >20mm:	14		
Method of compaction: Static Compaction Method 2			

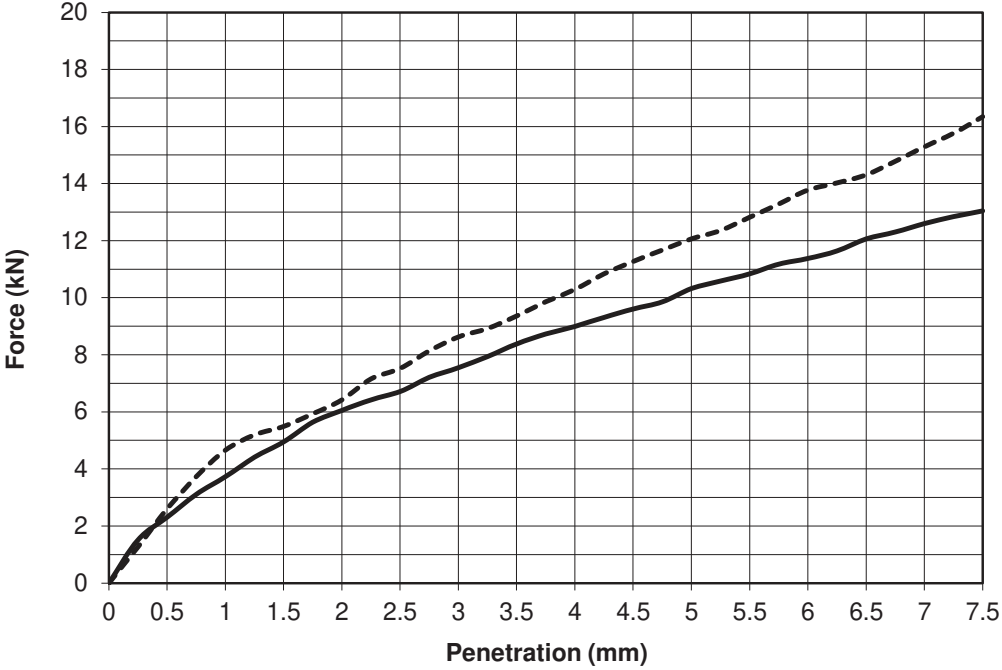
Test Result	Top	Base
CBR %	41	39
Moisture Content %	13	14

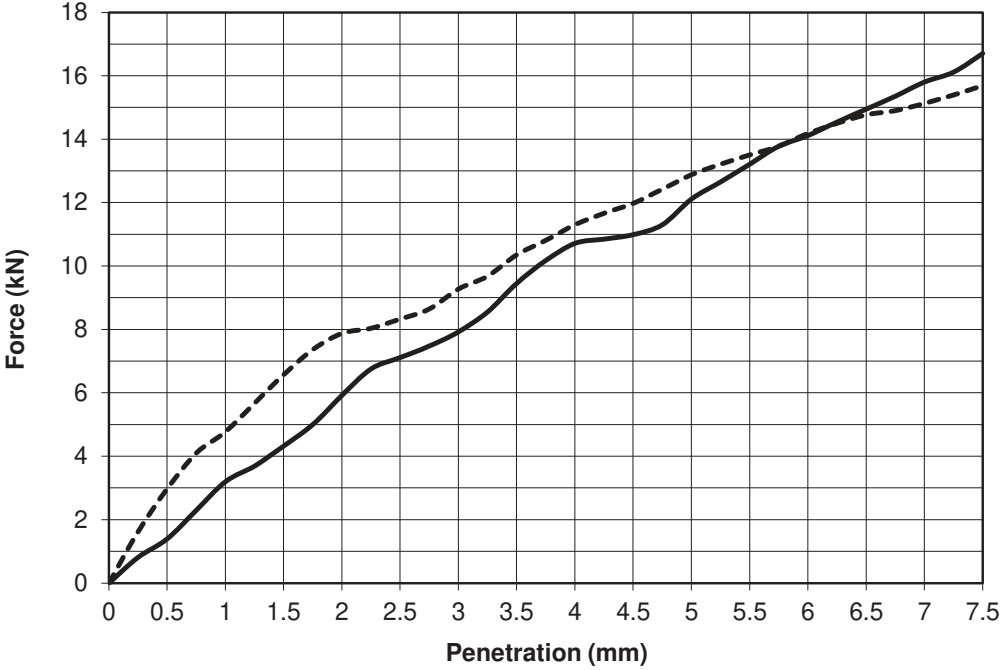
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142661</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>13/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP04</td> <td>Sample No.*</td> <td>AA186982 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7562</td> </tr> </table>			Report No.	R142661	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	13/02/23	BH/TP No.*	TP04	Sample No.*	AA186982 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7562				
Report No.	R142661	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	13/02/23																							
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7562																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2% Lime/ Soaked 7 Days</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.15</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.89</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 2% Lime/ Soaked 7 Days				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.15	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2% Lime/ Soaked 7 Days																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.15																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>42</td> <td>54</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>14</td> </tr> </table>			Test Result	Top	Base	CBR %	42	54	Moisture Content %	14	14															
Test Result	Top	Base																								
CBR %	42	54																								
Moisture Content %	14	14																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">23/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		23/02/23	1 of 1																		
Approved by	Date	Page No.																								
	23/02/23	1 of 1																								

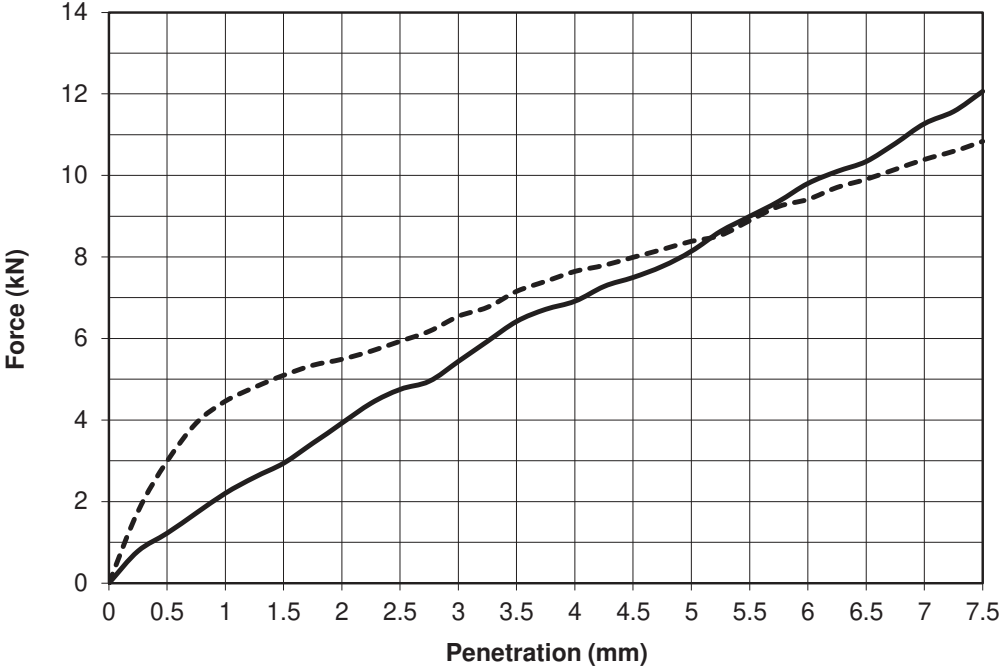
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142663</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>01/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP04</td> <td>Sample No.*</td> <td>AA186982 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7562</td> </tr> </table>			Report No.	R142663	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	01/02/23	BH/TP No.*	TP04	Sample No.*	AA186982 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7562				
Report No.	R142663	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	01/02/23																							
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7562																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 3% Lime/ 3 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.20</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.94</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 3% Lime/ 3 Days Soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.20	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 3% Lime/ 3 Days Soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.20																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>31</td> <td>37</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	31	37	Moisture Content %	14	13															
Test Result	Top	Base																								
CBR %	31	37																								
Moisture Content %	14	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">23/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		23/02/23	1 of 1																		
Approved by	Date	Page No.																								
	23/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143176</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>13/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP04</td> <td>Sample No.*</td> <td>AA186982 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7562</td> </tr> </table>			Report No.	R143176	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	13/02/23	BH/TP No.*	TP04	Sample No.*	AA186982 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7562				
Report No.	R143176	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	13/02/23																							
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7562																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: Unsoaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.16</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.90</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: Unsoaked				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.16	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: Unsoaked																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.16																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <td style="width: 33%;">Test Result</td> <td style="width: 33%;">Top</td> <td style="width: 33%;">Base</td> </tr> <tr> <td>CBR %</td> <td>52</td> <td>60</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>14</td> </tr> </table>			Test Result	Top	Base	CBR %	52	60	Moisture Content %	14	14															
Test Result	Top	Base																								
CBR %	52	60																								
Moisture Content %	14	14																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142753</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>16/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP04</td> <td>Sample No.*</td> <td>AA186982 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7562</td> </tr> </table>			Report No.	R142753	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	16/02/23	BH/TP No.*	TP04	Sample No.*	AA186982 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7562				
Report No.	R142753	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	16/02/23																							
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7562																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 3 % Lime/ 7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.18</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.95</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 3 % Lime/ 7 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.18	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 3 % Lime/ 7 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.18																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>61</td> <td>65</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	61	65	Moisture Content %	12	12															
Test Result	Top	Base																								
CBR %	61	65																								
Moisture Content %	12	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">23/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		23/02/23	1 of 1																		
Approved by	Date	Page No.																								
	23/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142660	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	13/02/23
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B
Depth* (m)	0.60	Lab sample No.	A22/7562



Key: ————— Top - - - - - Base

Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime 2% Cement/ 3 Days Soaked			
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.16
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90
% Material >20mm:	14		
Method of compaction: Static Compaction Method 2			

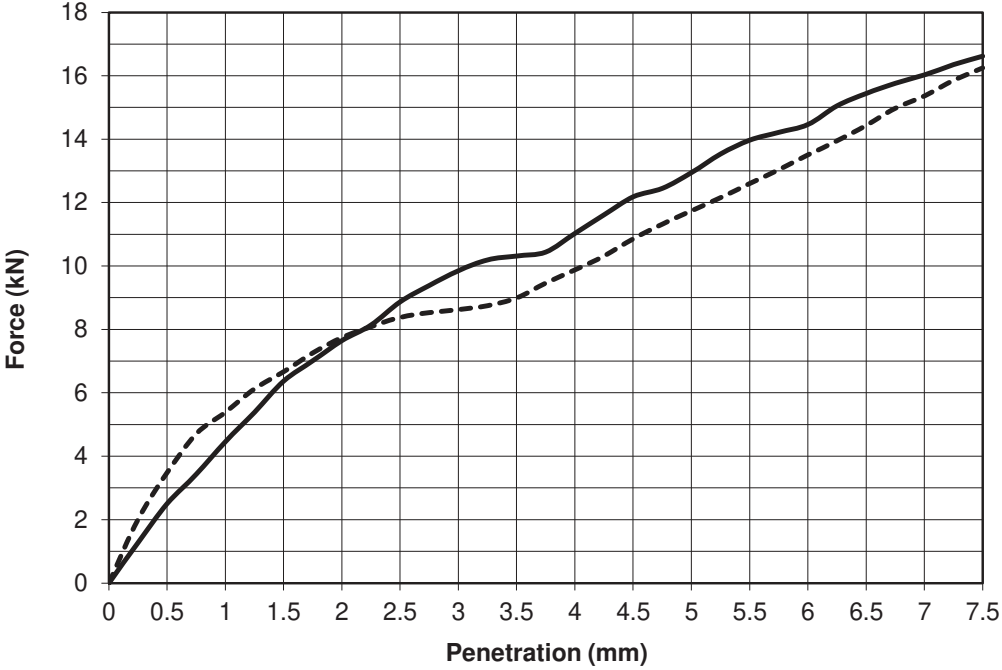
Test Result	Top	Base
CBR %	41	45
Moisture Content %	14	14

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142664	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	01/02/23
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B
Depth* (m)	0.60	Lab sample No.	A22/7562



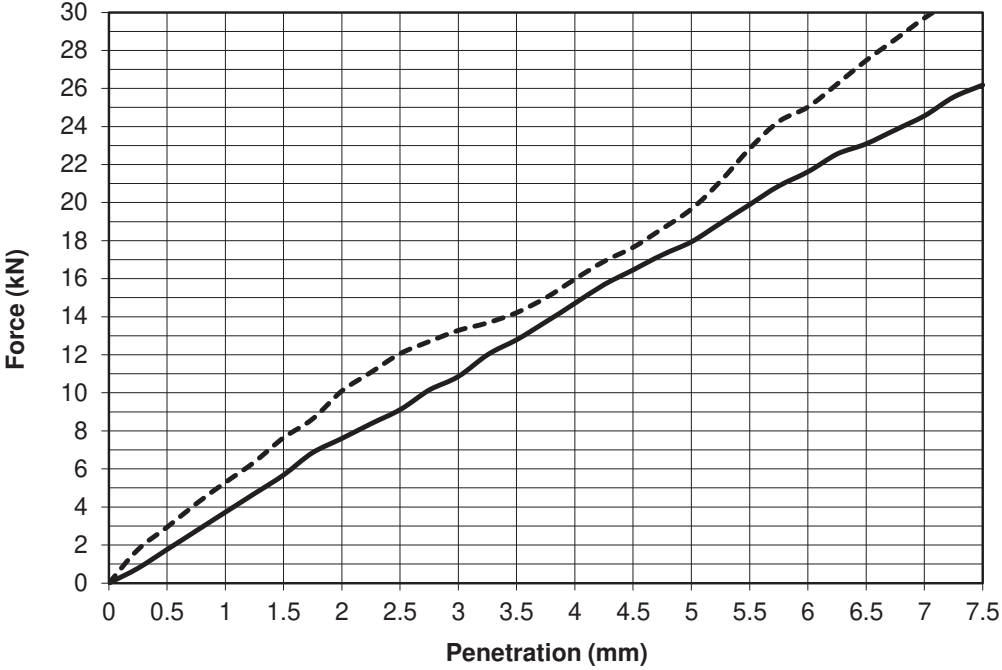
Key: ————— Top - - - - - Base

Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime 2% Cement/ 5 Days Soaked			
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.23
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.98
% Material >20mm:	14		
Method of compaction: Static Compaction Method 2			

Test Result	Top	Base
CBR %	67	63
Moisture Content %	13	13

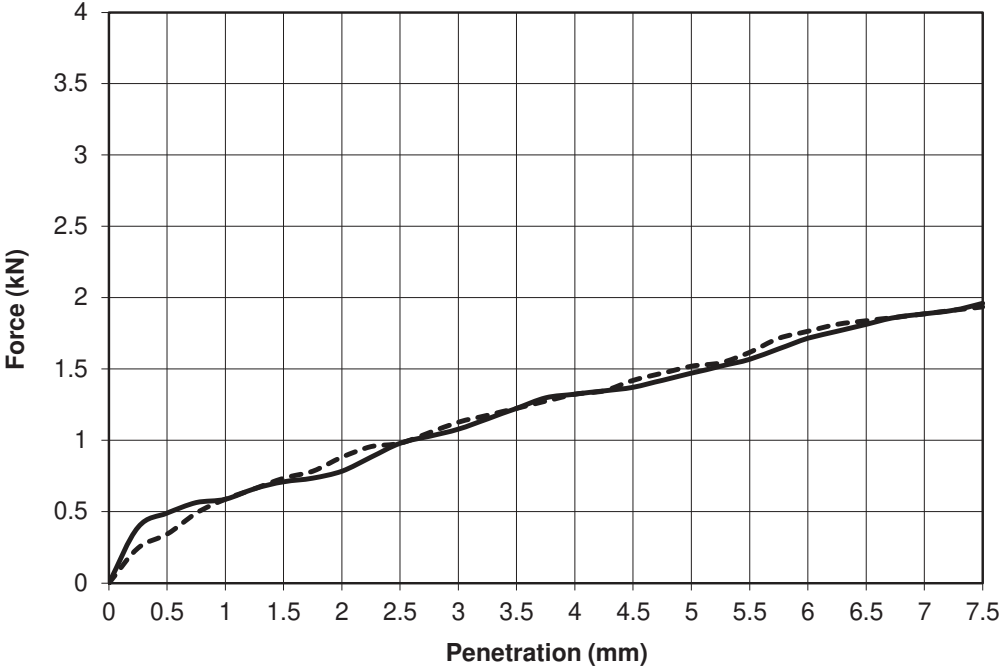
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143175</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>16/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP04</td> <td>Sample No.*</td> <td>AA186982 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.60</td> <td>Lab sample No.</td> <td>A22/7562</td> </tr> </table>			Report No.	R143175	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	16/02/23	BH/TP No.*	TP04	Sample No.*	AA186982 Type: B	Depth* (m)	0.60	Lab sample No.	A22/7562				
Report No.	R143175	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	16/02/23																							
BH/TP No.*	TP04	Sample No.*	AA186982 Type: B																							
Depth* (m)	0.60	Lab sample No.	A22/7562																							
 Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime 2% Cement/7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.14</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.91</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime 2% Cement/7 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.14	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.91	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime 2% Cement/7 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.14																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.91																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>90</td> <td>99</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	90	99	Moisture Content %	12	12															
Test Result	Top	Base																								
CBR %	90	99																								
Moisture Content %	12	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border: none;">Date</td> <td style="width: 50%; border: none;">Page No.</td> </tr> <tr> <td style="border: 1px solid black; text-align: center;">24/02/23</td> <td style="border: 1px solid black; text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	24/02/23	1 of 1																				
Date	Page No.																									
24/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R145771	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	21/02/23
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7563



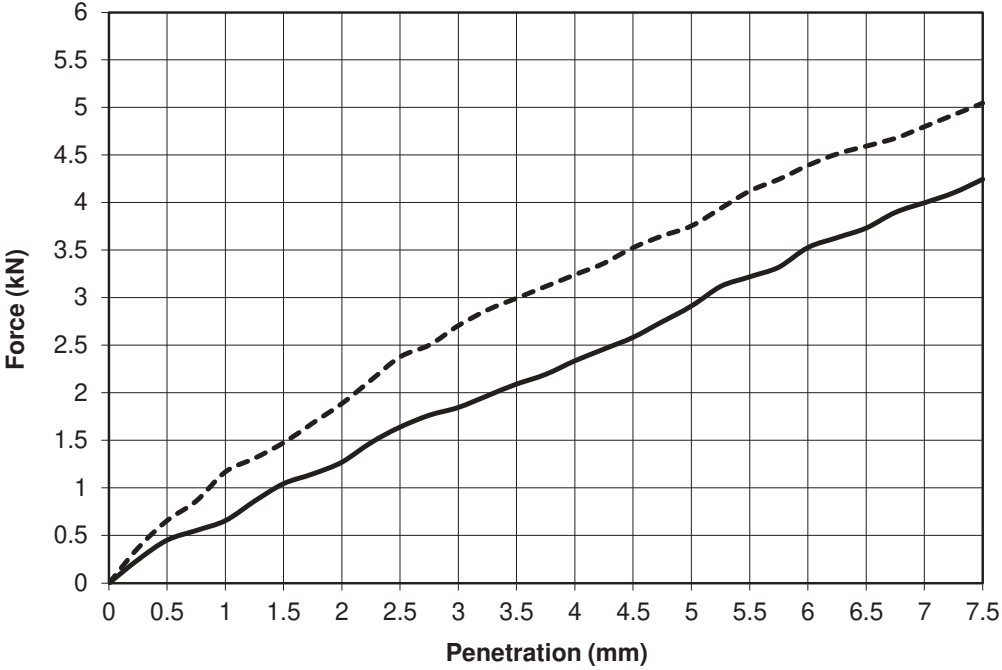
Key: ————— Top - - - - - Base

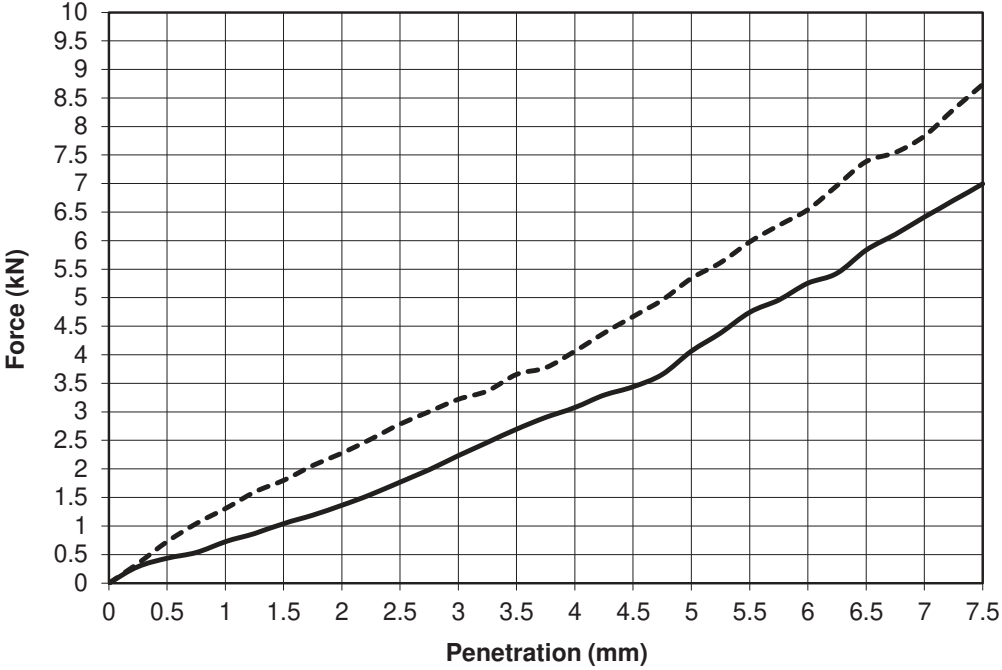
Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime/ 3 Days soaked			
Moisture Content (%):	18	Bulk Density (Mg/m ³):	2.08
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.77
% Material >20mm:	6.4		
Method of compaction: Static Compaction Method 2			

Test Result	Top	Base
CBR %	7.4	7.6
Moisture Content %	18	18

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

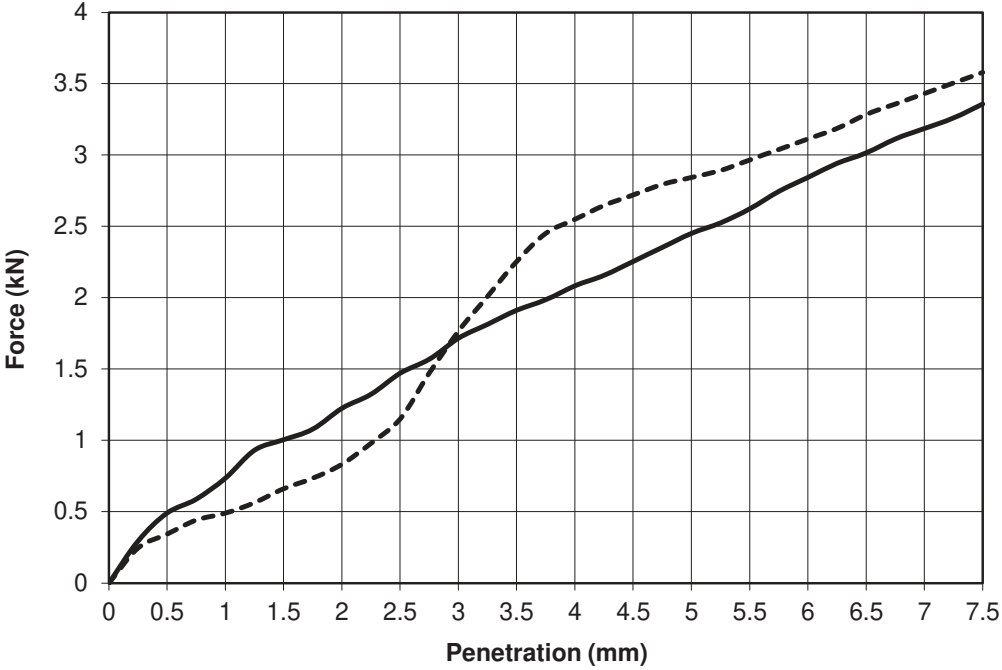
IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																				
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R145772</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>21/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP12</td> <td>Sample No.*</td> <td>AA195481 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7563</td> </tr> </table>			Report No.	R145772	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	21/02/23	BH/TP No.*	TP12	Sample No.*	AA195481 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7563
Report No.	R145772	Contract	Halverstown , Naas - Proposed Data Centres																			
Contract No.	24330	Customer	DOBA																			
Date received	24/01/23	Date Tested	21/02/23																			
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B																			
Depth* (m)	0.50	Lab sample No.	A22/7563																			
 Force (kN) 0 to 6 Penetration (mm) 0 to 7.5 Key: ————— Top - - - - - Base																						
Description: Brown slightly sandy slightly gravelly CLAY																						
Initial Condition: 1% Lime/ 5 Days soaked																						
Moisture Content (%): 17 Bulk Density (Mg/m ³): 2.11																						
Surcharge (kg): 4 Dry Density (Mg/m ³): 1.81																						
% Material >20mm: 6.4																						
Method of compaction: Static Compaction Method 2																						
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>14.6</td> <td>18.8</td> </tr> <tr> <td>Moisture Content %</td> <td>17</td> <td>17</td> </tr> </table>			Test Result	Top	Base	CBR %	14.6	18.8	Moisture Content %	17	17											
Test Result	Top	Base																				
CBR %	14.6	18.8																				
Moisture Content %	17	17																				
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																				
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">23/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		23/02/23	1 of 1														
Approved by	Date	Page No.																				
	23/02/23	1 of 1																				

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R145773</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>21/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP12</td> <td>Sample No.*</td> <td>AA195481 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7563</td> </tr> </table>			Report No.	R145773	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	21/02/23	BH/TP No.*	TP12	Sample No.*	AA195481 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7563				
Report No.	R145773	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	21/02/23																							
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7563																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime/ 7 Days soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.13</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.86</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.4</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime/ 7 Days soaked				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.13	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.86	% Material >20mm:	6.4			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime/ 7 Days soaked																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.13																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.86																							
% Material >20mm:	6.4																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>20.4</td> <td>26.7</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>14</td> </tr> </table>			Test Result	Top	Base	CBR %	20.4	26.7	Moisture Content %	14	14															
Test Result	Top	Base																								
CBR %	20.4	26.7																								
Moisture Content %	14	14																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">23/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		23/02/23	1 of 1																		
Approved by	Date	Page No.																								
	23/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142668	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	21/02/23
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7563



Key: ————— Top - - - - - Base

Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition: 2% Lime/ 3 Days soaked			
Moisture Content (%):	18	Bulk Density (Mg/m ³):	2.07
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.76
% Material >20mm:	6.4		
Method of compaction: Static Compaction Method 2			

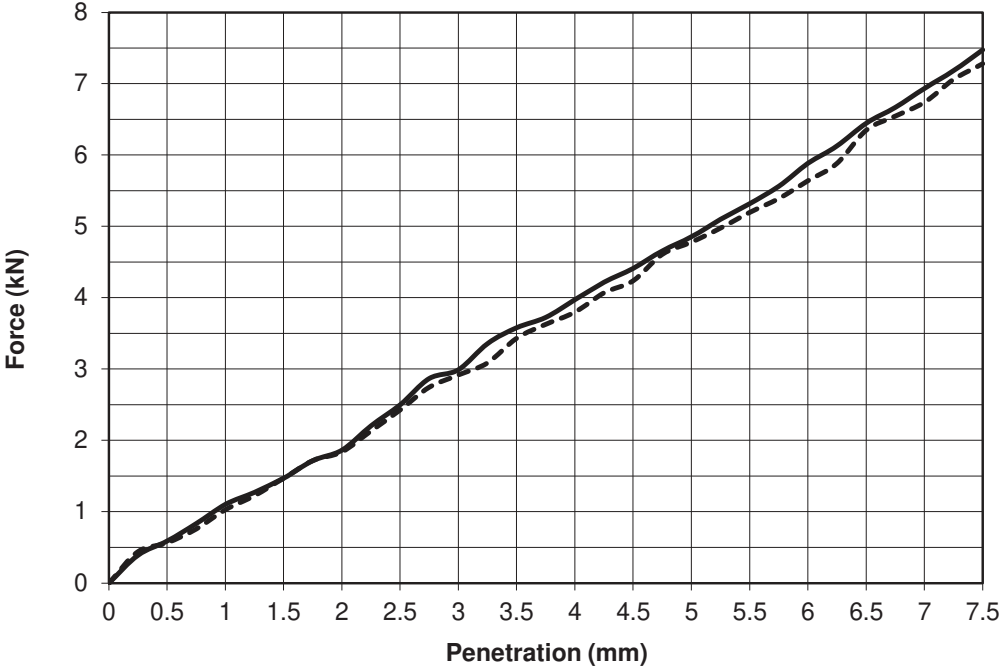
Test Result	Top	Base
CBR %	12	14
Moisture Content %	19	16

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142666	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	13/02/23
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7563



Key: ————— Top - - - - - Base

Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition: 2% Lime /5 Days Soaked			
Moisture Content (%):	15	Bulk Density (Mg/m ³):	2.40
Surcharge (kg):	4	Dry Density (Mg/m ³):	0.80
% Material >20mm:	6.4		
Method of compaction: Static Compaction Method 2			

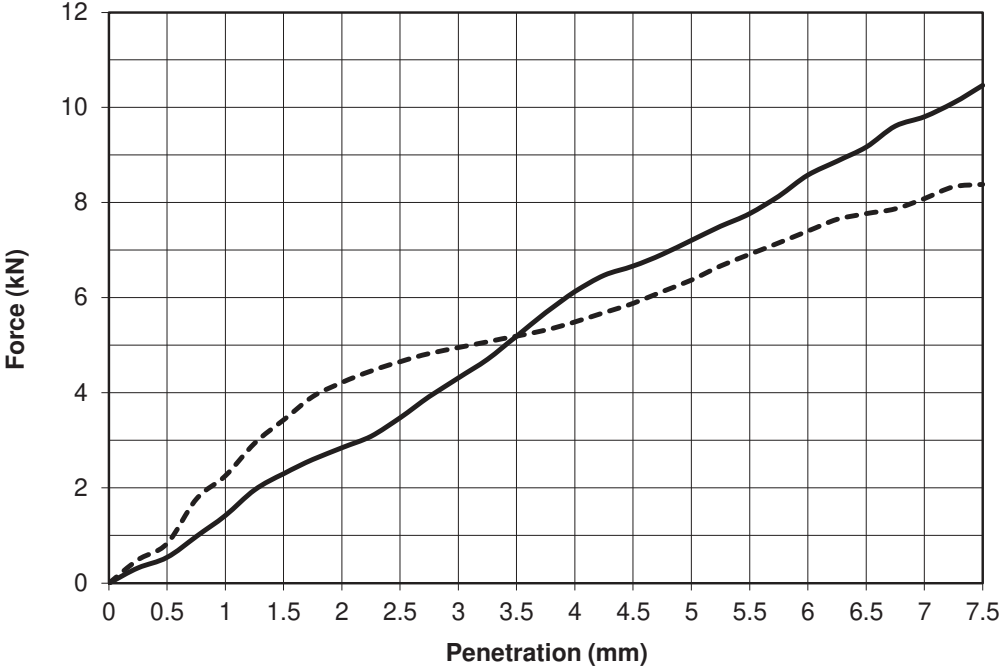
Test Result	Top	Base
CBR %	24	24
Moisture Content %	15	15

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R143177	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	17/02/23
BH/TP No.*	TP12	Sample No.*	AA185481 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7563



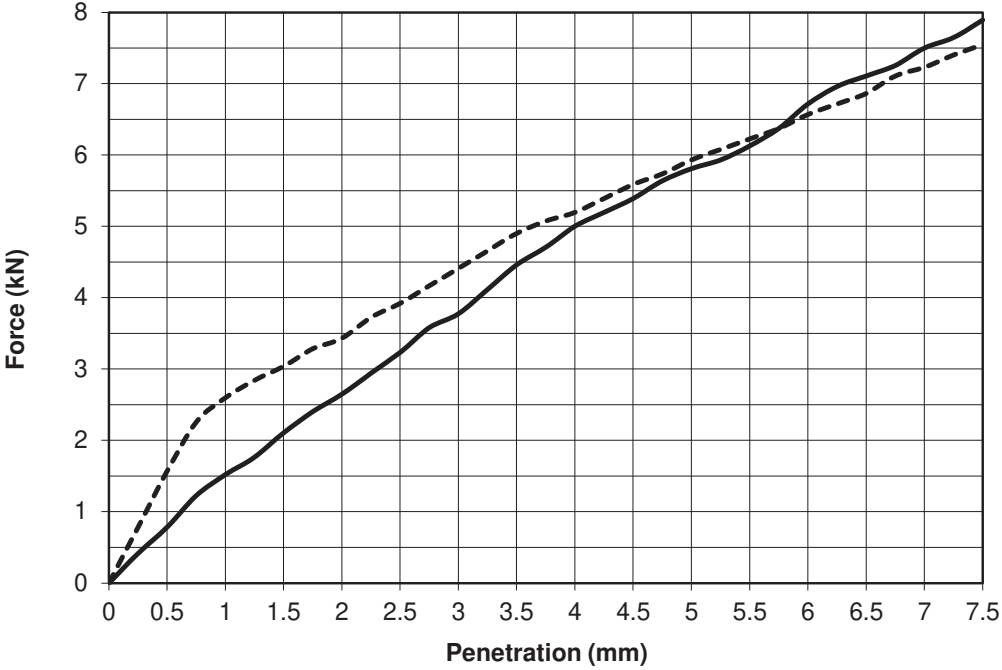
Key: ————— Top - - - - - Base

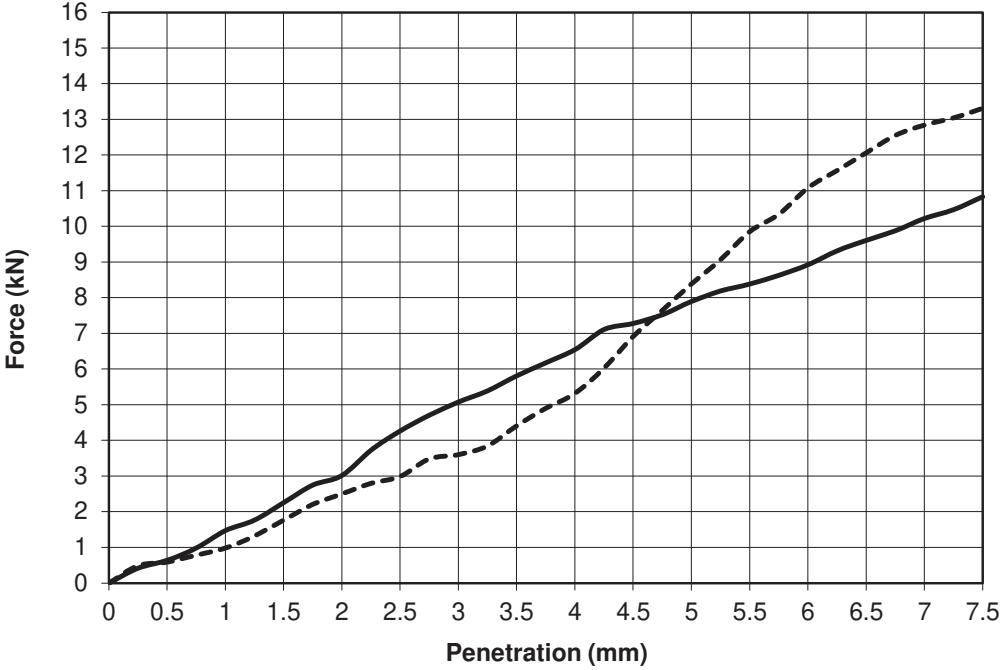
Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition: 2 % Lime/ 7 Days Soaked			
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.17
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93
% Material >20mm:	6.4		
Method of compaction: Static Compaction Method 2			

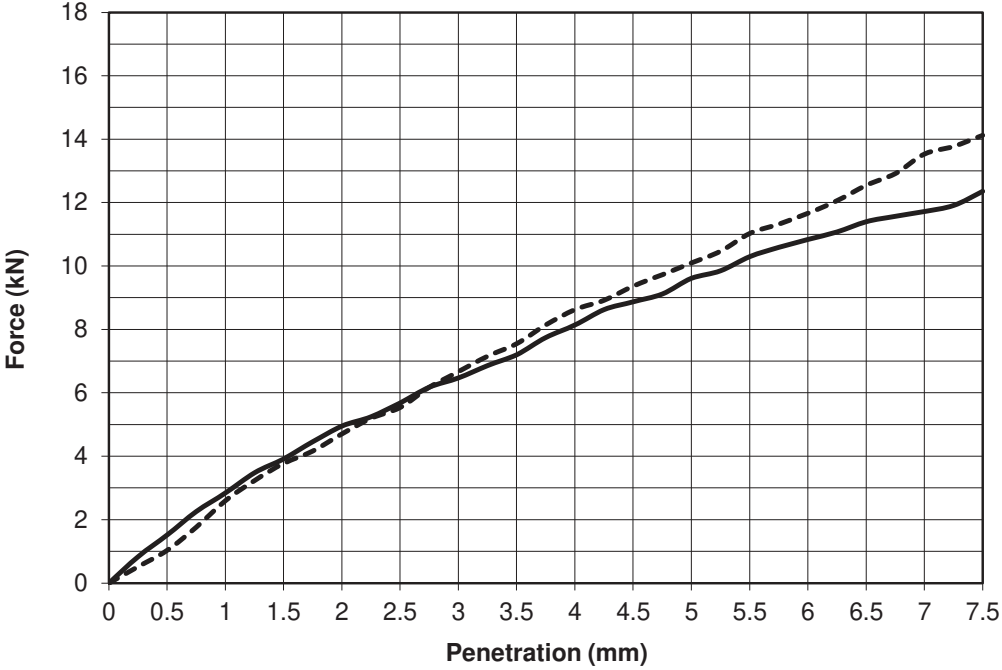
Test Result	Top	Base
CBR %	36	35
Moisture Content %	13	12

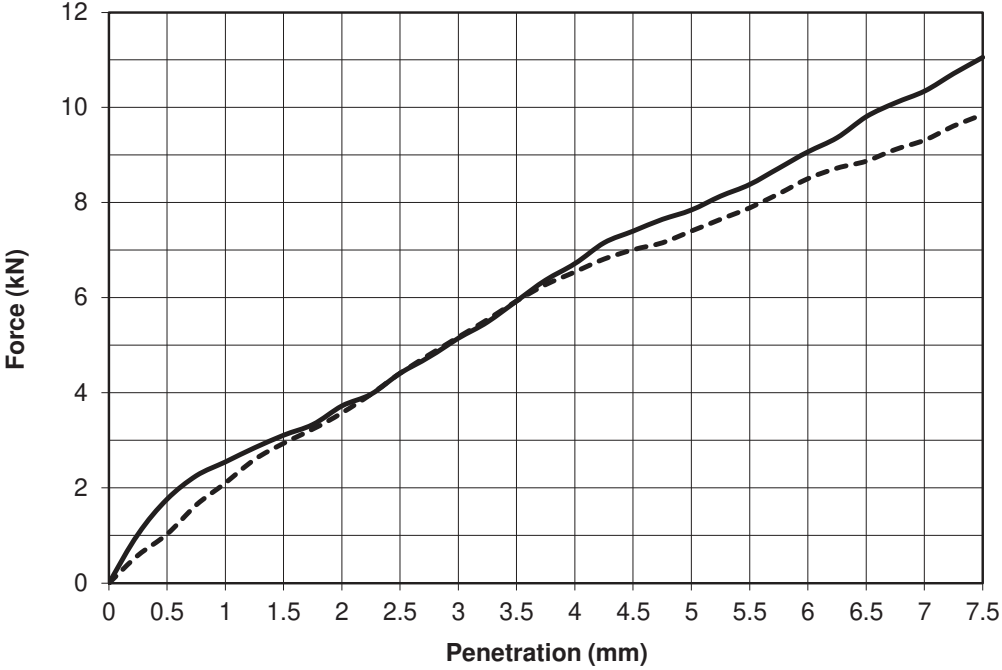
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

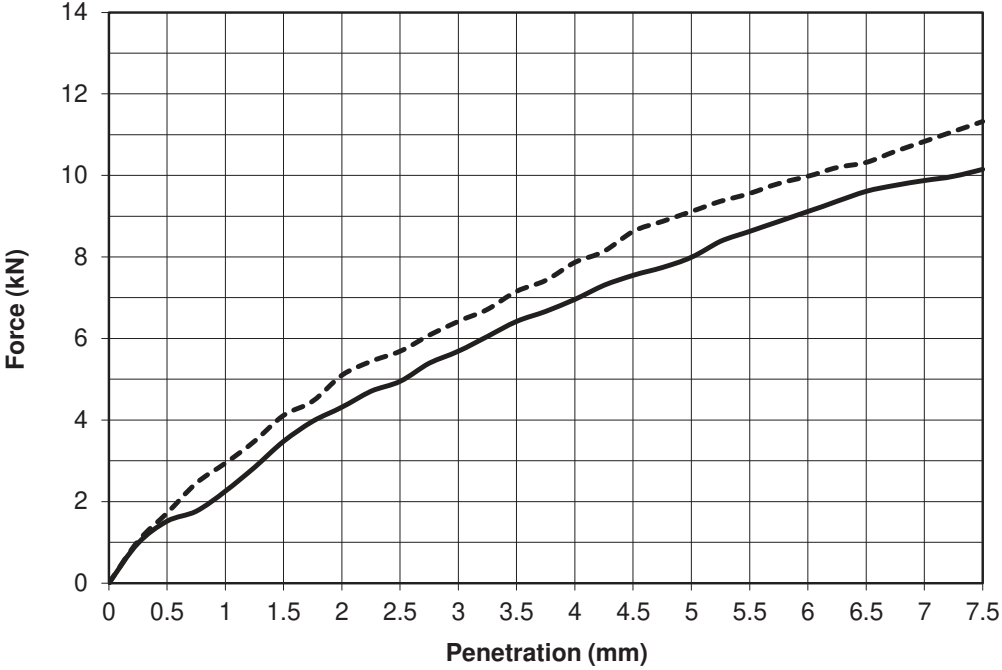
IGSL Ltd Materials Laboratory	Approved by 	Date 24/02/23	Page No. 1 of 1

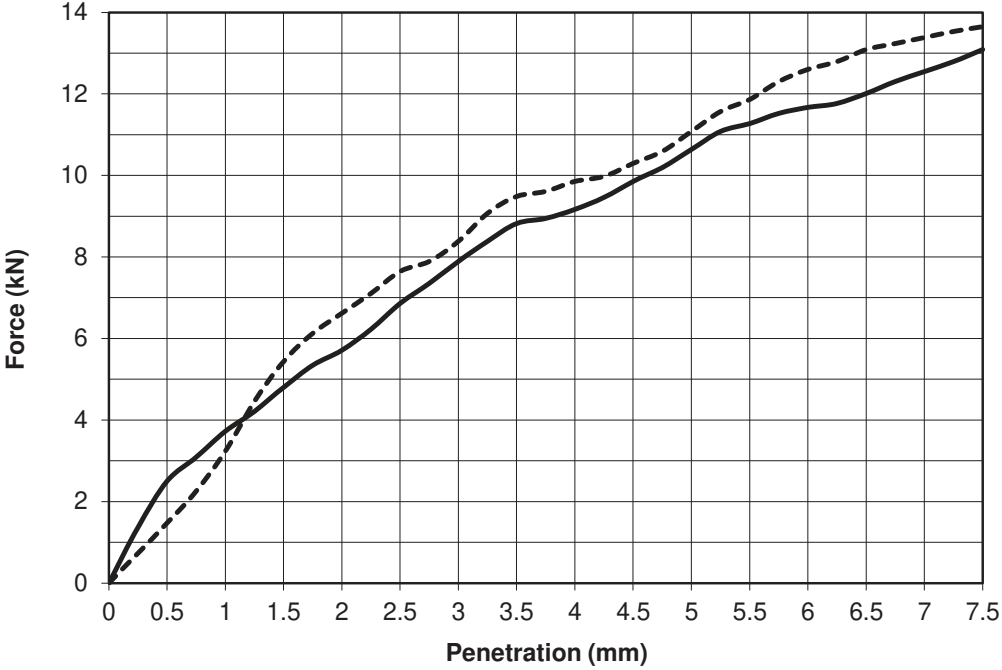
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142665</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>13/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP12</td> <td>Sample No.*</td> <td>AA195481 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7563</td> </tr> </table>			Report No.	R142665	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	13/02/23	BH/TP No.*	TP12	Sample No.*	AA195481 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7563				
Report No.	R142665	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	13/02/23																							
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7563																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2% Lime/Soaked 3 Days</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.89</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.4</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 2% Lime/Soaked 3 Days				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89	% Material >20mm:	6.4			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2% Lime/Soaked 3 Days																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89																							
% Material >20mm:	6.4																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>29</td> <td>30</td> </tr> <tr> <td>Moisture Content %</td> <td>15</td> <td>15</td> </tr> </table>			Test Result	Top	Base	CBR %	29	30	Moisture Content %	15	15															
Test Result	Top	Base																								
CBR %	29	30																								
Moisture Content %	15	15																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Date</td> <td style="width: 50%;">Page No.</td> </tr> <tr> <td>23/02/23</td> <td>1 of 1</td> </tr> </table>	Date	Page No.	23/02/23	1 of 1																				
Date	Page No.																									
23/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142670</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>01/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP12</td> <td>Sample No.*</td> <td>AA195481 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7563</td> </tr> </table>			Report No.	R142670	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	01/02/23	BH/TP No.*	TP12	Sample No.*	AA195481 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7563				
Report No.	R142670	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	01/02/23																							
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7563																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2% Lime /5 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>16</td> <td>Bulk Density (Mg/m³):</td> <td>2.15</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.86</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.4</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 2% Lime /5 Days Soaked				Moisture Content (%):	16	Bulk Density (Mg/m ³):	2.15	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.86	% Material >20mm:	6.4			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2% Lime /5 Days Soaked																										
Moisture Content (%):	16	Bulk Density (Mg/m ³):	2.15																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.86																							
% Material >20mm:	6.4																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>40</td> <td>42</td> </tr> <tr> <td>Moisture Content %</td> <td>16</td> <td>16</td> </tr> </table>			Test Result	Top	Base	CBR %	40	42	Moisture Content %	16	16															
Test Result	Top	Base																								
CBR %	40	42																								
Moisture Content %	16	16																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 60%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 20%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">23/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		23/02/23	1 of 1																		
Approved by	Date	Page No.																								
	23/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143178</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>17/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP12</td> <td>Sample No.*</td> <td>AA185481 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7563</td> </tr> </table>			Report No.	R143178	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	17/02/23	BH/TP No.*	TP12	Sample No.*	AA185481 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7563				
Report No.	R143178	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	17/02/23																							
BH/TP No.*	TP12	Sample No.*	AA185481 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7563																							
 Force (kN) 0 to 18 Penetration (mm) 0 to 7.5 Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 3% Lime/ 7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>15</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.90</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 3% Lime/ 7 Days Soaked				Moisture Content (%):	15	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 3% Lime/ 7 Days Soaked																										
Moisture Content (%):	15	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>48</td> <td>51</td> </tr> <tr> <td>Moisture Content %</td> <td>15</td> <td>14</td> </tr> </table>			Test Result	Top	Base	CBR %	48	51	Moisture Content %	15	14															
Test Result	Top	Base																								
CBR %	48	51																								
Moisture Content %	15	14																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

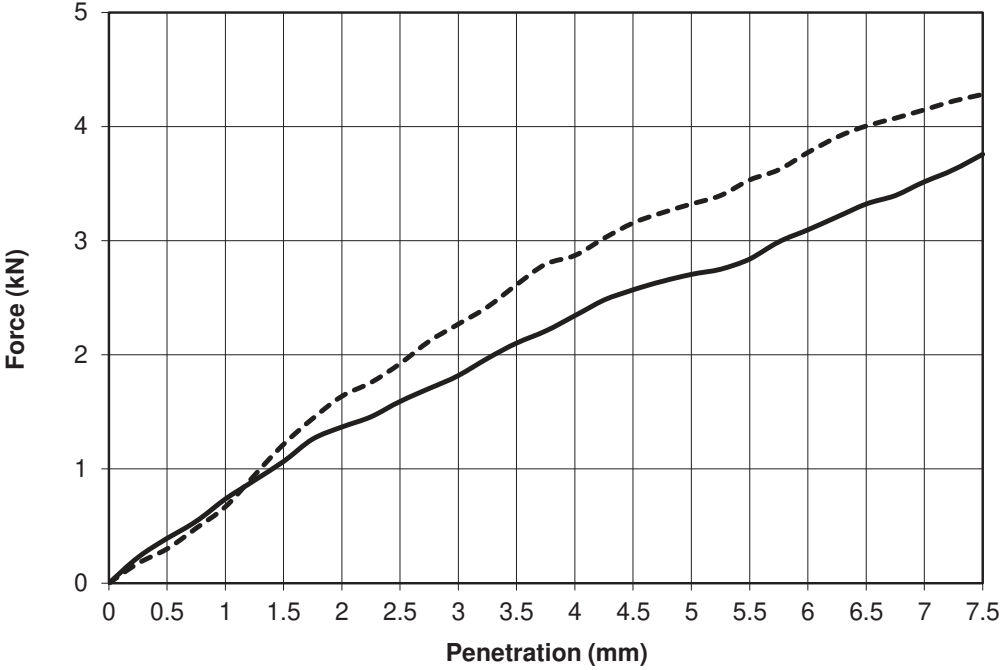
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142667</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>13/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP12</td> <td>Sample No.*</td> <td>AA195481 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7563</td> </tr> </table>			Report No.	R142667	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	13/02/23	BH/TP No.*	TP12	Sample No.*	AA195481 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7563				
Report No.	R142667	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	13/02/23																							
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7563																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime 2% Cement 3 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.16</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.89</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.4</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime 2% Cement 3 Days Soaked				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.16	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89	% Material >20mm:	6.4			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime 2% Cement 3 Days Soaked																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.16																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89																							
% Material >20mm:	6.4																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>39</td> <td>37</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>15</td> </tr> </table>			Test Result	Top	Base	CBR %	39	37	Moisture Content %	14	15															
Test Result	Top	Base																								
CBR %	39	37																								
Moisture Content %	14	15																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Date</td> <td style="width: 50%;">Page No.</td> </tr> <tr> <td>23/02/23</td> <td>1 of 1</td> </tr> </table>	Date	Page No.	23/02/23	1 of 1																				
Date	Page No.																									
23/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143179</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>17/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP12</td> <td>Sample No.*</td> <td>AA185481 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7563</td> </tr> </table>			Report No.	R143179	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	17/02/23	BH/TP No.*	TP12	Sample No.*	AA185481 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7563				
Report No.	R143179	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	17/02/23																							
BH/TP No.*	TP12	Sample No.*	AA185481 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7563																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime 2% Cement/5 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>16</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.87</td> </tr> <tr> <td>% Material >20mm:</td> <td>14</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime 2% Cement/5 Days Soaked				Moisture Content (%):	16	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.87	% Material >20mm:	14			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime 2% Cement/5 Days Soaked																										
Moisture Content (%):	16	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.87																							
% Material >20mm:	14																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>40</td> <td>46</td> </tr> <tr> <td>Moisture Content %</td> <td>16</td> <td>16</td> </tr> </table>			Test Result	Top	Base	CBR %	40	46	Moisture Content %	16	16															
Test Result	Top	Base																								
CBR %	40	46																								
Moisture Content %	16	16																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142669</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>01/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP12</td> <td>Sample No.*</td> <td>AA195481 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7563</td> </tr> </table>			Report No.	R142669	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	01/02/23	BH/TP No.*	TP12	Sample No.*	AA195481 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7563				
Report No.	R142669	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	01/02/23																							
BH/TP No.*	TP12	Sample No.*	AA195481 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7563																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime 2% Cement/7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>15</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.89</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.4</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime 2% Cement/7 Days Soaked				Moisture Content (%):	15	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89	% Material >20mm:	6.4			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime 2% Cement/7 Days Soaked																										
Moisture Content (%):	15	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89																							
% Material >20mm:	6.4																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>53</td> <td>58</td> </tr> <tr> <td>Moisture Content %</td> <td>16</td> <td>15</td> </tr> </table>			Test Result	Top	Base	CBR %	53	58	Moisture Content %	16	15															
Test Result	Top	Base																								
CBR %	53	58																								
Moisture Content %	16	15																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">23/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		23/02/23	1 of 1																		
Approved by	Date	Page No.																								
	23/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R145763	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	18/02/23
BH/TP No.*	TP19	Sample No.*	AA185468 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7568



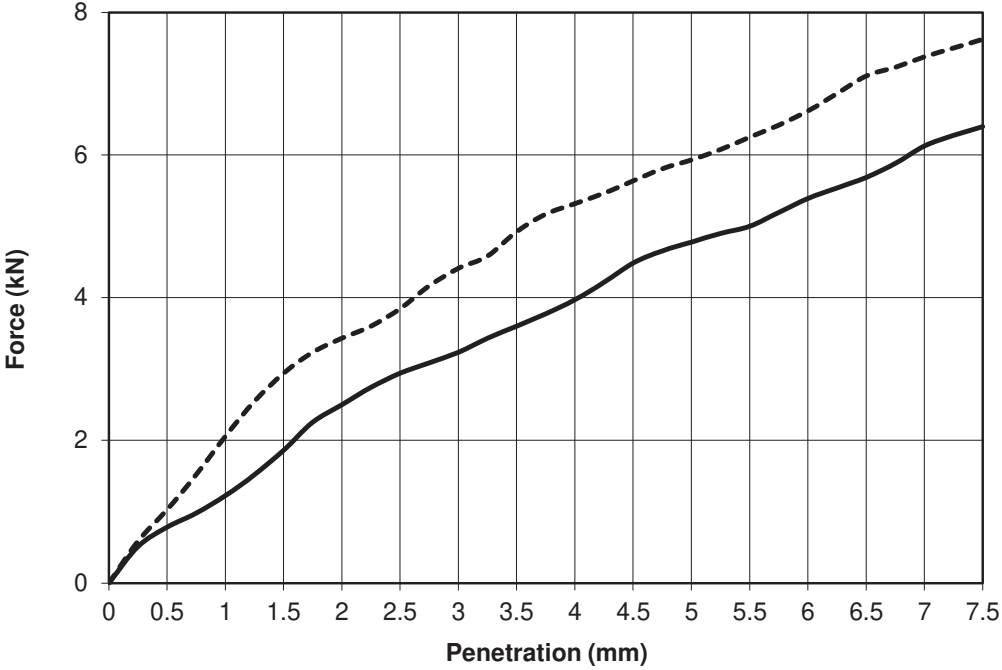
Key: ————— Top - - - - - Base

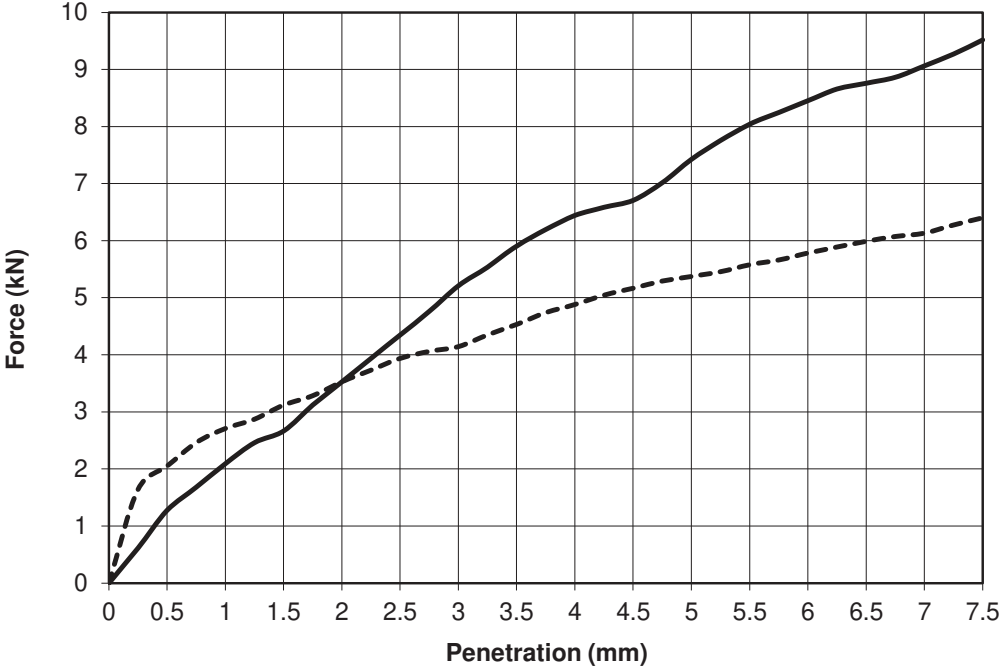
Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1 % Lime/ 3 Days Soaked			
Moisture Content (%):	16	Bulk Density (Mg/m ³):	2.16
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.86
% Material >20mm:	9		
Method of compaction: Static Compaction Method 2			

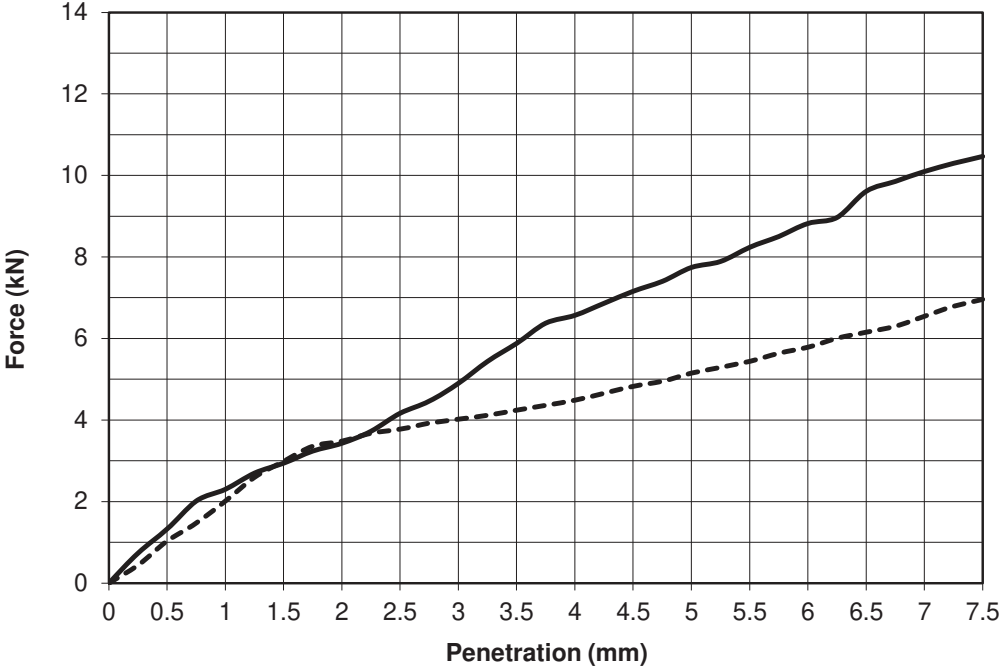
Test Result	Top	Base
CBR %	14	17
Moisture Content %	16	16

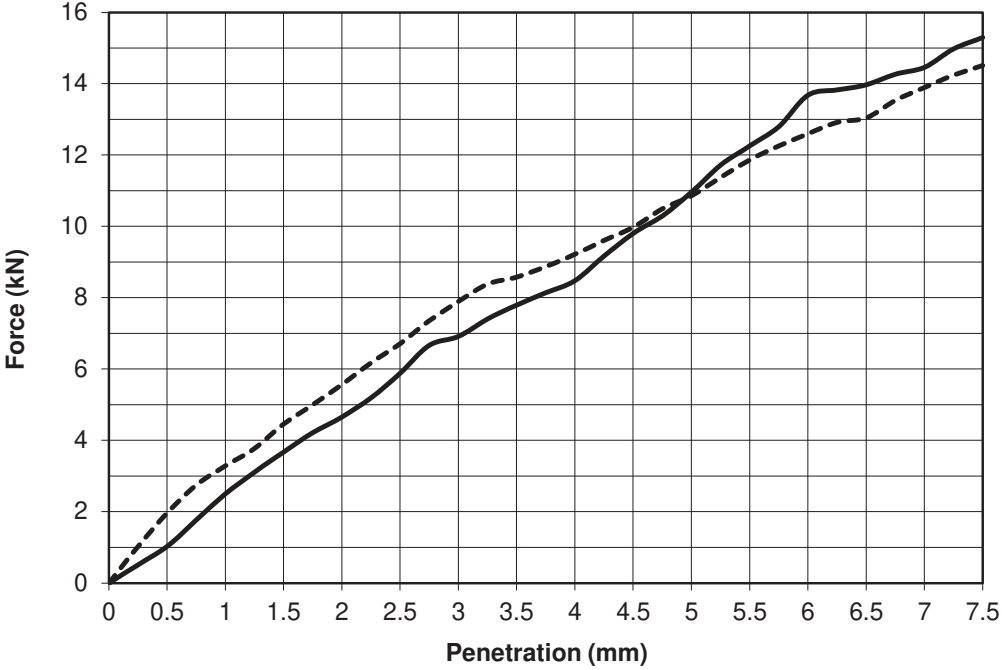
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

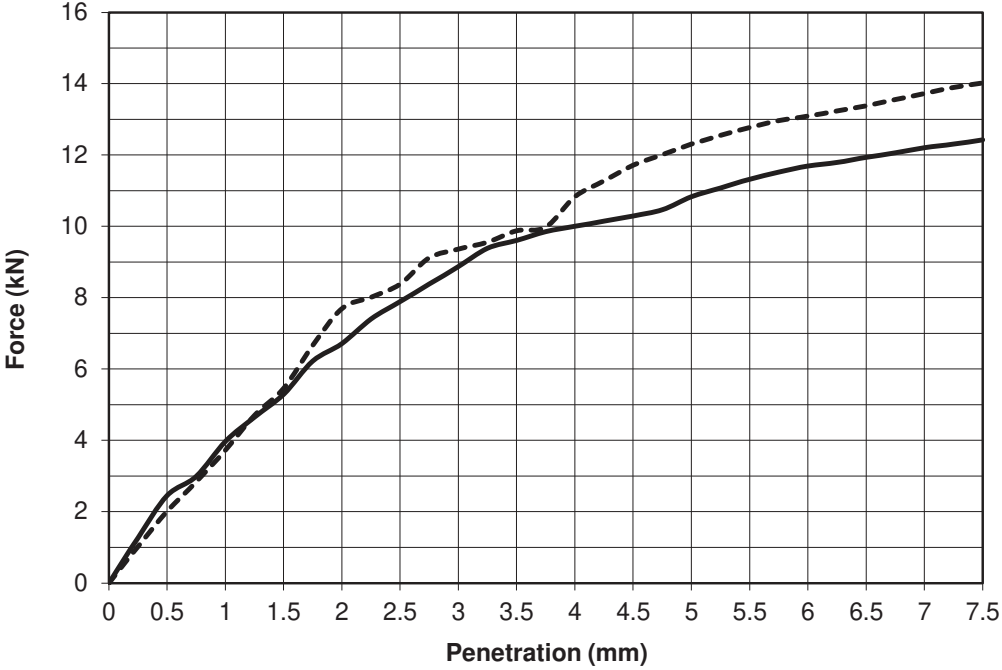
IGSL Ltd Materials Laboratory	Approved by 	Date 24/02/23	Page No. 1 of 1

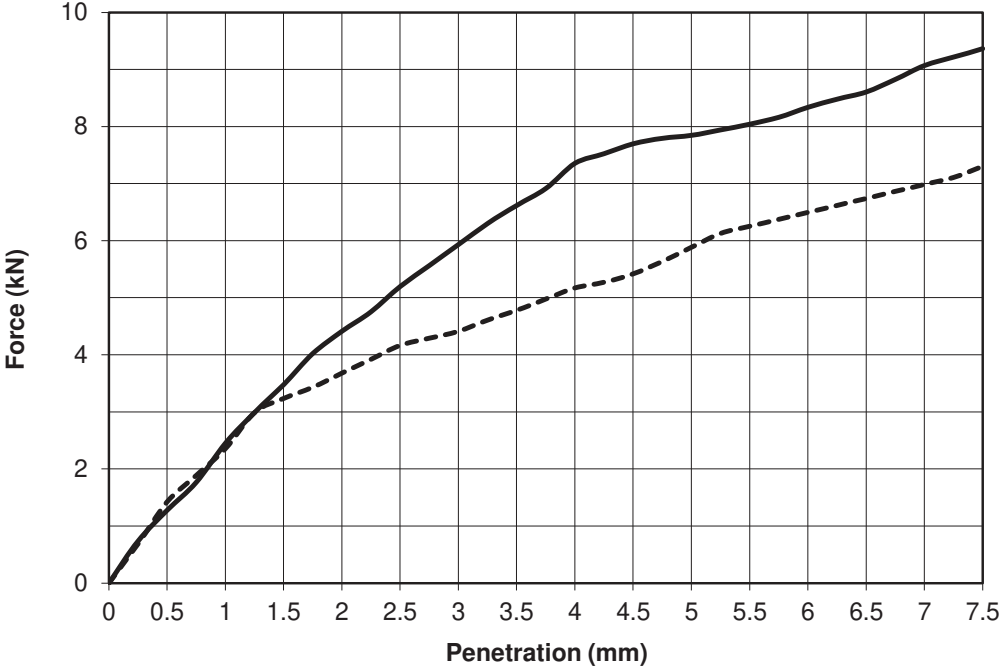
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143180</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>18/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP19</td> <td>Sample No.*</td> <td>AA185468 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7568</td> </tr> </table>			Report No.	R143180	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	18/02/23	BH/TP No.*	TP19	Sample No.*	AA185468 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7568				
Report No.	R143180	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	18/02/23																							
BH/TP No.*	TP19	Sample No.*	AA185468 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7568																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1 % Lime/ 5 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>16</td> <td>Bulk Density (Mg/m³):</td> <td>2.18</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.88</td> </tr> <tr> <td>% Material >20mm:</td> <td>9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1 % Lime/ 5 Days Soaked				Moisture Content (%):	16	Bulk Density (Mg/m ³):	2.18	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.88	% Material >20mm:	9			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1 % Lime/ 5 Days Soaked																										
Moisture Content (%):	16	Bulk Density (Mg/m ³):	2.18																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.88																							
% Material >20mm:	9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>24</td> <td>30</td> </tr> <tr> <td>Moisture Content %</td> <td>16</td> <td>16</td> </tr> </table>			Test Result	Top	Base	CBR %	24	30	Moisture Content %	16	16															
Test Result	Top	Base																								
CBR %	24	30																								
Moisture Content %	16	16																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R145764</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>24/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP19</td> <td>Sample No.*</td> <td>AA185468 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7568</td> </tr> </table>			Report No.	R145764	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	24/02/23	BH/TP No.*	TP19	Sample No.*	AA185468 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7568				
Report No.	R145764	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	24/02/23																							
BH/TP No.*	TP19	Sample No.*	AA185468 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7568																							
 Force (kN) Penetration (mm) Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1 % Lime/ 7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.18</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.94</td> </tr> <tr> <td>% Material >20mm:</td> <td>9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1 % Lime/ 7 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.18	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94	% Material >20mm:	9			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1 % Lime/ 7 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.18																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94																							
% Material >20mm:	9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>37</td> <td>30</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	37	30	Moisture Content %	12	13															
Test Result	Top	Base																								
CBR %	37	30																								
Moisture Content %	12	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">27/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		27/02/23	1 of 1																		
Approved by	Date	Page No.																								
	27/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142672</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>01/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP19</td> <td>Sample No.*</td> <td>AA185498 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7568</td> </tr> </table>			Report No.	R142672	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	01/02/23	BH/TP No.*	TP19	Sample No.*	AA185498 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7568				
Report No.	R142672	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	01/02/23																							
BH/TP No.*	TP19	Sample No.*	AA185498 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7568																							
 Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2 % Lime/3 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.20</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.93</td> </tr> <tr> <td>% Material >20mm:</td> <td>9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 2 % Lime/3 Days Soaked				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.20	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93	% Material >20mm:	9			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2 % Lime/3 Days Soaked																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.20																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93																							
% Material >20mm:	9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>39</td> <td>29</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>15</td> </tr> </table>			Test Result	Top	Base	CBR %	39	29	Moisture Content %	14	15															
Test Result	Top	Base																								
CBR %	39	29																								
Moisture Content %	14	15																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">23/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		23/02/23	1 of 1																		
Approved by	Date	Page No.																								
	23/02/23	1 of 1																								

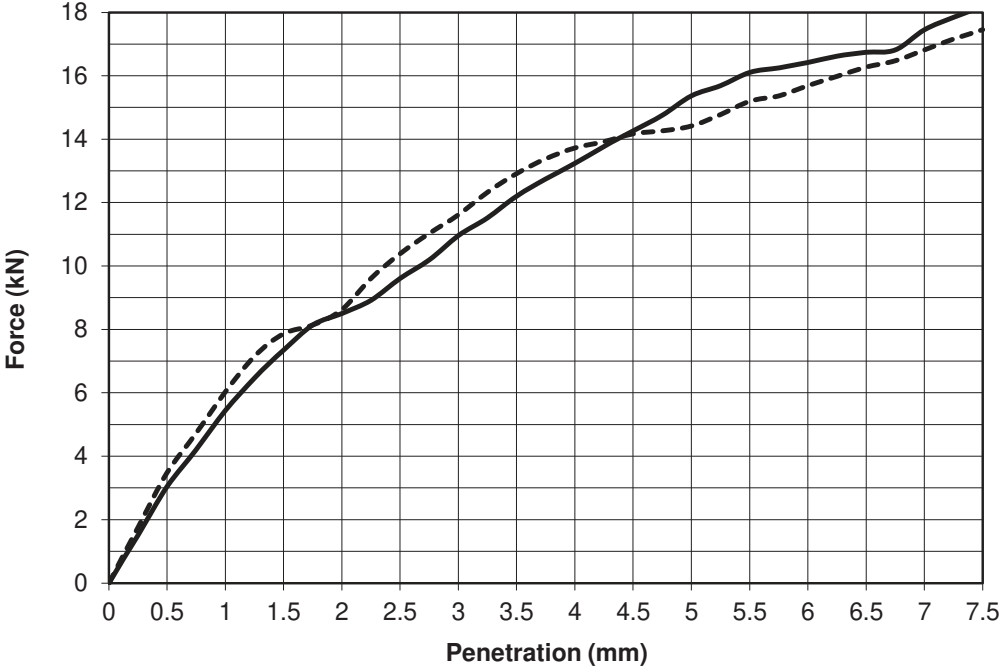
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142671</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>13/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP19</td> <td>Sample No.*</td> <td>AA185498 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7568</td> </tr> </table>			Report No.	R142671	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	13/02/23	BH/TP No.*	TP19	Sample No.*	AA185498 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7568				
Report No.	R142671	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	13/02/23																							
BH/TP No.*	TP19	Sample No.*	AA185498 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7568																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2% Lime added 5 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.92</td> </tr> <tr> <td>% Material >20mm:</td> <td>9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 2% Lime added 5 Days Soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92	% Material >20mm:	9			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2% Lime added 5 Days Soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92																							
% Material >20mm:	9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>55</td> <td>54</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	55	54	Moisture Content %	13	13															
Test Result	Top	Base																								
CBR %	55	54																								
Moisture Content %	13	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border-bottom: 1px solid black;">Date</td> <td style="width: 50%; border-bottom: 1px solid black;">Page No.</td> </tr> <tr> <td style="text-align: center;">23/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	23/02/23	1 of 1																				
Date	Page No.																									
23/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143181</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>16/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP19</td> <td>Sample No.*</td> <td>AA185468 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7568</td> </tr> </table>			Report No.	R143181	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	16/02/23	BH/TP No.*	TP19	Sample No.*	AA185468 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7568				
Report No.	R143181	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	16/02/23																							
BH/TP No.*	TP19	Sample No.*	AA185468 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7568																							
 Force (kN) vs Penetration (mm) Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2 % Lime/ 7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.93</td> </tr> <tr> <td>% Material >20mm:</td> <td>9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 2 % Lime/ 7 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93	% Material >20mm:	9			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2 % Lime/ 7 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93																							
% Material >20mm:	9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>60</td> <td>63</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	60	63	Moisture Content %	12	12															
Test Result	Top	Base																								
CBR %	60	63																								
Moisture Content %	12	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143186</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>03/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP19</td> <td>Sample No.*</td> <td>AA185468 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7568</td> </tr> </table>			Report No.	R143186	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	03/02/23	BH/TP No.*	TP19	Sample No.*	AA185468 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7568				
Report No.	R143186	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	03/02/23																							
BH/TP No.*	TP19	Sample No.*	AA185468 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7568																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 3% Lime 3 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.09</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.84</td> </tr> <tr> <td>% Material >20mm:</td> <td>9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 3% Lime 3 Days Soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.09	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.84	% Material >20mm:	9			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 3% Lime 3 Days Soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.09																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.84																							
% Material >20mm:	9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>39</td> <td>32</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	39	32	Moisture Content %	14	13															
Test Result	Top	Base																								
CBR %	39	32																								
Moisture Content %	14	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border: none;">Date</td> <td style="width: 50%; border: none;">Page No.</td> </tr> <tr> <td style="border: 1px solid black; text-align: center;">24/02/23</td> <td style="border: 1px solid black; text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	24/02/23	1 of 1																				
Date	Page No.																									
24/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R143184	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	17/02/23
BH/TP No.*	TP19	Sample No.*	AA185468 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7568



Key: ————— Top - - - - - Base

Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 3 % Lime /5 Days soaked			
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.20
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95
% Material >20mm:	9		
Method of compaction: Static Compaction Method 2			

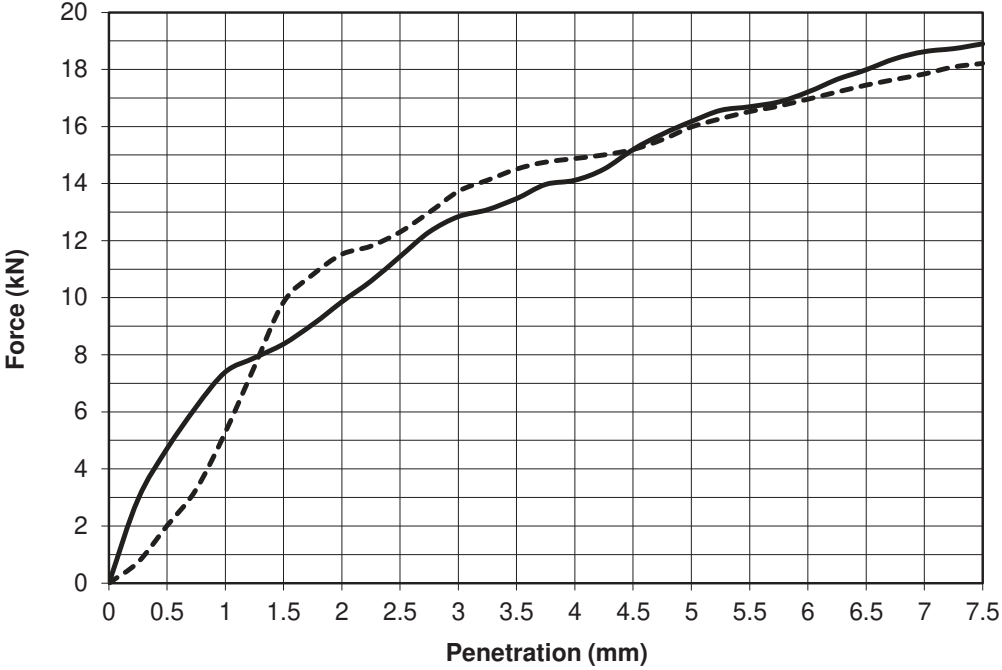
Test Result	Top	Base
CBR %	77	79
Moisture Content %	14	13

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 24/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142673	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	01/02/23
BH/TP No.*	TP19	Sample No.*	AA185498 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7568



Key: ————— Top - - - - - Base

Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 3 % Lime /7 Days soaked			
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.20
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93
% Material >20mm:	9		
Method of compaction: Static Compaction Method 2			

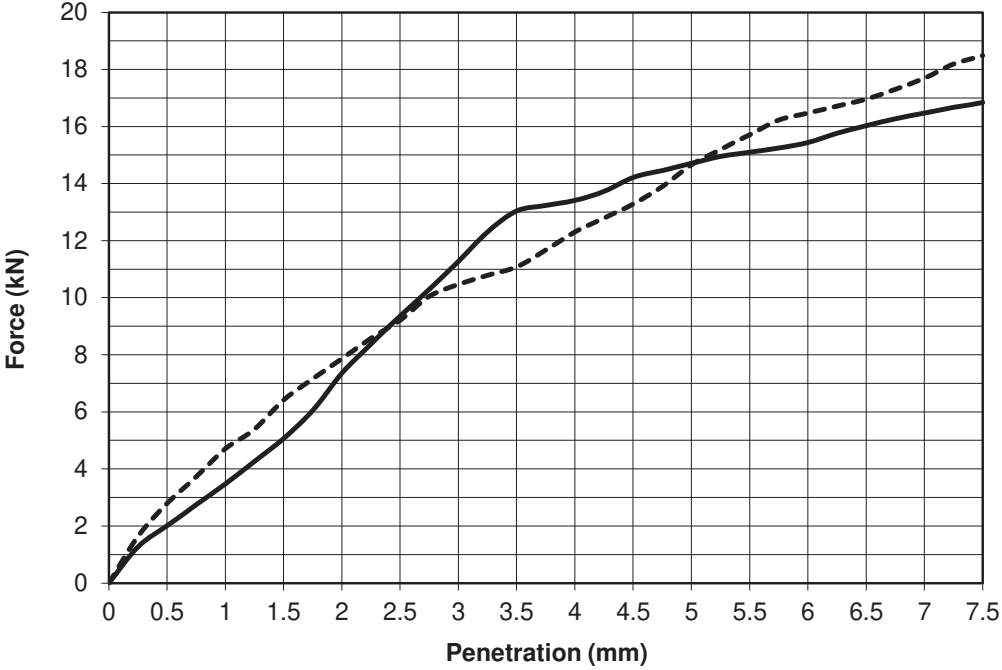
Test Result	Top	Base
CBR %	86	93
Moisture Content %	15	14

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142674	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	01/02/23
BH/TP No.*	TP19	Sample No.*	AA185498 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7568



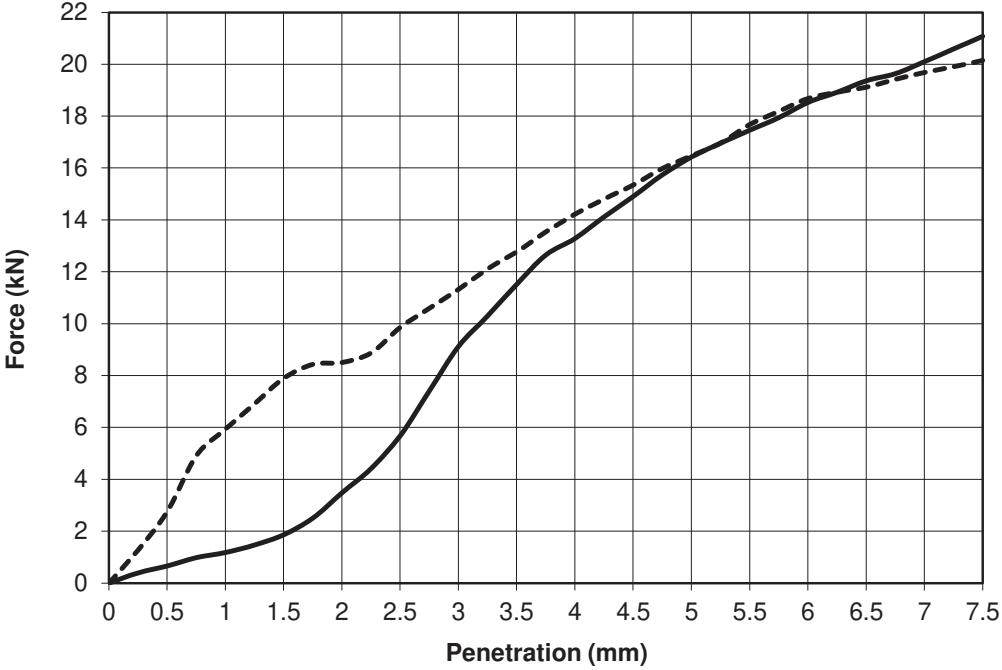
Key: ————— Top - - - - - Base

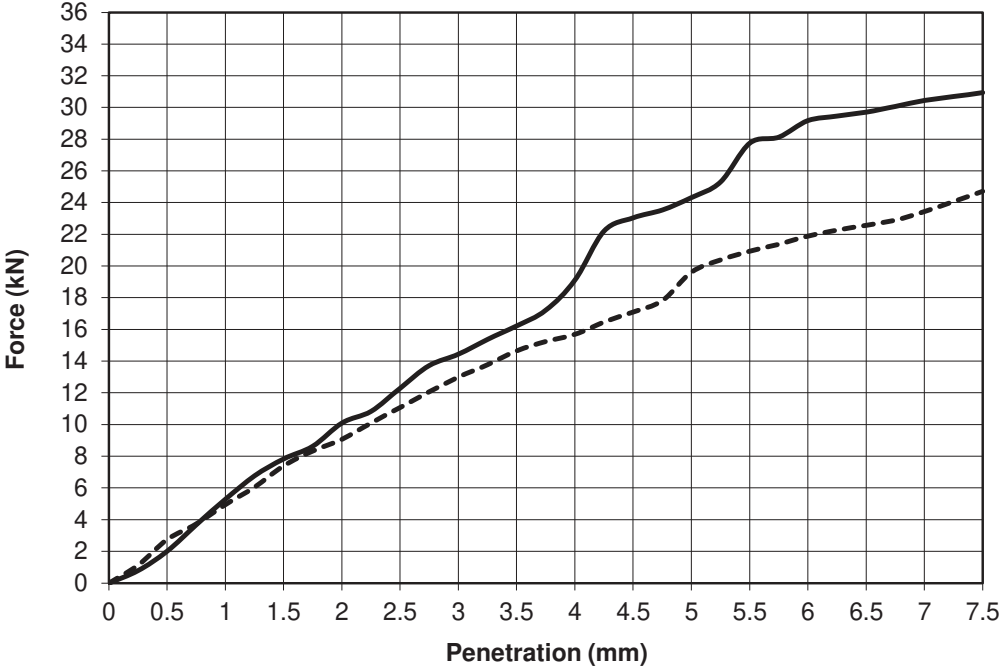
Description: Mottle brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime /2% Cement 3 Days Soaked			
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.15
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.89
% Material >20mm:	9		
Method of compaction: Static Compaction Method 2			

Test Result	Top	Base
CBR %	74	73
Moisture Content %	14	14

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

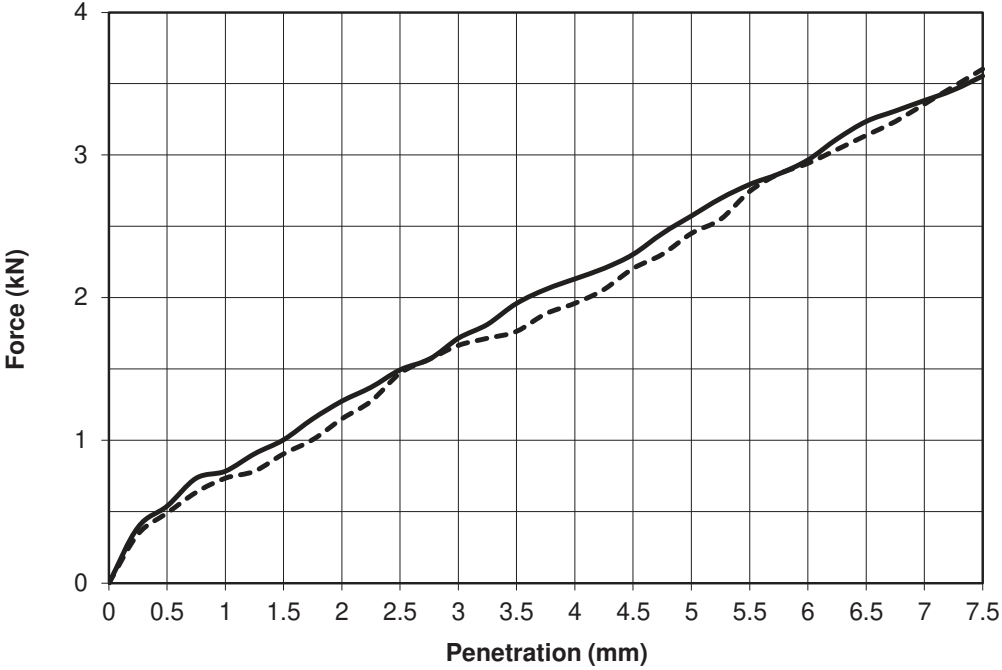
IGSL Ltd Materials Laboratory	Approved by 	Date 23/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143185</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>17/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP19</td> <td>Sample No.*</td> <td>AA185468 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7568</td> </tr> </table>			Report No.	R143185	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	17/02/23	BH/TP No.*	TP19	Sample No.*	AA185468 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7568				
Report No.	R143185	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	17/02/23																							
BH/TP No.*	TP19	Sample No.*	AA185468 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7568																							
 Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime/2 Cement 5 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.18</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.94</td> </tr> <tr> <td>% Material >20mm:</td> <td>9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime/2 Cement 5 Days Soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.18	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94	% Material >20mm:	9			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime/2 Cement 5 Days Soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.18																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94																							
% Material >20mm:	9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>82</td> <td>83</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	82	83	Moisture Content %	13	12															
Test Result	Top	Base																								
CBR %	82	83																								
Moisture Content %	13	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																																	
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143187</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>03/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP19</td> <td>Sample No.*</td> <td>AA185468 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7568</td> </tr> </table>			Report No.	R143187	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	03/02/23	BH/TP No.*	TP19	Sample No.*	AA185468 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7568													
Report No.	R143187	Contract	Halverstown , Naas - Proposed Data Centres																																
Contract No.	24330	Customer	DOBA																																
Date received	24/01/23	Date Tested	03/02/23																																
BH/TP No.*	TP19	Sample No.*	AA185468 Type: B																																
Depth* (m)	0.50	Lab sample No.	A22/7568																																
																																			
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime/2% Cement /7 Days soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.18</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.93</td> </tr> <tr> <td>% Material >20mm:</td> <td>9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table> <table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <td style="width: 33%;">Test Result</td> <td style="width: 33%;">Top</td> <td style="width: 33%;">Base</td> </tr> <tr> <td>CBR %</td> <td>122</td> <td>98</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>13</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime/2% Cement /7 Days soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.18	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93	% Material >20mm:	9			Method of compaction: Static Compaction Method 2				Test Result	Top	Base	CBR %	122	98	Moisture Content %	13	13
Description: Mottled brown slightly sandy slightly gravelly CLAY																																			
Initial Condition: 1% Lime/2% Cement /7 Days soaked																																			
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.18																																
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93																																
% Material >20mm:	9																																		
Method of compaction: Static Compaction Method 2																																			
Test Result	Top	Base																																	
CBR %	122	98																																	
Moisture Content %	13	13																																	
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																																	
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																											
Approved by	Date	Page No.																																	
	24/02/23	1 of 1																																	

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R145765	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	18/02/23
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7575



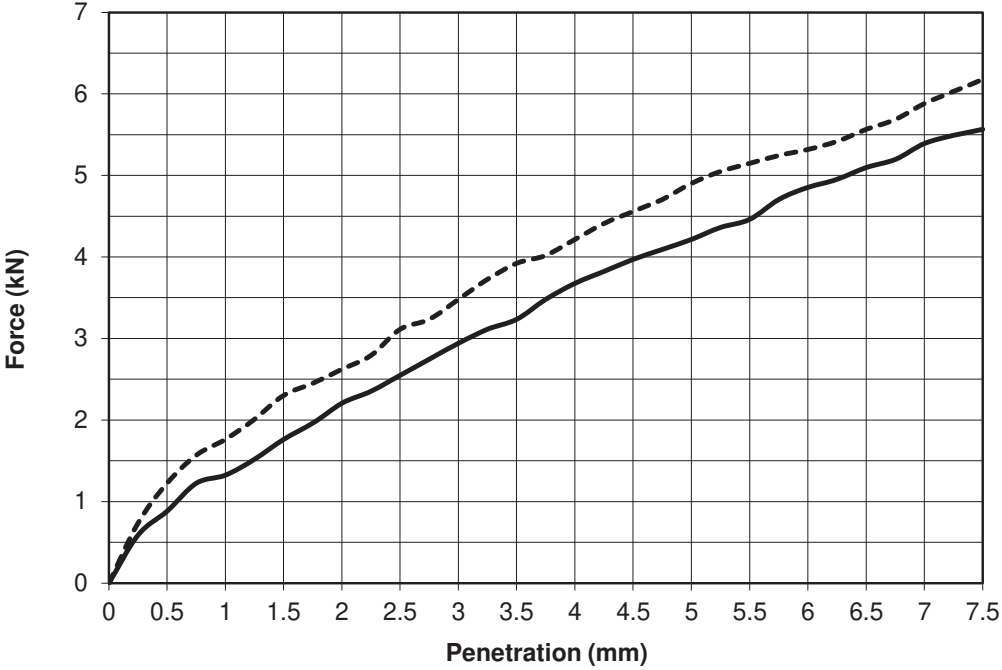
Key: ————— Top - - - - - Base

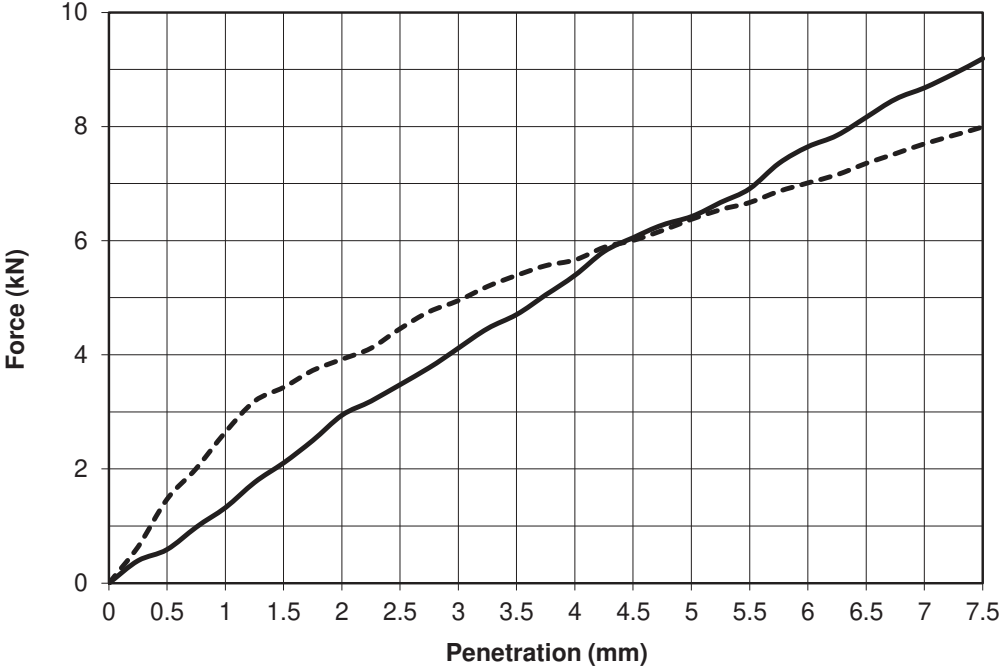
Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime /3 Days Soaked			
Moisture Content (%):	16	Bulk Density (Mg/m ³):	2.16
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.87
% Material >20mm:	7.6		
Method of compaction: Static Compaction Method 2			

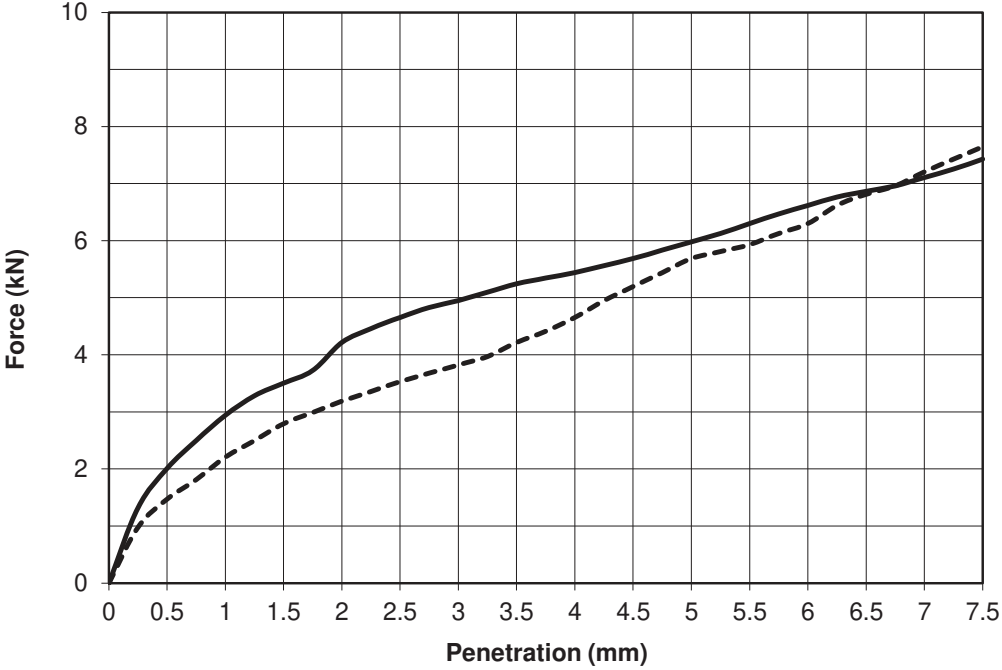
Test Result	Top	Base
CBR %	13	12
Moisture Content %	16	16

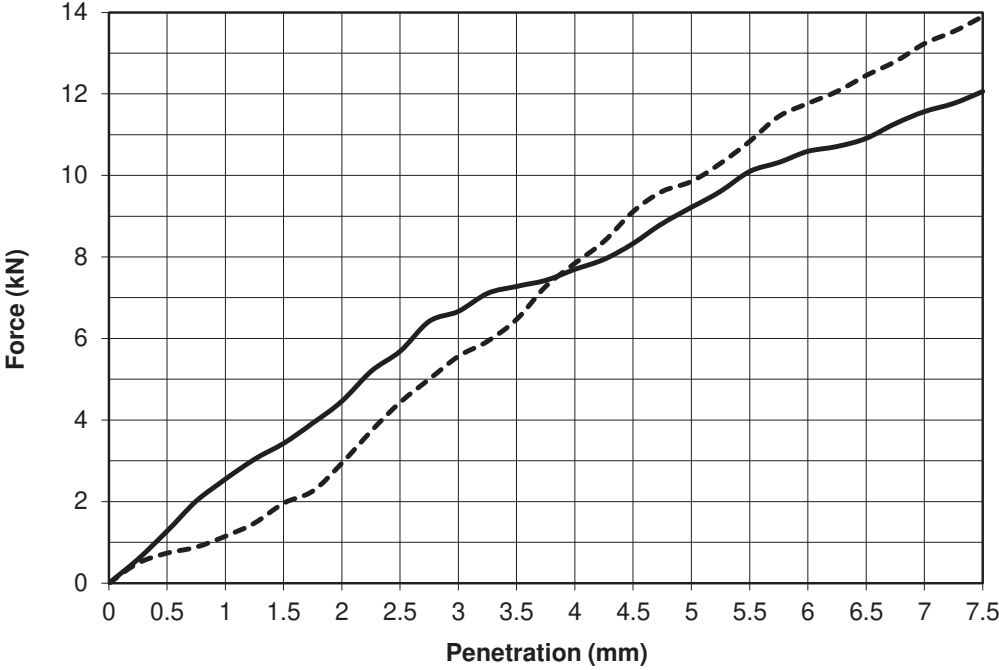
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

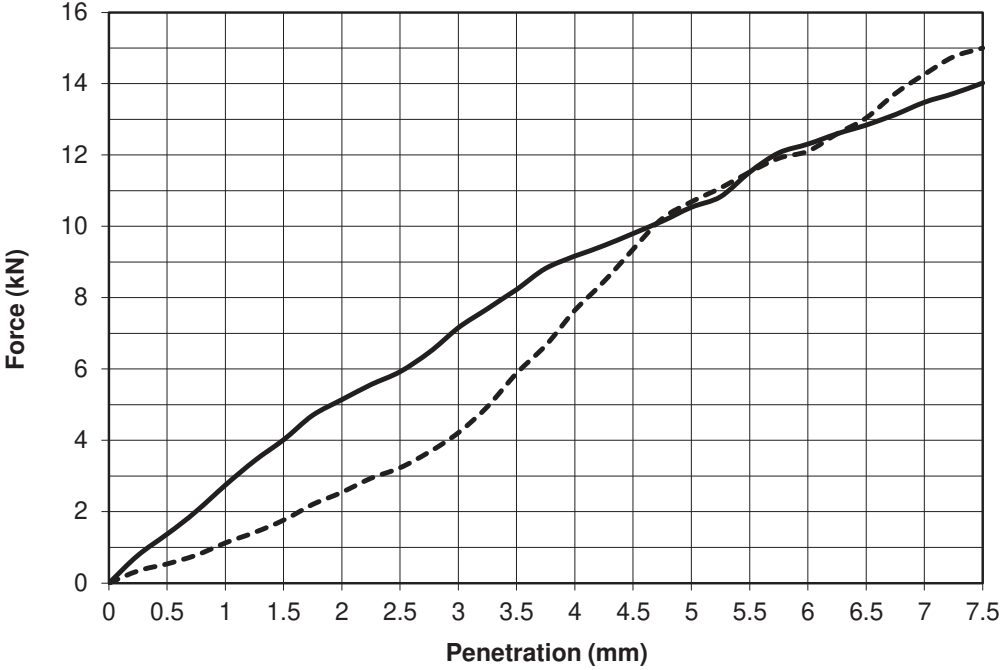
IGSL Ltd Materials Laboratory	Approved by 	Date 18/02/23	Page No. 1 of 1

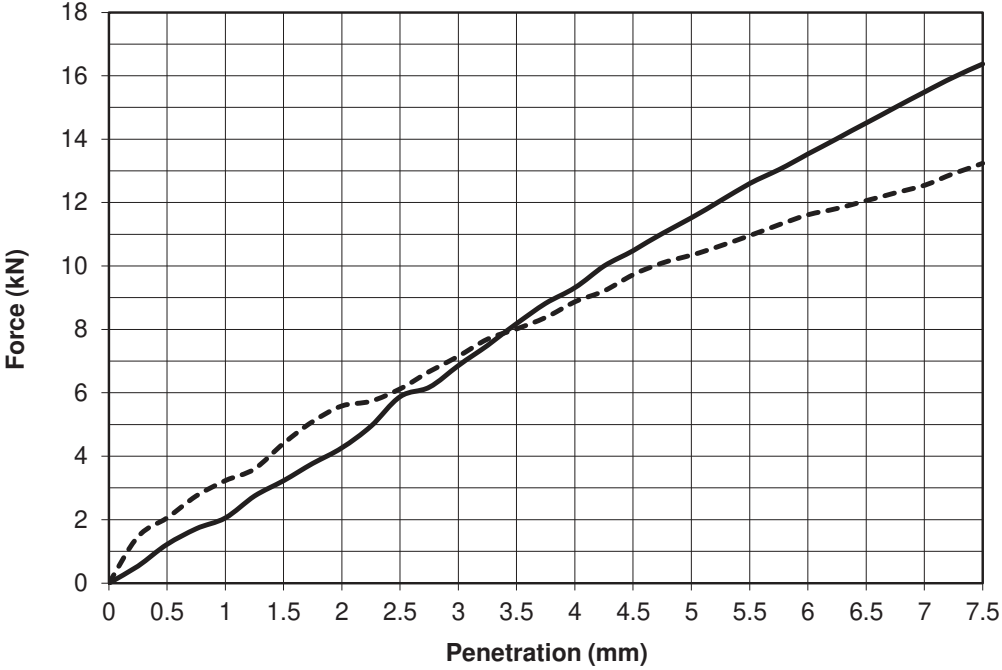
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143182</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>18/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP26</td> <td>Sample No.*</td> <td>AA181975 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7575</td> </tr> </table>			Report No.	R143182	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	18/02/23	BH/TP No.*	TP26	Sample No.*	AA181975 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7575				
Report No.	R143182	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	18/02/23																							
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7575																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime /5 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>17</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.86</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime /5 Days Soaked				Moisture Content (%):	17	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.86	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime /5 Days Soaked																										
Moisture Content (%):	17	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.86																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>21</td> <td>25</td> </tr> <tr> <td>Moisture Content %</td> <td>16</td> <td>17</td> </tr> </table>			Test Result	Top	Base	CBR %	21	25	Moisture Content %	16	17															
Test Result	Top	Base																								
CBR %	21	25																								
Moisture Content %	16	17																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">18/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		18/02/23	1 of 1																		
Approved by	Date	Page No.																								
	18/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142676</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>13/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP26</td> <td>Sample No.*</td> <td>AA181975 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7575</td> </tr> </table>			Report No.	R142676	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	13/02/23	BH/TP No.*	TP26	Sample No.*	AA181975 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7575				
Report No.	R142676	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	13/02/23																							
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7575																							
 Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1 % Lime /7 Day Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.93</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 1 % Lime /7 Day Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1 % Lime /7 Day Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>32</td> <td>34</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	32	34	Moisture Content %	13	12															
Test Result	Top	Base																								
CBR %	32	34																								
Moisture Content %	13	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border: none;">Date</td> <td style="width: 50%; border: none;">Page No.</td> </tr> <tr> <td style="border: none; text-align: center;">24/02/23</td> <td style="border: none; text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	24/02/23	1 of 1																				
Date	Page No.																									
24/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143183</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>18/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP26</td> <td>Sample No.*</td> <td>AA181975 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7575</td> </tr> </table>			Report No.	R143183	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	18/02/23	BH/TP No.*	TP26	Sample No.*	AA181975 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7575				
Report No.	R143183	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	18/02/23																							
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7575																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2% Lime/ 3 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.18</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.94</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 2% Lime/ 3 Days Soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.18	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2% Lime/ 3 Days Soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.18																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>35</td> <td>28</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	35	28	Moisture Content %	12	13															
Test Result	Top	Base																								
CBR %	35	28																								
Moisture Content %	12	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">18/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		18/02/23	1 of 1																		
Approved by	Date	Page No.																								
	18/02/23	1 of 1																								

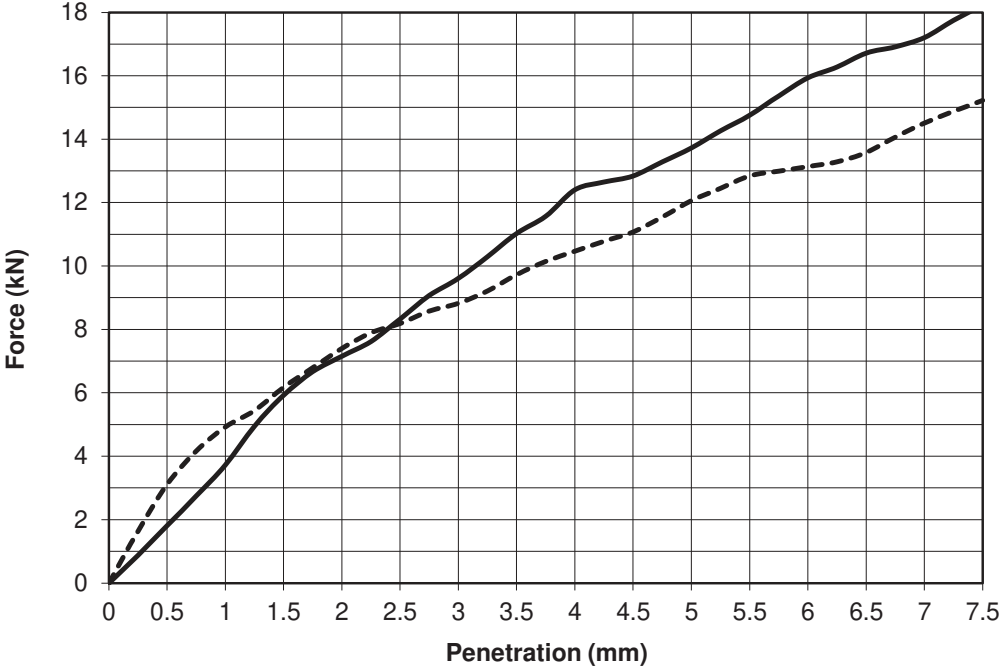
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142678</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>01/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP26</td> <td>Sample No.*</td> <td>AA181975 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7575</td> </tr> </table>			Report No.	R142678	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	01/02/23	BH/TP No.*	TP26	Sample No.*	AA181975 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7575				
Report No.	R142678	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	01/02/23																							
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7575																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2 % Lime/5 Day Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.24</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.97</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 2 % Lime/5 Day Soaked				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.24	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.97	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2 % Lime/5 Day Soaked																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.24																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.97																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>46</td> <td>49</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>14</td> </tr> </table>			Test Result	Top	Base	CBR %	46	49	Moisture Content %	13	14															
Test Result	Top	Base																								
CBR %	46	49																								
Moisture Content %	13	14																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border: none;">Date</td> <td style="width: 50%; border: none;">Page No.</td> </tr> <tr> <td style="border: 1px solid black; text-align: center;">27/02/23</td> <td style="border: 1px solid black; text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	27/02/23	1 of 1																				
Date	Page No.																									
27/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 NAB ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142679</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>01/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP26</td> <td>Sample No.*</td> <td>AA181975 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7575</td> </tr> </table>			Report No.	R142679	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	01/02/23	BH/TP No.*	TP26	Sample No.*	AA181975 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7575				
Report No.	R142679	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	01/02/23																							
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7575																							
 Force (kN) Penetration (mm) Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2% Lime/7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.16</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.91</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 2% Lime/7 Days Soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.16	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.91	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2% Lime/7 Days Soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.16																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.91																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>53</td> <td>54</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>14</td> </tr> </table>			Test Result	Top	Base	CBR %	53	54	Moisture Content %	13	14															
Test Result	Top	Base																								
CBR %	53	54																								
Moisture Content %	13	14																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border: none;">Date</td> <td style="width: 50%; border: none;">Page No.</td> </tr> <tr> <td style="border: 1px solid black; text-align: center;">27/02/23</td> <td style="border: 1px solid black; text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	27/02/23	1 of 1																				
Date	Page No.																									
27/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142677</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>13/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP26</td> <td>Sample No.*</td> <td>AA181975 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7575</td> </tr> </table>			Report No.	R142677	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	13/02/23	BH/TP No.*	TP26	Sample No.*	AA181975 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7575				
Report No.	R142677	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	13/02/23																							
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7575																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 3 % Lime /3 Day Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.90</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 3 % Lime /3 Day Soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 3 % Lime /3 Day Soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>58</td> <td>52</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	58	52	Moisture Content %	13	12															
Test Result	Top	Base																								
CBR %	58	52																								
Moisture Content %	13	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R143189	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	17/02/23
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7575



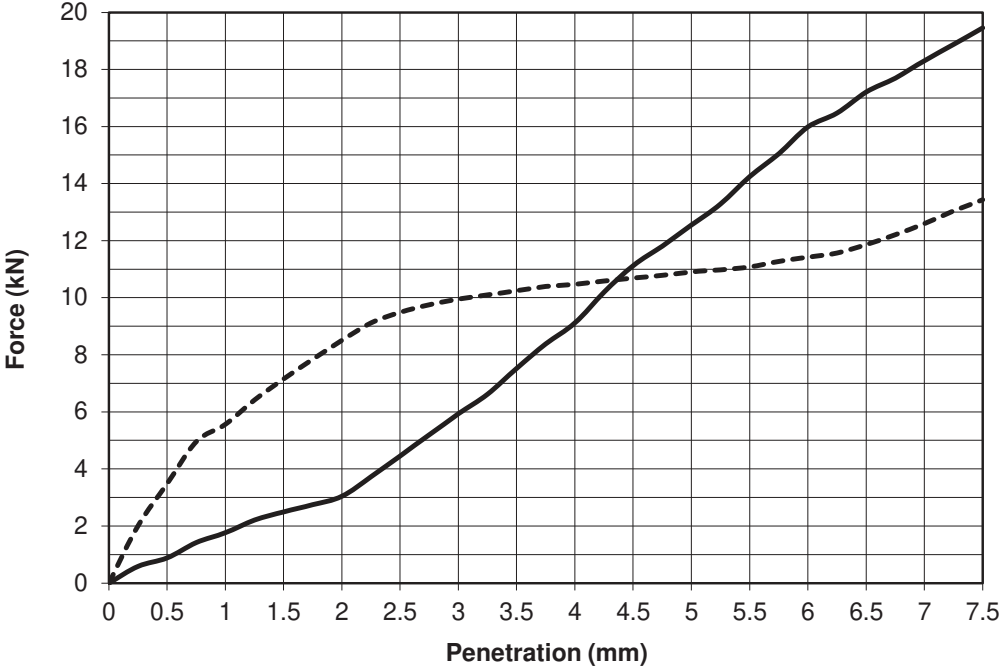
Key: ————— Top - - - - - Base

Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 3 % Lime / 5 Days soaked			
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.18
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.95
% Material >20mm:	7.6		
Method of compaction: Static Compaction Method 2			

Test Result	Top	Base
CBR %	69	62
Moisture Content %	12	12

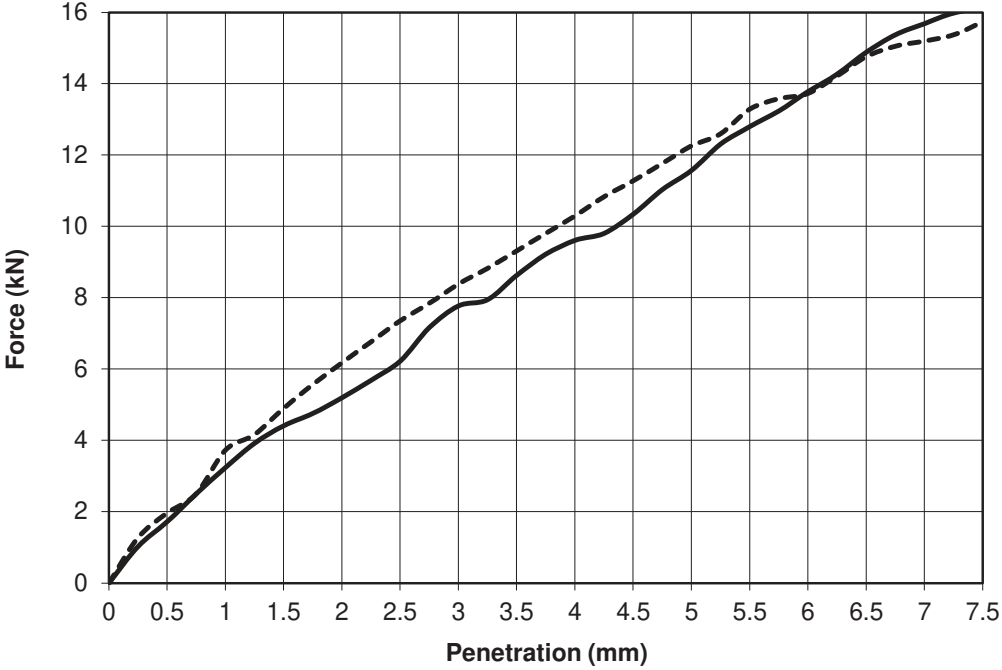
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 24/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 NAB ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143191</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>17/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP26</td> <td>Sample No.*</td> <td>AA181975 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7575</td> </tr> </table>			Report No.	R143191	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	17/02/23	BH/TP No.*	TP26	Sample No.*	AA181975 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7575				
Report No.	R143191	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	17/02/23																							
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7575																							
 Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 3% Lime/7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.93</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly CLAY				Initial Condition: 3% Lime/7 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 3% Lime/7 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>63</td> <td>72</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	63	72	Moisture Content %	12	12															
Test Result	Top	Base																								
CBR %	63	72																								
Moisture Content %	12	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142675	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	13/02/23
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7575



Key: ————— Top - - - - - Base

Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime/2% Cement /3 Days Soaked			
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.17
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93
% Material >20mm:	7.6		
Method of compaction: Static Compaction Method 2			

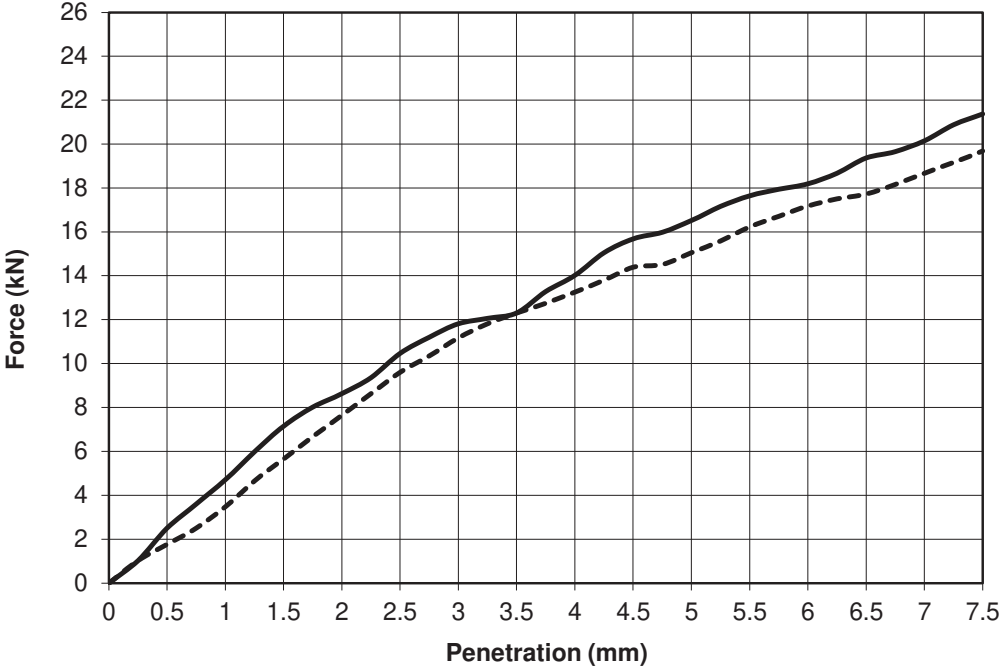
Test Result	Top	Base
CBR %	58	61
Moisture Content %	13	12

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 24/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142680	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	01/02/23
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7575



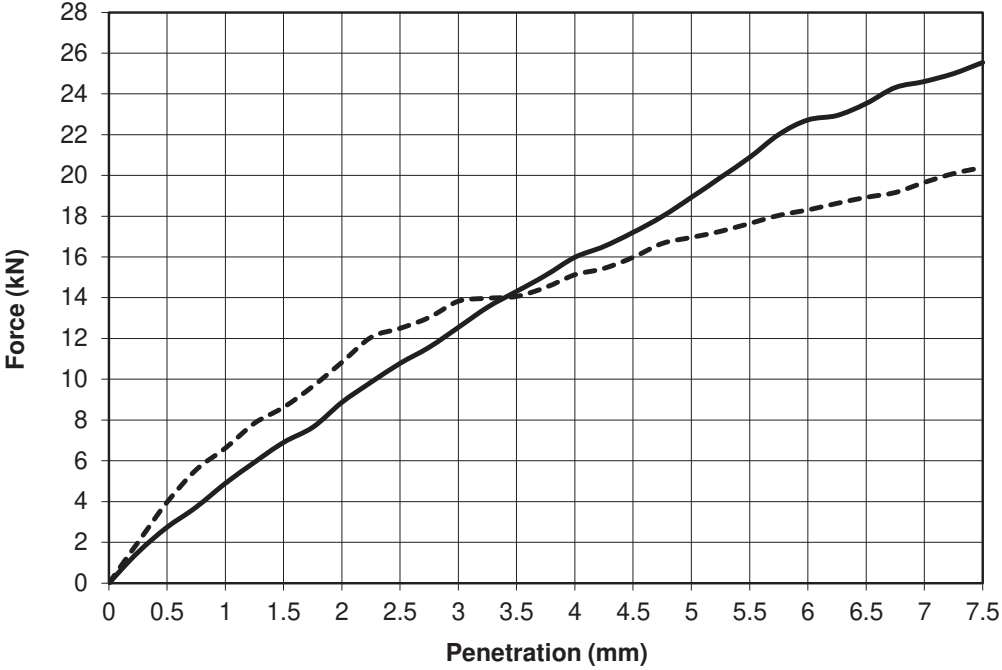
Key: ————— Top - - - - - Base

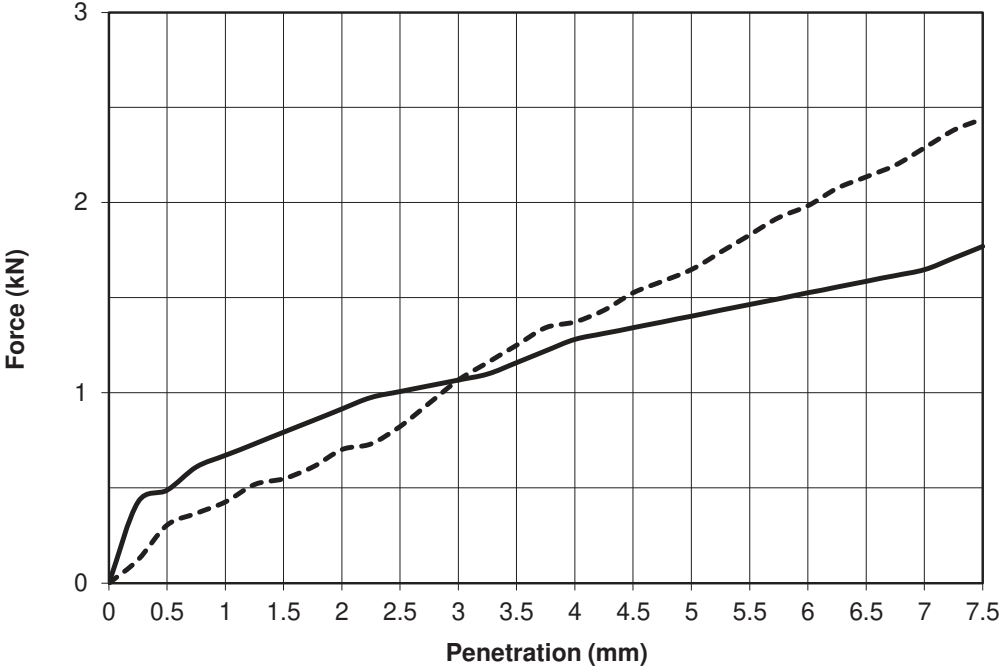
Description: Mottled brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime/2% Cement/ 5 Days Soaked			
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.16
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90
% Material >20mm:	7.6		
Method of compaction: Static Compaction Method 2			

Test Result	Top	Base
CBR %	83	75
Moisture Content %	13	14

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

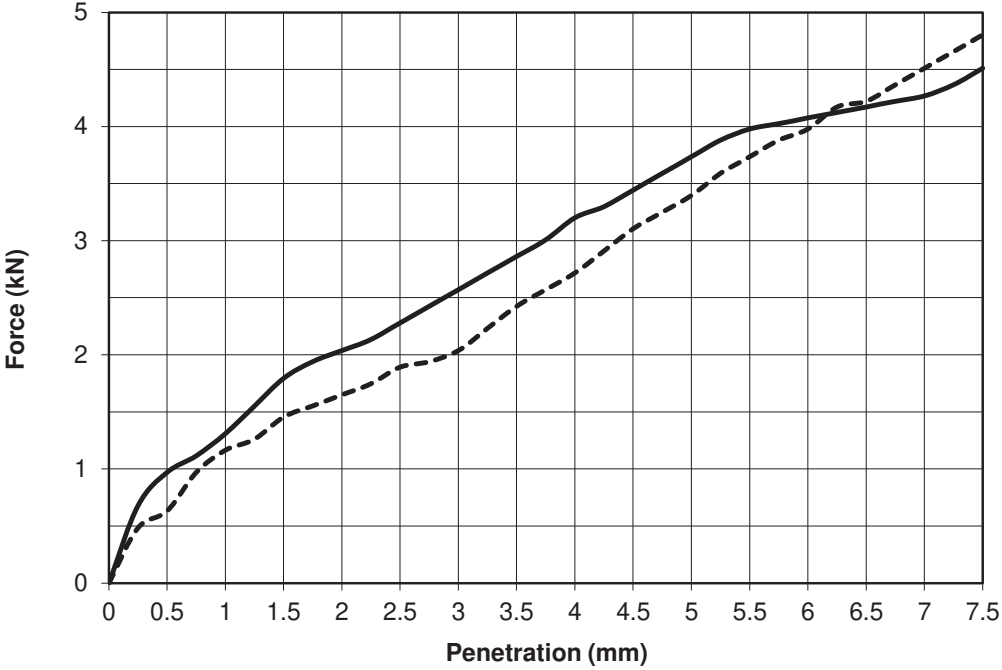
IGSL Ltd Materials Laboratory	Approved by 	Date 27/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143190</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>17/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP26</td> <td>Sample No.*</td> <td>AA181975 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7575</td> </tr> </table>			Report No.	R143190	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	17/02/23	BH/TP No.*	TP26	Sample No.*	AA181975 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7575				
Report No.	R143190	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	17/02/23																							
BH/TP No.*	TP26	Sample No.*	AA181975 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7575																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Mottled brown slightly sandy slightly gravelly SILT/CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime/2% Cement 7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.18</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.94</td> </tr> <tr> <td>% Material >20mm:</td> <td>7.6</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Mottled brown slightly sandy slightly gravelly SILT/CLAY				Initial Condition: 1% Lime/2% Cement 7 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.18	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94	% Material >20mm:	7.6			Method of compaction: Static Compaction Method 2			
Description: Mottled brown slightly sandy slightly gravelly SILT/CLAY																										
Initial Condition: 1% Lime/2% Cement 7 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.18																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.94																							
% Material >20mm:	7.6																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>95</td> <td>94</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	95	94	Moisture Content %	12	12															
Test Result	Top	Base																								
CBR %	95	94																								
Moisture Content %	12	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">24/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		24/02/23	1 of 1																		
Approved by	Date	Page No.																								
	24/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R145766</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>18/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP31</td> <td>Sample No.*</td> <td>AA181992 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7578</td> </tr> </table>			Report No.	R145766	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	18/02/23	BH/TP No.*	TP31	Sample No.*	AA181992 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7578				
Report No.	R145766	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	18/02/23																							
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7578																							
 Key: ————— Top - - - - - Base																										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime /3 Days soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.25</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.99</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime /3 Days soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.25	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.99	% Material >20mm:	6.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime /3 Days soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.25																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.99																							
% Material >20mm:	6.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>7.6</td> <td>8.3</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	7.6	8.3	Moisture Content %	13	13															
Test Result	Top	Base																								
CBR %	7.6	8.3																								
Moisture Content %	13	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	Date 27/02/23																								
		Page No. 1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R145767	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	18/02/23
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7578



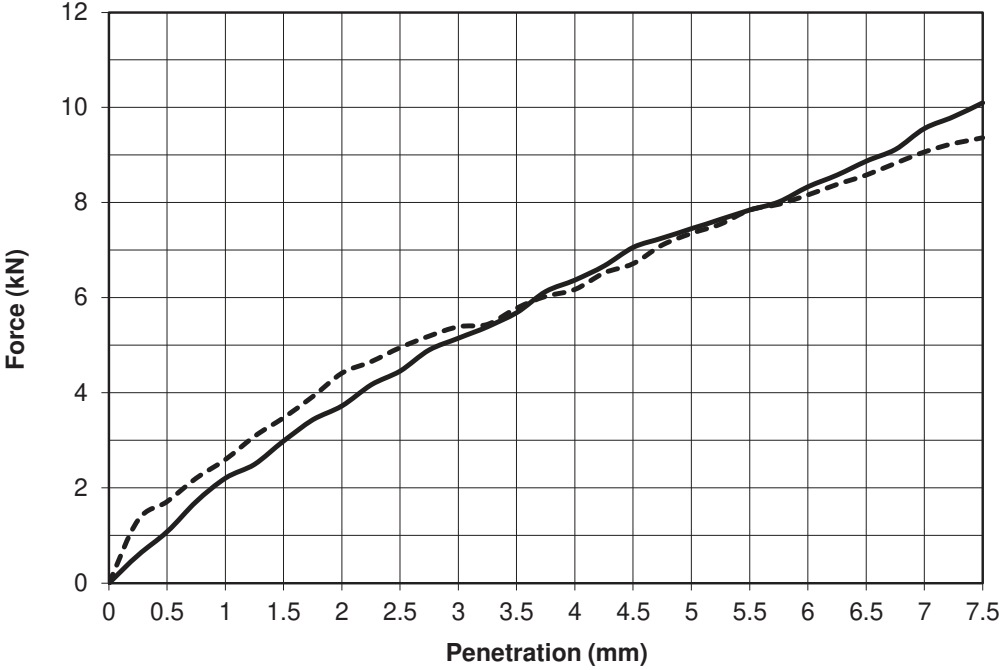
Key: ————— Top - - - - - Base

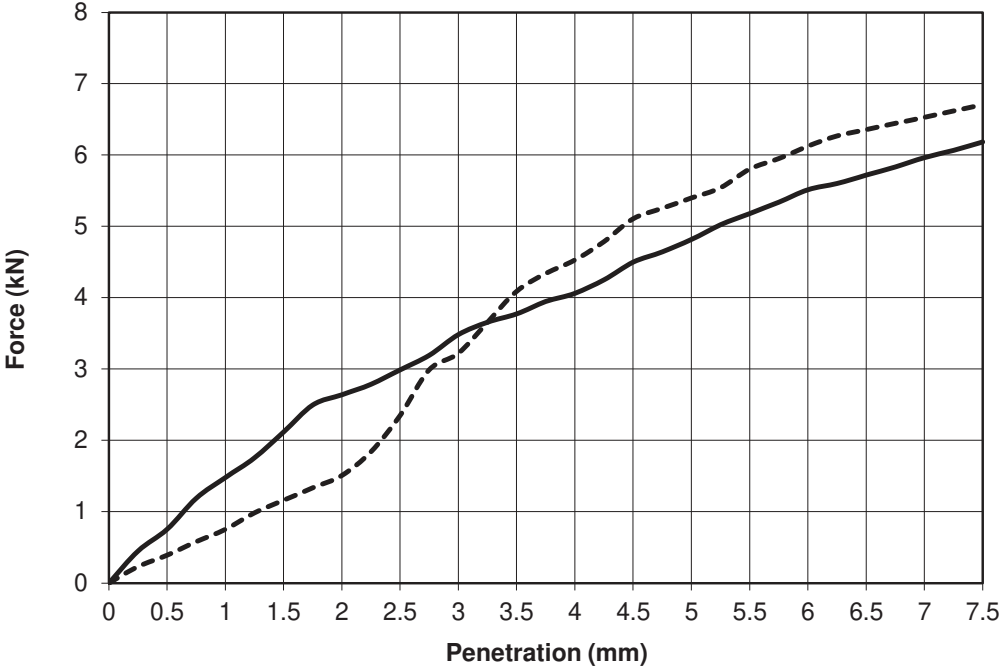
Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime /5 Days soaked			
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.18
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93
% Material >20mm:	6.9		
Method of compaction: Static Compaction Method 2			

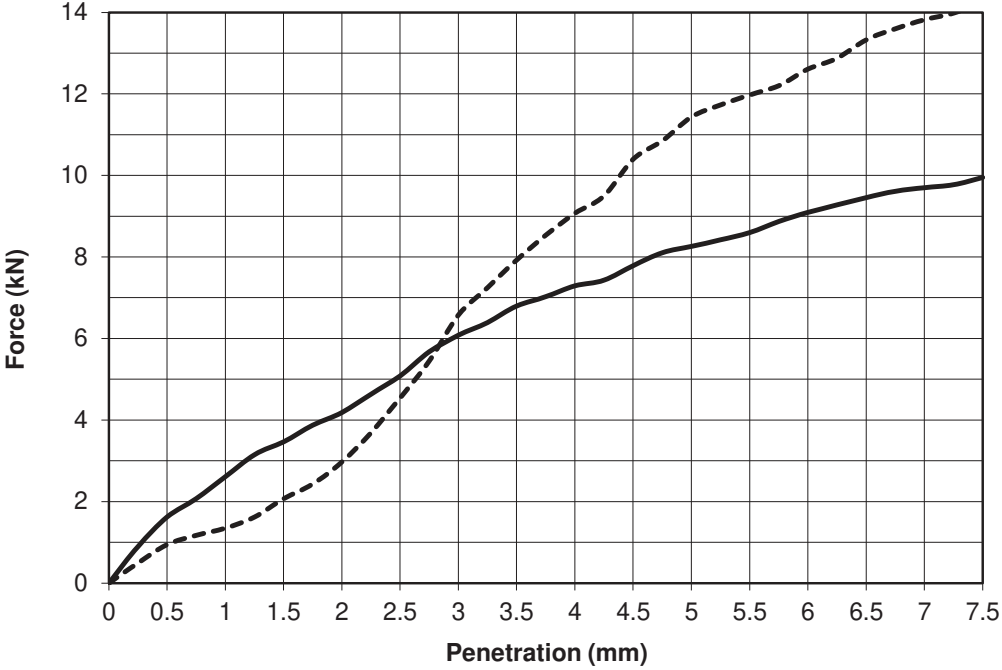
Test Result	Top	Base
CBR %	19	17
Moisture Content %	13	13

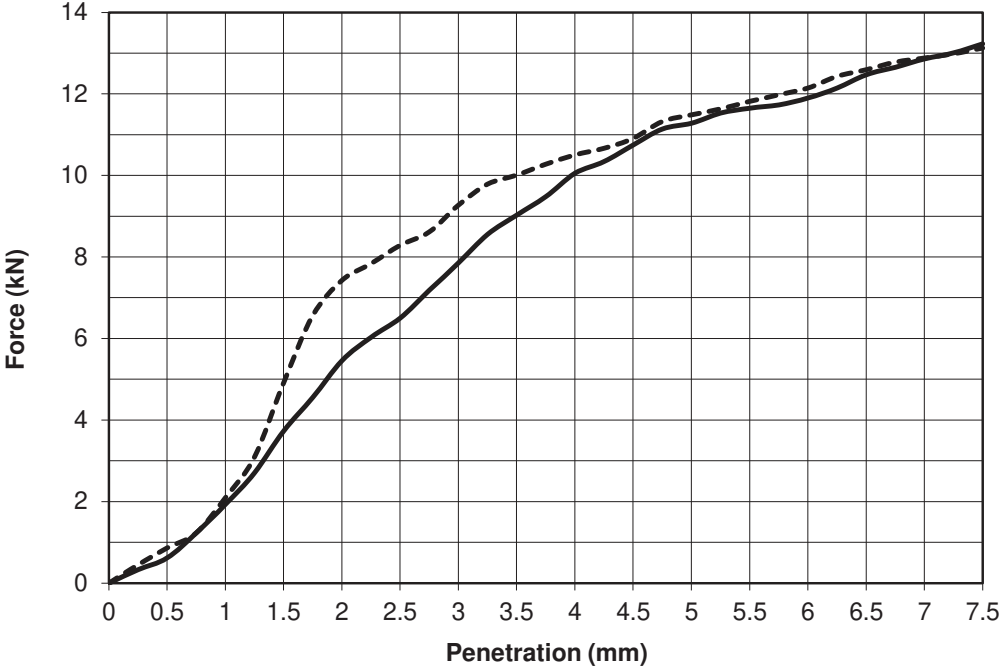
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

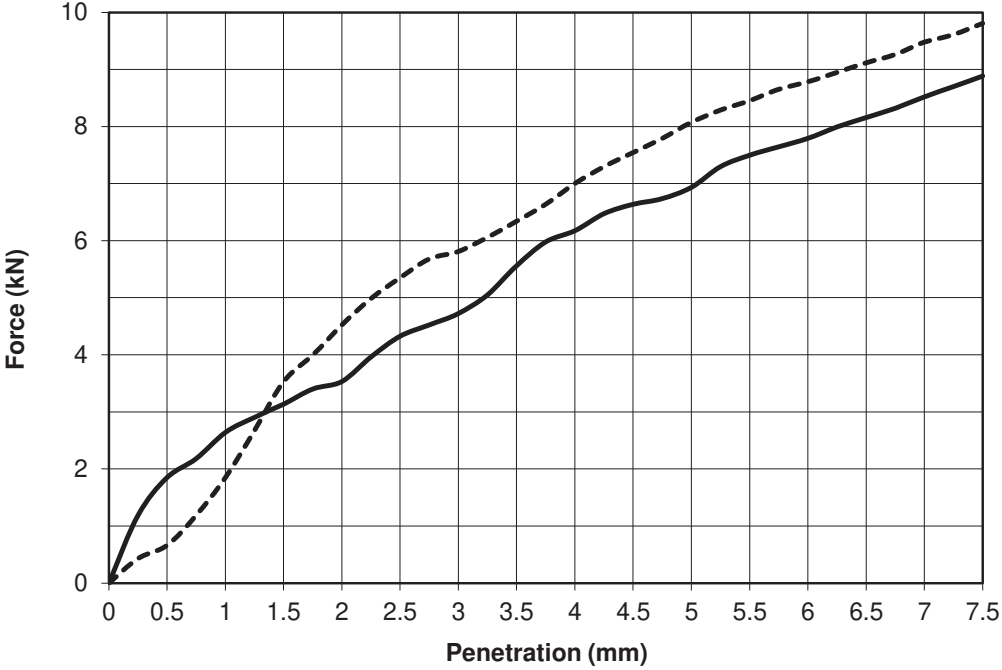
IGSL Ltd Materials Laboratory	Approved by 	Date 27/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R14319</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>18/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP31</td> <td>Sample No.*</td> <td>AA181992 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7578</td> </tr> </table>			Report No.	R14319	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	18/02/23	BH/TP No.*	TP31	Sample No.*	AA181992 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7578				
Report No.	R14319	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	18/02/23																							
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7578																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime /7 Days soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>14</td> <td>Bulk Density (Mg/m³):</td> <td>2.17</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.90</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime /7 Days soaked				Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.17	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90	% Material >20mm:	6.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime /7 Days soaked																										
Moisture Content (%):	14	Bulk Density (Mg/m ³):	2.17																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.90																							
% Material >20mm:	6.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th style="width: 30%;">Test Result</th> <th style="width: 35%;">Top</th> <th style="width: 35%;">Base</th> </tr> <tr> <td>CBR %</td> <td>37</td> <td>37</td> </tr> <tr> <td>Moisture Content %</td> <td>14</td> <td>14</td> </tr> </table>			Test Result	Top	Base	CBR %	37	37	Moisture Content %	14	14															
Test Result	Top	Base																								
CBR %	37	37																								
Moisture Content %	14	14																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border-bottom: 1px solid black;">Date</td> <td style="width: 50%; border-bottom: 1px solid black;">Page No.</td> </tr> <tr> <td style="text-align: center;">27/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	27/02/23	1 of 1																				
Date	Page No.																									
27/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142682</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>01/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP31</td> <td>Sample No.*</td> <td>AA181992 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7578</td> </tr> </table>			Report No.	R142682	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	01/02/23	BH/TP No.*	TP31	Sample No.*	AA181992 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7578				
Report No.	R142682	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	01/02/23																							
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7578																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2% Lime /3 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.16</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.92</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 2% Lime /3 Days Soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.16	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92	% Material >20mm:	6.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2% Lime /3 Days Soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.16																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.92																							
% Material >20mm:	6.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>41</td> <td>46</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	41	46	Moisture Content %	13	12															
Test Result	Top	Base																								
CBR %	41	46																								
Moisture Content %	13	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 20%;">Date</td> <td style="width: 30%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">27/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		27/02/23	1 of 1																		
Approved by	Date	Page No.																								
	27/02/23	1 of 1																								

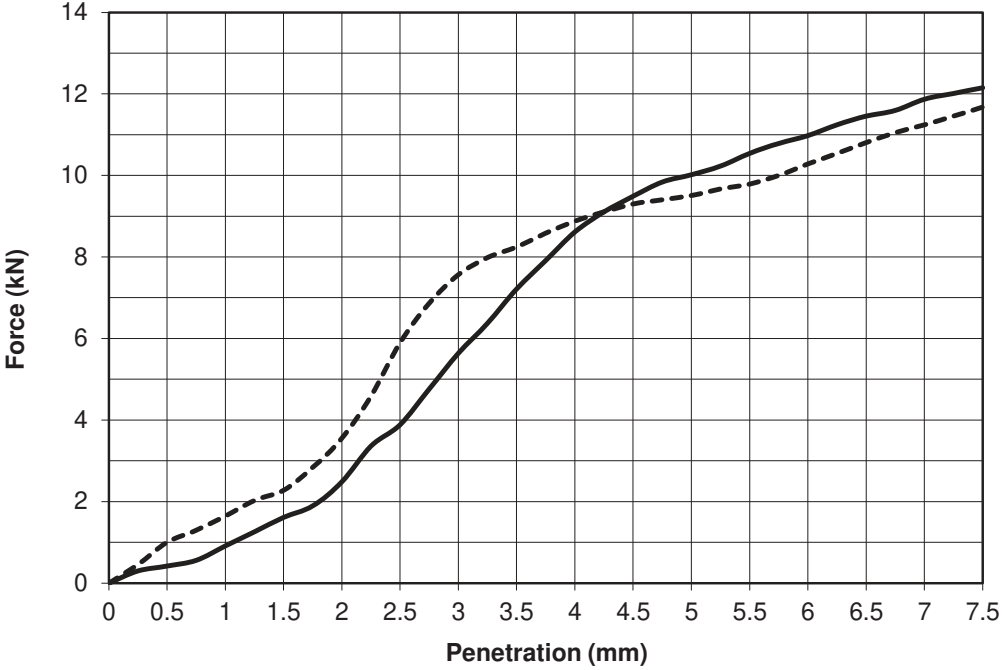
IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142681</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>13/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP31</td> <td>Sample No.*</td> <td>AA181992 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7578</td> </tr> </table>			Report No.	R142681	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	13/02/23	BH/TP No.*	TP31	Sample No.*	AA181992 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7578				
Report No.	R142681	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	13/02/23																							
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7578																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2% Lime /5 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.22</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.97</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 2% Lime /5 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.22	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.97	% Material >20mm:	6.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2% Lime /5 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.22																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.97																							
% Material >20mm:	6.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>41</td> <td>57</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	41	57	Moisture Content %	12	13															
Test Result	Top	Base																								
CBR %	41	57																								
Moisture Content %	12	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">27/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		27/02/23	1 of 1																		
Approved by	Date	Page No.																								
	27/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142683</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>01/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP31</td> <td>Sample No.*</td> <td>AA181992 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7578</td> </tr> </table>			Report No.	R142683	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	01/02/23	BH/TP No.*	TP31	Sample No.*	AA181992 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7578				
Report No.	R142683	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	01/02/23																							
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7578																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 2% Lime /7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>13</td> <td>Bulk Density (Mg/m³):</td> <td>2.18</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.93</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 2% Lime /7 Days Soaked				Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.18	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93	% Material >20mm:	6.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 2% Lime /7 Days Soaked																										
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.18																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93																							
% Material >20mm:	6.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <td style="width: 30%;">Test Result</td> <td style="width: 35%;">Top</td> <td style="width: 35%;">Base</td> </tr> <tr> <td>CBR %</td> <td>63</td> <td>57</td> </tr> <tr> <td>Moisture Content %</td> <td>13</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	63	57	Moisture Content %	13	13															
Test Result	Top	Base																								
CBR %	63	57																								
Moisture Content %	13	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table style="width: 100%; border: none;"> <tr> <td style="width: 50%; border-bottom: 1px solid black;">Date</td> <td style="width: 50%; border-bottom: 1px solid black;">Page No.</td> </tr> <tr> <td style="text-align: center;">27/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Date	Page No.	27/02/23	1 of 1																				
Date	Page No.																									
27/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143196</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>13/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP31</td> <td>Sample No.*</td> <td>AA181992 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7578</td> </tr> </table>			Report No.	R143196	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	13/02/23	BH/TP No.*	TP31	Sample No.*	AA181992 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7578				
Report No.	R143196	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	13/02/23																							
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7578																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 3% Lime/ 3 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.16</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.93</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 3% Lime/ 3 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.16	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93	% Material >20mm:	6.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 3% Lime/ 3 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.16																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.93																							
% Material >20mm:	6.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>35</td> <td>40</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	35	40	Moisture Content %	12	12															
Test Result	Top	Base																								
CBR %	35	40																								
Moisture Content %	12	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">27/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		27/02/23	1 of 1																		
Approved by	Date	Page No.																								
	27/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R142684	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	01/02/23
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7578



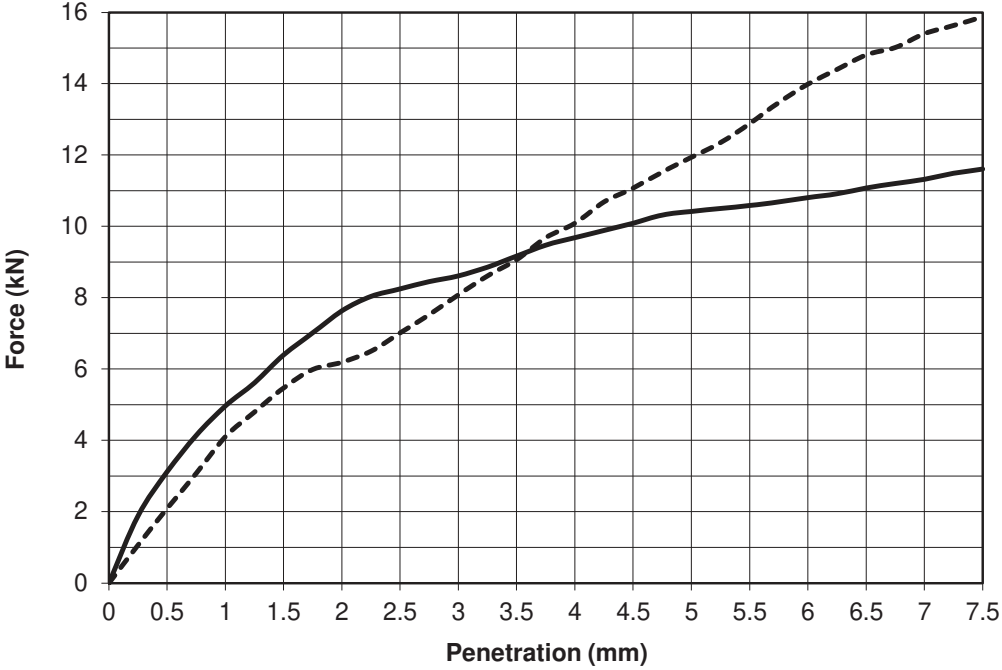
Key: ————— Top - - - - - Base

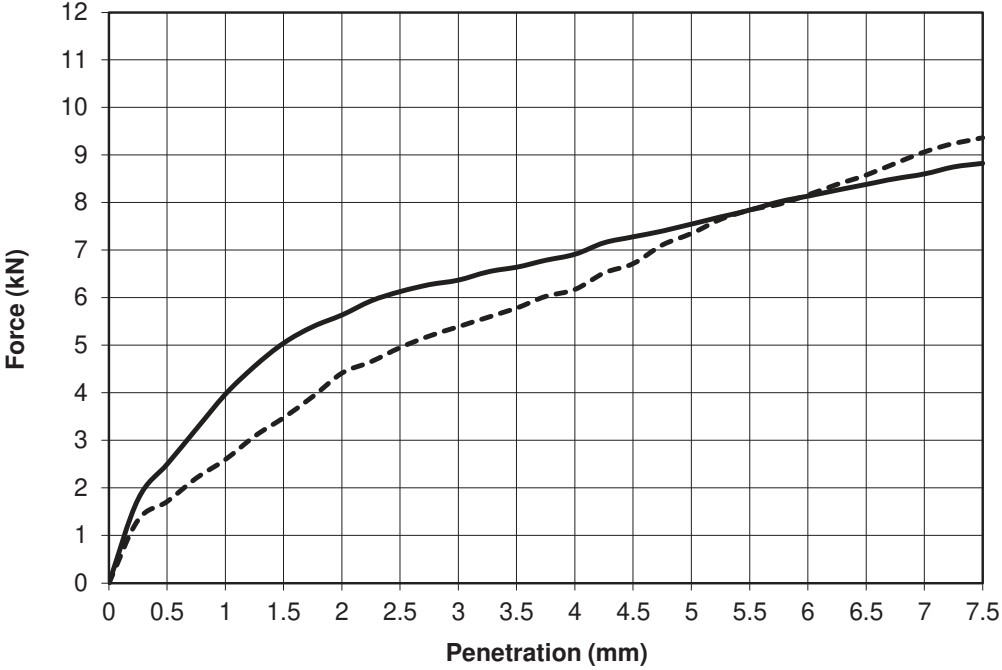
Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition: 3% Lime/ 5 Day Soaked			
Moisture Content (%):	13	Bulk Density (Mg/m ³):	2.11
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.86
% Material >20mm:	6.9		
Method of compaction: Static Compaction Method 2			

Test Result	Top	Base
CBR %	50	48
Moisture Content %	13	13

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

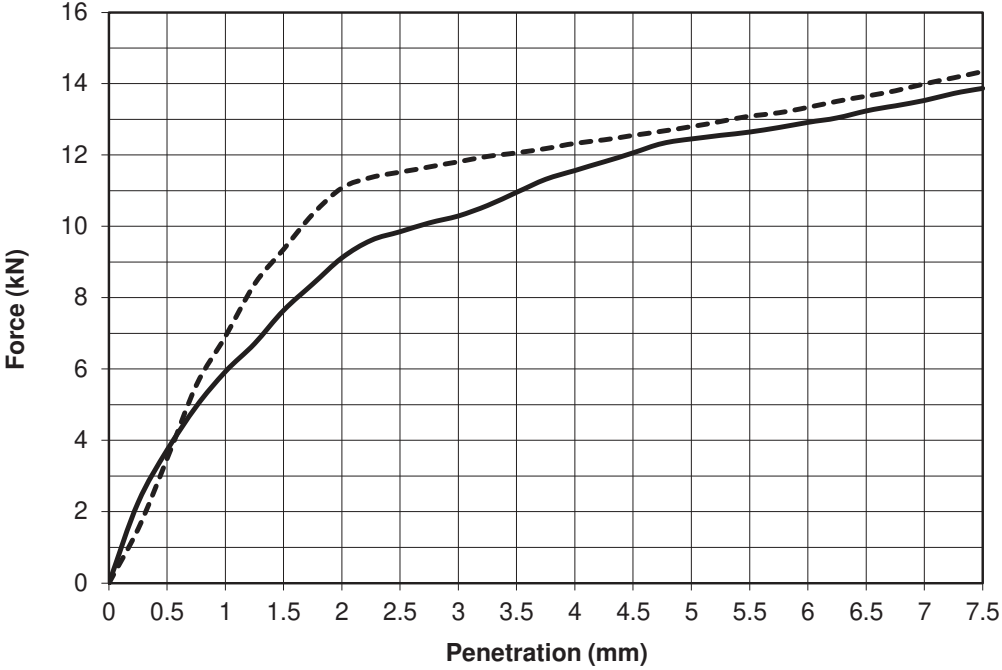
IGSL Ltd Materials Laboratory	Approved by 	Date 27/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	 ISO 17025 ACCREDITED TESTING DETAILED IN SCOPE REG NO.1331																								
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R143195</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>16/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP31</td> <td>Sample No.*</td> <td>AA181992 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7578</td> </tr> </table>			Report No.	R143195	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	16/02/23	BH/TP No.*	TP31	Sample No.*	AA181992 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7578				
Report No.	R143195	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	16/02/23																							
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7578																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 3% Lime/ 7 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.24</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>2.00</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 3% Lime/ 7 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.24	Surcharge (kg):	4	Dry Density (Mg/m ³):	2.00	% Material >20mm:	6.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 3% Lime/ 7 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.24																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	2.00																							
% Material >20mm:	6.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>62</td> <td>60</td> </tr> <tr> <td>Moisture Content %</td> <td>11</td> <td>13</td> </tr> </table>			Test Result	Top	Base	CBR %	62	60	Moisture Content %	11	13															
Test Result	Top	Base																								
CBR %	62	60																								
Moisture Content %	11	13																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Approved by</td> <td style="width: 25%;">Date</td> <td style="width: 25%;">Page No.</td> </tr> <tr> <td style="text-align: center;"></td> <td style="text-align: center;">27/02/23</td> <td style="text-align: center;">1 of 1</td> </tr> </table>	Approved by	Date	Page No.		27/02/23	1 of 1																		
Approved by	Date	Page No.																								
	27/02/23	1 of 1																								

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7																									
<table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Report No.</td> <td style="width: 33%;">R142193</td> <td style="width: 33%;">Contract</td> <td>Halverstown , Naas - Proposed Data Centres</td> </tr> <tr> <td>Contract No.</td> <td>24330</td> <td>Customer</td> <td>DOBA</td> </tr> <tr> <td>Date received</td> <td>24/01/23</td> <td>Date Tested</td> <td>17/02/23</td> </tr> <tr> <td>BH/TP No.*</td> <td>TP31</td> <td>Sample No.*</td> <td>AA181992 Type: B</td> </tr> <tr> <td>Depth* (m)</td> <td>0.50</td> <td>Lab sample No.</td> <td>A22/7578</td> </tr> </table>			Report No.	R142193	Contract	Halverstown , Naas - Proposed Data Centres	Contract No.	24330	Customer	DOBA	Date received	24/01/23	Date Tested	17/02/23	BH/TP No.*	TP31	Sample No.*	AA181992 Type: B	Depth* (m)	0.50	Lab sample No.	A22/7578				
Report No.	R142193	Contract	Halverstown , Naas - Proposed Data Centres																							
Contract No.	24330	Customer	DOBA																							
Date received	24/01/23	Date Tested	17/02/23																							
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B																							
Depth* (m)	0.50	Lab sample No.	A22/7578																							
																										
Key: ————— Top - - - - - Base <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="4">Description: Brown slightly sandy slightly gravelly CLAY</td> </tr> <tr> <td colspan="4">Initial Condition: 1% Lime 2 % Cement/ 3 Days Soaked</td> </tr> <tr> <td>Moisture Content (%):</td> <td>12</td> <td>Bulk Density (Mg/m³):</td> <td>2.22</td> </tr> <tr> <td>Surcharge (kg):</td> <td>4</td> <td>Dry Density (Mg/m³):</td> <td>1.97</td> </tr> <tr> <td>% Material >20mm:</td> <td>6.9</td> <td colspan="2"></td> </tr> <tr> <td colspan="4">Method of compaction: Static Compaction Method 2</td> </tr> </table>			Description: Brown slightly sandy slightly gravelly CLAY				Initial Condition: 1% Lime 2 % Cement/ 3 Days Soaked				Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.22	Surcharge (kg):	4	Dry Density (Mg/m ³):	1.97	% Material >20mm:	6.9			Method of compaction: Static Compaction Method 2			
Description: Brown slightly sandy slightly gravelly CLAY																										
Initial Condition: 1% Lime 2 % Cement/ 3 Days Soaked																										
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.22																							
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.97																							
% Material >20mm:	6.9																									
Method of compaction: Static Compaction Method 2																										
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <tr> <th>Test Result</th> <th>Top</th> <th>Base</th> </tr> <tr> <td>CBR %</td> <td>46</td> <td>37</td> </tr> <tr> <td>Moisture Content %</td> <td>12</td> <td>12</td> </tr> </table>			Test Result	Top	Base	CBR %	46	37	Moisture Content %	12	12															
Test Result	Top	Base																								
CBR %	46	37																								
Moisture Content %	12	12																								
Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.		Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)																								
IGSL Ltd Materials Laboratory	Approved by 	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th>Date</th> <th>Page No.</th> </tr> <tr> <td>27/02/23</td> <td>1 of 1</td> </tr> </table>	Date	Page No.	27/02/23	1 of 1																				
Date	Page No.																									
27/02/23	1 of 1																									

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R143194	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	17/02/23
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7578



Key: ————— Top - - - - - Base

Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime 2% Cement/ 5 Day Soaked			
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.24
Surcharge (kg):	4	Dry Density (Mg/m ³):	2.00
% Material >20mm:	6.9		
Method of compaction: Static Compaction Method 2			

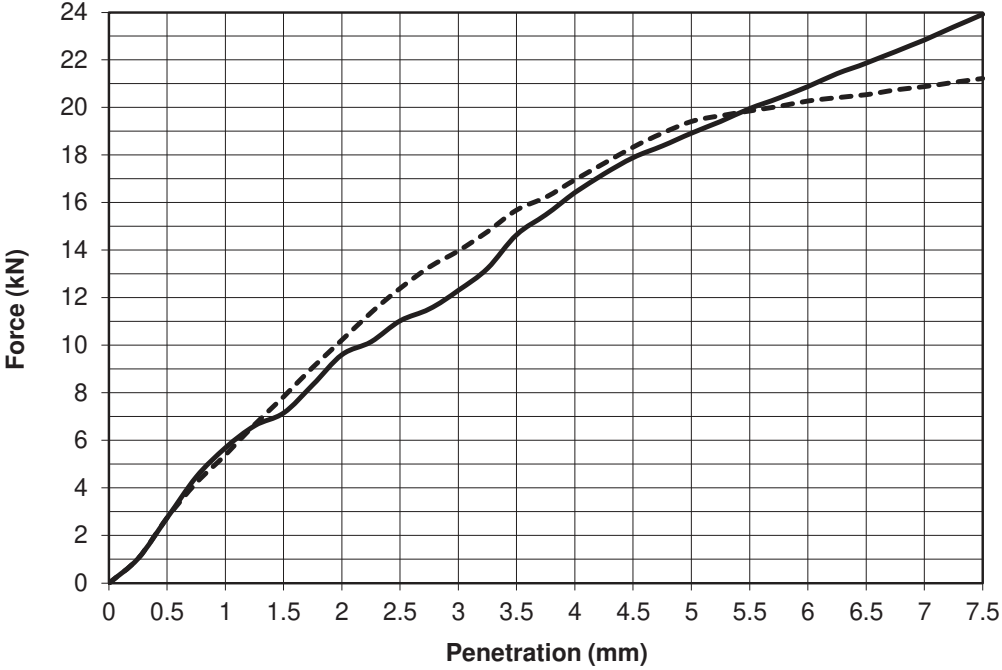
Test Result	Top	Base
CBR %	74	87
Moisture Content %	12	12

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 27/02/23	Page No. 1 of 1

IGSL Ltd Materials Laboratory Unit J5,M7 Business Park Naas Co.Kildare 045 899324	TEST REPORT Determination of California Bearing Ratio (CBR) Tested in accordance with BS1377:Part 4:1990, clause 7	

Report No.	R143197	Contract	Halverstown , Naas - Proposed Data Centres
Contract No.	24330	Customer	DOBA
Date received	24/01/23	Date Tested	13/02/23
BH/TP No.*	TP31	Sample No.*	AA181992 Type: B
Depth* (m)	0.50	Lab sample No.	A22/7578



Key: ————— Top - - - - - Base

Description: Brown slightly sandy slightly gravelly CLAY			
Initial Condition: 1% Lime 2% Cement /7 Day Soaked			
Moisture Content (%):	12	Bulk Density (Mg/m ³):	2.20
Surcharge (kg):	4	Dry Density (Mg/m ³):	1.97
% Material >20mm:	6.9		
Method of compaction: Static Compaction Method 2			

Test Result	Top	Base
CBR %	95	97
Moisture Content %	12	12

Results relate only to the specimen tested, in as received condition unless otherwise noted Opinions and interpretations are outside the scope of accreditation. * denotes Customer supplied information This report shall not be reproduced except in full without written approval from the Laboratory.	Persons authorized to approve reports J Barrett (Quality Manager) H Byrne (Laboratory Manager)

IGSL Ltd Materials Laboratory	Approved by 	Date 27/02/23	Page No. 1 of 1

Test Report

Dry Density/Moisture Content Relationship

Tested in accordance with BS1377:Part 4:1990



Report No. R142691 Contract No. 24330

Contract Name: Halverstown, Naas - Proposed Data Centres

Location*: TP04

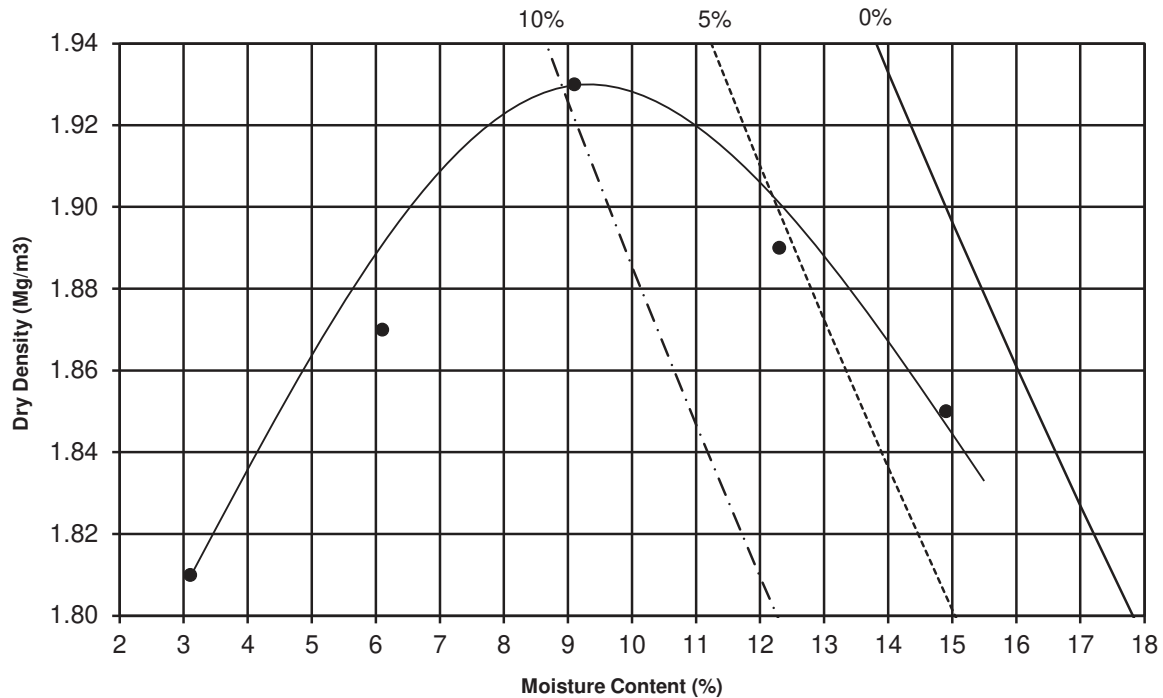
Sample No*. AA186982 Depth* (m) 0.6 Material Type B

Lab sample no. A22/7562 Customer: DOBA

Date Received: 24/01/2023 Test Method: 2.5 Kg Rammer

Date Tested: 26/01/2023 BS1377:Part 4:1990 3.3

Dry Density (Mg/m ³)	1.85	1.87	1.93	1.89	1.81		
Moisture Content (%)	15	6.1	9.1	12	3.1	0	



Maximum Dry Density (Mg/m³): 1.93 Optimum Moisture Content (%): 9

Description: Mottled brown sandy gravelly SILT/CLAY

Sample Preparation: Material passing 20mm Single / Separate samples used

Particle Density (Mg/m³): 2.65 Particle Density: Assumed

% retained on 20/37.5mm sieve: 1.5

Results relate only to the specimen tested, in as received condition unless otherwise noted.
Opinions and interpretations are outside the scope of accreditation.
* denotes Customer supplied information
This report shall not be reproduced except in full without the written approval of the Laboratory.

Persons authorised to approve reports
J Barrett (Quality Manager)
H Byrne (Laboratory Manager)

IGSL Materials Laboratory

Approved by

H Byrne

Date

01/03/23

Page

1 of 1

Test Report

Dry Density/Moisture Content Relationship

Tested in accordance with BS1377:Part 4:1990



Report No. R145759 Contract No. 24330

Contract Name: Halverstown, Naas - Proposed Data Centres

Location*: TP12

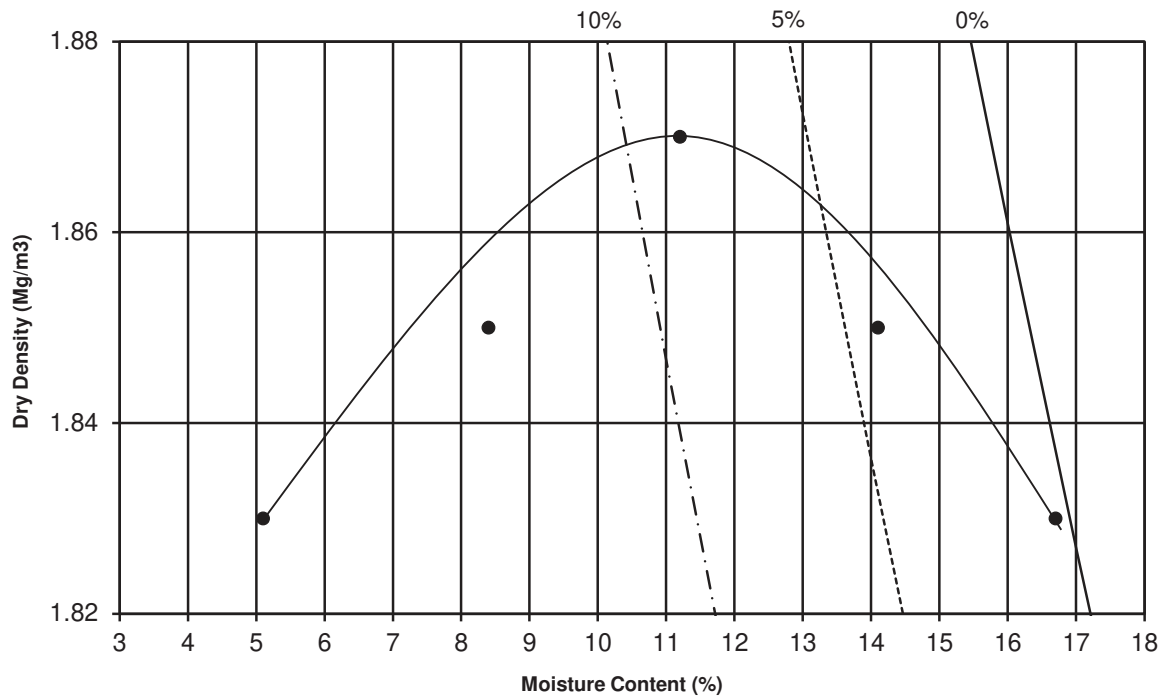
Sample No*. AA185481 Depth* (m) 0.5 Material Type B

Lab sample no. A22/7563 Customer: DOBA

Date Received: 24/01/2023 Test Method: 2.5 Kg Rammer

Date Tested: 26/01/2023 BS1377:Part 4:1990 3.3

Dry Density (Mg/m ³)	1.83	1.85	1.87	1.85	1.83		
Moisture Content (%)	17	8.4	11	14	5.1	0.0	



Maximum Dry Density (Mg/m³): 1.87 Optimum Moisture Content (%): 11

Description: Brown slightly sandy, slightly gravelly, CLAY

Sample Preparation: Material passing 20mm Single / Separate samples used

Particle Density (Mg/m³): 2.65 Particle Density: Assumed

% retained on 20/37.5mm sieve: 3.9

Results relate only to the specimen tested, in as received condition unless otherwise noted.
Opinions and interpretations are outside the scope of accreditation.
* denotes Customer supplied information
This report shall not be reproduced except in full without the written approval of the Laboratory.

Persons authorised to approve reports
J Barrett (Quality Manager)
H Byrne (Laboratory Manager)

IGSL Materials Laboratory

Approved by

H. Byrne

Date

1/3/23

Page

1 of 1

Test Report

Dry Density/Moisture Content Relationship

Tested in accordance with BS1377:Part 4:1990



Report No. R142692 Contract No. 24330

Contract Name: Halverstown, Naas - Proposed Data Centres

Location*: TP15

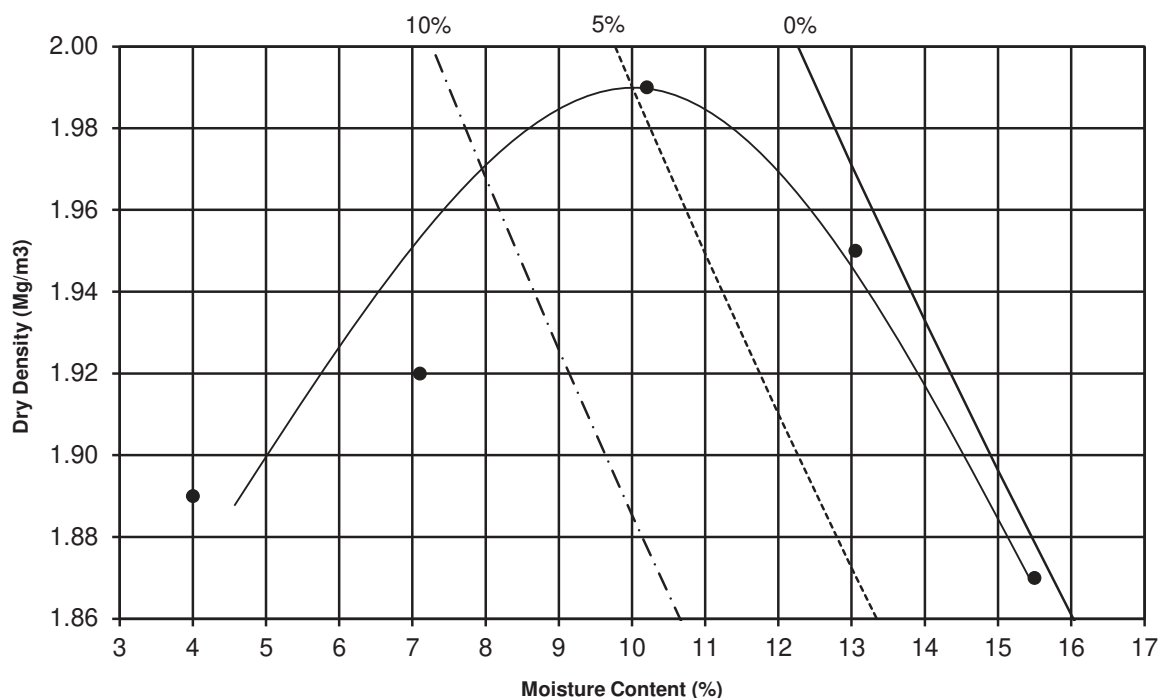
Sample No*. AA185479 Depth* (m) 1.5 Material Type B

Lab sample no. A22/7565 Customer: DOBA

Date Received: 24/01/2023 Test Method: 2.5 Kg Rammer

Date Tested: 26/01/2023 BS1377:Part 4:1990 3.3

Dry Density (Mg/m ³)	1.95	1.89	1.92	1.99	1.87		
Moisture Content (%)	13	4.0	7.1	10	16	0	



Maximum Dry Density (Mg/m³): 1.99 Optimum Moisture Content (%): 10

Description: Brown slightly sandy, slightly gravelly, CLAY

Sample Preparation: Material passing 20mm Single / Separate samples used

Particle Density (Mg/m³): 2.65 Particle Density: Assumed

% retained on 20/37.5mm sieve: 2.9

Results relate only to the specimen tested, in as received condition unless otherwise noted.

Opinions and interpretations are outside the scope of accreditation.

* denotes Customer supplied information

This report shall not be reproduced except in full without the written approval of the Laboratory.

Persons authorised to approve reports

J Barrett (Quality Manager)

H Byrne (Laboratory Manager)

IGSL Materials Laboratory

Approved by

H Byrne

Date

01/03/23

Page

1 of 1

Test Report

Dry Density/Moisture Content Relationship

Tested in accordance with BS1377:Part 4:1990



Report No. R142693 Contract No. 24330

Contract Name: Halverstown, Naas - Proposed Data Centres

Location*: TP16

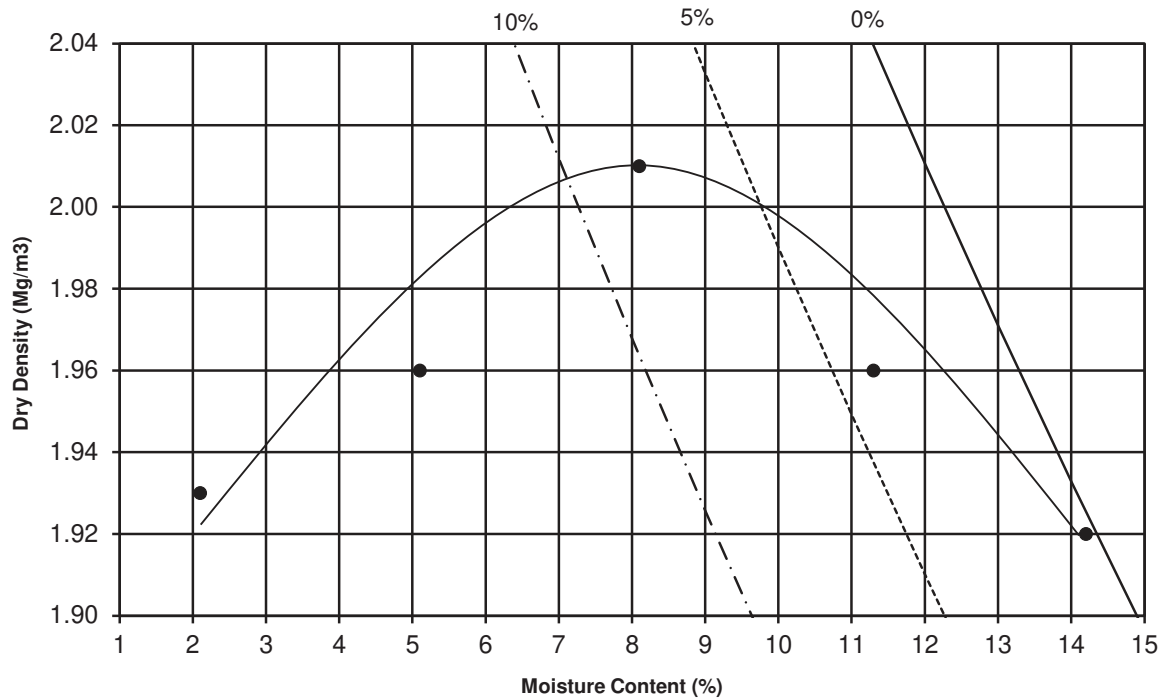
Sample No*. AA185481 Depth* (m) 1 Material Type B

Lab sample no. A22/7566 Customer: DOBA

Date Received: 24/01/2023 Test Method: 2.5 Kg Rammer

Date Tested: 24/01/2023 BS1377:Part 4:1990 3.3

Dry Density (Mg/m ³)	1.92	1.96	2.01	1.96	1.93		
Moisture Content (%)	14	5.1	8.1	11	2.1	0	



Maximum Dry Density (Mg/m³): 2.01 Optimum Moisture Content (%): 8

Description: Mottled brown slightly sandy, slightly gravelly, CLAY

Sample Preparation: Material passing 20mm Single / Separate samples used

Particle Density (Mg/m³): 2.65 Particle Density: Assumed

% retained on 20/37.5mm sieve: 11

Results relate only to the specimen tested, in as received condition unless otherwise noted.
Opinions and interpretations are outside the scope of accreditation.
* denotes Customer supplied information
This report shall not be reproduced except in full without the written approval of the Laboratory.

Persons authorised to approve reports
J Barrett (Quality Manager)
H Byrne (Laboratory Manager)

IGSL Materials Laboratory

Approved by

H Byrne

Date

01/03/23

Page

1 of 1

Test Report

Dry Density/Moisture Content Relationship

Tested in accordance with BS1377:Part 4:1990



Report No. R145756 Contract No. 24330

Contract Name: Halverstown, Naas - Proposed Data Centres

Location*: TP19

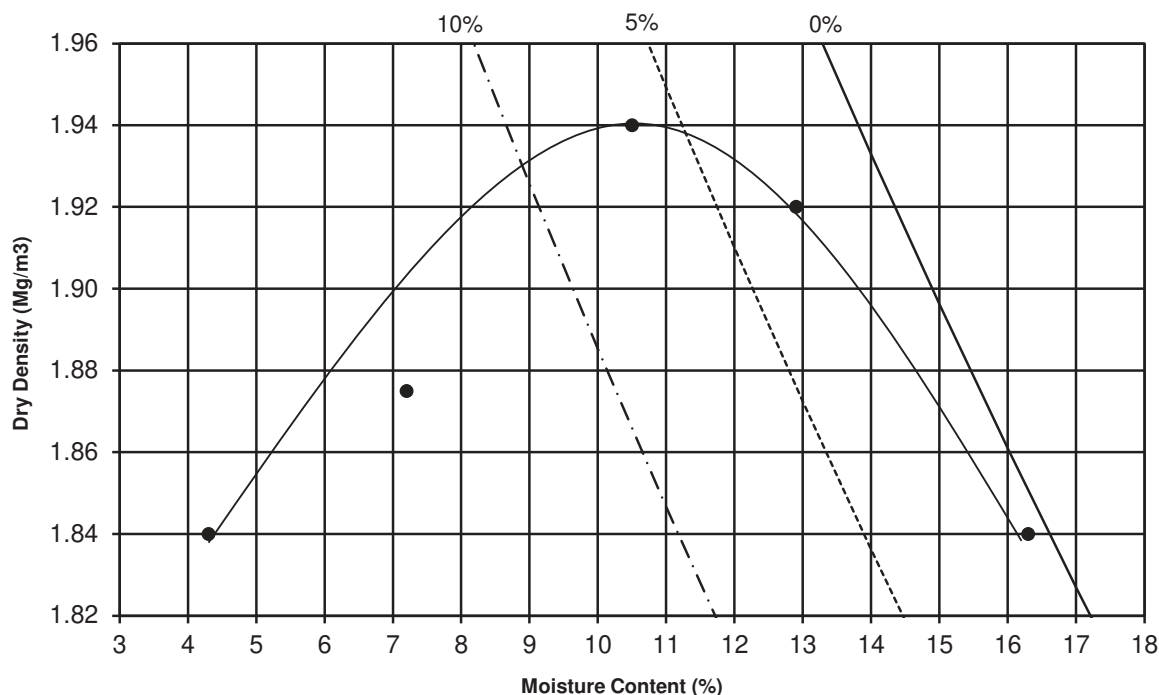
Sample No*. AA185468 Depth* (m) 0.5 Material Type B

Lab sample no. A22/7568 Customer: DOBA

Date Received: 24/01/2023 Test Method: 2.5 Kg Rammer

Date Tested: 26/01/2023 BS1377:Part 4:1990 3.3

Dry Density (Mg/m ³)	1.92	1.88	1.94	1.84	1.84		
Moisture Content (%)	13	7.2	11	16	4.3	0.0	



Maximum Dry Density (Mg/m³): 1.94 Optimum Moisture Content (%): 11

Description: Mottled brown slightly sandy, slightly gravelly, CLAY

Sample Preparation: Material passing 20mm Single / Separate samples used

Particle Density (Mg/m³): 2.65 Particle Density: Assumed

% retained on 20/37.5mm sieve: 5.1

Results relate only to the specimen tested, in as received condition unless otherwise noted.

Opinions and interpretations are outside the scope of accreditation.

* denotes Customer supplied information

This report shall not be reproduced except in full without the written approval of the Laboratory.

Persons authorised to approve reports

J Barrett (Quality Manager)

H Byrne (Laboratory Manager)

IGSL Materials Laboratory

Approved by

H Byrne

Date

1/3/23

Page

1 of 1

Test Report

Dry Density/Moisture Content Relationship

Tested in accordance with BS1377:Part 4:1990



Report No. R142694 Contract No. 24330

Contract Name: Halverstown, Naas - Proposed Data Centres

Location*: TP22

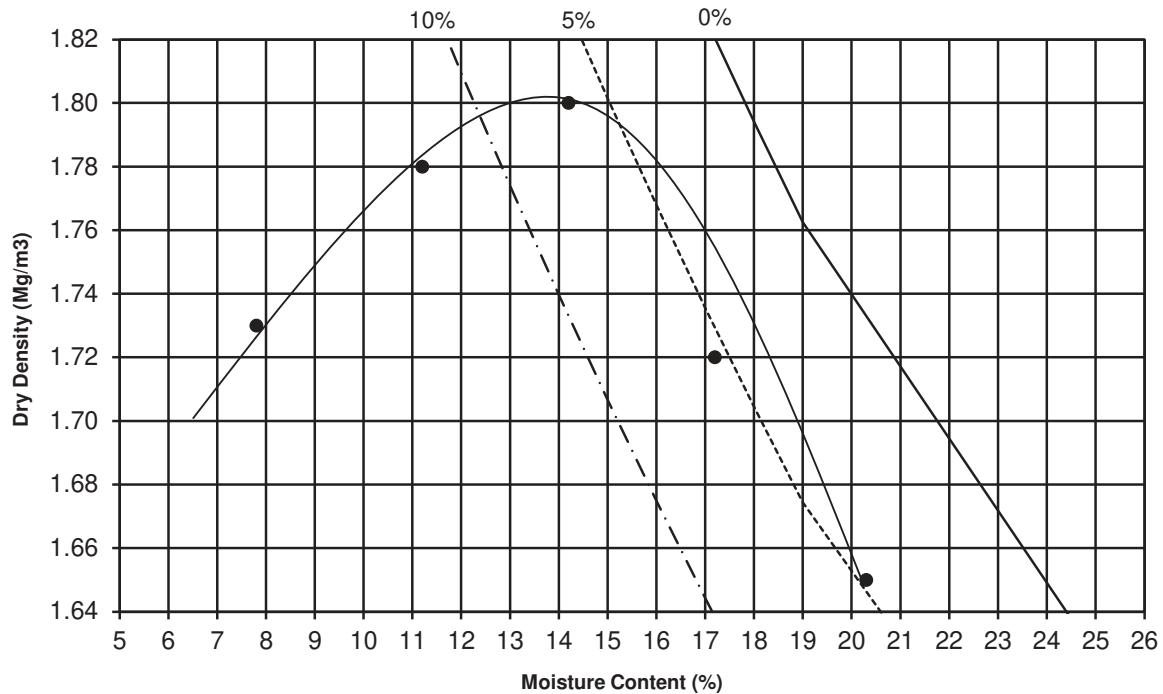
Sample No*. AA185497 Depth* (m) 0.6 Material Type B

Lab sample no. A22/7571 Customer: DOBA

Date Received: 24/01/2023 Test Method: 2.5 Kg Rammer

Date Tested: 26/01/2023 BS1377:Part 4:1990 3.3

Dry Density (Mg/m ³)	1.65	1.73	1.78	1.80	1.72		
Moisture Content (%)	20	7.8	11	14	17	0.0	



Maximum Dry Density (Mg/m³): 1.80 Optimum Moisture Content (%): 14

Description: Mottled brown slightly sandy, slightly gravelly, CLAY

Sample Preparation: Material passing 20mm Single / Separate samples used

Particle Density (Mg/m³): 2.65 Particle Density: Assumed

% retained on 20/37.5mm sieve: 5.9

Results relate only to the specimen tested, in as received condition unless otherwise noted.
Opinions and interpretations are outside the scope of accreditation.
* denotes Customer supplied information
This report shall not be reproduced except in full without the written approval of the Laboratory.

Persons authorised to approve reports
J Barrett (Quality Manager)
H Byrne (Laboratory Manager)

IGSL Materials Laboratory

Approved by

H. Byrne

Date

1/3/23

Page

1 of 1

Test Report

Dry Density/Moisture Content Relationship

Tested in accordance with BS1377:Part 4:1990



Report No. R145758 Contract No. 24330

Contract Name: Halverstown, Naas - Proposed Data Centres

Location*: TP26

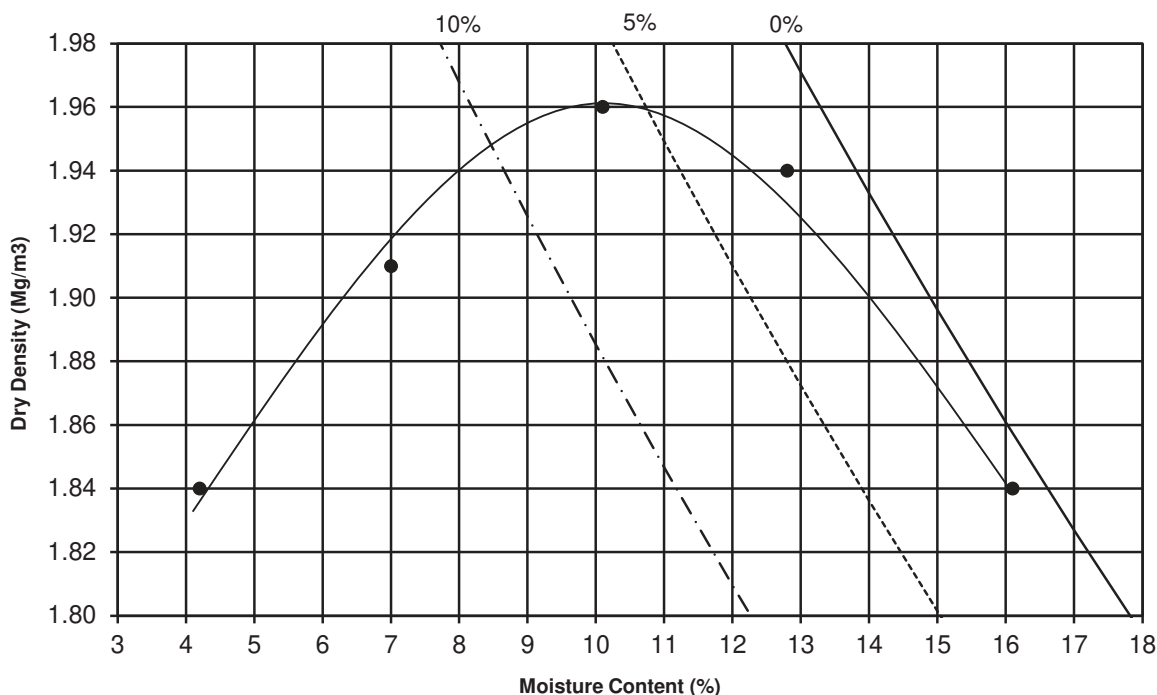
Sample No*. AA181975 Depth* (m) 0.5 Material Type B

Lab sample no. A22/7575 Customer: DOBA

Date Received: 24/01/2023 Test Method: 2.5 Kg Rammer

Date Tested: 26/01/2023 BS1377:Part 4:1990 3.3

Dry Density (Mg/m ³)	1.94	1.84	1.91	1.96	1.84		
Moisture Content (%)	13	4.2	7.0	10	16	0.0	



Maximum Dry Density (Mg/m³): 1.96 Optimum Moisture Content (%): 10

Description: Brown slightly sandy, slightly gravelly, CLAY

Sample Preparation: Material passing 20mm Single / Separate samples used

Particle Density (Mg/m³): 2.65 Particle Density: Assumed

% retained on 20/37.5mm sieve: 7.6

Results relate only to the specimen tested, in as received condition unless otherwise noted.

Opinions and interpretations are outside the scope of accreditation.

* denotes Customer supplied information

This report shall not be reproduced except in full without the written approval of the Laboratory.

Persons authorised to approve reports

J Barrett (Quality Manager)

H Byrne (Laboratory Manager)

IGSL Materials Laboratory

Approved by

H Byrne

Date

1/3/23

Page

1 of 1

Test Report

Dry Density/Moisture Content Relationship

Tested in accordance with BS1377:Part 4:1990



Report No. R145755 Contract No. 24330

Contract Name: Halverstown, Naas - Proposed Data Centres

Location*: TP28

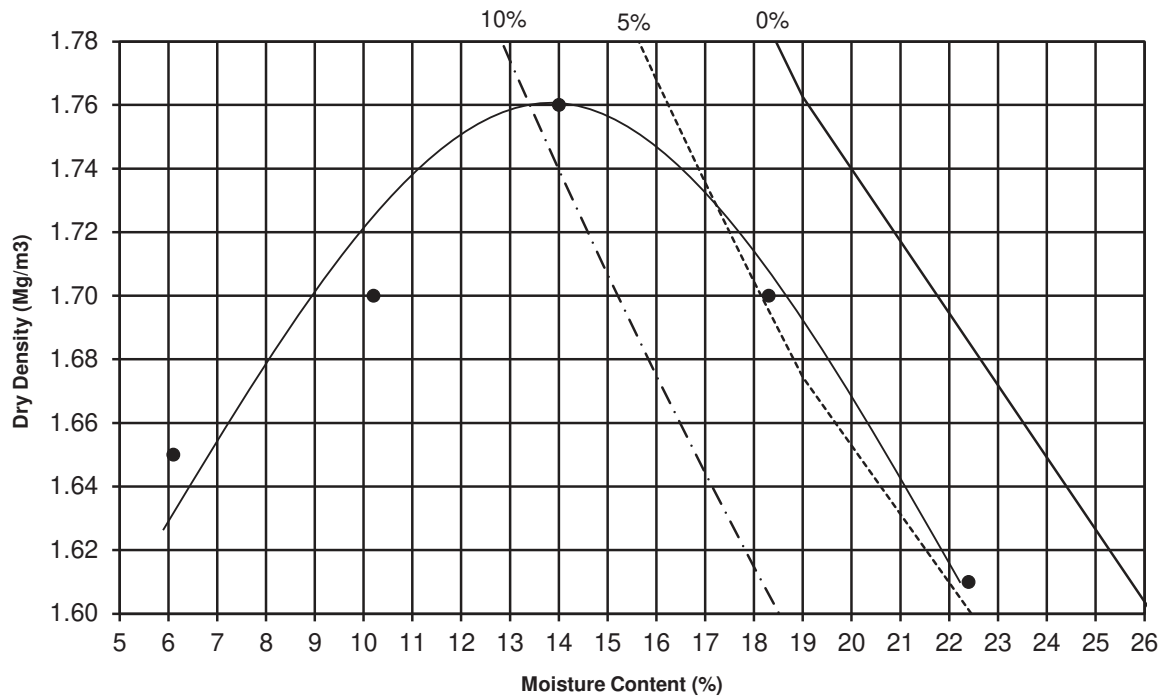
Sample No*. AA181969 Depth* (m) 0.6 Material Type B

Lab sample no. A22/7576 Customer: DOBA

Date Received: 24/01/2023 Test Method: 2.5 Kg Rammer

Date Tested: 26/01/2023 BS1377:Part 4:1990 3.3

Dry Density (Mg/m ³)	1.55	1.61	1.70	1.76	1.70	1.65	
Moisture Content (%)	26	22	18	14	10	6.1	



Maximum Dry Density (Mg/m³): 1.76 Optimum Moisture Content (%): 14

Description: Mottled brown slightly sandy, slightly gravelly, CLAY

Sample Preparation: Material passing 20mm Single / Separate samples used

Particle Density (Mg/m³): 2.65 Particle Density: Assumed

% retained on 20/37.5mm sieve: 2.8

Results relate only to the specimen tested, in as received condition unless otherwise noted.
Opinions and interpretations are outside the scope of accreditation.
* denotes Customer supplied information
This report shall not be reproduced except in full without the written approval of the Laboratory.

Persons authorised to approve reports
J Barrett (Quality Manager)
H Byrne (Laboratory Manager)

IGSL Materials Laboratory

Approved by

H. Byrne

Date

1/3/23

Page

1 of 1

Test Report

Dry Density/Moisture Content Relationship

Tested in accordance with BS1377:Part 4:1990



Report No. R145757 Contract No. 24330

Contract Name: Halverstown, Naas - Proposed Data Centres

Location*: TP31

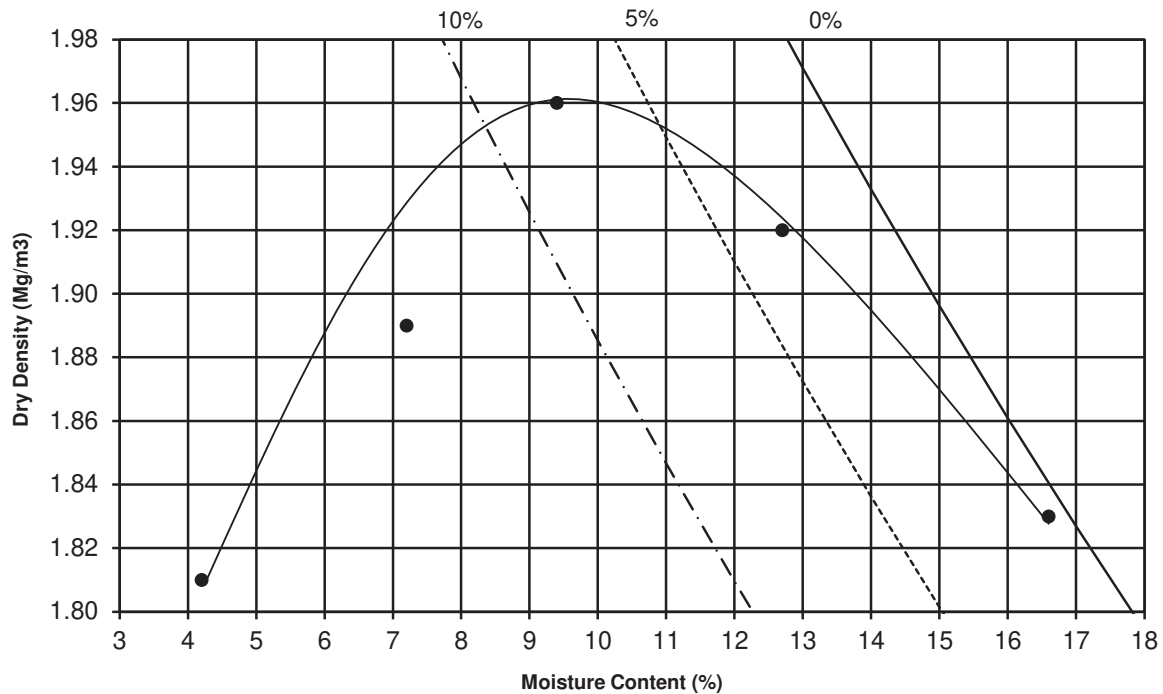
Sample No*. AA181992 Depth* (m) 0.5 Material Type B

Lab sample no. A22/7578 Customer: DOBA

Date Received: 24/01/2023 Test Method: 2.5 Kg Rammer

Date Tested: 26/01/2023 BS1377:Part 4:1990 3.3

Dry Density (Mg/m ³)	1.92	1.81	1.89	1.96	1.83		
Moisture Content (%)	13	4.2	7.2	9.4	17	0.0	



Maximum Dry Density (Mg/m³): 1.96 Optimum Moisture Content (%): 9

Description: Brown slightly sandy, slightly gravelly, CLAY

Sample Preparation: Material passing 20mm Single / Separate samples used

Particle Density (Mg/m³): 2.65 Particle Density: Assumed

% retained on 20/37.5mm sieve: 6.9

Results relate only to the specimen tested, in as received condition unless otherwise noted.
Opinions and interpretations are outside the scope of accreditation.
* denotes Customer supplied information
This report shall not be reproduced except in full without the written approval of the Laboratory.

Persons authorised to approve reports
J Barrett (Quality Manager)
H Byrne (Laboratory Manager)

IGSL Materials Laboratory

Approved by

H. Byrne

Date

1/3/23

Page

1 of 1

Appendix 12

Chemical / Environmental Laboratory Results (Soil)

Report_22-48580

Report_22-48622

Report_ L23-00718-IGS - 23-32082



Eurofins Chemtest Ltd
Depot Road
Newmarket
CB8 0AL

Tel: 01638 606070
Email: info@chemtest.com

Final Report

Report No.:	22-48580-1		
Initial Date of Issue:	18-Jan-2023		
Client	IGSL		
Client Address:	M7 Business Park Naas County Kildare Ireland		
Contact(s):	Darren Keogh		
Project	24330 Halversown Naas Proposed Data Centre Sites (DOBA)		
Quotation No.:	Q22-28896	Date Received:	20-Dec-2022
Order No.:		Date Instructed:	20-Dec-2022
No. of Samples:	36		
Turnaround (Wkdays):	7	Results Due:	04-Jan-2023
Date Approved:	18-Jan-2023		
Approved By:			
Details:	Stuart Henderson, Technical Manager		

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567070	1567071	1567072	1567073	1567074	1567075	1567076	1567077	1567079
Order No.:	Client Sample Ref.:				AA184690	AA184693	AA184669	AA184668	AA174678	AA184675	AA186957	AA181997	AA186960
	Sample Location:				BH03	BH04	BH06	BH08	BH10	BH12	TP01	TP02	TP05
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.00	1.00	1.00	1.00	1.00	1.00	0.50	0.50	0.50
	Asbestos Lab:					DURHAM	DURHAM		DURHAM		DURHAM		
Determinand	Accred.	SOP	Units	LOD									
ACM Type	U	2192		N/A		-	-		-		-		
Asbestos Identification	U	2192		N/A		No Asbestos Detected	No Asbestos Detected		No Asbestos Detected		No Asbestos Detected		
Moisture	N	2030	%	0.020	14	16	11	12	13	14	9.8	13	18
pH	M	2010		4.0		[A] 8.2	[A] 8.4		[A] 8.4		[A] 8.4		
Boron (Hot Water Soluble)	M	2120	mg/kg	0.40		[A] < 0.40	[A] < 0.40		[A] < 0.40		[A] < 0.40		
Sulphate (2:1 Water Soluble) as SO4	M	2120	g/l	0.010		[A] < 0.010	[A] < 0.010		[A] < 0.010		[A] < 0.010		
Total Sulphur	M	2175	%	0.010		[A] < 0.010	[A] 0.025		[A] < 0.010		[A] < 0.010		
Sulphur (Elemental)	M	2180	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0		
Cyanide (Free)	M	2300	mg/kg	0.50		[A] < 0.50	[A] < 0.50		[A] < 0.50		[A] < 0.50		
Cyanide (Total)	M	2300	mg/kg	0.50		[A] 0.50	[A] < 0.50		[A] < 0.50		[A] < 0.50		
Thiocyanate	M	2300	mg/kg	5.0		[A] < 5.0	[A] < 5.0		[A] < 5.0		[A] < 5.0		
Aluminium (Total)	N	2430	mg/kg	100		[A] 5200	[A] 1200		[A] 5000		[A] 3100		
Iron (Total)	N	2430	mg/kg	100		[A] 11000	[A] 5800		[A] 10000		[A] 8100		
Arsenic	M	2455	mg/kg	0.5		7.0	6.6		8.9		4.7		
Barium	M	2455	mg/kg	0		52	33		42		27		
Beryllium	U	2455	mg/kg	0.5		0.6	< 0.5		0.5		< 0.5		
Cadmium	M	2455	mg/kg	0.10		1.3	0.96		1.5		0.81		
Chromium	M	2455	mg/kg	0.5		18	6.2		15		14		
Manganese	M	2455	mg/kg	1.0		680	550		750		490		
Copper	M	2455	mg/kg	0.50		13	10		17		6.9		
Mercury	M	2455	mg/kg	0.05		0.06	< 0.05		0.06		< 0.05		
Nickel	M	2455	mg/kg	0.50		33	17		34		21		
Lead	M	2455	mg/kg	0.50		22	12		26		13		
Selenium	M	2455	mg/kg	0.25		0.79	0.54		0.72		0.46		
Vanadium	U	2455	mg/kg	0.5		17	7.0		15		11		
Zinc	M	2455	mg/kg	0.50		88	57		100		53		
Chromium (Hexavalent)	N	2490	mg/kg	0.50		< 0.50	< 0.50		< 0.50		< 0.50		
Organic Matter	M	2625	%	0.40		[A] 1.3	[A] 1.2		[A] 0.55		[A] < 0.40		
Total Organic Carbon	M	2625	%	0.20		[A] 0.77	[A] 0.67		[A] 0.32		[A] < 0.20		
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0		
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0		
Aliphatic TPH >C8-C10	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0		
Aliphatic TPH >C10-C12	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0		
Aliphatic TPH >C12-C16	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0		
Aliphatic TPH >C16-C21	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0		
Aliphatic TPH >C21-C35	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0		
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0		

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567070	1567071	1567072	1567073	1567074	1567075	1567076	1567077
Order No.:	Client Sample Ref.:				AA184690	AA184693	AA184669	AA184668	AA174678	AA184675	AA186957	AA181997
	Sample Location:				BH03	BH04	BH06	BH08	BH10	BH12	TP01	TP02
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.00	1.00	1.00	1.00	1.00	1.00	0.50	0.50
	Asbestos Lab:					DURHAM	DURHAM		DURHAM		DURHAM	
Determinand	Accred.	SOP	Units	LOD								
Total Aliphatic Hydrocarbons	N	2680	mg/kg	5.0		[A] < 5.0	[A] < 5.0		[A] < 5.0		[A] < 5.0	
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0	
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0	
Aromatic TPH >C8-C10	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0	
Aromatic TPH >C10-C12	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0	
Aromatic TPH >C12-C16	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0	
Aromatic TPH >C16-C21	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0	
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0	
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0		[A] < 1.0	[A] < 1.0		[A] < 1.0		[A] < 1.0	
Total Aromatic Hydrocarbons	N	2680	mg/kg	5.0		[A] < 5.0	[A] < 5.0		[A] < 5.0		[A] < 5.0	
Total Petroleum Hydrocarbons	N	2680	mg/kg	10.0		[A] < 10	[A] < 10		[A] < 10		[A] < 10	
Dichlorodifluoromethane	U	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Chloromethane	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Vinyl Chloride	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Bromomethane	M	2760	mg/kg	0.020	[A] < 0.020			[A] < 0.020		[A] < 0.020		[A] < 0.020
Chloroethane	U	2760	mg/kg	0.0020	[A] < 0.0020			[A] < 0.0020		[A] < 0.0020		[A] < 0.0020
Trichlorofluoromethane	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,1-Dichloroethene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Trans 1,2-Dichloroethene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,1-Dichloroethane	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
cis 1,2-Dichloroethene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Bromochloromethane	U	2760	mg/kg	0.0050	[A] < 0.0050			[A] < 0.0050		[A] < 0.0050		[A] < 0.0050
Trichloromethane	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,1,1-Trichloroethane	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Tetrachloromethane	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,1-Dichloropropene	U	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Benzene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
1,2-Dichloroethane	M	2760	mg/kg	0.0020	[A] < 0.0020			[A] < 0.0020		[A] < 0.0020		[A] < 0.0020
Trichloroethene	N	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,2-Dichloropropane	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Dibromomethane	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Bromodichloromethane	M	2760	mg/kg	0.0050	[A] < 0.0050			[A] < 0.0050		[A] < 0.0050		[A] < 0.0050
cis-1,3-Dichloropropene	N	2760	mg/kg	0.010	[A] < 0.010			[A] < 0.010		[A] < 0.010		[A] < 0.010
Toluene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
Trans-1,3-Dichloropropene	N	2760	mg/kg	0.010	[A] < 0.010			[A] < 0.010		[A] < 0.010		[A] < 0.010
1,1,2-Trichloroethane	M	2760	mg/kg	0.010	[A] < 0.010			[A] < 0.010		[A] < 0.010		[A] < 0.010
Tetrachloroethene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,3-Dichloropropane	U	2760	mg/kg	0.0020	[A] < 0.0020			[A] < 0.0020		[A] < 0.0020		[A] < 0.0020

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567070	1567071	1567072	1567073	1567074	1567075	1567076	1567077
Order No.:	Client Sample Ref.:				AA184690	AA184693	AA184669	AA184668	AA174678	AA184675	AA186957	AA181997
	Sample Location:				BH03	BH04	BH06	BH08	BH10	BH12	TP01	TP02
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.00	1.00	1.00	1.00	1.00	1.00	0.50	0.50
	Asbestos Lab:					DURHAM	DURHAM		DURHAM		DURHAM	
Determinand	Accred.	SOP	Units	LOD								
Dibromochloromethane	U	2760	mg/kg	0.010	[A] < 0.010			[A] < 0.010		[A] < 0.010		[A] < 0.010
1,2-Dibromoethane	M	2760	mg/kg	0.0050	[A] < 0.0050			[A] < 0.0050		[A] < 0.0050		[A] < 0.0050
Chlorobenzene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,1,1,2-Tetrachloroethane	M	2760	mg/kg	0.0020	[A] < 0.0020			[A] < 0.0020		[A] < 0.0020		[A] < 0.0020
Ethylbenzene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
m & p-Xylene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
o-Xylene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
Styrene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Tribromomethane	U	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Isopropylbenzene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Bromobenzene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,2,3-Trichloropropane	N	2760	mg/kg	0.050	[A] < 0.050			[A] < 0.050		[A] < 0.050		[A] < 0.050
N-Propylbenzene	U	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
2-Chlorotoluene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,3,5-Trimethylbenzene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
4-Chlorotoluene	U	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Tert-Butylbenzene	U	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,2,4-Trimethylbenzene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Sec-Butylbenzene	U	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,3-Dichlorobenzene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
4-Isopropyltoluene	N	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,4-Dichlorobenzene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
N-Butylbenzene	U	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,2-Dichlorobenzene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,2-Dibromo-3-Chloropropane	U	2760	mg/kg	0.050	[A] < 0.050			[A] < 0.050		[A] < 0.050		[A] < 0.050
1,2,4-Trichlorobenzene	M	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
Hexachlorobutadiene	U	2760	mg/kg	0.0010	[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		[A] < 0.0010
1,2,3-Trichlorobenzene	U	2760	mg/kg	0.0020	[A] < 0.0020			[A] < 0.0020		[A] < 0.0020		[A] < 0.0020
Methyl Tert-Butyl Ether	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
N-Nitrosodimethylamine	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Phenol	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2-Chlorophenol	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Bis-(2-Chloroethyl)Ether	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
1,3-Dichlorobenzene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
1,4-Dichlorobenzene	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
1,2-Dichlorobenzene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2-Methylphenol	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Bis(2-Chloroisopropyl)Ether	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567070	1567071	1567072	1567073	1567074	1567075	1567076	1567077
Order No.:	Client Sample Ref.:				AA184690	AA184693	AA184669	AA184668	AA174678	AA184675	AA186957	AA181997
	Sample Location:				BH03	BH04	BH06	BH08	BH10	BH12	TP01	TP02
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.00	1.00	1.00	1.00	1.00	1.00	0.50	0.50
	Asbestos Lab:					DURHAM	DURHAM		DURHAM		DURHAM	
Determinand	Accred.	SOP	Units	LOD								
Hexachloroethane	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
N-Nitrosodi-n-propylamine	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
4-Methylphenol	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Nitrobenzene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Isophorone	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2-Nitrophenol	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2,4-Dimethylphenol	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Bis(2-Chloroethoxy)Methane	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2,4-Dichlorophenol	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
1,2,4-Trichlorobenzene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
4-Chloroaniline	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Hexachlorobutadiene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
4-Chloro-3-Methylphenol	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2-Methylnaphthalene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
4-Nitrophenol	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Hexachlorocyclopentadiene	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2,4,6-Trichlorophenol	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2,4,5-Trichlorophenol	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2-Chloronaphthalene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2-Nitroaniline	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Dimethylphthalate	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2,6-Dinitrotoluene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
3-Nitroaniline	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Dibenzofuran	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
4-Chlorophenylphenylether	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2,4-Dinitrotoluene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Diethyl Phthalate	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
4-Nitroaniline	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
2-Methyl-4,6-Dinitrophenol	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Azobenzene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
4-Bromophenylphenyl Ether	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Hexachlorobenzene	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Pentachlorophenol	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Carbazole	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Di-N-Butyl Phthalate	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Butylbenzyl Phthalate	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Bis(2-Ethylhexyl)Phthalate	N	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Di-N-Octyl Phthalate	M	2790	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567070	1567071	1567072	1567073	1567074	1567075	1567076	1567077
Order No.:	Client Sample Ref.:				AA184690	AA184693	AA184669	AA184668	AA174678	AA184675	AA186957	AA181997
	Sample Location:				BH03	BH04	BH06	BH08	BH10	BH12	TP01	TP02
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.00	1.00	1.00	1.00	1.00	1.00	0.50	0.50
	Asbestos Lab:					DURHAM	DURHAM		DURHAM		DURHAM	
Determinand	Accred.	SOP	Units	LOD								
Naphthalene	M	2800	mg/kg	0.10		< 0.10	0.26		< 0.10		< 0.10	
Acenaphthylene	N	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Acenaphthene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Fluorene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Phenanthrene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Anthracene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Fluoranthene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Pyrene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Benzo[a]anthracene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Chrysene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Benzo[b]fluoranthene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Benzo[k]fluoranthene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Benzo[a]pyrene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Indeno(1,2,3-c,d)Pyrene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Dibenz(a,h)Anthracene	N	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Benzo[g,h,i]perylene	M	2800	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	
Total Of 16 PAH's	N	2800	mg/kg	2.0		< 2.0	< 2.0		< 2.0		< 2.0	
PCB 81	N	2815	mg/kg	0.010								< 0.010
PCB 77	U	2815	mg/kg	0.010								< 0.010
PCB 105	N	2815	mg/kg	0.010								< 0.010
PCB 114	N	2815	mg/kg	0.010								< 0.010
PCB 118	N	2815	mg/kg	0.010								< 0.010
PCB 123	N	2815	mg/kg	0.010								< 0.010
PCB 126	N	2815	mg/kg	0.010								< 0.010
PCB 156	N	2815	mg/kg	0.010								< 0.010
PCB 157	N	2815	mg/kg	0.010								< 0.010
PCB 167	N	2815	mg/kg	0.010								< 0.010
PCB 169	N	2815	mg/kg	0.010								< 0.010
PCB 189	N	2815	mg/kg	0.010								< 0.010
Total PCBs (12 Congeners)	N	2815	mg/kg	0.12								< 0.12
Resorcinol	M	2920	mg/kg	0.020		< 0.020	< 0.020		< 0.020		< 0.020	
Phenol	M	2920	mg/kg	0.020		< 0.020	< 0.020		< 0.020		< 0.020	
Cresols	M	2920	mg/kg	0.020		< 0.020	< 0.020		< 0.020		< 0.020	
Xylenols	M	2920	mg/kg	0.020		< 0.020	< 0.020		< 0.020		< 0.020	
1-Naphthol	N	2920	mg/kg	0.020		< 0.020	< 0.020		< 0.020		< 0.020	
Trimethylphenols	M	2920	mg/kg	0.020		< 0.020	< 0.020		< 0.020		< 0.020	
Total Phenols	M	2920	mg/kg	0.10		< 0.10	< 0.10		< 0.10		< 0.10	

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567080	1567081	1567082	1567084	1567085	1567086	1567087	1567089
Order No.:	Client Sample Ref.:				AA186979	AA186963	AA186966	AA186969	AA185474	AA185457	AA185458	AA185485
	Sample Location:				TP06	TP07	TP08	TP10	TP13	TP14	TP14	TP17
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	0.50	0.50	0.50	0.50	0.50	0.80	0.60
	Asbestos Lab:				DURHAM			DURHAM		DURHAM		DURHAM
Determinand	Accred.	SOP	Units	LOD								
ACM Type	U	2192		N/A	-			-		-		-
Asbestos Identification	U	2192		N/A	No Asbestos Detected			No Asbestos Detected		No Asbestos Detected		No Asbestos Detected
Moisture	N	2030	%	0.020	13	13	12	13	14	10	6.6	9.5
pH	M	2010		4.0	[A] 8.5			[A] 8.6		[A] 8.4		[A] 8.5
Boron (Hot Water Soluble)	M	2120	mg/kg	0.40	[A] < 0.40			[A] < 0.40		[A] < 0.40		[A] < 0.40
Sulphate (2:1 Water Soluble) as SO4	M	2120	g/l	0.010	[A] < 0.010			[A] < 0.010		[A] < 0.010		[A] < 0.010
Total Sulphur	M	2175	%	0.010	[A] < 0.010			[A] < 0.010		[A] < 0.010		[A] < 0.010
Sulphur (Elemental)	M	2180	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Cyanide (Free)	M	2300	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Cyanide (Total)	M	2300	mg/kg	0.50	[A] < 0.50			[A] < 0.50		[A] < 0.50		[A] < 0.50
Thiocyanate	M	2300	mg/kg	5.0	[A] < 5.0			[A] < 5.0		[A] < 5.0		[A] < 5.0
Aluminium (Total)	N	2430	mg/kg	100	[A] 3700			[A] 5500		[A] 6200		[A] 4700
Iron (Total)	N	2430	mg/kg	100	[A] 7500			[A] 10000		[A] 9600		[A] 13000
Arsenic	M	2455	mg/kg	0.5	4.5			6.5		4.6		6.8
Barium	M	2455	mg/kg	0	27			40		45		54
Beryllium	U	2455	mg/kg	0.5	< 0.5			0.6		0.5		0.6
Cadmium	M	2455	mg/kg	0.10	0.85			1.1		0.76		1.4
Chromium	M	2455	mg/kg	0.5	12			18		13		18
Manganese	M	2455	mg/kg	1.0	330			410		190		440
Copper	M	2455	mg/kg	0.50	10			17		6.4		13
Mercury	M	2455	mg/kg	0.05	< 0.05			0.08		< 0.05		0.05
Nickel	M	2455	mg/kg	0.50	19			29		17		28
Lead	M	2455	mg/kg	0.50	29			22		19		26
Selenium	M	2455	mg/kg	0.25	0.55			0.74		0.67		0.95
Vanadium	U	2455	mg/kg	0.5	12			16		13		17
Zinc	M	2455	mg/kg	0.50	62			96		54		97
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50			< 0.50		< 0.50		< 0.50
Organic Matter	M	2625	%	0.40	[A] 1.3			[A] 0.54		[A] 0.88		[A] 1.3
Total Organic Carbon	M	2625	%	0.20	[A] 0.76			[A] 0.32		[A] 0.51		[A] 0.78
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aliphatic TPH >C8-C10	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aliphatic TPH >C10-C12	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aliphatic TPH >C12-C16	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aliphatic TPH >C16-C21	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aliphatic TPH >C21-C35	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567080	1567081	1567082	1567084	1567085	1567086	1567087	1567090
Order No.:	Client Sample Ref.:				AA186979	AA186963	AA186966	AA186969	AA185474	AA185457	AA185458	AA185464
	Sample Location:				TP06	TP07	TP08	TP10	TP13	TP14	TP14	TP17
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	0.50	0.50	0.50	0.50	0.50	0.80	0.60
	Asbestos Lab:				DURHAM			DURHAM		DURHAM		DURHAM
Determinand	Accred.	SOP	Units	LOD								
Total Aliphatic Hydrocarbons	N	2680	mg/kg	5.0	[A] < 5.0			[A] < 5.0		[A] < 5.0		[A] < 5.0
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aromatic TPH >C8-C10	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aromatic TPH >C10-C12	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aromatic TPH >C12-C16	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aromatic TPH >C16-C21	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0	[A] < 1.0			[A] < 1.0		[A] < 1.0		[A] < 1.0
Total Aromatic Hydrocarbons	N	2680	mg/kg	5.0	[A] < 5.0			[A] < 5.0		[A] < 5.0		[A] < 5.0
Total Petroleum Hydrocarbons	N	2680	mg/kg	10.0	[A] < 10			[A] < 10		[A] < 10		[A] < 10
Dichlorodifluoromethane	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Chloromethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Vinyl Chloride	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Bromomethane	M	2760	mg/kg	0.020		[A] < 0.020			[A] < 0.020		[A] < 0.020	
Chloroethane	U	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020	
Trichlorofluoromethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,1-Dichloroethene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Trans 1,2-Dichloroethene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,1-Dichloroethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
cis 1,2-Dichloroethene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Bromochloromethane	U	2760	mg/kg	0.0050		[A] < 0.0050			[A] < 0.0050		[A] < 0.0050	
Trichloromethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,1,1-Trichloroethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Tetrachloromethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,1-Dichloropropene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Benzene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
1,2-Dichloroethane	M	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020	
Trichloroethene	N	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,2-Dichloropropane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Dibromomethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Bromodichloromethane	M	2760	mg/kg	0.0050		[A] < 0.0050			[A] < 0.0050		[A] < 0.0050	
cis-1,3-Dichloropropene	N	2760	mg/kg	0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010	
Toluene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
Trans-1,3-Dichloropropene	N	2760	mg/kg	0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010	
1,1,2-Trichloroethane	M	2760	mg/kg	0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010	
Tetrachloroethene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,3-Dichloropropane	U	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020	

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567080	1567081	1567082	1567084	1567085	1567086	1567087	1567089	1567090
Order No.:	Client Sample Ref.:				AA186979	AA186963	AA186966	AA186969	AA185474	AA185457	AA185458	AA185485	AA185464
	Sample Location:				TP06	TP07	TP08	TP10	TP13	TP14	TP14	TP17	TP18
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	0.50	0.50	0.50	0.50	0.50	0.80	0.60	0.50
	Asbestos Lab:				DURHAM			DURHAM		DURHAM			DURHAM
Determinand	Accred.	SOP	Units	LOD									
Dibromochloromethane	U	2760	mg/kg	0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010		
1,2-Dibromoethane	M	2760	mg/kg	0.0050		[A] < 0.0050			[A] < 0.0050		[A] < 0.0050		
Chlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
1,1,1,2-Tetrachloroethane	M	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020		
Ethylbenzene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010
m & p-Xylene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010
o-Xylene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010
Styrene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
Tribromomethane	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
Isopropylbenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
Bromobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
1,2,3-Trichloropropane	N	2760	mg/kg	0.050		[A] < 0.050			[A] < 0.050		[A] < 0.050		
N-Propylbenzene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
2-Chlorotoluene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
1,3,5-Trimethylbenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
4-Chlorotoluene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
Tert-Butylbenzene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
1,2,4-Trimethylbenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
Sec-Butylbenzene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
1,3-Dichlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
4-Isopropyltoluene	N	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
1,4-Dichlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
N-Butylbenzene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
1,2-Dichlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
1,2-Dibromo-3-Chloropropane	U	2760	mg/kg	0.050		[A] < 0.050			[A] < 0.050		[A] < 0.050		
1,2,4-Trichlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
Hexachlorobutadiene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010		
1,2,3-Trichlorobenzene	U	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020		
Methyl Tert-Butyl Ether	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010
N-Nitrosodimethylamine	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50		
Phenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50		
2-Chlorophenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50		
Bis-(2-Chloroethyl)Ether	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50		
1,3-Dichlorobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50		
1,4-Dichlorobenzene	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50		
1,2-Dichlorobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50		
2-Methylphenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50		
Bis(2-Chloroisopropyl)Ether	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50		

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567080	1567081	1567082	1567084	1567085	1567086	1567087	1567090
Order No.:	Client Sample Ref.:				AA186979	AA186963	AA186966	AA186969	AA185474	AA185457	AA185458	AA185485
	Sample Location:				TP06	TP07	TP08	TP10	TP13	TP14	TP14	TP17
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	0.50	0.50	0.50	0.50	0.50	0.80	0.60
	Asbestos Lab:				DURHAM			DURHAM		DURHAM		DURHAM
Determinand	Accred.	SOP	Units	LOD								
Hexachloroethane	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
N-Nitrosodi-n-propylamine	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Methylphenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Nitrobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Isophorone	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Nitrophenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4-Dimethylphenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Bis(2-Chloroethoxy)Methane	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4-Dichlorophenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
1,2,4-Trichlorobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Chloroaniline	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Hexachlorobutadiene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Chloro-3-Methylphenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Methylnaphthalene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Nitrophenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Hexachlorocyclopentadiene	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4,6-Trichlorophenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4,5-Trichlorophenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Chloronaphthalene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Nitroaniline	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Dimethylphthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,6-Dinitrotoluene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
3-Nitroaniline	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Dibenzofuran	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Chlorophenylphenylether	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4-Dinitrotoluene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Diethyl Phthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Nitroaniline	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Methyl-4,6-Dinitrophenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Azobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Bromophenylphenyl Ether	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Hexachlorobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Pentachlorophenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Carbazole	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Di-N-Butyl Phthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Butylbenzyl Phthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Bis(2-Ethylhexyl)Phthalate	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Di-N-Octyl Phthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567080	1567081	1567082	1567084	1567085	1567086	1567087	1567089
Order No.:	Client Sample Ref.:				AA186979	AA186963	AA186966	AA186969	AA185474	AA185457	AA185458	AA185485
	Sample Location:				TP06	TP07	TP08	TP10	TP13	TP14	TP14	TP17
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	0.50	0.50	0.50	0.50	0.50	0.80	0.60
	Asbestos Lab:				DURHAM			DURHAM		DURHAM		DURHAM
Determinand	Accred.	SOP	Units	LOD								
Naphthalene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Acenaphthylene	N	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Acenaphthene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Fluorene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Phenanthrene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Anthracene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Fluoranthene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Pyrene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Benzo[a]anthracene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Chrysene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Benzo[b]fluoranthene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Benzo[k]fluoranthene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Benzo[a]pyrene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Indeno(1,2,3-c,d)Pyrene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Dibenz(a,h)Anthracene	N	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Benzo[g,h,i]perylene	M	2800	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10
Total Of 16 PAH's	N	2800	mg/kg	2.0	< 2.0			< 2.0		< 2.0		< 2.0
PCB 81	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 77	U	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 105	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 114	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 118	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 123	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 126	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 156	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 157	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 167	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 169	N	2815	mg/kg	0.010			< 0.010				< 0.010	
PCB 189	N	2815	mg/kg	0.010			< 0.010				< 0.010	
Total PCBs (12 Congeners)	N	2815	mg/kg	0.12			< 0.12				< 0.12	
Resorcinol	M	2920	mg/kg	0.020	< 0.020			< 0.020		< 0.020		< 0.020
Phenol	M	2920	mg/kg	0.020	< 0.020			< 0.020		< 0.020		< 0.020
Cresols	M	2920	mg/kg	0.020	< 0.020			< 0.020		< 0.020		< 0.020
Xylenols	M	2920	mg/kg	0.020	< 0.020			< 0.020		< 0.020		< 0.020
1-Naphthol	N	2920	mg/kg	0.020	< 0.020			< 0.020		< 0.020		< 0.020
Trimethylphenols	M	2920	mg/kg	0.020	< 0.020			< 0.020		< 0.020		< 0.020
Total Phenols	M	2920	mg/kg	0.10	< 0.10			< 0.10		< 0.10		< 0.10

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567091	1567092	1567093	1567094	1567096	1567097	1567098	1567099
Order No.:	Client Sample Ref.:				AA185488	AA185498	AA181957	AA181963	AA181976	AA181972	AA181969	AA181966
	Sample Location:				TP20	TP22	TP23	TP25	TP26	TP27	TP28	TP29
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.60	1.40	0.50	0.50	1.30	0.50	0.60	0.50
	Asbestos Lab:				DURHAM		DURHAM			DURHAM		DURHAM
Determinand	Accred.	SOP	Units	LOD								
ACM Type	U	2192		N/A	-		-			-		-
Asbestos Identification	U	2192		N/A	No Asbestos Detected		No Asbestos Detected			No Asbestos Detected		No Asbestos Detected
Moisture	N	2030	%	0.020	13	11	14	13	10	11	21	8.4
pH	M	2010		4.0	[A] 8.6		[A] 8.5			[A] 8.5		[A] 8.4
Boron (Hot Water Soluble)	M	2120	mg/kg	0.40	[A] < 0.40		[A] < 0.40			[A] < 0.40		[A] < 0.40
Sulphate (2:1 Water Soluble) as SO4	M	2120	g/l	0.010	[A] < 0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010
Total Sulphur	M	2175	%	0.010	[A] < 0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010
Sulphur (Elemental)	M	2180	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Cyanide (Free)	M	2300	mg/kg	0.50	[A] < 0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50
Cyanide (Total)	M	2300	mg/kg	0.50	[A] < 0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50
Thiocyanate	M	2300	mg/kg	5.0	[A] < 5.0		[A] < 5.0			[A] < 5.0		[A] < 5.0
Aluminium (Total)	N	2430	mg/kg	100	[A] 3700		[A] 7500			[A] 4100		[A] 4800
Iron (Total)	N	2430	mg/kg	100	[A] 9200		[A] 15000			[A] 9800		[A] 4900
Arsenic	M	2455	mg/kg	0.5	5.8		9.1			7.5		7.7
Barium	M	2455	mg/kg	0	79		51			71		46
Beryllium	U	2455	mg/kg	0.5	< 0.5		0.8			0.5		0.8
Cadmium	M	2455	mg/kg	0.10	1.2		2.4			1.9		1.7
Chromium	M	2455	mg/kg	0.5	14		20			14		19
Manganese	M	2455	mg/kg	1.0	< 1.0		1000			1000		680
Copper	M	2455	mg/kg	0.50	11		21			13		17
Mercury	M	2455	mg/kg	0.05	< 0.05		0.07			< 0.05		0.06
Nickel	M	2455	mg/kg	0.50	24		52			35		37
Lead	M	2455	mg/kg	0.50	19		29			23		25
Selenium	M	2455	mg/kg	0.25	0.60		1.1			0.54		0.84
Vanadium	U	2455	mg/kg	0.5	14		21			14		18
Zinc	M	2455	mg/kg	0.50	73		130			88		110
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50		< 0.50			< 0.50		< 0.50
Organic Matter	M	2625	%	0.40	[A] 0.75		[A] 0.66			[A] < 0.40		[A] < 0.40
Total Organic Carbon	M	2625	%	0.20	[A] 0.43		[A] 0.38			[A] < 0.20		[A] < 0.20
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aliphatic TPH >C8-C10	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aliphatic TPH >C10-C12	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aliphatic TPH >C12-C16	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aliphatic TPH >C16-C21	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aliphatic TPH >C21-C35	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567091	1567092	1567093	1567094	1567096	1567097	1567098	1567100
Order No.:	Client Sample Ref.:				AA185488	AA185498	AA181957	AA181963	AA181976	AA181972	AA181969	AA181978
	Sample Location:				TP20	TP22	TP23	TP25	TP26	TP27	TP28	TP29
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.60	1.40	0.50	0.50	1.30	0.50	0.60	0.50
	Asbestos Lab:				DURHAM		DURHAM			DURHAM		DURHAM
Determinand	Accred.	SOP	Units	LOD								
Total Aliphatic Hydrocarbons	N	2680	mg/kg	5.0	[A] < 5.0		[A] < 5.0			[A] < 5.0		[A] < 5.0
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aromatic TPH >C8-C10	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aromatic TPH >C10-C12	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aromatic TPH >C12-C16	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aromatic TPH >C16-C21	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0	[A] < 1.0		[A] < 1.0			[A] < 1.0		[A] < 1.0
Total Aromatic Hydrocarbons	N	2680	mg/kg	5.0	[A] < 5.0		[A] < 5.0			[A] < 5.0		[A] < 5.0
Total Petroleum Hydrocarbons	N	2680	mg/kg	10.0	[A] < 10		[A] < 10			[A] < 10		[A] < 10
Dichlorodifluoromethane	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Chloromethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Vinyl Chloride	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Bromomethane	M	2760	mg/kg	0.020		[A] < 0.020			[A] < 0.020		[A] < 0.020	
Chloroethane	U	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020	
Trichlorofluoromethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,1-Dichloroethene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Trans 1,2-Dichloroethene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,1-Dichloroethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
cis 1,2-Dichloroethene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Bromochloromethane	U	2760	mg/kg	0.0050		[A] < 0.0050			[A] < 0.0050		[A] < 0.0050	
Trichloromethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,1,1-Trichloroethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Tetrachloromethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,1-Dichloropropene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Benzene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
1,2-Dichloroethane	M	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020	
Trichloroethene	N	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,2-Dichloropropane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Dibromomethane	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Bromodichloromethane	M	2760	mg/kg	0.0050		[A] < 0.0050			[A] < 0.0050		[A] < 0.0050	
cis-1,3-Dichloropropene	N	2760	mg/kg	0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010	
Toluene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
Trans-1,3-Dichloropropene	N	2760	mg/kg	0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010	
1,1,2-Trichloroethane	M	2760	mg/kg	0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010	
Tetrachloroethene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,3-Dichloropropane	U	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020	

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567091	1567092	1567093	1567094	1567096	1567097	1567098	1567100
Order No.:	Client Sample Ref.:				AA185488	AA185498	AA181957	AA181963	AA181976	AA181972	AA181969	AA181978
	Sample Location:				TP20	TP22	TP23	TP25	TP26	TP27	TP28	TP29
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.60	1.40	0.50	0.50	1.30	0.50	0.60	0.50
	Asbestos Lab:				DURHAM		DURHAM			DURHAM		DURHAM
Determinand	Accred.	SOP	Units	LOD								
Dibromochloromethane	U	2760	mg/kg	0.010		[A] < 0.010			[A] < 0.010		[A] < 0.010	
1,2-Dibromoethane	M	2760	mg/kg	0.0050		[A] < 0.0050			[A] < 0.0050		[A] < 0.0050	
Chlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,1,1,2-Tetrachloroethane	M	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020	
Ethylbenzene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
m & p-Xylene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
o-Xylene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
Styrene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Tribromomethane	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Isopropylbenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Bromobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,2,3-Trichloropropane	N	2760	mg/kg	0.050		[A] < 0.050			[A] < 0.050		[A] < 0.050	
N-Propylbenzene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
2-Chlorotoluene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,3,5-Trimethylbenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
4-Chlorotoluene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Tert-Butylbenzene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,2,4-Trimethylbenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Sec-Butylbenzene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,3-Dichlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
4-Isopropyltoluene	N	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,4-Dichlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
N-Butylbenzene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,2-Dichlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,2-Dibromo-3-Chloropropane	U	2760	mg/kg	0.050		[A] < 0.050			[A] < 0.050		[A] < 0.050	
1,2,4-Trichlorobenzene	M	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
Hexachlorobutadiene	U	2760	mg/kg	0.0010		[A] < 0.0010			[A] < 0.0010		[A] < 0.0010	
1,2,3-Trichlorobenzene	U	2760	mg/kg	0.0020		[A] < 0.0020			[A] < 0.0020		[A] < 0.0020	
Methyl Tert-Butyl Ether	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010		[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
N-Nitrosodimethylamine	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Phenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Chlorophenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Bis-(2-Chloroethyl)Ether	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
1,3-Dichlorobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
1,4-Dichlorobenzene	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
1,2-Dichlorobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Methylphenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Bis(2-Chloroisopropyl)Ether	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567091	1567092	1567093	1567094	1567096	1567097	1567098	1567100
Order No.:	Client Sample Ref.:				AA185488	AA185498	AA181957	AA181963	AA181976	AA181972	AA181969	AA181966
	Sample Location:				TP20	TP22	TP23	TP25	TP26	TP27	TP28	TP29
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.60	1.40	0.50	0.50	1.30	0.50	0.60	0.50
	Asbestos Lab:				DURHAM		DURHAM			DURHAM		DURHAM
Determinand	Accred.	SOP	Units	LOD								
Hexachloroethane	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
N-Nitrosodi-n-propylamine	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Methylphenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Nitrobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Isophorone	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Nitrophenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4-Dimethylphenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Bis(2-Chloroethoxy)Methane	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4-Dichlorophenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
1,2,4-Trichlorobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Chloroaniline	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Hexachlorobutadiene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Chloro-3-Methylphenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Methylnaphthalene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Nitrophenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Hexachlorocyclopentadiene	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4,6-Trichlorophenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4,5-Trichlorophenol	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Chloronaphthalene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Nitroaniline	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Dimethylphthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,6-Dinitrotoluene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
3-Nitroaniline	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Dibenzofuran	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Chlorophenylphenylether	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2,4-Dinitrotoluene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Diethyl Phthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Nitroaniline	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
2-Methyl-4,6-Dinitrophenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Azobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
4-Bromophenylphenyl Ether	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Hexachlorobenzene	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Pentachlorophenol	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Carbazole	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Di-N-Butyl Phthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Butylbenzyl Phthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Bis(2-Ethylhexyl)Phthalate	N	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	
Di-N-Octyl Phthalate	M	2790	mg/kg	0.50		[A] < 0.50			[A] < 0.50		[A] < 0.50	

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567091	1567092	1567093	1567094	1567096	1567097	1567098	1567100
Order No.:	Client Sample Ref.:				AA185488	AA185498	AA181957	AA181963	AA181976	AA181972	AA181969	AA181966
	Sample Location:				TP20	TP22	TP23	TP25	TP26	TP27	TP28	TP29
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.60	1.40	0.50	0.50	1.30	0.50	0.60	0.50
	Asbestos Lab:				DURHAM		DURHAM			DURHAM		DURHAM
Determinand	Accred.	SOP	Units	LOD								
Naphthalene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Acenaphthylene	N	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Acenaphthene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Fluorene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Phenanthrene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Anthracene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Fluoranthene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Pyrene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Benzo[a]anthracene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Chrysene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Benzo[b]fluoranthene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Benzo[k]fluoranthene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Benzo[a]pyrene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Indeno(1,2,3-c,d)Pyrene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Dibenz(a,h)Anthracene	N	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Benzo[g,h,i]perylene	M	2800	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10
Total Of 16 PAH's	N	2800	mg/kg	2.0	< 2.0		< 2.0			< 2.0		< 2.0
PCB 81	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 77	U	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 105	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 114	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 118	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 123	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 126	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 156	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 157	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 167	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 169	N	2815	mg/kg	0.010			< 0.010					< 0.010
PCB 189	N	2815	mg/kg	0.010			< 0.010					< 0.010
Total PCBs (12 Congeners)	N	2815	mg/kg	0.12			< 0.12					< 0.12
Resorcinol	M	2920	mg/kg	0.020	< 0.020		< 0.020			< 0.020		< 0.020
Phenol	M	2920	mg/kg	0.020	< 0.020		< 0.020			< 0.020		< 0.020
Cresols	M	2920	mg/kg	0.020	< 0.020		< 0.020			< 0.020		< 0.020
Xylenols	M	2920	mg/kg	0.020	< 0.020		< 0.020			< 0.020		< 0.020
1-Naphthol	N	2920	mg/kg	0.020	< 0.020		< 0.020			< 0.020		< 0.020
Trimethylphenols	M	2920	mg/kg	0.020	< 0.020		< 0.020			< 0.020		< 0.020
Total Phenols	M	2920	mg/kg	0.10	< 0.10		< 0.10			< 0.10		< 0.10

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567101	1567103	1567104	1567105
Order No.:	Client Sample Ref.:				AA181992	AA181995	AA181989	AA181987
	Sample Location:				TP31	TP32	TP33	TP34
	Sample Type:				SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	1.40	0.50	1.40
	Asbestos Lab:				DURHAM	DURHAM	DURHAM	
Determinand	Accred.	SOP	Units	LOD				
ACM Type	U	2192		N/A	-	-	-	
Asbestos Identification	U	2192		N/A	No Asbestos Detected	No Asbestos Detected	No Asbestos Detected	
Moisture	N	2030	%	0.020	11	9.0	15	9.1
pH	M	2010		4.0	[A] 7.3	[A] 8.3	[A] 7.7	
Boron (Hot Water Soluble)	M	2120	mg/kg	0.40	[A] < 0.40	[A] < 0.40	[A] < 0.40	
Sulphate (2:1 Water Soluble) as SO4	M	2120	g/l	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	
Total Sulphur	M	2175	%	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	
Sulphur (Elemental)	M	2180	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Cyanide (Free)	M	2300	mg/kg	0.50	[A] 0.50	[A] 1.1	[A] 0.60	
Cyanide (Total)	M	2300	mg/kg	0.50	[A] 0.60	[A] 1.1	[A] 0.60	
Thiocyanate	M	2300	mg/kg	5.0	[A] < 5.0	[A] < 5.0	[A] < 5.0	
Aluminium (Total)	N	2430	mg/kg	100	[A] 8700	[A] 2200	[A] 5100	
Iron (Total)	N	2430	mg/kg	100	[A] 17000	[A] 7700	[A] 14000	
Arsenic	M	2455	mg/kg	0.5	9.4	6.9	7.6	
Barium	M	2455	mg/kg	0	42	35	42	
Beryllium	U	2455	mg/kg	0.5	0.8	< 0.5	0.6	
Cadmium	M	2455	mg/kg	0.10	1.1	0.99	1.6	
Chromium	M	2455	mg/kg	0.5	19	6.8	15	
Manganese	M	2455	mg/kg	1.0	990	580	740	
Copper	M	2455	mg/kg	0.50	18	10	16	
Mercury	M	2455	mg/kg	0.05	0.08	< 0.05	0.05	
Nickel	M	2455	mg/kg	0.50	41	17	34	
Lead	M	2455	mg/kg	0.50	32	12	25	
Selenium	M	2455	mg/kg	0.25	0.95	0.62	0.72	
Vanadium	U	2455	mg/kg	0.5	21	7.2	16	
Zinc	M	2455	mg/kg	0.50	130	58	100	
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50	< 0.50	< 0.50	
Organic Matter	M	2625	%	0.40	[A] 0.59	[A] < 0.40	[A] 0.67	
Total Organic Carbon	M	2625	%	0.20	[A] 0.34	[A] 0.22	[A] 0.39	
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aliphatic TPH >C8-C10	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aliphatic TPH >C10-C12	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aliphatic TPH >C12-C16	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aliphatic TPH >C16-C21	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aliphatic TPH >C21-C35	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567101	1567103	1567104	1567105
Order No.:	Client Sample Ref.:				AA181992	AA181995	AA181989	AA181987
	Sample Location:				TP31	TP32	TP33	TP34
	Sample Type:				SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	1.40	0.50	1.40
	Asbestos Lab:				DURHAM	DURHAM	DURHAM	
Determinand	Accred.	SOP	Units	LOD				
Total Aliphatic Hydrocarbons	N	2680	mg/kg	5.0	[A] < 5.0	[A] < 5.0	[A] < 5.0	
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aromatic TPH >C8-C10	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aromatic TPH >C10-C12	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aromatic TPH >C12-C16	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aromatic TPH >C16-C21	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	
Total Aromatic Hydrocarbons	N	2680	mg/kg	5.0	[A] < 5.0	[A] < 5.0	[A] < 5.0	
Total Petroleum Hydrocarbons	N	2680	mg/kg	10.0	[A] < 10	[A] < 10	[A] < 10	
Dichlorodifluoromethane	U	2760	mg/kg	0.0010				[A] < 0.0010
Chloromethane	M	2760	mg/kg	0.0010				[A] < 0.0010
Vinyl Chloride	M	2760	mg/kg	0.0010				[A] < 0.0010
Bromomethane	M	2760	mg/kg	0.020				[A] < 0.020
Chloroethane	U	2760	mg/kg	0.0020				[A] < 0.0020
Trichlorofluoromethane	M	2760	mg/kg	0.0010				[A] < 0.0010
1,1-Dichloroethene	M	2760	mg/kg	0.0010				[A] < 0.0010
Trans 1,2-Dichloroethene	M	2760	mg/kg	0.0010				[A] < 0.0010
1,1-Dichloroethane	M	2760	mg/kg	0.0010				[A] < 0.0010
cis 1,2-Dichloroethene	M	2760	mg/kg	0.0010				[A] < 0.0010
Bromochloromethane	U	2760	mg/kg	0.0050				[A] < 0.0050
Trichloromethane	M	2760	mg/kg	0.0010				[A] < 0.0010
1,1,1-Trichloroethane	M	2760	mg/kg	0.0010				[A] < 0.0010
Tetrachloromethane	M	2760	mg/kg	0.0010				[A] < 0.0010
1,1-Dichloropropene	U	2760	mg/kg	0.0010				[A] < 0.0010
Benzene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
1,2-Dichloroethane	M	2760	mg/kg	0.0020				[A] < 0.0020
Trichloroethene	N	2760	mg/kg	0.0010				[A] < 0.0010
1,2-Dichloropropane	M	2760	mg/kg	0.0010				[A] < 0.0010
Dibromomethane	M	2760	mg/kg	0.0010				[A] < 0.0010
Bromodichloromethane	M	2760	mg/kg	0.0050				[A] < 0.0050
cis-1,3-Dichloropropene	N	2760	mg/kg	0.010				[A] < 0.010
Toluene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
Trans-1,3-Dichloropropene	N	2760	mg/kg	0.010				[A] < 0.010
1,1,2-Trichloroethane	M	2760	mg/kg	0.010				[A] < 0.010
Tetrachloroethene	M	2760	mg/kg	0.0010				[A] < 0.0010
1,3-Dichloropropane	U	2760	mg/kg	0.0020				[A] < 0.0020

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567101	1567103	1567104	1567105
Order No.:	Client Sample Ref.:				AA181992	AA181995	AA181989	AA181987
	Sample Location:				TP31	TP32	TP33	TP34
	Sample Type:				SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	1.40	0.50	1.40
	Asbestos Lab:				DURHAM	DURHAM	DURHAM	
Determinand	Accred.	SOP	Units	LOD				
Dibromochloromethane	U	2760	mg/kg	0.010				[A] < 0.010
1,2-Dibromoethane	M	2760	mg/kg	0.0050				[A] < 0.0050
Chlorobenzene	M	2760	mg/kg	0.0010				[A] < 0.0010
1,1,1,2-Tetrachloroethane	M	2760	mg/kg	0.0020				[A] < 0.0020
Ethylbenzene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
m & p-Xylene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
o-Xylene	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
Styrene	M	2760	mg/kg	0.0010				[A] < 0.0010
Tribromomethane	U	2760	mg/kg	0.0010				[A] < 0.0010
Isopropylbenzene	M	2760	mg/kg	0.0010				[A] < 0.0010
Bromobenzene	M	2760	mg/kg	0.0010				[A] < 0.0010
1,2,3-Trichloropropane	N	2760	mg/kg	0.050				[A] < 0.050
N-Propylbenzene	U	2760	mg/kg	0.0010				[A] < 0.0010
2-Chlorotoluene	M	2760	mg/kg	0.0010				[A] < 0.0010
1,3,5-Trimethylbenzene	M	2760	mg/kg	0.0010				[A] < 0.0010
4-Chlorotoluene	U	2760	mg/kg	0.0010				[A] < 0.0010
Tert-Butylbenzene	U	2760	mg/kg	0.0010				[A] < 0.0010
1,2,4-Trimethylbenzene	M	2760	mg/kg	0.0010				[A] < 0.0010
Sec-Butylbenzene	U	2760	mg/kg	0.0010				[A] < 0.0010
1,3-Dichlorobenzene	M	2760	mg/kg	0.0010				[A] < 0.0010
4-Isopropyltoluene	N	2760	mg/kg	0.0010				[A] < 0.0010
1,4-Dichlorobenzene	M	2760	mg/kg	0.0010				[A] < 0.0010
N-Butylbenzene	U	2760	mg/kg	0.0010				[A] < 0.0010
1,2-Dichlorobenzene	M	2760	mg/kg	0.0010				[A] < 0.0010
1,2-Dibromo-3-Chloropropane	U	2760	mg/kg	0.050				[A] < 0.050
1,2,4-Trichlorobenzene	M	2760	mg/kg	0.0010				[A] < 0.0010
Hexachlorobutadiene	U	2760	mg/kg	0.0010				[A] < 0.0010
1,2,3-Trichlorobenzene	U	2760	mg/kg	0.0020				[A] < 0.0020
Methyl Tert-Butyl Ether	M	2760	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
N-Nitrosodimethylamine	M	2790	mg/kg	0.50				[A] < 0.50
Phenol	M	2790	mg/kg	0.50				[A] < 0.50
2-Chlorophenol	M	2790	mg/kg	0.50				[A] < 0.50
Bis-(2-Chloroethyl)Ether	M	2790	mg/kg	0.50				[A] < 0.50
1,3-Dichlorobenzene	M	2790	mg/kg	0.50				[A] < 0.50
1,4-Dichlorobenzene	N	2790	mg/kg	0.50				[A] < 0.50
1,2-Dichlorobenzene	M	2790	mg/kg	0.50				[A] < 0.50
2-Methylphenol	M	2790	mg/kg	0.50				[A] < 0.50
Bis(2-Chloroisopropyl)Ether	M	2790	mg/kg	0.50				[A] < 0.50

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567101	1567103	1567104	1567105
Order No.:	Client Sample Ref.:				AA181992	AA181995	AA181989	AA181987
	Sample Location:				TP31	TP32	TP33	TP34
	Sample Type:				SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	1.40	0.50	1.40
	Asbestos Lab:				DURHAM	DURHAM	DURHAM	
Determinand	Accred.	SOP	Units	LOD				
Hexachloroethane	N	2790	mg/kg	0.50				[A] < 0.50
N-Nitrosodi-n-propylamine	M	2790	mg/kg	0.50				[A] < 0.50
4-Methylphenol	M	2790	mg/kg	0.50				[A] < 0.50
Nitrobenzene	M	2790	mg/kg	0.50				[A] < 0.50
Isophorone	M	2790	mg/kg	0.50				[A] < 0.50
2-Nitrophenol	N	2790	mg/kg	0.50				[A] < 0.50
2,4-Dimethylphenol	N	2790	mg/kg	0.50				[A] < 0.50
Bis(2-Chloroethoxy)Methane	M	2790	mg/kg	0.50				[A] < 0.50
2,4-Dichlorophenol	M	2790	mg/kg	0.50				[A] < 0.50
1,2,4-Trichlorobenzene	M	2790	mg/kg	0.50				[A] < 0.50
4-Chloroaniline	N	2790	mg/kg	0.50				[A] < 0.50
Hexachlorobutadiene	M	2790	mg/kg	0.50				[A] < 0.50
4-Chloro-3-Methylphenol	M	2790	mg/kg	0.50				[A] < 0.50
2-Methylnaphthalene	M	2790	mg/kg	0.50				[A] < 0.50
4-Nitrophenol	N	2790	mg/kg	0.50				[A] < 0.50
Hexachlorocyclopentadiene	N	2790	mg/kg	0.50				[A] < 0.50
2,4,6-Trichlorophenol	M	2790	mg/kg	0.50				[A] < 0.50
2,4,5-Trichlorophenol	M	2790	mg/kg	0.50				[A] < 0.50
2-Chloronaphthalene	M	2790	mg/kg	0.50				[A] < 0.50
2-Nitroaniline	M	2790	mg/kg	0.50				[A] < 0.50
Dimethylphthalate	M	2790	mg/kg	0.50				[A] < 0.50
2,6-Dinitrotoluene	M	2790	mg/kg	0.50				[A] < 0.50
3-Nitroaniline	N	2790	mg/kg	0.50				[A] < 0.50
Dibenzofuran	M	2790	mg/kg	0.50				[A] < 0.50
4-Chlorophenylphenylether	M	2790	mg/kg	0.50				[A] < 0.50
2,4-Dinitrotoluene	M	2790	mg/kg	0.50				[A] < 0.50
Diethyl Phthalate	M	2790	mg/kg	0.50				[A] < 0.50
4-Nitroaniline	M	2790	mg/kg	0.50				[A] < 0.50
2-Methyl-4,6-Dinitrophenol	N	2790	mg/kg	0.50				[A] < 0.50
Azobenzene	M	2790	mg/kg	0.50				[A] < 0.50
4-Bromophenylphenyl Ether	M	2790	mg/kg	0.50				[A] < 0.50
Hexachlorobenzene	M	2790	mg/kg	0.50				[A] < 0.50
Pentachlorophenol	N	2790	mg/kg	0.50				[A] < 0.50
Carbazole	M	2790	mg/kg	0.50				[A] < 0.50
Di-N-Butyl Phthalate	M	2790	mg/kg	0.50				[A] < 0.50
Butylbenzyl Phthalate	M	2790	mg/kg	0.50				[A] < 0.50
Bis(2-Ethylhexyl)Phthalate	N	2790	mg/kg	0.50				[A] < 0.50
Di-N-Octyl Phthalate	M	2790	mg/kg	0.50				[A] < 0.50

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48580	22-48580	22-48580	22-48580
Quotation No.: Q22-28896	Chemtest Sample ID.:				1567101	1567103	1567104	1567105
Order No.:	Client Sample Ref.:				AA181992	AA181995	AA181989	AA181987
	Sample Location:				TP31	TP32	TP33	TP34
	Sample Type:				SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.50	1.40	0.50	1.40
	Asbestos Lab:				DURHAM	DURHAM	DURHAM	
Determinand	Accred.	SOP	Units	LOD				
Naphthalene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Acenaphthylene	N	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Acenaphthene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Fluorene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Phenanthrene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Anthracene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Fluoranthene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Pyrene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Benzo[a]anthracene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Chrysene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Benzo[b]fluoranthene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Benzo[k]fluoranthene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Benzo[a]pyrene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Indeno(1,2,3-c,d)Pyrene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Dibenz(a,h)Anthracene	N	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Benzo[g,h,i]perylene	M	2800	mg/kg	0.10	< 0.10	< 0.10	< 0.10	
Total Of 16 PAH's	N	2800	mg/kg	2.0	< 2.0	< 2.0	< 2.0	
PCB 81	N	2815	mg/kg	0.010				
PCB 77	U	2815	mg/kg	0.010				
PCB 105	N	2815	mg/kg	0.010				
PCB 114	N	2815	mg/kg	0.010				
PCB 118	N	2815	mg/kg	0.010				
PCB 123	N	2815	mg/kg	0.010				
PCB 126	N	2815	mg/kg	0.010				
PCB 156	N	2815	mg/kg	0.010				
PCB 157	N	2815	mg/kg	0.010				
PCB 167	N	2815	mg/kg	0.010				
PCB 169	N	2815	mg/kg	0.010				
PCB 189	N	2815	mg/kg	0.010				
Total PCBs (12 Congeners)	N	2815	mg/kg	0.12				
Resorcinol	M	2920	mg/kg	0.020	< 0.020	< 0.020	< 0.020	
Phenol	M	2920	mg/kg	0.020	< 0.020	< 0.020	< 0.020	
Cresols	M	2920	mg/kg	0.020	< 0.020	< 0.020	< 0.020	
Xylenols	M	2920	mg/kg	0.020	< 0.020	< 0.020	< 0.020	
1-Naphthol	N	2920	mg/kg	0.020	< 0.020	< 0.020	< 0.020	
Trimethylphenols	M	2920	mg/kg	0.020	< 0.020	< 0.020	< 0.020	
Total Phenols	M	2920	mg/kg	0.10	< 0.10	< 0.10	< 0.10	

Results - Single Stage WAC

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Chemtest Job No: 22-48580					Landfill Waste Acceptance Criteria		
Chemtest Sample ID: 1567078					Limits		
Sample Ref: AA186953					Inert Waste Landfill	Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample ID:							
Sample Location: TP03							
Top Depth(m): 0.50							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	M	%	[A] 0.20	3	5	6
Loss On Ignition	2610	M	%	1.7	--	--	10
Total BTEX	2760	M	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 Congeners)	2815	M	mg/kg	< 0.10	1	--	--
TPH Total WAC	2670	M	mg/kg	[A] < 10	500	--	--
Total (Of 17) PAH's	2700	N	mg/kg	< 2.0	100	--	--
pH	2010	M		8.4	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.035	--	To evaluate	To evaluate
Eluate Analysis					Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg		
Arsenic	1455	U	0.0009	0.0093	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	0.0010	0.010	0.5	10	70
Copper	1455	U	0.0020	0.020	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	0.0009	0.0092	0.5	10	30
Nickel	1455	U	0.0016	0.016	0.4	10	40
Lead	1455	U	0.0010	0.0097	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	< 0.0005	< 0.0050	0.1	0.5	7
Zinc	1455	U	0.032	0.32	4	50	200
Chloride	1220	U	< 1.0	< 10	800	15000	25000
Fluoride	1220	U	0.39	3.9	10	150	500
Sulphate	1220	U	< 1.0	< 10	1000	20000	50000
Total Dissolved Solids	1020	N	46	460	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	9.0	90	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	13

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Results - Single Stage WAC

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Project: 24000 Haverdown Road Proposed Data Centre Sites (DCS)					Landfill Waste Acceptance Criteria		
Chemtest Job No: 22-48580					Limits		
Chemtest Sample ID: 1567083					Inert Waste Landfill	Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample Ref: AA186975							
Sample ID:							
Sample Location: TP09							
Top Depth(m): 0.50							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	M	%	[A] 0.26	3	5	6
Loss On Ignition	2610	M	%	1.7	--	--	10
Total BTEX	2760	M	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 Congeners)	2815	M	mg/kg	< 0.10	1	--	--
TPH Total WAC	2670	M	mg/kg	[A] < 10	500	--	--
Total (Of 17) PAH's	2700	N	mg/kg	< 2.0	100	--	--
pH	2010	M		8.5	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.044	--	To evaluate	To evaluate
Eluate Analysis					Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg		
Arsenic	1455	U	0.0002	0.0023	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	< 0.0005	< 0.0050	0.5	10	70
Copper	1455	U	0.0011	0.011	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	0.0009	0.0094	0.5	10	30
Nickel	1455	U	0.0007	0.0072	0.4	10	40
Lead	1455	U	< 0.0005	< 0.0050	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	0.0007	0.0069	0.1	0.5	7
Zinc	1455	U	0.011	0.11	4	50	200
Chloride	1220	U	< 1.0	< 10	800	15000	25000
Fluoride	1220	U	0.69	6.9	10	150	500
Sulphate	1220	U	< 1.0	< 10	1000	20000	50000
Total Dissolved Solids	1020	N	62	620	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	4.8	< 50	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	14

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Results - Single Stage WAC

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Chemtest Job No: 22-48580					Landfill Waste Acceptance Criteria		
Chemtest Sample ID: 1567088					Limits		
Sample Ref: AA185478					Inert Waste Landfill	Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample ID:							
Sample Location: TP15							
Top Depth(m): 0.50							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	M	%	[A] 0.55	3	5	6
Loss On Ignition	2610	M	%	1.8	--	--	10
Total BTEX	2760	M	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 Congeners)	2815	M	mg/kg	< 0.10	1	--	--
TPH Total WAC	2670	M	mg/kg	[A] < 10	500	--	--
Total (Of 17) PAH's	2700	N	mg/kg	< 2.0	100	--	--
pH	2010	M		8.7	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.20	--	To evaluate	To evaluate
Eluate Analysis						Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg	
Arsenic	1455	U	< 0.0002	< 0.0020	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	< 0.0005	< 0.0050	0.5	10	70
Copper	1455	U	0.0012	0.012	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	0.0014	0.014	0.5	10	30
Nickel	1455	U	0.0007	0.0073	0.4	10	40
Lead	1455	U	< 0.0005	< 0.0050	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	< 0.0005	< 0.0050	0.1	0.5	7
Zinc	1455	U	0.019	0.19	4	50	200
Chloride	1220	U	< 1.0	< 10	800	15000	25000
Fluoride	1220	U	0.40	4.0	10	150	500
Sulphate	1220	U	< 1.0	< 10	1000	20000	50000
Total Dissolved Solids	1020	N	46	460	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	4.5	< 50	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	9.8

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Results - Single Stage WAC

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Project: 24000 Haverdown Road Proposed Data Centre Sites (DCA)					Landfill Waste Acceptance Criteria		
Chemtest Job No: 22-48580					Limits		
Chemtest Sample ID: 1567095					Inert Waste Landfill	Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample Ref: AA181975							
Sample ID:							
Sample Location: TP26							
Top Depth(m): 0.50							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	M	%	[A] 0.63	3	5	6
Loss On Ignition	2610	M	%	2.9	--	--	10
Total BTEX	2760	M	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 Congeners)	2815	M	mg/kg	< 0.10	1	--	--
TPH Total WAC	2670	M	mg/kg	[A] < 10	500	--	--
Total (Of 17) PAH's	2700	N	mg/kg	< 2.0	100	--	--
pH	2010	M		8.4	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.043	--	To evaluate	To evaluate
Eluate Analysis						Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg	
Arsenic	1455	U	0.0004	0.0039	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	< 0.0005	< 0.0050	0.5	10	70
Copper	1455	U	0.0019	0.019	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	0.0009	0.0090	0.5	10	30
Nickel	1455	U	0.0013	0.013	0.4	10	40
Lead	1455	U	0.0005	0.0051	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	< 0.0005	< 0.0050	0.1	0.5	7
Zinc	1455	U	0.028	0.28	4	50	200
Chloride	1220	U	< 1.0	< 10	800	15000	25000
Fluoride	1220	U	0.28	2.8	10	150	500
Sulphate	1220	U	< 1.0	< 10	1000	20000	50000
Total Dissolved Solids	1020	N	72	710	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	9.1	91	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	14

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Results - Single Stage WAC

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Chemtest Job No: 22-48580					Landfill Waste Acceptance Criteria		
Chemtest Sample ID: 1567102					Limits		
Sample Ref: AA181994					Inert Waste Landfill	Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample ID:							
Sample Location: TP32							
Top Depth(m): 0.50							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	M	%	[A] 0.30	3	5	6
Loss On Ignition	2610	M	%	3.3	--	--	10
Total BTEX	2760	M	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 Congeners)	2815	M	mg/kg	< 0.10	1	--	--
TPH Total WAC	2670	M	mg/kg	[A] < 10	500	--	--
Total (Of 17) PAH's	2700	N	mg/kg	< 2.0	100	--	--
pH	2010	M		7.1	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.038	--	To evaluate	To evaluate
Eluate Analysis						Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg	
Arsenic	1455	U	0.0006	0.0056	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	0.0010	0.0097	0.5	10	70
Copper	1455	U	0.0021	0.021	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	< 0.0002	< 0.0020	0.5	10	30
Nickel	1455	U	0.0027	0.027	0.4	10	40
Lead	1455	U	0.0010	0.010	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	< 0.0005	< 0.0050	0.1	0.5	7
Zinc	1455	U	0.041	0.41	4	50	200
Chloride	1220	U	1.2	12	800	15000	25000
Fluoride	1220	U	0.13	1.3	10	150	500
Sulphate	1220	U	< 1.0	< 10	1000	20000	50000
Total Dissolved Solids	1020	N	13	130	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	11	110	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	14

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Deviations

In accordance with UKAS Policy on Deviating Samples TPS 63. Chemtest have a procedure to ensure 'upon receipt of each sample a competent laboratory shall assess whether the sample is suitable with regard to the requested test(s)'. This policy and the respective holding times applied, can be supplied upon request. The reason a sample is declared as deviating is detailed below. Where applicable the analysis remains UKAS/MCERTs accredited but the results may be compromised.

Sample:	Sample Ref:	Sample ID:	Sample Location:	Sampled Date:	Deviation Code(s):	Containers Received:
1567070	AA184690		BH03		A	Amber Glass 250ml
1567070	AA184690		BH03		A	Plastic Tub 500g
1567071	AA184693		BH04		A	Amber Glass 250ml
1567071	AA184693		BH04		A	Plastic Tub 500g
1567072	AA184669		BH06		A	Amber Glass 250ml
1567072	AA184669		BH06		A	Plastic Tub 500g
1567073	AA184668		BH08		A	Amber Glass 250ml
1567073	AA184668		BH08		A	Plastic Tub 500g
1567074	AA174678		BH10		A	Amber Glass 250ml
1567074	AA174678		BH10		A	Plastic Tub 500g
1567075	AA184675		BH12		A	Amber Glass 250ml
1567075	AA184675		BH12		A	Plastic Tub 500g
1567076	AA186957		TP01		A	Amber Glass 250ml
1567076	AA186957		TP01		A	Plastic Tub 500g
1567077	AA181997		TP02		A	Amber Glass 250ml
1567077	AA181997		TP02		A	Plastic Tub 500g
1567078	AA186953		TP03		A	Amber Glass 250ml
1567078	AA186953		TP03		A	Plastic Tub 500g
1567080	AA186979		TP06		A	Amber Glass 250ml
1567080	AA186979		TP06		A	Plastic Tub 500g
1567081	AA186963		TP07		A	Amber Glass 250ml
1567081	AA186963		TP07		A	Plastic Tub 500g

Deviations

In accordance with UKAS Policy on Deviating Samples TPS 63. Chemtest have a procedure to ensure 'upon receipt of each sample a competent laboratory shall assess whether the sample is suitable with regard to the requested test(s)'. This policy and the respective holding times applied, can be supplied upon request. The reason a sample is declared as deviating is detailed below. Where applicable the analysis remains UKAS/MCERTs accredited but the results may be compromised.

Sample:	Sample Ref:	Sample ID:	Sample Location:	Sampled Date:	Deviation Code(s):	Containers Received:
1567083	AA186975		TP09		A	Amber Glass 250ml
1567083	AA186975		TP09		A	Plastic Tub 500g
1567084	AA186969		TP10		A	Amber Glass 250ml
1567084	AA186969		TP10		A	Plastic Tub 500g
1567085	AA185474		TP13		A	Amber Glass 250ml
1567085	AA185474		TP13		A	Plastic Tub 500g
1567086	AA185457		TP14		A	Amber Glass 250ml
1567086	AA185457		TP14		A	Plastic Tub 500g
1567087	AA185458		TP14		A	Amber Glass 250ml
1567087	AA185458		TP14		A	Plastic Tub 500g
1567088	AA185478		TP15		A	Amber Glass 250ml
1567088	AA185478		TP15		A	Plastic Tub 500g
1567090	AA185464		TP18		A	Amber Glass 250ml
1567090	AA185464		TP18		A	Plastic Tub 500g
1567091	AA185488		TP20		A	Amber Glass 250ml
1567091	AA185488		TP20		A	Plastic Tub 500g
1567092	AA185498		TP22		A	Amber Glass 250ml
1567092	AA185498		TP22		A	Plastic Tub 500g
1567093	AA181957		TP23		A	Amber Glass 250ml
1567093	AA181957		TP23		A	Plastic Tub 500g
1567095	AA181975		TP26		A	Amber Glass 250ml
1567095	AA181975		TP26		A	Plastic Tub 500g

Deviations

In accordance with UKAS Policy on Deviating Samples TPS 63. Chemtest have a procedure to ensure 'upon receipt of each sample a competent laboratory shall assess whether the sample is suitable with regard to the requested test(s)'. This policy and the respective holding times applied, can be supplied upon request. The reason a sample is declared as deviating is detailed below. Where applicable the analysis remains UKAS/MCERTs accredited but the results may be compromised.

Sample:	Sample Ref:	Sample ID:	Sample Location:	Sampled Date:	Deviation Code(s):	Containers Received:
1567096	AA181976		TP26		A	Amber Glass 250ml
1567096	AA181976		TP26		A	Plastic Tub 500g
1567097	AA181972		TP27		A	Amber Glass 250ml
1567097	AA181972		TP27		A	Plastic Tub 500g
1567098	AA181969		TP28		A	Amber Glass 250ml
1567098	AA181969		TP28		A	Plastic Tub 500g
1567099	AA181966		TP29		A	Amber Glass 250ml
1567099	AA181966		TP29		A	Plastic Tub 500g
1567101	AA181992		TP31		A	Amber Glass 250ml
1567101	AA181992		TP31		A	Plastic Tub 500g
1567102	AA181994		TP32		A	Amber Glass 250ml
1567102	AA181994		TP32		A	Plastic Tub 500g
1567103	AA181995		TP32		A	Amber Glass 250ml
1567103	AA181995		TP32		A	Plastic Tub 500g
1567104	AA181989		TP33		A	Amber Glass 250ml
1567104	AA181989		TP33		A	Plastic Tub 500g
1567105	AA181987		TP34		A	Amber Glass 250ml
1567105	AA181987		TP34		A	Plastic Tub 500g

Test Methods

SOP	Title	Parameters included	Method summary
1020	Electrical Conductivity and Total Dissolved Solids (TDS) in Waters	Electrical Conductivity and Total Dissolved Solids (TDS) in Waters	Conductivity Meter
1220	Anions, Alkalinity & Ammonium in Waters	Fluoride; Chloride; Nitrite; Nitrate; Total; Oxidisable Nitrogen (TON); Sulfate; Phosphate; Alkalinity; Ammonium	Automated colorimetric analysis using 'Aquakem 600' Discrete Analyser.
1455	Metals in Waters by ICP-MS	Metals, including: Antimony; Arsenic; Barium; Beryllium; Boron; Cadmium; Chromium; Cobalt; Copper; Lead; Manganese; Mercury; Molybdenum; Nickel; Selenium; Tin; Vanadium; Zinc	Filtration of samples followed by direct determination by inductively coupled plasma mass spectrometry (ICP-MS).
1610	Total/Dissolved Organic Carbon in Waters	Organic Carbon	TOC Analyser using Catalytic Oxidation
1920	Phenols in Waters by HPLC	Phenolic compounds including: Phenol, Cresols, Xylenols, Trimethylphenols Note: Chlorophenols are excluded.	Determination by High Performance Liquid Chromatography (HPLC) using electrochemical detection.
2010	pH Value of Soils	pH	pH Meter
2015	Acid Neutralisation Capacity	Acid Reserve	Titration
2030	Moisture and Stone Content of Soils(Requirement of MCERTS)	Moisture content	Determination of moisture content of soil as a percentage of its as received mass obtained at <37°C.
2040	Soil Description(Requirement of MCERTS)	Soil description	As received soil is described based upon BS5930
2120	Water Soluble Boron, Sulphate, Magnesium & Chromium	Boron; Sulphate; Magnesium; Chromium	Aqueous extraction / ICP-OES
2175	Total Sulphur in Soils	Total Sulphur	Determined by high temperature combustion under oxygen, using an Eltra elemental analyser.
2180	Sulphur (Elemental) in Soils by HPLC	Sulphur	Dichloromethane extraction / HPLC with UV detection
2192	Asbestos	Asbestos	Polarised light microscopy / Gravimetry
2300	Cyanides & Thiocyanate in Soils	Free (or easy liberatable) Cyanide; total Cyanide; complex Cyanide; Thiocyanate	Alkaline extraction followed by colorimetric determination using Automated Flow Injection Analyser.
2430	Total Sulphate in soils	Total Sulphate	Acid digestion followed by determination of sulphate in extract by ICP-OES.
2455	Acid Soluble Metals in Soils	Metals, including: Arsenic; Barium; Beryllium; Cadmium; Chromium; Cobalt; Copper; Lead; Manganese; Mercury; Molybdenum; Nickel; Selenium; Vanadium; Zinc	Acid digestion followed by determination of metals in extract by ICP-MS.
2490	Hexavalent Chromium in Soils	Chromium [VI]	Soil extracts are prepared by extracting dried and ground soil samples into boiling water. Chromium [VI] is determined by 'Aquakem 600' Discrete Analyser using 1,5-diphenylcarbazide.
2610	Loss on Ignition	loss on ignition (LOI)	Determination of the proportion by mass that is lost from a soil by ignition at 550°C.
2625	Total Organic Carbon in Soils	Total organic Carbon (TOC)	Determined by high temperature combustion under oxygen, using an Eltra elemental analyser.
2670	Total Petroleum Hydrocarbons (TPH) in Soils by GC-FID	TPH (C6–C40); optional carbon banding, e.g. 3-band – GRO, DRO & LRO*TPH C8–C40	Dichloromethane extraction / GC-FID
2680	TPH A/A Split	Aliphatics: >C5–C6, >C6–C8,>C8–C10, >C10–C12, >C12–C16, >C16–C21, >C21–C35, >C35– C44Aromatics: >C5–C7, >C7–C8, >C8– C10, >C10–C12, >C12–C16, >C16– C21, >C21– C35, >C35– C44	Dichloromethane extraction / GCxGC FID detection

Test Methods

SOP	Title	Parameters included	Method summary
2700	Speciated Polynuclear Aromatic Hydrocarbons (PAH) in Soil by GC-FID	Acenaphthene; Acenaphthylene; Anthracene; Benzo[a]Anthracene; Benzo[a]Pyrene; Benzo[b]Fluoranthene; Benzo[ghi]Perylene; Benzo[k]Fluoranthene; Chrysene; Dibenzo[ah]Anthracene; Fluoranthene; Fluorene; Indeno[123cd]Pyrene; Naphthalene; Phenanthrene; Pyrene	Dichloromethane extraction / GC-FID (GC-FID detection is non-selective and can be subject to interference from co-eluting compounds)
2760	Volatile Organic Compounds (VOCs) in Soils by Headspace GC-MS	Volatile organic compounds, including BTEX and halogenated Aliphatic/Aromatics.(cf. USEPA Method 8260)*please refer to UKAS schedule	Automated headspace gas chromatographic (GC) analysis of a soil sample, as received, with mass spectrometric (MS) detection of volatile organic compounds.
2790	Semi-Volatile Organic Compounds (SVOCs) in Soils by GC-MS	Semi-volatile organic compounds(cf. USEPA Method 8270)	Acetone/Hexane extraction / GC-MS
2800	Speciated Polynuclear Aromatic Hydrocarbons (PAH) in Soil by GC-MS	Acenaphthene*; Acenaphthylene; Anthracene*; Benzo[a]Anthracene*; Benzo[a]Pyrene*; Benzo[b]Fluoranthene*; Benzo[ghi]Perylene*; Benzo[k]Fluoranthene; Chrysene*; Dibenzo[ah]Anthracene; Fluoranthene*; Fluorene*; Indeno[123cd]Pyrene*; Naphthalene*; Phenanthrene*; Pyrene*	Dichloromethane extraction / GC-MS
2810	Polychlorinated Biphenyls (PCB) as Aroclors in Soils by GC-ECD	Polychlorinated Biphenyls expressed as an Aroclor (normally reported as *Aroclor 1242)	Extraction of a soil sample, as received, into hexane/acetone (50:50) followed by gas chromatography (GC) using mass spectrometric (MS) detection for identification of polychlorinated biphenyls and electron capture detection (ECD) for quantitation if present.
2815	Polychlorinated Biphenyls (PCB) ICES7 Congeners in Soils by GC-MS	ICES7 PCB congeners	Acetone/Hexane extraction / GC-MS
2920	Phenols in Soils by HPLC	Phenolic compounds including Resorcinol, Phenol, Methylphenols, Dimethylphenols, 1-Naphthol and TrimethylphenolsNote: chlorophenols are excluded.	60:40 methanol/water mixture extraction, followed by HPLC determination using electrochemical detection.
640	Characterisation of Waste (Leaching C10)	Waste material including soil, sludges and granular waste	ComplianceTest for Leaching of Granular Waste Material and Sludge

Report Information

Key

U	UKAS accredited
M	MCERTS and UKAS accredited
N	Unaccredited
S	This analysis has been subcontracted to a UKAS accredited laboratory that is accredited for this analysis
SN	This analysis has been subcontracted to a UKAS accredited laboratory that is not accredited for this analysis
T	This analysis has been subcontracted to an unaccredited laboratory
I/S	Insufficient Sample
U/S	Unsuitable Sample
N/E	not evaluated
<	"less than"
>	"greater than"
SOP	Standard operating procedure
LOD	Limit of detection

Comments or interpretations are beyond the scope of UKAS accreditation

The results relate only to the items tested

Uncertainty of measurement for the determinands tested are available upon request

None of the results in this report have been recovery corrected

All results are expressed on a dry weight basis

The following tests were analysed on samples as received and the results subsequently corrected to a dry weight basis TPH, BTEX, VOCs, SVOCs, PCBs, Phenols

For all other tests the samples were dried at < 37°C prior to analysis

All Asbestos testing is performed at the indicated laboratory

Issue numbers are sequential starting with 1 all subsequent reports are incremented by 1

Sample Deviation Codes

A - Date of sampling not supplied

B - Sample age exceeds stability time (sampling to extraction)

C - Sample not received in appropriate containers

D - Broken Container

E - Insufficient Sample (Applies to LOI in Trommel Fines Only)

Sample Retention and Disposal

All soil samples will be retained for a period of 30 days from the date of receipt

All water samples will be retained for 14 days from the date of receipt

Charges may apply to extended sample storage

If you require extended retention of samples, please email your requirements to:
customerservices@chemtest.com



Eurofins Chemtest Ltd
Depot Road
Newmarket
CB8 0AL

Tel: 01638 606070
Email: info@chemtest.com

Final Report

Report No.:	22-48622-1		
Initial Date of Issue:	05-Jan-2023		
Client	IGSL		
Client Address:	M7 Business Park Naas County Kildare Ireland		
Contact(s):	Darren Keogh		
Project	24330 Halversown Naas Proposed Data Centre Sites (DOBA)		
Quotation No.:	Q20-21693	Date Received:	20-Dec-2022
Order No.:		Date Instructed:	20-Dec-2022
No. of Samples:	10		
Turnaround (Wkdays):	7	Results Due:	04-Jan-2023
Date Approved:	05-Jan-2023		
Approved By:			
Details:	Stuart Henderson, Technical Manager		

Results - Soil

Project: 24330 Halversown Naas Proposed Data Centre Sites (DOBA)

Client: IGSL	Chemtest Job No.:				22-48622	22-48622	22-48622	22-48622	22-48622	22-48622	22-48622	22-48622	22-48622	22-48622
Quotation No.: Q20-21693	Chemtest Sample ID.:				1567189	1567190	1567191	1567192	1567193	1567194	1567196	1567197	1567198	1567199
Order No.:	Client Sample Ref.:				AA184687	AA184690	AA184670	AA184673	AA184679	AA184677	AA186982	AA185481	AA185468	AA181975
	Sample Location:				BH01	BH03	BH05	BH07	BH09	BH11	TP04	TP12	TP19	TP26
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				1.00	1.00	1.00	1.00	1.00	1.00	0.60	0.50	0.50	0.50
Determinand	Accred.	SOP	Units	LOD										
Moisture	N	2030	%	0.020	14	13	10	28	14	21	16	11	9.3	17
pH (2.5:1)	N	2010		4.0	[A] 8.5	[A] 8.7	[A] 8.5	[A] 8.3	[A] 8.6	[A] 8.2	[A] 8.5	[A] 8.4	[A] 8.6	[A] 8.4
Magnesium (Water Soluble)	N	2120	g/l	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Sulphate (2:1 Water Soluble) as SO ₄	U	2120	g/l	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Total Sulphur	U	2175	%	0.010	[A] 0.032	[A] 0.051	[A] < 0.010	[A] 0.026	[A] < 0.010	[A] < 0.010	[A] 0.013	[A] 0.015	[A] 0.25	[A] 0.099
Chloride (Water Soluble)	U	2220	g/l	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Nitrate (Water Soluble)	N	2220	g/l	0.010	0.011	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
Ammonium (Water Soluble)	U	2220	g/l	0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01
Sulphate (Acid Soluble)	U	2430	%	0.010	[A] 0.11	[A] 0.024	[A] 0.037	[A] 0.074	[A] 0.024	[A] 0.036	[A] 0.026	[A] 0.015	[A] 0.019	[A] 0.030

Deviations

In accordance with UKAS Policy on Deviating Samples TPS 63. Chemtest have a procedure to ensure 'upon receipt of each sample a competent laboratory shall assess whether the sample is suitable with regard to the requested test(s)'. This policy and the respective holding times applied, can be supplied upon request. The reason a sample is declared as deviating is detailed below. Where applicable the analysis remains UKAS/MCERTs accredited but the results may be compromised.

Sample:	Sample Ref:	Sample ID:	Sample Location:	Sampled Date:	Deviation Code(s):	Containers Received:
1567189	AA184687		BH01		A	Amber Glass 250ml
1567189	AA184687		BH01		A	Plastic Tub 500g
1567190	AA184690		BH03		A	Amber Glass 250ml
1567190	AA184690		BH03		A	Plastic Tub 500g
1567191	AA184670		BH05		A	Amber Glass 250ml
1567191	AA184670		BH05		A	Plastic Tub 500g
1567192	AA184673		BH07		A	Amber Glass 250ml
1567192	AA184673		BH07		A	Plastic Tub 500g
1567193	AA184679		BH09		A	Amber Glass 250ml
1567193	AA184679		BH09		A	Plastic Tub 500g
1567194	AA184677		BH11		A	Amber Glass 250ml
1567194	AA184677		BH11		A	Plastic Tub 500g
1567196	AA186982		TP04		A	Amber Glass 250ml
1567196	AA186982		TP04		A	Plastic Tub 500g
1567197	AA185481		TP12		A	Amber Glass 250ml
1567197	AA185481		TP12		A	Plastic Tub 500g
1567198	AA185468		TP19		A	Amber Glass 250ml
1567198	AA185468		TP19		A	Plastic Tub 500g
1567199	AA181975		TP26		A	Amber Glass 250ml
1567199	AA181975		TP26		A	Plastic Tub 500g

Test Methods

SOP	Title	Parameters included	Method summary
2010	pH Value of Soils	pH	pH Meter
2030	Moisture and Stone Content of Soils(Requirement of MCERTS)	Moisture content	Determination of moisture content of soil as a percentage of its as received mass obtained at <37°C.
2040	Soil Description(Requirement of MCERTS)	Soil description	As received soil is described based upon BS5930
2120	Water Soluble Boron, Sulphate, Magnesium & Chromium	Boron; Sulphate; Magnesium; Chromium	Aqueous extraction / ICP-OES
2175	Total Sulphur in Soils	Total Sulphur	Determined by high temperature combustion under oxygen, using an Eltra elemental analyser.
2220	Water soluble Chloride in Soils	Chloride	Aqueous extraction and measurement by 'Aquakem 600' Discrete Analyser using ferric nitrate / mercuric thiocyanate.
2430	Total Sulphate in soils	Total Sulphate	Acid digestion followed by determination of sulphate in extract by ICP-OES.

Report Information

Key

U	UKAS accredited
M	MCERTS and UKAS accredited
N	Unaccredited
S	This analysis has been subcontracted to a UKAS accredited laboratory that is accredited for this analysis
SN	This analysis has been subcontracted to a UKAS accredited laboratory that is not accredited for this analysis
T	This analysis has been subcontracted to an unaccredited laboratory
I/S	Insufficient Sample
U/S	Unsuitable Sample
N/E	not evaluated
<	"less than"
>	"greater than"
SOP	Standard operating procedure
LOD	Limit of detection

Comments or interpretations are beyond the scope of UKAS accreditation

The results relate only to the items tested

Uncertainty of measurement for the determinands tested are available upon request

None of the results in this report have been recovery corrected

All results are expressed on a dry weight basis

The following tests were analysed on samples as received and the results subsequently corrected to a dry weight basis TPH, BTEX, VOCs, SVOCs, PCBs, Phenols

For all other tests the samples were dried at < 37°C prior to analysis

All Asbestos testing is performed at the indicated laboratory

Issue numbers are sequential starting with 1 all subsequent reports are incremented by 1

Sample Deviation Codes

A - Date of sampling not supplied

B - Sample age exceeds stability time (sampling to extraction)

C - Sample not received in appropriate containers

D - Broken Container

E - Insufficient Sample (Applies to LOI in Trommel Fines Only)

Sample Retention and Disposal

All soil samples will be retained for a period of 30 days from the date of receipt

All water samples will be retained for 14 days from the date of receipt

Charges may apply to extended sample storage

If you require extended retention of samples, please email your requirements to:
customerservices@chemtest.com



7 - 11 Harding Street
Leicester
LE1 4DH

IGSL
Unit F
M7 Business Park
Naas

Analytical Test Report: L23/00718/IGS - 23-32082

Your Project Reference:	24330 Halverstown Naas		
Your Order Number:	21187	Samples Received / Instructed:	15/02/2023 / 15/02/2023
Report Issue Number:	1	Sample Tested:	15/02 to 22/02/2023
Samples Analysed:	5 aggregate samples	Report issued:	23/02/2023

Signed

James Gane
Analytical Services Manager
CTS Group

Notes:

General

Please refer to Methodologies page for details pertaining to the analytical methods undertaken.

Samples will be retained for 14 days after issue of this report unless otherwise requested.

Moisture Content was determined in accordance with CTS method statement MS - CL - Sample Prep, oven dried at <30°C.

Moisture Content is reported as a percentage of the dry mass of soil, this calculation is in accordance with BS1377, Part 2, 1990, Clause 3.2

Where specification limits are included these are for guidance only. Where a measured value has been highlighted this is not implying acceptance or failure and certainty of measurement values have not been taken into account.

Uncertainty of measurement values are available on request.

Samples were supplied by customer, results apply to the samples as received.

Deviating Samples

On receipt samples are compared against our sample holding and handling protocols, where any deviations have been noted these are reported on our deviating sample page (if present)

Accreditation Key

UKAS = UKAS Accreditation, MCERTS = MCERTS Accreditation, u = Unaccredited

MCERTS Accreditation only covers the SAND, CLAY and LOAM matrices

Date of Issue: 23.09.2022

Issued by: J. Gane

Issue No: 1

Rev No: 1



7 - 11 Harding Street
Leicester
LE1 4DH

L23/00718/IGS - 23-32082

Project Reference - 24330 Halverstown Naas

Analytical Test Results - Chemical Analysis

Lab Reference			279664	279665	279666	279667	279668
Client Sample ID			A22/7562	A22/7575	A22/7568	A22/7563	A22/7578
Material			Soil	Soil	Soil	Soil	Soil
Source/Client Reference			TP04@ 0.6m	TP026@ 0.5m	TP19 @ 0.5m	TP12@ 0.5m	TP31@ 0.5m
Sample Matrix			Sand	Sand	Sand	Sand	Sand
Determinant	Units	Accreditation					
Water soluble sulphate	(mg/l)	u	< 10	< 10	< 10	< 10	< 10
Acid Soluble Sulphate	(%)	u	0.07	0.06	0.05	0.05	0.20
Total Sulphur	(%)	UKAS	0.03	0.03	0.03	0.03	0.08
pH Value	pH Units	MCERTS	12.7	12.6	12.8	12.5	12.6



7 - 11 Harding Street
Leicester
LE1 4DH

L23/00718/IGS - 23-32082

Project Reference - 24330 Halverstown Naas

Sample Descriptions

Lab Reference	Client Sample ID	Material	Source/Client Reference	Description	Moisture Content (%)	Stone Content (%)	Passing 2mm test sieve (%)
279664	A22/7562	Soil	TP04@0.6m	Mottled brown very gravelly silty sand	-	-	40
279665	A22/7575	Soil	TP026@0.5m	Mottled brown very gravelly silty sand	-	-	57
279666	A22/7568	Soil	TP19@0.5m	Mottled brown very gravelly silty sand	-	-	52
279667	A22/7563	Soil	TP12@0.5m	Mottled brown very gravelly silty sand	-	-	61
279668	A22/7578	Soil	TP31@0.5m	Mottled brown very gravelly silty sand	-	-	55



7 - 11 Harding Street
Leicester
LE1 4DH

L23/00718/IGS - 23-32082

Project Reference - 24330 Halverstown Naas

Sample Comments

Lab Reference	Client Sample ID	Material	Source/Client Reference	Comments
279664	A22/7562	Soil	TP04@0.6m	
279665	A22/7575	Soil	TP026@0.5m	
279666	A22/7568	Soil	TP19@0.5m	
279667	A22/7563	Soil	TP12@0.5m	
279668	A22/7578	Soil	TP31@0.5m	



7 - 11 Harding Street
Leicester
LE1 4DH

L23/00718/IGS - 23-32082

Project Reference - 24330 Halverstown Naas

Analysis Methodologies

Test Code	Test Name / Reference	Sample condition for analysis	Sample Preparation	Test Details
ANIONSS	MS - CL - Anions by Aquakem (2:1Extract)	Oven dried	Passing 2mm test sieve	Determination of Anions (inc Sulphate, chloride etc.) in soils by Aquakem. Analysis is based on a 2:1 water to soil extraction ratio
PHS	MS - CL - pH in Soils	As received	Passing 10mm test sieve	Determination of pH in soils using a pH probe (using a 1:3 soil to water extraction)
ASSO4S	MS - CL - Acid Soluble Sulphate	Oven Dried	Passing 2mm test sieve	Determination of total sulphate in soils by acid extraction followed by ICP analysis
SAMPLEPREP	MS - CL - Sample Preparation	-	-	Preparation of samples (including determination of moisture content) to allow for subsequent analysis
1377TS-ELT	BS1377 Total Sulphur Content by HTC	Oven dried	BS1377 : Part 1 : 2016	Total Sulphur Content testing of Soil in accordance with BS 1377 : Part 3 : 2018 + A1 : 2021 Clause 7.10 (using Eltra CS-800 Analyser)



L23/00718/IGS - 23-32082

Project Reference - 24330 Halverstown Naas

Sample Deviations

Deviations are listed below against each sample and associated test method, where deviation(s) are noted it means data may not be representative of the sample at the time of sampling and it is possible that results provided may be compromised.

Observations on receipt

A - No date of sampling provided

C - Received in inappropriate container

H - Contains headspace

T - Temperature on receipt exceeds storage temperature

R - Date of sampling to receipt insufficient to allow analysis to be completed without deviation, Please note this is only a deviation if 'X' is also recorded against the sample

Observations whilst in laboratory

X - Exceeds sampling to extraction or analysis timescales

Lab Reference	Client Sample ID	Material	Source/Client Reference	Test	Deviations
279664	A22/7562	Soil	TP04@0.6m		A
279665	A22/7575	Soil	TP026@0.5m		A
279666	A22/7568	Soil	TP19@0.5m		A
279667	A22/7563	Soil	TP12@0.5m		A
279668	A22/7578	Soil	TP31@0.5m		A

Appendix 13

Waste Characterisation Report (OCM)

Unit 15
Melbourne Business Park
Model Farm Road
Cork T12 WR89



T: 021 434 5366
E: admin@ocallaghanmoran.com
www.ocallaghanmoran.com

Waste Characterisation Assessment

Lands at Halverstown

Naas

Co. Kildare

Prepared For: -

IGSL Limited
Unit F
M7 Business Park
Naas
County Kildare

Prepared By: -

O'Callaghan Moran & Associates
Unit 15 Melbourne Business Park
Model Farm Road
Cork

February 2023

Project	Waste Characterisation: Halverstown, Naas, Co. Kildare			
Client	IGSL Limited			
Report No	Date	Status	Prepared By	Reviewed By
230010101	15/02/2023	Final	Austin Hynes PGeo MSc	Sean Moran B.Sc. MSc

TABLE OF CONTENTS

	<u>PAGE</u>
1 INTRODUCTION	1
1.1 METHODOLOGY.....	1
2 WASTE CLASSIFICATION ASSESSMENT	2
2.1 SOIL SAMPLING AND LABORATORY ANALYSIS.....	2
2.2 WASTE CLASSIFICATION	5
2.3 WASTE ACCEPTANCE CRITERIA	6
2.4 WASTE MANAGEMENT OPTIONS	8
3 CONCLUSIONS AND RECOMMENDATIONS	10
3.1 CONCLUSIONS	10
3.2 RECOMMENDATIONS	10

APPENDICES

APPENDIX 1	-	Trial Pit Logs
APPENDIX 2	-	Laboratory Results
APPENDIX 3	-	Waste Classification Report

1 INTRODUCTION

IGSL Limited requested O’Callaghan Moran & Associates (OCM) to undertake a waste characterisation assessment of five (5 No.) samples of natural ground collected from five (5 No.) trial pits from lands at Halverstown, Naas, Co. Kildare.

1.1 Methodology

IGSL provided a description of the ground conditions and collected samples of the soils from the trial pit locations. The samples were analysed at an accredited laboratory and the results formed the basis for a waste classification assessment, which was undertaken by OCM in accordance with the Environmental Protection Agency (EPA) Guidelines on the Classification of Waste (2015).

2 WASTE CLASSIFICATION ASSESSMENT

2.1 Soil Sampling and Laboratory Analysis

2.1.1 Site Investigation

The site investigation was completed by IGSL Limited in October 2022 and included the collection of five (5 No.) composite samples from five (5 No.) trial pits. The location of the samples is shown on Figure 2.1. The logs for the trial pits are in Appendix 1.

Each trial pit was installed in a separate field across the site area. There is topsoil at the surface of all trial pits to 0.30 mbgl. The subsurface of all trial pits comprises Natural Ground.

The subsurface of TP03 is composed of silty slight gravelly SAND to 0.80 mbgl. This is underlain by stiff, sandy gravelly SILT to 1.80 mbgl. Firm to stiff sandy gravelly CLAY was encountered between 1.80-2.20 mbgl.

At TP09, firm sandy gravelly SILT was encountered between 0.30-0.80 mbgl. This is underlain by firm, sandy gravelly SILT with cobble content to 1.60 mbgl. Silty sandy GRAVEL with cobble content was encountered to a depth of 2.40 mbgl.

TP15 is composed of firm, sandy gravelly SILT with cobble content to 1.00 mbgl. This is underlain by firm, sandy gravelly SILT to 1.70 mbgl. Soft to firm, sandy gravelly CLAY with cobble content was encountered between 1.70-2.80 mbgl.

The subsurface of TP26 comprises firm, sandy gravelly CLAY to 0.90 mbgl. Stiff, sandy gravelly CLAY with cobble content was encountered between 0.90-2.10 mbgl. This is underlain by firm to stiff, sandy gravelly CLAY with cobble content.

At TP32, firm, sandy gravelly CLAY was encountered to 0.80 mbgl. This is underlain by stiff, sandy gravelly CLAY with cobble content to 2.30 mbgl.

2.1.2 Sample Collection

IGSL collected the samples and placed them in laboratory prepared containers that were stored in coolers prior to shipment to Chemtest Ltd.

2.1.3 Laboratory Analysis

The samples were tested for metals (arsenic, barium, cadmium, chromium, copper, mercury, molybdenum, nickel, lead, antimony, selenium and zinc, total organic carbon (TOC), BTEX (benzene, toluene, ethylbenzene and xylene) aliphatic and aromatic hydrocarbons, polychlorinated biphenyls (PCB), mineral oil, polyaromatic hydrocarbons (PAH) and asbestos. Leachate generated from the samples was tested for arsenic, barium, cadmium, chromium, copper,

mercury, molybdenum, nickel, lead, antimony, selenium and zinc, chloride, fluoride, soluble sulphate, phenols, dissolved organic carbon (DOC), total dissolved solids (TDS).

This parameter range facilitates an assessment of the hazardous properties of the waste, and also allows a determination of appropriate off-site management options based on the Waste Acceptance Criteria (WAC) applied by landfill operators.

The analytical methods were all ISO/CEN approved and the method detection limits were below the relevant guidance/threshold values. The full laboratory report is in Appendix 2.



O'Callaghan Moran & Associates,
Unit 15 Melbourne Business Park,
Model Farm Road, Cork.
Tel. (021) 4345366
Email: info@ocallaghanmoran.com

Title:

Figure 2.1 Sample Location Plan

Legend

This drawing is the property of O'Callaghan Moran & Associates and shall not be used, reproduced or disclosed to anyone without the prior written permission of O'Callaghan Moran & Associates and shall be returned upon request.

Client:

IGSL Limited

2.2 Waste Classification

The Haz Waste Online Classification Engine, developed in the UK by One Touch Data Ltd, was used to determine the waste classification. This tool was developed specifically to establish whether waste is non-hazardous or hazardous and has been approved for use in Ireland by the Environmental Protection Agency. The full Waste Classification Report is in Appendix 3 and the results are summarised in Table 2.1.

Table 2.1 Waste Classification

Sample No.	Depth	Classification	LoW Code
TP3	0.5	Non-Hazardous	17 05 04
TP9	0.5	Non-Hazardous	17 05 04
TP15	0.5	Non-Hazardous	17 05 04
TP26	0.5	Non-Hazardous	17 05 04
TP32	0.5	Non-Hazardous	17 05 04

Asbestos was not detected in any of the samples tested.

All samples are classified as non-hazardous and the appropriate List of Waste Code is 17 05 04 (Soil and Stone other than those mentioned in 17 05 03*).

2.3 Waste Acceptance Criteria

The results of the WAC testing are presented in Table 2.2, which includes for comparative purposes the WAC for Inert, Non Hazardous and Hazardous Waste Landfills pursuant to Article 16 of the EU Landfill Directive 1999/31/EC Annex II which establishes criteria and procedures for the acceptance of waste at landfills.

The sample from TP26 marginally exceeds the inert WAC for Total Organic Carbon (TOC).

All other samples meet the inert WAC.

Table 2.2 WAC Results

Parameter	Unit	TP3	TP9	TP15	TP26	TP32	Inert Landfill	Inert Landfill Increased Limits	Non-Hazardous Landfill	Hazardous Landfill
Depth	m	0.5	0.5	0.5	0.5	0.5				
Antimony	mg/kg	< 0.0050	< 0.0050	< 0.0050	< 0.0050	< 0.0050	0.06	0.18	0.7	5
Arsenic	mg/kg	0.013	0.020	0.022	0.017	0.015	0.5	1.5	2	25
Barium	mg/kg	< 0.050	< 0.050	< 0.050	< 0.050	< 0.050	20	20	100	300
Cadmium	mg/kg	< 0.0011	< 0.0011	< 0.0011	< 0.0011	< 0.0011	0.04	0.04	1	5
Chromium	mg/kg	< 0.0050	0.015	0.010	< 0.0050	0.0074	0.5	0.5	10	70
Copper	mg/kg	0.024	0.022	0.020	0.016	0.010	2	2	50	100
Lead	mg/kg	< 0.0050	0.011	0.014	< 0.0050	< 0.0050	0.5	0.5	10	50
Molybdenum	mg/kg	0.0090	0.0041	0.0083	0.013	0.0062	0.5	1.5	10	30
Nickel	mg/kg	0.0050	0.016	0.012	0.0063	0.0058	0.4	0.4	10	40
Selenium	mg/kg	0.048	0.043	0.047	0.043	0.041	0.1	0.3	0.5	7
Zinc	mg/kg	0.12	0.10	0.081	0.076	0.041	4	4	50	200
Mercury	mg/kg	< 0.00050	< 0.00050	< 0.00050	< 0.00050	< 0.00050	0.01	0.01	0.2	2
Phenol	mg/kg	< 0.30	< 0.30	< 0.30	< 0.30	< 0.30	1	1	NE	NE
Fluoride	mg/kg	1.1	2.5	1.6	1.2	1.2	10	10	150	500
Chloride	mg/kg	13	< 10	< 10	< 10	< 10	800	2,400	15,000	25,000
Sulphate	mg/kg	28	13	< 10	< 10	< 10	1000*	3,000	20000*	50,000
DOC **	mg/kg	55	65	68	63	< 50	500	500	800	1,000
pH	pH units	8.7	8.6	8.7	8.4	8.9	NE	NE	NE	NE
TDS ***	mg/kg	640	300	390	540	420	4,000	12,000	60,000	100,000
TOC	%	0.23	0.29	< 0.20	3.2	0.9	3	6	NE	6
Benzene	mg/kg	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	6	6	NE	NE
Toluene	mg/kg	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	6	6	NE	NE
Ethylbenzene	mg/kg	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	6	6	NE	NE
m/p-Xylene	mg/kg	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	6	6	NE	NE
o-Xylene	mg/kg	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	6	6	NE	NE
PCB Total of 7	mg/kg	< 0.0010	< 0.0010	< 0.0010	< 0.0010	< 0.0010	1	1	NE	NE
Total 17 PAH's	mg/kg	< 0.20	< 0.20	< 0.20	< 0.20	< 0.20	NE	100	NE	NE
Mineral Oil	mg/kg	< 10	< 10	< 10	< 10	< 10	500	500	NE	NE
Asbestos	% mass	NAD	NAD	NAD	NAD	NAD	NE	NE	NE	NE

NAD denotes No Asbestos Detected

* denotes sulphate level exceeding inert waste limit may be considered as complying if the TDS value does not exceed 6,000mg/kg at L/S = 10l/kg.

** denotes a higher limit may be accepted provided the DOC alternative values of 500mg/kg is achieved

*** denotes TDS. The values for TDS can be used to sulphate and chloride.

 PAH over 1mg/kg and Mineral Oil over 50 mg/kg exceeds limit at soil recovery site in Ireland

2.4 Waste Management Options

All of the soils are suitable for retention on site for landscaping or similar purposes. However if the soils are removed from the site options for recovery or disposal are outlined in this section.

The EPA has issued guidance on acceptance criteria for a range of parameters for soil recovery sites. This includes;

- Metals (solid conc. not leachability) in soil and stone (including As, Cd, Cr, Cu, Hg, Ni, Pb, Zn);
- Total organic carbon in soil and stone;
- Total BTEX (benzene, toluene, ethylbenzene, xylenes) in soil and stone;
- Mineral oil in soil and stone;
- Polycyclic aromatic hydrocarbons (PAHs) in soil and stone;
- Polychlorinated Biphenyls (PCBs) in soil and stone;
- Asbestos fibres in soil and stone.

The guidance requires that soils from brownfield sites should not exceed the limits for the parameters specified in Table 2.3 and 2.4. For metals limits have been specified for a range of soil types nationally separated into six domain areas.

Table 2.3 Soil Recovery Site Criteria

Parameter	Limit for Soil Recovery Sites
Total BTEX	0.05 mg/kg
Mineral Oil	50 mg/kg
Total PAHs	1 mg/kg
Total PCBs	0.05 mg/kg

All samples which meet the Inert WAC meet the soil recovery criteria for BTEX, Mineral Oil, PAH's and PCB's.

The soil and stone cannot be sent to soil recovery sites if the trigger levels for a particular domain are exceeded. There is however some flexibility in applying the limits. A derogation applies where up to three parameters can exceed the limit for a sample provided the concentration in the samples is no more than 1.5 times the trigger level. The site which is subject to this investigation is located in Domain 2 and the trigger levels are listed in Table 2.4.

Table 2.4 Soil Recovery Trigger Levels

		Domain 2 Trigger Level	1.5 times Trigger Level
Arsenic	mg/kg	24.90	37.35
Cadmium	mg/kg	3.28	4.92
Chromium	mg/kg	50.30	75.45
Copper	mg/kg	63.50	95.25
Mercury	mg/kg	0.36	0.54
Nickel	mg/kg	61.90	92.85
Lead	mg/kg	86.10	129.15
Zinc	mg/kg	197.00	295.5

All samples meet the soil recovery criteria for metal concentrations.

Waste management options are summarised on Table 2.5. All are subject to approval of the waste management facility operators. The sample from TP-26 marginally exceeded the TOC limit but the level exceedance is not considered to be significant and the sample is therefore considered to meet Class A for recovery purposes subject to approval of the facility operator. If it is not accepted then it must be sent to a facility that can accept Class B-1 material (inert waste increased limits). Class A material is suitable for soil recovery at permitted soil recovery sites.

Table 2.5 Waste Management Options

Sample No.	Depth	Classification	LoW Code	Category
TP3	0.5	Non-Hazardous	17 05 04	A
TP9	0.5	Non-Hazardous	17 05 04	A
TP15	0.5	Non-Hazardous	17 05 04	A
TP26	0.5	Non-Hazardous	17 05 04	A
TP32	0.5	Non-Hazardous	17 05 04	A

A	Meets Soil Recovery Criteria

3 CONCLUSIONS AND RECOMMENDATIONS

3.1 Conclusions

3.1.1 *Waste Classification*

Asbestos was not detected in any of the samples tested.

All samples are classified as non-hazardous and the appropriate List of Waste Code is 17 05 04 (Soil and Stone other than those mentioned in 17 05 03*).

If the soils have to be removed from the site the recovery/disposal options are discussed in Section 2.4.

3.2 Recommendations

OCM recommend that a copy of this report be provided in full to the relevant waste management facilities to which the made ground and subsoils will be consigned to confirm its suitability for acceptance.

Appendix 1

Trial Pit Logs



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. TP03

SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,128.56 E
719,683.63 N

DATE STARTED 18/10/2022

DATE COMPLETED 18/10/2022




CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 80.45



EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Brownish grey slightly gravelly silty SAND. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.		0.30	80.15		AA186953	B	0.50-0.60	39 31 34	
	Stiff grey mottled orange sandy gravelly SILT. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded.		0.80	79.65		AA186954	B	1.20-1.20		
1.0										
	Firm to stiff brown sandy gravelly clayey SILT with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.80	78.65		AA186955	B	1.80-1.80		
2.0										
	Brownish grey very gravelly silty SAND with medium cobbles and occasional boulders. Sand is fine to medium. Gravel is fine to coarse subangular to subrounded. Cobbles and boulders are subrounded to rounded of limestone.		2.20	78.25		AA186956	B	2.50-2.60		
3.0	End of Trial Pit at 2.90m		2.90	77.55						

Groundwater Conditions
Dry**Stability**
Slightly unstable from 2.20m**General Remarks**
Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings.

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP09		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,274.81 E 719,546.61 N			DATE STARTED 19/10/2022		DATE COMPLETED 19/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 79.66			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm grey mottled orange sandy gravelly SILT with silty sand lenses. Sand is fine to coarse. Gravel is fine to coarse subrounded.		0.30	79.36		AA186975	B	0.50-0.60	40 38 46 60 63 67	
	Firm greyish brown sandy gravelly clayey SILT with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.80	78.86		AA186976	B	1.20-1.30		
1.0	Brown silty sandy GRAVEL with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		1.60	78.06		AA186977	B	1.90-2.00		
2.0	Side wall collapse at 1.60m									
	Firm dark grey very sandy gravelly clayey SILT with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone. (Recovered wet)		2.40	77.26	↓ (Seepage)	AA186978	B	2.50-2.60		
3.0	End of Trial Pit at 3.00m		3.00	76.66						
Groundwater Conditions Seepage at 2.50m										
Stability Unstable, side wall collapse from 1.60m										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 18/1/23

		TRIAL PIT RECORD						REPORT NUMBER 24330		
CONTRACT Halverstown						TRIAL PIT NO. TP26		SHEET Sheet 1 of 1		
LOGGED BY MB			CO-ORDINATES 686,611.58 E 719,726.52 N			DATE STARTED 13/10/2022		DATE COMPLETED 13/10/2022		
CLIENT ENGINEER DOBA			GROUND LEVEL (m) 83.00			EXCAVATION METHOD 7t Hitachi				
	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy silty CLAY. Sand is fine to coarse. Gravel is fine to medium subrounded.									
	Firm brown sandy gravelly silty CLAY with root hairs. Sand is fine to coarse. Gravel is fine to coarse subangular to subrounded.		0.30	82.70		AA181975	B	0.50-0.60	38 46 42 66 73 68	
1.0	Stiff brown very sandy very gravelly silty CLAY with a medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		0.90	82.10		AA181976	B	1.30-1.40		
	Boulder at 1.80m (up to 400mm)									
2.0	Firm to stiff brown sandy very gravelly silty CLAY with a low cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		2.10	80.90		AA181978	B	2.40-2.50		
	End of Trial Pit at 2.70m		2.70	80.30						
3.0										
Groundwater Conditions Dry										
Stability Good										
General Remarks Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings.										

IGSL TP LOG 24330.GPJ IGSL GDT 18/1/23



TRIAL PIT RECORD

REPORT NUMBER

24330

CONTRACT Halverstown

TRIAL PIT NO. TP32

SHEET Sheet 1 of 1

LOGGED BY MB

CO-ORDINATES 686,084.15 E
719,879.36 N

DATE STARTED 17/10/2022

DATE COMPLETED 17/10/2022

CLIENT
ENGINEER DOBA

GROUND LEVEL (m) 83.16

EXCAVATION
METHOD 7t Hitachi

	Geotechnical Description	Legend	Depth (m)	Elevation	Water Strike	Samples			Vane Test (KPa)	Hand Penetrometer (KPa)
						Sample Ref	Type	Depth		
0.0	TOPSOIL: Soft brown gravelly sandy CLAY with rootlets. Sand is fine to coarse. Gravel is fine to medium subrounded.		0.30	82.86		AA181994	B	0.50-0.60	25 34 29	
	Firm brown very sandy slightly gravelly silty CLAY. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.		0.80	82.36					50 56 58	
1.0	Stiff brown very sandy slightly silty gravelly CLAY with a medium cobble content. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles are subrounded to rounded of limestone.					AA181995	B	1.40-1.50		
2.0	Stiff greyish brown sandy gravelly clayey SILT with a medium cobble content and occasional boulders. Sand is fine to coarse. Gravel is fine to coarse subrounded. Cobbles and boulders are subrounded to rounded of limestone.		2.30	80.86		AA181996	B	2.50-2.60		
3.0	End of Trial Pit at 2.30m		2.80	80.36						

Groundwater Conditions
DryStability
Good

General Remarks

Pit footprint scanned using cable avoidance tool [CAT]. Pit backfilled with arisings.

Appendix 2
Laboratory Report



Eurofins Chemtest Ltd
Depot Road
Newmarket
CB8 0AL

Tel: 01638 606070

Email: info@chemtest.com

Final Report

Report No.: 23-02702-1
Initial Date of Issue: 13-Feb-2023
Client: IGSL
Client Address: M7 Business Park
Naas
County Kildare
Ireland
Contact(s): Darren Keogh
Project: Halverstown
Quotation No.: Q20-19951
Order No.:
No. of Samples: 5
Turnaround (Wkdays): 7
Date Approved: 13-Feb-2023
Approved By:

Date Received:	30-Jan-2023
Date Instructed:	30-Jan-2023
Results Due:	07-Feb-2023

Details: Stuart Henderson, Technical
Manager

Results - Leachate

Project: Halverstown

Client: IGSL	Chemtest Job No.:					23-02702	23-02702	23-02702	23-02702	23-02702
Quotation No.: Q20-19951	Chemtest Sample ID.:					1580840	1580841	1580842	1580843	1580844
	Client Sample ID.:					TP3	TP9	TP15	TP26	TP32
	Sample Type:					SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):					0.5	0.5	0.5	0.5	0.5
Determinand	Accred.	SOP	Type	Units	LOD					
pH	U	1010	10:1		N/A	7.2	7.5	7.8	7.9	8.2
Ammonium	U	1220	10:1	mg/l	0.050	0.077	< 0.050	0.073	0.095	0.11
Ammonium	N	1220	10:1	mg/kg	0.10	0.78	1.1	0.76	1.0	1.2
Boron (Dissolved)	U	1455	10:1	mg/kg	0.01	< 0.01	< 0.01	< 0.01	0.11	< 0.01
Benzofl[anthene]	N	1800	10:1	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010

Results - Soil

Project: Halverstown

Client: IGSL	Chemtest Job No.:				23-02702	23-02702	23-02702	23-02702	23-02702
Quotation No.: Q20-19951	Chemtest Sample ID.:				1580840	1580841	1580842	1580843	1580844
	Client Sample ID.:				TP3	TP9	TP15	TP26	TP32
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.5	0.5	0.5	0.5	0.5
	Asbestos Lab:				NEW-ASB	NEW-ASB	NEW-ASB	NEW-ASB	NEW-ASB
Determinand	Accred.	SOP	Units	LOD					
ACM Type	U	2192		N/A	-	-	-	-	-
Asbestos Identification	U	2192		N/A	No Asbestos Detected	No Asbestos Detected	No Asbestos Detected	No Asbestos Detected	No Asbestos Detected
Moisture	N	2030	%	0.020	13	16	9.8	27	13
Boron (Hot Water Soluble)	U	2120	mg/kg	0.40	[A] < 0.40	[A] < 0.40	[A] < 0.40	[A] < 0.40	[A] < 0.40
Sulphur (Elemental)	U	2180	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Cyanide (Total)	U	2300	mg/kg	0.50	[A] < 0.50	[A] < 0.50	[A] < 0.50	[A] < 0.50	[A] < 0.50
Sulphide (Easily Liberatable)	N	2325	mg/kg	0.50	[A] 3.9	[A] 2.4	[A] 7.5	[A] 6.4	[A] 5.5
Sulphate (Acid Soluble)	U	2430	%	0.010	[A] 0.024	[A] 0.015	[A] 0.027	[A] 0.030	[A] 0.031
Arsenic	U	2455	mg/kg	0.5	7.1	7.3	9.7	7.4	9.7
Barium	U	2455	mg/kg	0	42	66	69	42	49
Cadmium	U	2455	mg/kg	0.10	1.9	1.7	1.9	1.3	2.2
Chromium	U	2455	mg/kg	0.5	14	19	19	16	20
Molybdenum	U	2455	mg/kg	0.5	0.7	< 0.5	1.0	0.6	1.6
Antimony	N	2455	mg/kg	2.0	< 2.0	< 2.0	< 2.0	< 2.0	< 2.0
Copper	U	2455	mg/kg	0.50	13	16	17	14	17
Mercury	U	2455	mg/kg	0.05	0.08	0.07	0.07	0.07	0.10
Nickel	U	2455	mg/kg	0.50	32	34	37	28	37
Lead	U	2455	mg/kg	0.50	36	28	29	30	47
Selenium	U	2455	mg/kg	0.25	0.57	0.65	0.77	0.59	0.90
Zinc	U	2455	mg/kg	0.50	120	93	120	81	130
Chromium (Trivalent)	N	2490	mg/kg	1.0	14	19	19	16	20
Chromium (Hexavalent)	N	2490	mg/kg	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Mineral Oil (TPH Calculation)	N	2670	mg/kg	10	< 10	< 10	< 10	< 10	< 10
Aliphatic TPH >C5-C6	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aliphatic TPH >C6-C8	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aliphatic TPH >C8-C10	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aliphatic TPH >C10-C12	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aliphatic TPH >C12-C16	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aliphatic TPH >C16-C21	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aliphatic TPH >C21-C35	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aliphatic TPH >C35-C44	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Total Aliphatic Hydrocarbons	N	2680	mg/kg	5.0	[A] < 5.0	[A] < 5.0	[A] < 5.0	[A] < 5.0	[A] < 5.0
Aromatic TPH >C5-C7	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aromatic TPH >C7-C8	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aromatic TPH >C8-C10	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aromatic TPH >C10-C12	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aromatic TPH >C12-C16	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aromatic TPH >C16-C21	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Aromatic TPH >C21-C35	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0

Results - Soil

Project: Halverstown

Client: IGSL	Chemtest Job No.:				23-02702	23-02702	23-02702	23-02702	23-02702
Quotation No.: Q20-19951	Chemtest Sample ID.:				1580840	1580841	1580842	1580843	1580844
	Client Sample ID.:				TP3	TP9	TP15	TP26	TP32
	Sample Type:				SOIL	SOIL	SOIL	SOIL	SOIL
	Top Depth (m):				0.5	0.5	0.5	0.5	0.5
	Asbestos Lab:				NEW-ASB	NEW-ASB	NEW-ASB	NEW-ASB	NEW-ASB
Determinand	Accred.	SOP	Units	LOD					
Aromatic TPH >C35-C44	N	2680	mg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Total Aromatic Hydrocarbons	N	2680	mg/kg	5.0	[A] < 5.0	[A] < 5.0	[A] < 5.0	[A] < 5.0	[A] < 5.0
Total Petroleum Hydrocarbons	N	2680	mg/kg	10.0	[A] < 10	[A] < 10	[A] < 10	[A] < 10	[A] < 10
Benzene	U	2760	µg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Toluene	U	2760	µg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Ethylbenzene	U	2760	µg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
m & p-Xylene	U	2760	µg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
o-Xylene	U	2760	µg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Methyl Tert-Butyl Ether	U	2760	µg/kg	1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0	[A] < 1.0
Naphthalene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Acenaphthylene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Acenaphthene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Fluorene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Phenanthrene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Anthracene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Fluoranthene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Pyrene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Benzo[a]anthracene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Chrysene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Benzo[b]fluoranthene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Benzo[k]fluoranthene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Benzo[a]pyrene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Indeno(1,2,3-c,d)Pyrene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Dibenz(a,h)Anthracene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Benzo[g,h,i]perylene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Coronene	N	2800	mg/kg	0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010	[A] < 0.010
Total Of 17 PAH's	N	2800	mg/kg	0.20	[A] < 0.20	[A] < 0.20	[A] < 0.20	[A] < 0.20	[A] < 0.20
PCB 28	N	2815	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
PCB 52	N	2815	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
PCB 90+101	N	2815	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
PCB 118	N	2815	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
PCB 153	N	2815	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
PCB 138	N	2815	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
PCB 180	N	2815	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
Total PCBs (7 congeners)	N	2815	mg/kg	0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010	[A] < 0.0010
Total Phenols	U	2920	mg/kg	0.10	< 0.10	< 0.10	< 0.10	< 0.10	< 0.10

Results - Single Stage WAC

Project: Halverstown

Project: Harverstown					Landfill Waste Acceptance Criteria		
Chemtest Job No: 23-02702					Limits		
Chemtest Sample ID: 1580840					Inert Waste Landfill	Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample Ref:							
Sample ID: TP3							
Sample Location:							
Top Depth(m): 0.5							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	U	%	[A] 0.23	3	5	6
Loss On Ignition	2610	U	%	1.3	--	--	10
Total BTEX	2760	U	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 congeners)	2815	N	mg/kg	[A] < 0.0010	1	--	--
TPH Total WAC	2670	U	mg/kg	[A] < 10	500	--	--
Total Of 17 PAH's	2800	N	mg/kg	[A] < 0.20	100	--	--
pH	2010	U		8.7	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.10	--	To evaluate	To evaluate
Eluate Analysis					Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg		
			10:1 Eluate mg/l	10:1 Eluate mg/kg			
Arsenic	1455	U	0.0013	0.013	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	< 0.0005	< 0.0050	0.5	10	70
Copper	1455	U	0.0024	0.024	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	0.0009	0.0090	0.5	10	30
Nickel	1455	U	0.0005	0.0050	0.4	10	40
Lead	1455	U	< 0.0005	< 0.0050	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	0.0048	0.048	0.1	0.5	7
Zinc	1455	U	0.012	0.12	4	50	200
Chloride	1220	U	1.3	13	800	15000	25000
Fluoride	1220	U	0.11	1.1	10	150	500
Sulphate	1220	U	2.8	28	1000	20000	50000
Total Dissolved Solids	1020	N	64	640	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	5.5	55	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	13

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Results - Single Stage WAC

Project: Halverstown

Chemtest Job No: 23-02702					Landfill Waste Acceptance Criteria		
Chemtest Sample ID: 1580841					Limits		
Sample Ref:					Inert Waste Landfill	Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample ID: TP9							
Sample Location:							
Top Depth(m): 0.5							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	U	%	[A] 0.29	3	5	6
Loss On Ignition	2610	U	%	1.7	--	--	10
Total BTEX	2760	U	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 congeners)	2815	N	mg/kg	[A] < 0.0010	1	--	--
TPH Total WAC	2670	U	mg/kg	[A] < 10	500	--	--
Total Of 17 PAH's	2800	N	mg/kg	[A] < 0.20	100	--	--
pH	2010	U		8.6	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.026	--	To evaluate	To evaluate
Eluate Analysis				10:1 Eluate mg/l	10:1 Eluate mg/kg	Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg	
Arsenic	1455	U	0.0020	0.020	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	0.0015	0.015	0.5	10	70
Copper	1455	U	0.0022	0.022	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	0.0004	0.0041	0.5	10	30
Nickel	1455	U	0.0016	0.016	0.4	10	40
Lead	1455	U	0.0011	0.011	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	0.0044	0.043	0.1	0.5	7
Zinc	1455	U	0.010	0.10	4	50	200
Chloride	1220	U	< 1.0	< 10	800	15000	25000
Fluoride	1220	U	0.25	2.5	10	150	500
Sulphate	1220	U	1.3	13	1000	20000	50000
Total Dissolved Solids	1020	N	30	300	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	6.5	65	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	16

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Results - Single Stage WAC

Project: Halverstown

Project: Haverstow					Landfill Waste Acceptance Criteria		
Chemtest Job No: 23-02702					Inert Waste Landfill	Limits	
Chemtest Sample ID: 1580842						Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample Ref:							
Sample ID: TP15							
Sample Location:							
Top Depth(m): 0.5							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	U	%	[A] < 0.20	3	5	6
Loss On Ignition	2610	U	%	2.0	--	--	10
Total BTEX	2760	U	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 congeners)	2815	N	mg/kg	[A] < 0.0010	1	--	--
TPH Total WAC	2670	U	mg/kg	[A] < 10	500	--	--
Total Of 17 PAH's	2800	N	mg/kg	[A] < 0.20	100	--	--
pH	2010	U		8.7	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.12	--	To evaluate	To evaluate
Eluate Analysis						Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg	
Arsenic	1455	U	0.0022	0.022	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	0.0010	0.010	0.5	10	70
Copper	1455	U	0.0020	0.020	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	0.0008	0.0083	0.5	10	30
Nickel	1455	U	0.0012	0.012	0.4	10	40
Lead	1455	U	0.0014	0.014	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	0.0047	0.047	0.1	0.5	7
Zinc	1455	U	0.008	0.081	4	50	200
Chloride	1220	U	< 1.0	< 10	800	15000	25000
Fluoride	1220	U	0.16	1.6	10	150	500
Sulphate	1220	U	< 1.0	< 10	1000	20000	50000
Total Dissolved Solids	1020	N	39	390	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	6.8	68	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	9.8

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Results - Single Stage WAC

Project: Halverstown

Project: Harverstown					Landfill Waste Acceptance Criteria		
Chemtest Job No: 23-02702					Limits		
Chemtest Sample ID: 1580843					Inert Waste Landfill	Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample Ref:							
Sample ID: TP26							
Sample Location:							
Top Depth(m): 0.5							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	U	%	[A] 3.2	3	5	6
Loss On Ignition	2610	U	%	3.0	--	--	10
Total BTEX	2760	U	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 congeners)	2815	N	mg/kg	[A] < 0.0010	1	--	--
TPH Total WAC	2670	U	mg/kg	[A] < 10	500	--	--
Total Of 17 PAH's	2800	N	mg/kg	[A] < 0.20	100	--	--
pH	2010	U		8.4	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.028	--	To evaluate	To evaluate
Eluate Analysis			10:1 Eluate mg/l	10:1 Eluate mg/kg	Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg		
Arsenic	1455	U	0.0017	0.017	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	< 0.0005	< 0.0050	0.5	10	70
Copper	1455	U	0.0016	0.016	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	0.0013	0.013	0.5	10	30
Nickel	1455	U	0.0006	0.0063	0.4	10	40
Lead	1455	U	< 0.0005	< 0.0050	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	0.0044	0.043	0.1	0.5	7
Zinc	1455	U	0.008	0.076	4	50	200
Chloride	1220	U	< 1.0	< 10	800	15000	25000
Fluoride	1220	U	0.12	1.2	10	150	500
Sulphate	1220	U	< 1.0	< 10	1000	20000	50000
Total Dissolved Solids	1020	N	55	540	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	6.3	63	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	27

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Results - Single Stage WAC

Project: Halverstown

Project: Harverstown					Landfill Waste Acceptance Criteria		
Chemtest Job No: 23-02702					Limits		
Chemtest Sample ID: 1580844					Inert Waste Landfill	Stable, Non-reactive hazardous waste in non-hazardous Landfill	Hazardous Waste Landfill
Sample Ref:							
Sample ID: TP32							
Sample Location:							
Top Depth(m): 0.5							
Bottom Depth(m):							
Sampling Date:							
Determinand	SOP	Accred.	Units				
Total Organic Carbon	2625	U	%	[A] 0.90	3	5	6
Loss On Ignition	2610	U	%	1.8	--	--	10
Total BTEX	2760	U	mg/kg	[A] < 0.010	6	--	--
Total PCBs (7 congeners)	2815	N	mg/kg	[A] < 0.0010	1	--	--
TPH Total WAC	2670	U	mg/kg	[A] < 10	500	--	--
Total Of 17 PAH's	2800	N	mg/kg	[A] < 0.20	100	--	--
pH	2010	U		8.9	--	>6	--
Acid Neutralisation Capacity	2015	N	mol/kg	0.079	--	To evaluate	To evaluate
Eluate Analysis					Limit values for compliance leaching test using BS EN 12457 at L/S 10 l/kg		
			10:1 Eluate mg/l	10:1 Eluate mg/kg			
Arsenic	1455	U	0.0015	0.015	0.5	2	25
Barium	1455	U	< 0.005	< 0.050	20	100	300
Cadmium	1455	U	< 0.00011	< 0.0011	0.04	1	5
Chromium	1455	U	0.0007	0.0074	0.5	10	70
Copper	1455	U	0.0010	0.010	2	50	100
Mercury	1455	U	< 0.00005	< 0.00050	0.01	0.2	2
Molybdenum	1455	U	0.0006	0.0062	0.5	10	30
Nickel	1455	U	0.0006	0.0058	0.4	10	40
Lead	1455	U	< 0.0005	< 0.0050	0.5	10	50
Antimony	1455	U	< 0.0005	< 0.0050	0.06	0.7	5
Selenium	1455	U	0.0041	0.041	0.1	0.5	7
Zinc	1455	U	0.004	0.041	4	50	200
Chloride	1220	U	< 1.0	< 10	800	15000	25000
Fluoride	1220	U	0.12	1.2	10	150	500
Sulphate	1220	U	< 1.0	< 10	1000	20000	50000
Total Dissolved Solids	1020	N	42	420	4000	60000	100000
Phenol Index	1920	U	< 0.030	< 0.30	1	-	-
Dissolved Organic Carbon	1610	U	4.9	< 50	500	800	1000

Solid Information	
Dry mass of test portion/kg	0.090
Moisture (%)	13

Waste Acceptance Criteria

Landfill WAC analysis (specifically leaching test results) must not be used for hazardous waste classification purposes. This analysis is only applicable for hazardous waste landfill acceptance and does not give any indication as to whether a waste may be hazardous or non-hazardous.

Deviations

In accordance with UKAS Policy on Deviating Samples TPS 63. Chemtest have a procedure to ensure 'upon receipt of each sample a competent laboratory shall assess whether the sample is suitable with regard to the requested test(s)'. This policy and the respective holding times applied, can be supplied upon request. The reason a sample is declared as deviating is detailed below. Where applicable the analysis remains UKAS/MCERTs accredited but the results may be compromised.

Sample:	Sample Ref:	Sample ID:	Sample Location:	Sampled Date:	Deviation Code(s):	Containers Received:
1580840		TP3			A	Amber Glass 250ml
1580840		TP3			A	Plastic Tub 500g
1580841		TP9			A	Amber Glass 250ml
1580841		TP9			A	Plastic Tub 500g
1580842		TP15			A	Amber Glass 250ml
1580842		TP15			A	Plastic Tub 500g
1580843		TP26			A	Amber Glass 250ml
1580843		TP26			A	Plastic Tub 500g
1580844		TP32			A	Amber Glass 250ml
1580844		TP32			A	Plastic Tub 500g

Test Methods

SOP	Title	Parameters included	Method summary
1010	pH Value of Waters	pH	pH Meter
1020	Electrical Conductivity and Total Dissolved Solids (TDS) in Waters	Electrical Conductivity and Total Dissolved Solids (TDS) in Waters	Conductivity Meter
1220	Anions, Alkalinity & Ammonium in Waters	Fluoride; Chloride; Nitrite; Nitrate; Total; Oxidisable Nitrogen (TON); Sulfate; Phosphate; Alkalinity; Ammonium	Automated colorimetric analysis using 'Aquakem 600' Discrete Analyser.
1455	Metals in Waters by ICP-MS	Metals, including: Antimony; Arsenic; Barium; Beryllium; Boron; Cadmium; Chromium; Cobalt; Copper; Lead; Manganese; Mercury; Molybdenum; Nickel; Selenium; Tin; Vanadium; Zinc	Filtration of samples followed by direct determination by inductively coupled plasma mass spectrometry (ICP-MS).
1610	Total/Dissolved Organic Carbon in Waters	Organic Carbon	TOC Analyser using Catalytic Oxidation
1800	Speciated Polynuclear Aromatic Hydrocarbons (PAH) in Waters by GC-MS	Acenaphthene; Acenaphthylene; Anthracene; Benzo[a]Anthracene; Benzo[a]Pyrene; Benzo[b]Fluoranthene; Benzo[ghi]Perylene; Benzo[k]Fluoranthene; Chrysene; Dibenzo[ah]Anthracene; Fluoranthene; Fluorene; Indeno[123cd]Pyrene; Naphthalene; Phenanthrene; Pyrene	Pentane extraction / GCMS detection
1920	Phenols in Waters by HPLC	Phenolic compounds including: Phenol, Cresols, Xylenols, Trimethylphenols Note: Chlorophenols are excluded.	Determination by High Performance Liquid Chromatography (HPLC) using electrochemical detection.
2010	pH Value of Soils	pH	pH Meter
2015	Acid Neutralisation Capacity	Acid Reserve	Titration
2030	Moisture and Stone Content of Soils(Requirement of MCERTS)	Moisture content	Determination of moisture content of soil as a percentage of its as received mass obtained at <37°C.
2040	Soil Description(Requirement of MCERTS)	Soil description	As received soil is described based upon BS5930
2120	Water Soluble Boron, Sulphate, Magnesium & Chromium	Boron; Sulphate; Magnesium; Chromium	Aqueous extraction / ICP-OES
2180	Sulphur (Elemental) in Soils by HPLC	Sulphur	Dichloromethane extraction / HPLC with UV detection
2192	Asbestos	Asbestos	Polarised light microscopy / Gravimetry
2300	Cyanides & Thiocyanate in Soils	Free (or easy liberatable) Cyanide; total Cyanide; complex Cyanide; Thiocyanate	Alkaline extraction followed by colorimetric determination using Automated Flow Injection Analyser.
2325	Sulphide in Soils	Sulphide	Steam distillation with sulphuric acid / analysis by 'Aquakem 600' Discrete Analyser, using N,N-dimethyl-p-phenylenediamine.
2430	Total Sulphate in soils	Total Sulphate	Acid digestion followed by determination of sulphate in extract by ICP-OES.
2455	Acid Soluble Metals in Soils	Metals, including: Arsenic; Barium; Beryllium; Cadmium; Chromium; Cobalt; Copper; Lead; Manganese; Mercury; Molybdenum; Nickel; Selenium; Vanadium; Zinc	Acid digestion followed by determination of metals in extract by ICP-MS.
2490	Hexavalent Chromium in Soils	Chromium [VI]	Soil extracts are prepared by extracting dried and ground soil samples into boiling water. Chromium [VI] is determined by 'Aquakem 600' Discrete Analyser using 1,5-diphenylcarbazide.
2610	Loss on Ignition	loss on ignition (LOI)	Determination of the proportion by mass that is lost from a soil by ignition at 550°C.
2625	Total Organic Carbon in Soils	Total organic Carbon (TOC)	Determined by high temperature combustion under oxygen, using an Eltra elemental analyser.

Test Methods

SOP	Title	Parameters included	Method summary
2670	Total Petroleum Hydrocarbons (TPH) in Soils by GC-FID	TPH (C6–C40); optional carbon banding, e.g. 3-band – GRO, DRO & LRO*TPH C8–C40	Dichloromethane extraction / GC-FID
2680	TPH A/A Split	Aliphatics: >C5–C6, >C6–C8, >C8–C10, >C10–C12, >C12–C16, >C16–C21, >C21–C35, >C35–C44 Aromatics: >C5–C7, >C7–C8, >C8–C10, >C10–C12, >C12–C16, >C16–C21, >C21–C35, >C35–C44	Dichloromethane extraction / GCxGC FID detection
2760	Volatile Organic Compounds (VOCs) in Soils by Headspace GC-MS	Volatile organic compounds, including BTEX and halogenated Aliphatic/Aromatics. (cf. USEPA Method 8260)*please refer to UKAS schedule	Automated headspace gas chromatographic (GC) analysis of a soil sample, as received, with mass spectrometric (MS) detection of volatile organic compounds.
2800	Speciated Polynuclear Aromatic Hydrocarbons (PAH) in Soil by GC-MS	Acenaphthene*; Acenaphthylene; Anthracene*; Benzo[a]Anthracene*; Benzo[a]Pyrene*; Benzo[b]Fluoranthene*; Benzo[ghi]Perylene*; Benzo[k]Fluoranthene; Chrysene*; Dibenzo[ah]Anthracene; Fluoranthene*; Fluorene*; Indeno[123cd]Pyrene*; Naphthalene*; Phenanthrene*; Pyrene*	Dichloromethane extraction / GC-MS
2815	Polychlorinated Biphenyls (PCB) ICES7 Congeners in Soils by GC-MS	ICES7 PCB congeners	Acetone/Hexane extraction / GC-MS
2920	Phenols in Soils by HPLC	Phenolic compounds including Resorcinol, Phenol, Methylphenols, Dimethylphenols, 1-Naphthol and Trimethylphenols Note: chlorophenols are excluded.	60:40 methanol/water mixture extraction, followed by HPLC determination using electrochemical detection.
640	Characterisation of Waste (Leaching C10)	Waste material including soil, sludges and granular waste	Compliance Test for Leaching of Granular Waste Material and Sludge

Report Information

Key

U	UKAS accredited
M	MCERTS and UKAS accredited
N	Unaccredited
S	This analysis has been subcontracted to a UKAS accredited laboratory that is accredited for this analysis
SN	This analysis has been subcontracted to a UKAS accredited laboratory that is not accredited for this analysis
T	This analysis has been subcontracted to an unaccredited laboratory
I/S	Insufficient Sample
U/S	Unsuitable Sample
N/E	not evaluated
<	"less than"
>	"greater than"
SOP	Standard operating procedure
LOD	Limit of detection

Comments or interpretations are beyond the scope of UKAS accreditation

The results relate only to the items tested

Uncertainty of measurement for the determinands tested are available upon request

None of the results in this report have been recovery corrected

All results are expressed on a dry weight basis

The following tests were analysed on samples as received and the results subsequently corrected to a dry weight basis TPH, BTEX, VOCs, SVOCs, PCBs, Phenols

For all other tests the samples were dried at < 37°C prior to analysis

All Asbestos testing is performed at the indicated laboratory

Issue numbers are sequential starting with 1 all subsequent reports are incremented by 1

Sample Deviation Codes

- A - Date of sampling not supplied
- B - Sample age exceeds stability time (sampling to extraction)
- C - Sample not received in appropriate containers
- D - Broken Container
- E - Insufficient Sample (Applies to LOI in Trommel Fines Only)

Sample Retention and Disposal

All soil samples will be retained for a period of 30 days from the date of receipt

All water samples will be retained for 14 days from the date of receipt

Charges may apply to extended sample storage

If you require extended retention of samples, please email your requirements to:
customerservices@chemtest.com

Appendix 3

Waste Classification Report

Waste Classification Report

HazWasteOnline™ classifies waste as either **hazardous** or **non-hazardous** based on its chemical composition, related legislation and the rules and data defined in the current UK or EU technical guidance (Appendix C) (note that HP 9 Infectious is not assessed). It is the responsibility of the classifier named below to:

- understand the origin of the waste
- select the correct List of Waste code(s)
- confirm that the list of determinands, results and sampling plan are fit for purpose
- select and justify the chosen metal species (Appendix B)
- correctly apply moisture correction and other available corrections
- add the meta data for their user-defined substances (Appendix A)
- check that the classification engine is suitable with respect to the national destination of the waste (Appendix C)



HMMVA-RUOAH-IZTKI

To aid the reviewer, the laboratory results, assumptions and justifications managed by the classifier are highlighted in **pale yellow**.

Job name

23-001-01 Halverstown

Description/Comments

5 No. composite samples from 5 No. Trial Pits in a greenfield site.

Project

23-001-01

Site

Halverstown

Classified by

Name: **Austin Hynes**
 Date: **14 Feb 2023 11:05 GMT**
 Telephone: **+353 (0)21 4345366**
 Company: **O'Callaghan Moran & Associates**
Unit 15 Melbourne Business Park,
Model Farm Road
Cork

HazWasteOnline™ provides a two day, hazardous waste classification course that covers the use of the software and both basic and advanced waste classification techniques. Certification has to be renewed every 3 years.

HazWasteOnline™ Certification:

CERTIFIED

Course
 Hazardous Waste Classification

Date
 06 Oct 2022

Next 3 year Refresher due by Oct 2025

Purpose of classification

7 - Disposal of Waste

Address of the waste

Lands at Halverstown, Naas, Co. Kildare

Post Code NA

SIC for the process giving rise to the waste

41202 Construction of domestic buildings

Description of industry/producer giving rise to the waste

Site Investigation

Description of the specific process, sub-process and/or activity that created the waste

Excavation

Description of the waste

Soil and Stone



Job summary

#	Sample name	Depth [m]	Classification Result	Hazard properties	Page
1	TP3	0.5	Non Hazardous		3
2	TP9	0.5	Non Hazardous		6
3	TP15	0.5	Non Hazardous		9
4	TP26	0.5	Non Hazardous		12
5	TP32	0.5	Non Hazardous		15

Related documents

#	Name	Description
1	OCM Waste Stream Updated 2021	waste stream template used to create this Job

Report

Created by: Austin Hynes

Created date: 14 Feb 2023 11:05 GMT

Appendices	Page
Appendix A: Classifier defined and non EU CLP determinands	18
Appendix B: Rationale for selection of metal species	19
Appendix C: Version	20



Classification of sample: TP3

✔ **Non Hazardous Waste**
Classified as **17 05 04**
in the List of Waste

Sample details

Sample name:	LoW Code:	
TP3	Chapter:	17: Construction and Demolition Wastes (including excavated soil from contaminated sites)
Sample Depth:	Entry:	17 05 04 (Soil and stones other than those mentioned in 17 05 03)
0.5 m		
Moisture content:		
13%		
(dry weight correction)		

Hazard properties

None identified

Determinands

Moisture content: 13% Dry Weight Moisture Correction applied (MC)

#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.	Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number							
1	antimony { antimony trioxide }				<2 mg/kg	1.197	<2.394 mg/kg	<0.000239 %		<LOD
	051-005-00-X	215-175-0	1309-64-4							
2	arsenic { arsenic trioxide }				7.1 mg/kg	1.32	8.296 mg/kg	0.00083 %	✓	
	033-003-00-0	215-481-4	1327-53-3							
3	boron { diboron trioxide }				<0.4 mg/kg	3.22	<1.288 mg/kg	<0.000129 %		<LOD
	005-008-00-8	215-125-8	1303-86-2							
4	cadmium { cadmium oxide }				1.9 mg/kg	1.142	1.921 mg/kg	0.000192 %	✓	
	048-002-00-0	215-146-2	1306-19-0							
5	chromium in chromium(III) compounds { chromium(III) oxide (worst case) }				14 mg/kg	1.462	18.108 mg/kg	0.00181 %	✓	
		215-160-9	1308-38-9							
6	chromium in chromium(VI) compounds { chromium (VI) compounds, with the exception of barium chromate and of compounds specified elsewhere in this Annex }				<0.5 mg/kg	2.27	<1.135 mg/kg	<0.000113 %		<LOD
	024-017-00-8									
7	copper { dicopper oxide; copper (I) oxide }				13 mg/kg	1.126	12.953 mg/kg	0.0013 %	✓	
	029-002-00-X	215-270-7	1317-39-1							
8	lead { lead chromate }			1	36 mg/kg	1.56	49.693 mg/kg	0.00319 %	✓	
	082-004-00-2	231-846-0	7758-97-6							
9	mercury { mercury dichloride }				0.08 mg/kg	1.353	0.0958 mg/kg	0.00000958 %	✓	
	080-010-00-X	231-299-8	7487-94-7							
10	molybdenum { molybdenum(VI) oxide }				0.7 mg/kg	1.5	0.929 mg/kg	0.0000929 %	✓	
	042-001-00-9	215-204-7	1313-27-5							
11	nickel { nickel chromate }				32 mg/kg	2.976	84.284 mg/kg	0.00843 %	✓	
	028-035-00-7	238-766-5	14721-18-7							
12	selenium { nickel selenate }				0.57 mg/kg	2.554	1.288 mg/kg	0.000129 %	✓	
	028-031-00-5	239-125-2	15060-62-5							
13	zinc { zinc chromate }				120 mg/kg	2.774	294.6 mg/kg	0.0295 %	✓	
	024-007-00-3	236-878-9	13530-65-9							
14	TPH (C6 to C40) petroleum group				<10 mg/kg		<10 mg/kg	<0.001 %		<LOD
			TPH							
15	tert-butyl methyl ether; MTBE; 2-methoxy-2-methylpropane				<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %		<LOD
	603-181-00-X	216-653-1	1634-04-4							



#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.		Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number								
16	benzene 601-020-00-8	200-753-7	71-43-2		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
17	toluene 601-021-00-3	203-625-9	108-88-3		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
18	ethylbenzene 601-023-00-4	202-849-4	100-41-4		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
19	xylene 601-022-00-9	202-422-2 [1] 203-396-5 [2] 203-576-3 [3] 215-535-7 [4]	95-47-6 [1] 106-42-3 [2] 108-38-3 [3] 1330-20-7 [4]		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
20	cyanides { salts of hydrogen cyanide with the exception of complex cyanides such as ferrocyanides, ferricyanides and mercuric oxycyanide and those specified elsewhere in this Annex } 006-007-00-5				<0.5 mg/kg	1.884	<0.942 mg/kg	<0.0000942 %			<LOD
21	naphthalene 601-052-00-2	202-049-5	91-20-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
22	acenaphthylene 205-917-1	208-96-8			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
23	acenaphthene 201-469-6	83-32-9			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
24	fluorene 201-695-5	86-73-7			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
25	phenanthrene 201-581-5	85-01-8			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
26	anthracene 204-371-1	120-12-7			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
27	fluoranthene 205-912-4	206-44-0			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
28	pyrene 204-927-3	129-00-0			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
29	benzo[a]anthracene 601-033-00-9	200-280-6	56-55-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
30	chrysene 601-048-00-0	205-923-4	218-01-9		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
31	benzo[b]fluoranthene 601-034-00-4	205-911-9	205-99-2		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
32	benzo[k]fluoranthene 601-036-00-5	205-916-6	207-08-9		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
33	benzo[a]pyrene; benzo[def]chrysene 601-032-00-3	200-028-5	50-32-8		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
34	indeno[123-cd]pyrene 205-893-2	193-39-5			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
35	dibenz[a,h]anthracene 601-041-00-2	200-181-8	53-70-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
36	benzo[ghi]perylene 205-883-8	191-24-2			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
37	phenol 604-001-00-2	203-632-7	108-95-2		<0.1 mg/kg		<0.1 mg/kg	<0.00001 %			<LOD
38	polychlorobiphenyls; PCB 602-039-00-4	215-648-1	1336-36-3		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
Total:									0.047 %		



Key

	User supplied data
	Determinand values ignored for classification, see column 'Conc. Not Used' for reason
	Determinand defined or amended by HazWasteOnline (see Appendix A)
	Speciated Determinand - Unless the Determinand is Note 1, the Conversion Factor is used to calculate the compound concentration
<LOD	Below limit of detection
ND	Not detected
CLP: Note 1	Only the metal concentration has been used for classification

Classification of sample: TP9

✔ **Non Hazardous Waste**
Classified as **17 05 04**
in the List of Waste

Sample details

Sample name:	LoW Code:	
TP9	Chapter:	17: Construction and Demolition Wastes (including excavated soil from contaminated sites)
Sample Depth:	Entry:	17 05 04 (Soil and stones other than those mentioned in 17 05 03)
0.5 m		
Moisture content:		
16%		
(dry weight correction)		

Hazard properties

None identified

Determinands

Moisture content: 16% Dry Weight Moisture Correction applied (MC)

#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.		Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number								
1	antimony { antimony trioxide }				<2 mg/kg	1.197	<2.394	mg/kg	<0.000239 %		<LOD
	051-005-00-X	215-175-0	1309-64-4								
2	arsenic { arsenic trioxide }				7.3 mg/kg	1.32	8.309	mg/kg	0.000831 %	✓	
	033-003-00-0	215-481-4	1327-53-3								
3	boron { diboron trioxide }				<0.4 mg/kg	3.22	<1.288	mg/kg	<0.000129 %		<LOD
	005-008-00-8	215-125-8	1303-86-2								
4	cadmium { cadmium oxide }				1.7 mg/kg	1.142	1.674	mg/kg	0.000167 %	✓	
	048-002-00-0	215-146-2	1306-19-0								
5	chromium in chromium(III) compounds { chromium(III) oxide (worst case) }				19 mg/kg	1.462	23.939	mg/kg	0.00239 %	✓	
		215-160-9	1308-38-9								
6	chromium in chromium(VI) compounds { chromium (VI) compounds, with the exception of barium chromate and of compounds specified elsewhere in this Annex }				<0.5 mg/kg	2.27	<1.135	mg/kg	<0.000113 %		<LOD
	024-017-00-8										
7	copper { dicopper oxide; copper (I) oxide }				16 mg/kg	1.126	15.529	mg/kg	0.00155 %	✓	
	029-002-00-X	215-270-7	1317-39-1								
8	lead { lead chromate }			1	28 mg/kg	1.56	37.651	mg/kg	0.00241 %	✓	
	082-004-00-2	231-846-0	7758-97-6								
9	mercury { mercury dichloride }				0.07 mg/kg	1.353	0.0817	mg/kg	0.00000817 %	✓	
	080-010-00-X	231-299-8	7487-94-7								
10	molybdenum { molybdenum(VI) oxide }				<0.5 mg/kg	1.5	<0.75	mg/kg	<0.000075 %		<LOD
	042-001-00-9	215-204-7	1313-27-5								
11	nickel { nickel chromate }				34 mg/kg	2.976	87.235	mg/kg	0.00872 %	✓	
	028-035-00-7	238-766-5	14721-18-7								
12	selenium { nickel selenate }				0.65 mg/kg	2.554	1.431	mg/kg	0.000143 %	✓	
	028-031-00-5	239-125-2	15060-62-5								
13	zinc { zinc chromate }				93 mg/kg	2.774	222.41	mg/kg	0.0222 %	✓	
	024-007-00-3	236-878-9	13530-65-9								
14	TPH (C6 to C40) petroleum group				<10 mg/kg		<10	mg/kg	<0.001 %		<LOD
			TPH								
15	tert-butyl methyl ether; MTBE; 2-methoxy-2-methylpropane				<0.001 mg/kg		<0.001	mg/kg	<0.0000001 %		<LOD
	603-181-00-X	216-653-1	1634-04-4								



#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.		Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number								
16	benzene				<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
	601-020-00-8	200-753-7	71-43-2								
17	toluene				<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
	601-021-00-3	203-625-9	108-88-3								
18	ethylbenzene				<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
	601-023-00-4	202-849-4	100-41-4								
19	xylene				<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
	601-022-00-9	202-422-2 [1] 203-396-5 [2] 203-576-3 [3] 215-535-7 [4]	95-47-6 [1] 106-42-3 [2] 108-38-3 [3] 1330-20-7 [4]								
20	cyanides { salts of hydrogen cyanide with the exception of complex cyanides such as ferrocyanides, ferricyanides and mercuric oxycyanide and those specified elsewhere in this Annex }				<0.5 mg/kg	1.884	<0.942 mg/kg	<0.0000942 %			<LOD
	006-007-00-5										
21	naphthalene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
	601-052-00-2	202-049-5	91-20-3								
22	acenaphthylene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
		205-917-1	208-96-8								
23	acenaphthene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
		201-469-6	83-32-9								
24	fluorene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
		201-695-5	86-73-7								
25	phenanthrene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
		201-581-5	85-01-8								
26	anthracene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
		204-371-1	120-12-7								
27	fluoranthene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
		205-912-4	206-44-0								
28	pyrene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
		204-927-3	129-00-0								
29	benzo[a]anthracene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
	601-033-00-9	200-280-6	56-55-3								
30	chrysene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
	601-048-00-0	205-923-4	218-01-9								
31	benzo[b]fluoranthene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
	601-034-00-4	205-911-9	205-99-2								
32	benzo[k]fluoranthene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
	601-036-00-5	205-916-6	207-08-9								
33	benzo[a]pyrene; benzo[def]chrysene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
	601-032-00-3	200-028-5	50-32-8								
34	indeno[123-cd]pyrene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
		205-893-2	193-39-5								
35	dibenz[a,h]anthracene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
	601-041-00-2	200-181-8	53-70-3								
36	benzo[ghi]perylene				<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
		205-883-8	191-24-2								
37	phenol				<0.1 mg/kg		<0.1 mg/kg	<0.00001 %			<LOD
	604-001-00-2	203-632-7	108-95-2								
38	polychlorobiphenyls; PCB				<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
	602-039-00-4	215-648-1	1336-36-3								
Total:									0.0402 %		



Key

	User supplied data
	Determinand values ignored for classification, see column 'Conc. Not Used' for reason
■	Determinand defined or amended by HazWasteOnline (see Appendix A)
■	Speciated Determinand - Unless the Determinand is Note 1, the Conversion Factor is used to calculate the compound concentration
<LOD	Below limit of detection
ND	Not detected
CLP: Note 1	Only the metal concentration has been used for classification



Classification of sample: TP15

✔ **Non Hazardous Waste**
Classified as **17 05 04**
in the List of Waste

Sample details

Sample name:	LoW Code:	
TP15	Chapter:	17: Construction and Demolition Wastes (including excavated soil from contaminated sites)
Sample Depth:	Entry:	17 05 04 (Soil and stones other than those mentioned in 17 05 03)
0.5 m		
Moisture content:		
9.8%		
(dry weight correction)		

Hazard properties

None identified

Determinands

Moisture content: 9.8% Dry Weight Moisture Correction applied (MC)

#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.		Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number								
1	antimony { antimony trioxide }				<2 mg/kg	1.197	<2.394 mg/kg	<0.000239 %			<LOD
	051-005-00-X	215-175-0	1309-64-4								
2	arsenic { arsenic trioxide }				9.7 mg/kg	1.32	11.664 mg/kg	0.00117 %		✓	
	033-003-00-0	215-481-4	1327-53-3								
3	boron { diboron trioxide }				<0.4 mg/kg	3.22	<1.288 mg/kg	<0.000129 %			<LOD
	005-008-00-8	215-125-8	1303-86-2								
4	cadmium { cadmium oxide }				1.9 mg/kg	1.142	1.977 mg/kg	0.000198 %		✓	
	048-002-00-0	215-146-2	1306-19-0								
5	chromium in chromium(III) compounds { chromium(III) oxide (worst case) }				19 mg/kg	1.462	25.291 mg/kg	0.00253 %		✓	
		215-160-9	1308-38-9								
6	chromium in chromium(VI) compounds { chromium (VI) compounds, with the exception of barium chromate and of compounds specified elsewhere in this Annex }				<0.5 mg/kg	2.27	<1.135 mg/kg	<0.000113 %			<LOD
	024-017-00-8										
7	copper { dicopper oxide; copper (I) oxide }				17 mg/kg	1.126	17.432 mg/kg	0.00174 %		✓	
	029-002-00-X	215-270-7	1317-39-1								
8	lead { lead chromate }			1	29 mg/kg	1.56	41.197 mg/kg	0.00264 %		✓	
	082-004-00-2	231-846-0	7758-97-6								
9	mercury { mercury dichloride }				0.07 mg/kg	1.353	0.0863 mg/kg	0.00000863 %		✓	
	080-010-00-X	231-299-8	7487-94-7								
10	molybdenum { molybdenum(VI) oxide }				1 mg/kg	1.5	1.366 mg/kg	0.000137 %		✓	
	042-001-00-9	215-204-7	1313-27-5								
11	nickel { nickel chromate }				37 mg/kg	2.976	100.293 mg/kg	0.01 %		✓	
	028-035-00-7	238-766-5	14721-18-7								
12	selenium { nickel selenate }				0.77 mg/kg	2.554	1.791 mg/kg	0.000179 %		✓	
	028-031-00-5	239-125-2	15060-62-5								
13	zinc { zinc chromate }				120 mg/kg	2.774	303.185 mg/kg	0.0303 %		✓	
	024-007-00-3	236-878-9	13530-65-9								
14	TPH (C6 to C40) petroleum group				<10 mg/kg		<10 mg/kg	<0.001 %			<LOD
			TPH								
15	tert-butyl methyl ether; MTBE; 2-methoxy-2-methylpropane				<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
	603-181-00-X	216-653-1	1634-04-4								



#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.		Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number								
16	benzene 601-020-00-8	200-753-7	71-43-2		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
17	toluene 601-021-00-3	203-625-9	108-88-3		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
18	ethylbenzene 601-023-00-4	202-849-4	100-41-4		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
19	xylene 601-022-00-9	202-422-2 [1] 203-396-5 [2] 203-576-3 [3] 215-535-7 [4]	95-47-6 [1] 106-42-3 [2] 108-38-3 [3] 1330-20-7 [4]		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
20	cyanides { salts of hydrogen cyanide with the exception of complex cyanides such as ferrocyanides, ferricyanides and mercuric oxycyanide and those specified elsewhere in this Annex } 006-007-00-5				<0.5 mg/kg	1.884	<0.942 mg/kg	<0.0000942 %			<LOD
21	naphthalene 601-052-00-2	202-049-5	91-20-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
22	acenaphthylene 205-917-1	208-96-8			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
23	acenaphthene 201-469-6	83-32-9			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
24	fluorene 201-695-5	86-73-7			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
25	phenanthrene 201-581-5	85-01-8			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
26	anthracene 204-371-1	120-12-7			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
27	fluoranthene 205-912-4	206-44-0			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
28	pyrene 204-927-3	129-00-0			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
29	benzo[a]anthracene 601-033-00-9	200-280-6	56-55-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
30	chrysene 601-048-00-0	205-923-4	218-01-9		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
31	benzo[b]fluoranthene 601-034-00-4	205-911-9	205-99-2		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
32	benzo[k]fluoranthene 601-036-00-5	205-916-6	207-08-9		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
33	benzo[a]pyrene; benzo[def]chrysene 601-032-00-3	200-028-5	50-32-8		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
34	indeno[123-cd]pyrene 205-893-2	193-39-5			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
35	dibenz[a,h]anthracene 601-041-00-2	200-181-8	53-70-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
36	benzo[ghi]perylene 205-883-8	191-24-2			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
37	phenol 604-001-00-2	203-632-7	108-95-2		<0.1 mg/kg		<0.1 mg/kg	<0.00001 %			<LOD
38	polychlorobiphenyls; PCB 602-039-00-4	215-648-1	1336-36-3		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
Total:									0.0506 %		



Key

	User supplied data
	Determinand values ignored for classification, see column 'Conc. Not Used' for reason
	Determinand defined or amended by HazWasteOnline (see Appendix A)
	Speciated Determinand - Unless the Determinand is Note 1, the Conversion Factor is used to calculate the compound concentration
<LOD	Below limit of detection
ND	Not detected
CLP: Note 1	Only the metal concentration has been used for classification

Classification of sample: TP26

✔ **Non Hazardous Waste**
Classified as **17 05 04**
in the List of Waste

Sample details

Sample name:	LoW Code:	
TP26	Chapter:	17: Construction and Demolition Wastes (including excavated soil from contaminated sites)
Sample Depth:	Entry:	17 05 04 (Soil and stones other than those mentioned in 17 05 03)
0.5 m		
Moisture content:		
27%		
(dry weight correction)		

Hazard properties

None identified

Determinands

Moisture content: 27% Dry Weight Moisture Correction applied (MC)

#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.		Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number								
1	antimony { antimony trioxide }				<2 mg/kg	1.197	<2.394	mg/kg	<0.000239 %		<LOD
	051-005-00-X	215-175-0	1309-64-4								
2	arsenic { arsenic trioxide }				7.4 mg/kg	1.32	7.693	mg/kg	0.000769 %	✓	
	033-003-00-0	215-481-4	1327-53-3								
3	boron { diboron trioxide }				<0.4 mg/kg	3.22	<1.288	mg/kg	<0.000129 %		<LOD
	005-008-00-8	215-125-8	1303-86-2								
4	cadmium { cadmium oxide }				1.3 mg/kg	1.142	1.169	mg/kg	0.000117 %	✓	
	048-002-00-0	215-146-2	1306-19-0								
5	chromium in chromium(III) compounds { chromium(III) oxide (worst case) }				16 mg/kg	1.462	18.413	mg/kg	0.00184 %	✓	
		215-160-9	1308-38-9								
6	chromium in chromium(VI) compounds { chromium (VI) compounds, with the exception of barium chromate and of compounds specified elsewhere in this Annex }				<0.5 mg/kg	2.27	<1.135	mg/kg	<0.000113 %		<LOD
	024-017-00-8										
7	copper { dicopper oxide; copper (I) oxide }				14 mg/kg	1.126	12.411	mg/kg	0.00124 %	✓	
	029-002-00-X	215-270-7	1317-39-1								
8	lead { lead chromate }			1	30 mg/kg	1.56	36.846	mg/kg	0.00236 %	✓	
	082-004-00-2	231-846-0	7758-97-6								
9	mercury { mercury dichloride }				0.07 mg/kg	1.353	0.0746	mg/kg	0.00000746 %	✓	
	080-010-00-X	231-299-8	7487-94-7								
10	molybdenum { molybdenum(VI) oxide }				0.6 mg/kg	1.5	0.709	mg/kg	0.0000709 %	✓	
	042-001-00-9	215-204-7	1313-27-5								
11	nickel { nickel chromate }				28 mg/kg	2.976	65.618	mg/kg	0.00656 %	✓	
	028-035-00-7	238-766-5	14721-18-7								
12	selenium { nickel selenate }				0.59 mg/kg	2.554	1.186	mg/kg	0.000119 %	✓	
	028-031-00-5	239-125-2	15060-62-5								
13	zinc { zinc chromate }				81 mg/kg	2.774	176.934	mg/kg	0.0177 %	✓	
	024-007-00-3	236-878-9	13530-65-9								
14	TPH (C6 to C40) petroleum group				<10 mg/kg		<10	mg/kg	<0.001 %		<LOD
			TPH								
15	tert-butyl methyl ether; MTBE; 2-methoxy-2-methylpropane				<0.001 mg/kg		<0.001	mg/kg	<0.0000001 %		<LOD
	603-181-00-X	216-653-1	1634-04-4								



#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.	Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number							
16	benzene 601-020-00-8	200-753-7	71-43-2		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %		<LOD
17	toluene 601-021-00-3	203-625-9	108-88-3		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %		<LOD
18	ethylbenzene 601-023-00-4	202-849-4	100-41-4		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %		<LOD
19	xylene 601-022-00-9	202-422-2 [1] 203-396-5 [2] 203-576-3 [3] 215-535-7 [4]	95-47-6 [1] 106-42-3 [2] 108-38-3 [3] 1330-20-7 [4]		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %		<LOD
20	cyanides { salts of hydrogen cyanide with the exception of complex cyanides such as ferrocyanides, ferricyanides and mercuric oxycyanide and those specified elsewhere in this Annex } 006-007-00-5				<0.5 mg/kg	1.884	<0.942 mg/kg	<0.0000942 %		<LOD
21	naphthalene 601-052-00-2	202-049-5	91-20-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
22	acenaphthylene 205-917-1	208-96-8			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
23	acenaphthene 201-469-6	83-32-9			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
24	fluorene 201-695-5	86-73-7			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
25	phenanthrene 201-581-5	85-01-8			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
26	anthracene 204-371-1	120-12-7			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
27	fluoranthene 205-912-4	206-44-0			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
28	pyrene 204-927-3	129-00-0			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
29	benzo[a]anthracene 601-033-00-9	200-280-6	56-55-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
30	chrysene 601-048-00-0	205-923-4	218-01-9		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
31	benzo[b]fluoranthene 601-034-00-4	205-911-9	205-99-2		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
32	benzo[k]fluoranthene 601-036-00-5	205-916-6	207-08-9		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
33	benzo[a]pyrene; benzo[def]chrysene 601-032-00-3	200-028-5	50-32-8		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
34	indeno[123-cd]pyrene 205-893-2	193-39-5			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
35	dibenz[a,h]anthracene 601-041-00-2	200-181-8	53-70-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
36	benzo[ghi]perylene 205-883-8	191-24-2			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %		<LOD
37	phenol 604-001-00-2	203-632-7	108-95-2		<0.1 mg/kg		<0.1 mg/kg	<0.00001 %		<LOD
38	polychlorobiphenyls; PCB 602-039-00-4	215-648-1	1336-36-3		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %		<LOD
Total:								0.0324 %		



Key

	User supplied data
	Determinand values ignored for classification, see column 'Conc. Not Used' for reason
■	Determinand defined or amended by HazWasteOnline (see Appendix A)
■	Speciated Determinand - Unless the Determinand is Note 1, the Conversion Factor is used to calculate the compound concentration
<LOD	Below limit of detection
ND	Not detected
CLP: Note 1	Only the metal concentration has been used for classification



Classification of sample: TP32

✔ **Non Hazardous Waste**
Classified as **17 05 04**
in the List of Waste

Sample details

Sample name:	LoW Code:	
TP32	Chapter:	17: Construction and Demolition Wastes (including excavated soil from contaminated sites)
Sample Depth:	Entry:	17 05 04 (Soil and stones other than those mentioned in 17 05 03)
0.5 m		
Moisture content:		
13%		
(dry weight correction)		

Hazard properties

None identified

Determinands

Moisture content: 13% Dry Weight Moisture Correction applied (MC)

#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.		Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number								
1	antimony { antimony trioxide }				<2 mg/kg	1.197	<2.394 mg/kg	<0.000239 %			<LOD
	051-005-00-X	215-175-0	1309-64-4								
2	arsenic { arsenic trioxide }				9.7 mg/kg	1.32	11.334 mg/kg	0.00113 %		✓	
	033-003-00-0	215-481-4	1327-53-3								
3	boron { diboron trioxide }				<0.4 mg/kg	3.22	<1.288 mg/kg	<0.000129 %			<LOD
	005-008-00-8	215-125-8	1303-86-2								
4	cadmium { cadmium oxide }				2.2 mg/kg	1.142	2.224 mg/kg	0.000222 %		✓	
	048-002-00-0	215-146-2	1306-19-0								
5	chromium in chromium(III) compounds { chromium(III) oxide (worst case) }				20 mg/kg	1.462	25.868 mg/kg	0.00259 %		✓	
		215-160-9	1308-38-9								
6	chromium in chromium(VI) compounds { chromium (VI) compounds, with the exception of barium chromate and of compounds specified elsewhere in this Annex }				<0.5 mg/kg	2.27	<1.135 mg/kg	<0.000113 %			<LOD
	024-017-00-8										
7	copper { dicopper oxide; copper (I) oxide }				17 mg/kg	1.126	16.938 mg/kg	0.00169 %		✓	
	029-002-00-X	215-270-7	1317-39-1								
8	lead { lead chromate }			1	47 mg/kg	1.56	64.877 mg/kg	0.00416 %		✓	
	082-004-00-2	231-846-0	7758-97-6								
9	mercury { mercury dichloride }				0.1 mg/kg	1.353	0.12 mg/kg	0.000012 %		✓	
	080-010-00-X	231-299-8	7487-94-7								
10	molybdenum { molybdenum(VI) oxide }				1.6 mg/kg	1.5	2.124 mg/kg	0.000212 %		✓	
	042-001-00-9	215-204-7	1313-27-5								
11	nickel { nickel chromate }				37 mg/kg	2.976	97.453 mg/kg	0.00975 %		✓	
	028-035-00-7	238-766-5	14721-18-7								
12	selenium { nickel selenate }				0.9 mg/kg	2.554	2.034 mg/kg	0.000203 %		✓	
	028-031-00-5	239-125-2	15060-62-5								
13	zinc { zinc chromate }				130 mg/kg	2.774	319.15 mg/kg	0.0319 %		✓	
	024-007-00-3	236-878-9	13530-65-9								
14	TPH (C6 to C40) petroleum group				<10 mg/kg		<10 mg/kg	<0.001 %			<LOD
			TPH								
15	tert-butyl methyl ether; MTBE; 2-methoxy-2-methylpropane				<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
	603-181-00-X	216-653-1	1634-04-4								



#	Determinand			CLP Note	User entered data	Conv. Factor	Compound conc.		Classification value	MC Applied	Conc. Not Used
	EU CLP index number	EC Number	CAS Number								
16	benzene 601-020-00-8	200-753-7	71-43-2		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
17	toluene 601-021-00-3	203-625-9	108-88-3		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
18	ethylbenzene 601-023-00-4	202-849-4	100-41-4		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
19	xylene 601-022-00-9	202-422-2 [1] 203-396-5 [2] 203-576-3 [3] 215-535-7 [4]	95-47-6 [1] 106-42-3 [2] 108-38-3 [3] 1330-20-7 [4]		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
20	cyanides { salts of hydrogen cyanide with the exception of complex cyanides such as ferrocyanides, ferricyanides and mercuric oxycyanide and those specified elsewhere in this Annex } 006-007-00-5				<0.5 mg/kg	1.884	<0.942 mg/kg	<0.0000942 %			<LOD
21	naphthalene 601-052-00-2	202-049-5	91-20-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
22	acenaphthylene 205-917-1	208-96-8			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
23	acenaphthene 201-469-6	83-32-9			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
24	fluorene 201-695-5	86-73-7			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
25	phenanthrene 201-581-5	85-01-8			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
26	anthracene 204-371-1	120-12-7			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
27	fluoranthene 205-912-4	206-44-0			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
28	pyrene 204-927-3	129-00-0			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
29	benzo[a]anthracene 601-033-00-9	200-280-6	56-55-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
30	chrysene 601-048-00-0	205-923-4	218-01-9		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
31	benzo[b]fluoranthene 601-034-00-4	205-911-9	205-99-2		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
32	benzo[k]fluoranthene 601-036-00-5	205-916-6	207-08-9		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
33	benzo[a]pyrene; benzo[def]chrysene 601-032-00-3	200-028-5	50-32-8		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
34	indeno[123-cd]pyrene 205-893-2	193-39-5			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
35	dibenz[a,h]anthracene 601-041-00-2	200-181-8	53-70-3		<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
36	benzo[ghi]perylene 205-883-8	191-24-2			<0.01 mg/kg		<0.01 mg/kg	<0.000001 %			<LOD
37	phenol 604-001-00-2	203-632-7	108-95-2		<0.1 mg/kg		<0.1 mg/kg	<0.00001 %			<LOD
38	polychlorobiphenyls; PCB 602-039-00-4	215-648-1	1336-36-3		<0.001 mg/kg		<0.001 mg/kg	<0.0000001 %			<LOD
Total:									0.0535 %		



Key

	User supplied data
	Determinand values ignored for classification, see column 'Conc. Not Used' for reason
	Determinand defined or amended by HazWasteOnline (see Appendix A)
	Speciated Determinand - Unless the Determinand is Note 1, the Conversion Factor is used to calculate the compound concentration
<LOD	Below limit of detection
ND	Not detected
CLP: Note 1	Only the metal concentration has been used for classification

Appendix A: Classifier defined and non EU CLP determinands

chromium(III) oxide (worst case) (EC Number: 215-160-9, CAS Number: 1308-38-9)

Description/Comments: Data from C&L Inventory Database

Data source: <https://echa.europa.eu/information-on-chemicals/cl-inventory-database/-/discli/details/33806>

Data source date: 17 Jul 2015

Hazard Statements: Acute Tox. 4; H332 , Acute Tox. 4; H302 , Eye Irrit. 2; H319 , STOT SE 3; H335 , Skin Irrit. 2; H315 , Resp. Sens. 1; H334 , Skin Sens. 1; H317 , Repr. 1B; H360FD , Aquatic Acute 1; H400 , Aquatic Chronic 1; H410

TPH (C6 to C40) petroleum group (CAS Number: TPH)

Description/Comments: Hazard statements taken from WM3 1st Edition 2015; Risk phrases: WM2 3rd Edition 2013

Data source: WM3 1st Edition 2015

Data source date: 25 May 2015

Hazard Statements: Flam. Liq. 3; H226 , Asp. Tox. 1; H304 , STOT RE 2; H373 , Muta. 1B; H340 , Carc. 1B; H350 , Repr. 2; H361d , Aquatic Chronic 2; H411

ethylbenzene (EC Number: 202-849-4, CAS Number: 100-41-4)

EU CLP index number: 601-023-00-4

Description/Comments:

Additional Hazard Statement(s): Carc. 2; H351

Reason for additional Hazards Statement(s):

03 Jun 2015 - Carc. 2; H351 hazard statement sourced from: IARC Group 2B (77) 2000

salts of hydrogen cyanide with the exception of complex cyanides such as ferrocyanides, ferricyanides and mercuric oxycyanide and those specified elsewhere in this Annex

EU CLP index number: 006-007-00-5

Description/Comments: Conversion factor based on a worst case compound: sodium cyanide

Additional Hazard Statement(s): EUH032 >= 0.2 %

Reason for additional Hazards Statement(s):

14 Dec 2015 - EUH032 >= 0.2 % hazard statement sourced from: WM3, Table C12.2

acenaphthylene (EC Number: 205-917-1, CAS Number: 208-96-8)

Description/Comments: Data from C&L Inventory Database

Data source: <http://echa.europa.eu/web/guest/information-on-chemicals/cl-inventory-database>

Data source date: 17 Jul 2015

Hazard Statements: Acute Tox. 4; H302 , Acute Tox. 1; H330 , Acute Tox. 1; H310 , Eye Irrit. 2; H319 , STOT SE 3; H335 , Skin Irrit. 2; H315

acenaphthene (EC Number: 201-469-6, CAS Number: 83-32-9)

Description/Comments: Data from C&L Inventory Database

Data source: <http://echa.europa.eu/web/guest/information-on-chemicals/cl-inventory-database>

Data source date: 17 Jul 2015

Hazard Statements: Eye Irrit. 2; H319 , STOT SE 3; H335 , Skin Irrit. 2; H315 , Aquatic Acute 1; H400 , Aquatic Chronic 1; H410 , Aquatic Chronic 2; H411

fluorene (EC Number: 201-695-5, CAS Number: 86-73-7)

Description/Comments: Data from C&L Inventory Database

Data source: <http://echa.europa.eu/web/guest/information-on-chemicals/cl-inventory-database>

Data source date: 06 Aug 2015

Hazard Statements: Aquatic Acute 1; H400 , Aquatic Chronic 1; H410

phenanthrene (EC Number: 201-581-5, CAS Number: 85-01-8)

Description/Comments: Data from C&L Inventory Database

Data source: <http://echa.europa.eu/web/guest/information-on-chemicals/cl-inventory-database>

Data source date: 06 Aug 2015

Hazard Statements: Acute Tox. 4; H302 , Eye Irrit. 2; H319 , STOT SE 3; H335 , Carc. 2; H351 , Skin Sens. 1; H317 , Aquatic Acute 1; H400 , Aquatic Chronic 1; H410 , Skin Irrit. 2; H315

anthracene (EC Number: 204-371-1, CAS Number: 120-12-7)

Description/Comments: Data from C&L Inventory Database

Data source: <http://echa.europa.eu/web/guest/information-on-chemicals/cl-inventory-database>

Data source date: 17 Jul 2015

Hazard Statements: Eye Irrit. 2; H319 , STOT SE 3; H335 , Skin Irrit. 2; H315 , Skin Sens. 1; H317 , Aquatic Acute 1; H400 , Aquatic Chronic 1; H410

fluoranthene (EC Number: 205-912-4, CAS Number: 206-44-0)

Description/Comments: Data from C&L Inventory Database

Data source: <http://echa.europa.eu/web/guest/information-on-chemicals/cl-inventory-database>

Data source date: 21 Aug 2015

Hazard Statements: Acute Tox. 4; H302 , Aquatic Acute 1; H400 , Aquatic Chronic 1; H410

• **pyrene** (EC Number: 204-927-3, CAS Number: 129-00-0)

Description/Comments: Data from C&L Inventory Database; SDS Sigma Aldrich 2014
Data source: <http://echa.europa.eu/web/guest/information-on-chemicals/cl-inventory-database>
Data source date: 21 Aug 2015
Hazard Statements: Skin Irrit. 2; H315 , Eye Irrit. 2; H319 , STOT SE 3; H335 , Aquatic Acute 1; H400 , Aquatic Chronic 1; H410

• **indeno[123-cd]pyrene** (EC Number: 205-893-2, CAS Number: 193-39-5)

Description/Comments: Data from C&L Inventory Database
Data source: <http://echa.europa.eu/web/guest/information-on-chemicals/cl-inventory-database>
Data source date: 06 Aug 2015
Hazard Statements: Carc. 2; H351

• **benzo[ghi]perylene** (EC Number: 205-883-8, CAS Number: 191-24-2)

Description/Comments: Data from C&L Inventory Database; SDS Sigma Aldrich 28/02/2015
Data source: <http://echa.europa.eu/web/guest/information-on-chemicals/cl-inventory-database>
Data source date: 23 Jul 2015
Hazard Statements: Aquatic Acute 1; H400 , Aquatic Chronic 1; H410

• **polychlorobiphenyls; PCB** (EC Number: 215-648-1, CAS Number: 1336-36-3)

EU CLP index number: 602-039-00-4
Description/Comments: Worst Case: IARC considers PCB Group 1; Carcinogenic to humans; POP specific threshold from ATP1 (Regulation 756/2010/EU) to POPs Regulation (Regulation 850/2004/EC). Where applicable, the calculation method laid down in European standards EN 12766-1 and EN 12766-2 shall be applied.
Additional Hazard Statement(s): Carc. 1A; H350
Reason for additional Hazards Statement(s):
29 Sep 2015 - Carc. 1A; H350 hazard statement sourced from: IARC Group 1 (23, Sup 7, 100C) 2012

Appendix B: Rationale for selection of metal species

antimony {antimony trioxide}

Worst case CLP species based on hazard statements/molecular weight and low solubility. Industrial sources include: flame retardants in electrical apparatus, textiles and coatings (edit as required)

arsenic {arsenic trioxide}

Reasonable case CLP species based on hazard statements/molecular weight and most common (stable) oxide of arsenic. Industrial sources include: smelting; main precursor to other arsenic compounds (edit as required)

boron {diboron trioxide}

Reasonable case CLP species based on hazard statements/ molecular weight, physical form and low solubility. Industrial sources include: fluxing agent for glass/enamels; additive for fibre optics, borosilicate glass (edit as required)

cadmium {cadmium oxide}

Reasonable case CLP species based on hazard statements/molecular weight, very low solubility in water. Industrial sources include: electroplating baths, electrodes for storage batteries, catalysts, ceramic glazes, phosphors, pigments and nematocides. (edit as required) Worst case compounds in CLP: cadmium sulphate, chloride, fluoride & iodide not expected as either very soluble and/or compound's industrial usage not related to site history (edit as required)

chromium in chromium(III) compounds {chromium(III) oxide (worst case)}

Reasonable case species based on hazard statements/molecular weight. Industrial sources include: tanning, pigment in paint, inks and glass (edit as required)

chromium in chromium(VI) compounds {chromium (VI) compounds, with the exception of barium chromate and of compounds specified elsewhere in this Annex}

Worst case species based on hazard statements/molecular weight (edit as required)

copper {dicopper oxide; copper (I) oxide}

Reasonable case CLP species based on hazard statements/molecular weight and insolubility in water. Industrial sources include: oxidised copper metal, brake pads, pigments, antifouling paints, fungicide. (edit as required) Worse case copper sulphate is very soluble and likely to have been leached away if ever present and/or not enough soluble sulphate detected. (edit as required)

lead {lead chromate}

Worst case CLP species based on hazard statements/molecular weight (edit as required)

mercury {mercury dichloride}

Worst case CLP species based on hazard statements/molecular weight (edit as required)

molybdenum {molybdenum(VI) oxide}

Worst case CLP species based on hazard statements/molecular weight (edit as required)



nickel {nickel chromate}

Worst case CLP species based on hazard statements/molecular weight (edit as required)

selenium {nickel selenate}

Worst case CLP species based on hazard statements/molecular weight (edit as required)

zinc {zinc chromate}

Worst case CLP species based on hazard statements/molecular weight (edit as required)

cyanides {salts of hydrogen cyanide with the exception of complex cyanides such as ferrocyanides, ferricyanides and mercuric oxycyanide and those specified elsewhere in this Annex}

Harmonised group entry used as most reasonable case as complex cyanides and those specified elsewhere in the annex are not likely to be present in this soil: [Note conversion factor based on a worst case compound: sodium cyanide] (edit as required)

Appendix C: Version

HazWasteOnline Classification Engine: **WM3 1st Edition v1.1.NI - Jan 2021**

HazWasteOnline Classification Engine Version: 2023.25.5511.10206 (25 Jan 2023)

HazWasteOnline Database: 2023.25.5511.10206 (25 Jan 2023)

This classification utilises the following guidance and legislation:

WM3 v1.1.NI - Waste Classification - 1st Edition v1.1.NI - Jan 2021

CLP Regulation - Regulation 1272/2008/EC of 16 December 2008

1st ATP - Regulation 790/2009/EC of 10 August 2009

2nd ATP - Regulation 286/2011/EC of 10 March 2011

3rd ATP - Regulation 618/2012/EU of 10 July 2012

4th ATP - Regulation 487/2013/EU of 8 May 2013

Correction to 1st ATP - Regulation 758/2013/EU of 7 August 2013

5th ATP - Regulation 944/2013/EU of 2 October 2013

6th ATP - Regulation 605/2014/EU of 5 June 2014

WFD Annex III replacement - Regulation 1357/2014/EU of 18 December 2014

Revised List of Waste 2014 - Decision 2014/955/EU of 18 December 2014

7th ATP - Regulation 2015/1221/EU of 24 July 2015

8th ATP - Regulation (EU) 2016/918 of 19 May 2016

9th ATP - Regulation (EU) 2016/1179 of 19 July 2016

10th ATP - Regulation (EU) 2017/776 of 4 May 2017

HP14 amendment - Regulation (EU) 2017/997 of 8 June 2017

13th ATP - Regulation (EU) 2018/1480 of 4 October 2018

14th ATP - Regulation (EU) 2020/217 of 4 October 2019

15th ATP - Regulation (EU) 2020/1182 of 19 May 2020

The Chemicals (Health and Safety) and Genetically Modified Organisms (Contained Use)(Amendment etc.) (EU Exit)

Regulations 2020 - UK: 2020 No. 1567 of 16th December 2020

The Waste and Environmental Permitting etc. (Legislative Functions and Amendment etc.) (EU Exit) Regulations 2020 - UK: 2020 No. 1540 of 16th December 2020

17th ATP - Regulation (EU) 2021/849 of 11 March 2021

18th ATP - Regulation (EU) 2022/692 of 16 February 2022

Appendix 14

Environmental Laboratory Results (Water)

Report_22-47891

Final Report

Report No.:	22-47891-1		
Initial Date of Issue:	10-Jan-2023		
Client	IGSL		
Client Address:	M7 Business Park Naas County Kildare Ireland		
Contact(s):	Darren Keogh		
Project	Halverstown		
Quotation No.:		Date Received:	14-Dec-2022
Order No.:		Date Instructed:	19-Dec-2022
No. of Samples:	5		
Turnaround (Wkdays):	8	Results Due:	04-Jan-2023
Date Approved:	10-Jan-2023		
Approved By:			
Details:	Stuart Henderson, Technical Manager		

Results - Water

Project: Halverstown

Client: IGSL	Chemtest Job No.:				22-47891	22-47891	22-47891	22-47891	22-47891
Quotation No.:	Chemtest Sample ID.:				1564373	1564375	1564377	1564378	1564379
Order No.:	Client Sample Ref.:				Stream Start	Stream End	BH03	BH12	BH103
	Client Sample ID.:				WS1(1)	WS2(1)	WSBH03	WSBH12	WSBH103
	Sample Type:				WATER	WATER	WATER	WATER	WATER
	Top Depth (m):				0.5	0.7	1.3	0.98	2.2
	Date Sampled:				02-Dec-2022	02-Dec-2022	02-Dec-2022	02-Dec-2022	02-Dec-2022
Determinand	Accred.	SOP	Units	LOD					
pH	U	1010		N/A	[B] 8.3	[B] 7.9	[B] 7.6	[B] 7.4	[B] 7.5
Dissolved Oxygen	N	1150	mg O2/l	0.50	9.5	9.2	8.5	8.2	8.5
Dissolved CO2	N	1160	mg/l	0.60	[B] 3.8	[B] 10	[B] 19	[B] 29	[B] 22
Alkalinity (Total)	U	1220	mg/l	10	[B] 400	[B] 390	[B] 340	[B] 370	[B] 340
Orthophosphate as PO4	U	1220	mg/l	0.050	[B] 0.097	[B] 0.081	[B] 0.065	[B] 0.064	[B] 0.064
Sulphur	N	1220	mg/l	1.0	[B] 15	[B] 15	[B] 7.3	[B] 22	[B] 4.3
Cyanide (Total)	U	1300	mg/l	0.050	[B] < 0.050	[B] < 0.050	[B] < 0.050	[B] < 0.050	[B] < 0.050
Cyanide (Free)	U	1300	mg/l	0.050	[B] < 0.050	[B] < 0.050	[B] < 0.050	[B] < 0.050	[B] < 0.050
Sulphide	U	1325	mg/l	0.050	[B] < 0.050	[B] < 0.050	[B] < 0.050	[B] < 0.050	[B] < 0.050
Calcium (Dissolved)	U	1455	mg/l	2.00	[B] 120	[B] 120	[B] 77	[B] 110	[B] 87
Total Hardness as CaCO3	U	1270	mg/l	15	[B] 360	[B] 360	[B] 230	[B] 360	[B] 270
Aluminium (Dissolved)	N	1455	µg/l	5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0
Arsenic (Dissolved)	U	1455	µg/l	0.20	[B] 0.78	[B] 0.76	[B] 0.38	[B] 0.44	[B] 0.35
Boron (Dissolved)	U	1455	µg/l	10.0	[B] 26	[B] 27	[B] 29	[B] 22	[B] 32
Barium (Dissolved)	U	1455	µg/l	5.00	[B] 48	[B] 46	[B] 38	[B] 91	[B] 72
Beryllium (Dissolved)	U	1455	µg/l	1.00	[B] < 1.0	[B] < 1.0	[B] < 1.0	[B] < 1.0	[B] < 1.0
Cadmium (Dissolved)	U	1455	µg/l	0.11	[B] < 0.11	[B] < 0.11	[B] < 0.11	[B] < 0.11	[B] < 0.11
Chromium (Dissolved)	U	1455	µg/l	0.50	[B] 7.1	[B] 7.9	[B] 0.89	[B] 0.54	[B] 8.8
Copper (Dissolved)	U	1455	µg/l	0.50	[B] 2.1	[B] 1.9	[B] 2.4	[B] 3.5	[B] 1.2
Iron (Dissolved)	N	1455	µg/l	5.0	[B] 9.3	[B] 8.3	[B] 5.9	[B] 8.7	[B] 5.0
Mercury (Dissolved)	U	1455	µg/l	0.05	[B] < 0.05	[B] < 0.05	[B] < 0.05	[B] < 0.05	[B] < 0.05
Manganese (Dissolved)	U	1455	µg/l	0.50	[B] 0.57	[B] 0.58	[B] 450	[B] 170	[B] 1.3
Nickel (Dissolved)	U	1455	µg/l	0.50	[B] 1.9	[B] 2.0	[B] 9.6	[B] 7.0	[B] 1.2
Lead (Dissolved)	U	1455	µg/l	0.50	[B] < 0.50	[B] < 0.50	[B] < 0.50	[B] < 0.50	[B] < 0.50
Selenium (Dissolved)	U	1455	µg/l	0.50	[B] 5.6	[B] 5.7	[B] 7.6	[B] 8.8	[B] 1.8
Vanadium (Dissolved)	U	1455	µg/l	0.50	[B] < 0.50	[B] < 0.50	[B] < 0.50	[B] < 0.50	[B] < 0.50
Zinc (Dissolved)	U	1455	µg/l	2.5	[B] < 2.5	[B] 2.7	[B] 3.4	[B] 9.4	[B] < 2.5
Chromium (Total)	N	1455	µg/l	0.50	[B] 9.9	[B] 11	[B] 15	[B] 33	[B] 24
Low-Level Chromium (Hexavalent)	U	1495	µg/l	0.10	[B] 4.6	[B] 5.2	[B] 0.41	[B] 0.27	[B] 6.1
Dissolved Organic Carbon	U	1610	mg/l	2.0	3.7	3.4	3.6	5.5	< 2.0
Dissolved Methane	N	1630	mg/l	0.050	< 0.050	< 0.050	< 0.050	< 0.050	0.057
Aliphatic TPH >C5-C6	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C6-C8	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C8-C10	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C10-C12	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C12-C16	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C16-C21	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C21-C35	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aliphatic TPH >C35-C44	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10

Results - Water

Project: Halverstown

Client: IGSL	Chemtest Job No.:				22-47891	22-47891	22-47891	22-47891	22-47891
Quotation No.:	Chemtest Sample ID.:				1564373	1564375	1564377	1564378	1564379
Order No.:	Client Sample Ref.:				Stream Start	Stream End	BH03	BH12	BH103
	Client Sample ID.:				WS1(1)	WS2(1)	WSBH03	WSBH12	WSBH103
	Sample Type:				WATER	WATER	WATER	WATER	WATER
	Top Depth (m):				0.5	0.7	1.3	0.98	2.2
	Date Sampled:				02-Dec-2022	02-Dec-2022	02-Dec-2022	02-Dec-2022	02-Dec-2022
Determinand	Accred.	SOP	Units	LOD					
Total Aliphatic Hydrocarbons	N	1675	µg/l	5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0
Aromatic TPH >C5-C7	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C7-C8	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C8-C10	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C10-C12	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C12-C16	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C16-C21	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C21-C35	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Aromatic TPH >C35-C44	N	1675	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Total Aromatic Hydrocarbons	N	1675	µg/l	5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0	[B] < 5.0
Total Petroleum Hydrocarbons	N	1675	µg/l	10	[B] < 10	[B] < 10	[B] < 10	[B] < 10	[B] < 10
Dichlorodifluoromethane	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Chloromethane	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Vinyl Chloride	N	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Bromomethane	U	1760	µg/l	5	[BC] < 5	[BC] < 5	[BC] < 5	[BC] < 5	[BC] < 5
Chloroethane	U	1760	µg/l	2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0
Trichlorofluoromethane	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,1-Dichloroethene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Trans 1,2-Dichloroethene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,1-Dichloroethane	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
cis 1,2-Dichloroethene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Bromochloromethane	U	1760	µg/l	5	[BC] < 5	[BC] < 5	[BC] < 5	[BC] < 5	[BC] < 5
Trichloromethane	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,1,1-Trichloroethane	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Tetrachloromethane	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,1-Dichloropropene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Benzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,2-Dichloroethane	U	1760	µg/l	2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0
Trichloroethene	N	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,2-Dichloropropane	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Dibromomethane	U	1760	µg/l	10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10
Bromodichloromethane	U	1760	µg/l	5	[BC] < 5	[BC] < 5	[BC] < 5	[BC] < 5	[BC] < 5
cis-1,3-Dichloropropene	N	1760	µg/l	10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10
Toluene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Trans-1,3-Dichloropropene	N	1760	µg/l	10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10
1,1,2-Trichloroethane	U	1760	µg/l	10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10
Tetrachloroethene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,3-Dichloropropane	U	1760	µg/l	2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0
Dibromochloromethane	U	1760	µg/l	10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10	[BC] < 10

Results - Water

Project: Halverstown

Client: IGSL	Chemtest Job No.: 22-47891					22-47891	22-47891	22-47891	22-47891
Quotation No.:	Chemtest Sample ID.: 1564373					1564375	1564377	1564378	1564379
Order No.:	Client Sample Ref.: Stream Start					Stream End	BH03	BH12	BH103
	Client Sample ID.: WS1(1)					WS2(1)	WSBH03	WSBH12	WSBH103
	Sample Type: WATER					WATER	WATER	WATER	WATER
	Top Depth (m): 0.5					0.7	1.3	0.98	2.2
	Date Sampled: 02-Dec-2022					02-Dec-2022	02-Dec-2022	02-Dec-2022	02-Dec-2022
Determinand	Accred.	SOP	Units	LOD					
1,2-Dibromoethane	U	1760	µg/l	5	[BC] < 5	[BC] < 5	[BC] < 5	[BC] < 5	[BC] < 5
Chlorobenzene	N	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,1,1,2-Tetrachloroethane	U	1760	µg/l	2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0
Ethylbenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
m & p-Xylene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
o-Xylene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Styrene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Tribromomethane	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Isopropylbenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Bromobenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,2,3-Trichloropropane	N	1760	µg/l	50	[BC] < 50	[BC] < 50	[BC] < 50	[BC] < 50	[BC] < 50
N-Propylbenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
2-Chlorotoluene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,3,5-Trimethylbenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
4-Chlorotoluene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Tert-Butylbenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,2,4-Trimethylbenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Sec-Butylbenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,3-Dichlorobenzene	N	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
4-Isopropyltoluene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,4-Dichlorobenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
N-Butylbenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,2-Dichlorobenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,2-Dibromo-3-Chloropropane	U	1760	µg/l	50	[BC] < 50	[BC] < 50	[BC] < 50	[BC] < 50	[BC] < 50
1,2,4-Trichlorobenzene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
Hexachlorobutadiene	U	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
1,2,3-Trichlorobenzene	U	1760	µg/l	2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0	[BC] < 2.0
Methyl Tert-Butyl Ether	N	1760	µg/l	1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0	[BC] < 1.0
N-Nitrosodimethylamine	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Phenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2-Chlorophenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Bis-(2-Chloroethyl)Ether	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
1,3-Dichlorobenzene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
1,4-Dichlorobenzene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
1,2-Dichlorobenzene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2-Methylphenol (o-Cresol)	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Bis(2-Chloroisopropyl)Ether	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Hexachloroethane	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
N-Nitrosodi-n-propylamine	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50

Results - Water

Project: Halverstown

Client: IGSL	Chemtest Job No.:				22-47891	22-47891	22-47891	22-47891	22-47891
Quotation No.:	Chemtest Sample ID.:				1564373	1564375	1564377	1564378	1564379
Order No.:	Client Sample Ref.:				Stream Start	Stream End	BH03	BH12	BH103
	Client Sample ID.:				WS1(1)	WS2(1)	WSBH03	WSBH12	WSBH103
	Sample Type:				WATER	WATER	WATER	WATER	WATER
	Top Depth (m):				0.5	0.7	1.3	0.98	2.2
	Date Sampled:				02-Dec-2022	02-Dec-2022	02-Dec-2022	02-Dec-2022	02-Dec-2022
Determinand	Accred.	SOP	Units	LOD					
4-Methylphenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Nitrobenzene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Isophorone	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2-Nitrophenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2,4-Dimethylphenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Bis(2-Chloroethoxy)Methane	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2,4-Dichlorophenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
1,2,4-Trichlorobenzene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
4-Chloroaniline	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Hexachlorobutadiene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
4-Chloro-3-Methylphenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2-Methylnaphthalene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Hexachlorocyclopentadiene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2,4,6-Trichlorophenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2,4,5-Trichlorophenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2-Chloronaphthalene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2-Nitroaniline	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Dimethylphthalate	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2,6-Dinitrotoluene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
3-Nitroaniline	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Dibenzofuran	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
4-Chlorophenylphenylether	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2,4-Dinitrotoluene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Diethyl Phthalate	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
4-Nitroaniline	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
2-Methyl-4,6-Dinitrophenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Azobenzene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
4-Bromophenylphenyl Ether	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Hexachlorobenzene	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Pentachlorophenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Carbazole	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Di-N-Butyl Phthalate	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Butylbenzyl Phthalate	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Bis(2-Ethylhexyl)Phthalate	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Di-N-Octyl Phthalate	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
4-Nitrophenol	N	1790	µg/l	0.50	< 0.50	< 0.50	< 0.50	< 0.50	< 0.50
Naphthalene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Acenaphthylene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Acenaphthene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10

Results - Water

Project: Halverstown

Client: IGSL	Chemtest Job No.:				22-47891	22-47891	22-47891	22-47891	22-47891
Quotation No.:	Chemtest Sample ID.:				1564373	1564375	1564377	1564378	1564379
Order No.:	Client Sample Ref.:				Stream Start	Stream End	BH03	BH12	BH103
	Client Sample ID.:				WS1(1)	WS2(1)	WSBH03	WSBH12	WSBH103
	Sample Type:				WATER	WATER	WATER	WATER	WATER
	Top Depth (m):				0.5	0.7	1.3	0.98	2.2
	Date Sampled:				02-Dec-2022	02-Dec-2022	02-Dec-2022	02-Dec-2022	02-Dec-2022
Determinand	Accred.	SOP	Units	LOD					
Fluorene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Phenanthrene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Anthracene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Fluoranthene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Pyrene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Benzo[a]anthracene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Chrysene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Benzo[b]fluoranthene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Benzo[k]fluoranthene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Benzo[a]pyrene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Indeno(1,2,3-c,d)Pyrene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Dibenz(a,h)Anthracene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Benzo[g,h,i]perylene	U	1800	µg/l	0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10	[B] < 0.10
Total Of 16 PAH's	U	1800	µg/l	2.0	[B] < 2.0	[B] < 2.0	[B] < 2.0	[B] < 2.0	[B] < 2.0
PCB 81	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 77	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 105	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 114	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 118	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 123	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 126	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 156	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 157	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 167	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 169	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
PCB 189	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
Total PCBs (12 Congeners)	N	1815	µg/l	0.010	< 0.010	< 0.010	< 0.010	< 0.010	< 0.010
Resorcinol	U	1920	mg/l	0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050
Phenol	U	1920	mg/l	0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050
Cresols	U	1920	mg/l	0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050
Xylenols	U	1920	mg/l	0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050
1-Naphthol	N	1920	mg/l	0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050
Trimethylphenols	U	1920	mg/l	0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050	[B] < 0.0050
Total Phenols	U	1920	mg/l	0.030	[B] < 0.030	[B] < 0.030	[B] < 0.030	[B] < 0.030	[B] < 0.030

Deviations

In accordance with UKAS Policy on Deviating Samples TPS 63. Chemtest have a procedure to ensure 'upon receipt of each sample a competent laboratory shall assess whether the sample is suitable with regard to the requested test(s)'. This policy and the respective holding times applied, can be supplied upon request. The reason a sample is declared as deviating is detailed below. Where applicable the analysis remains UKAS/MCERTs accredited but the results may be compromised.

Sample:	Sample Ref:	Sample ID:	Sample Location:	Sampled Date:	Deviation Code(s):	Containers Received:
1564373	Stream Start	WS1(1)		02-Dec-2022	BC	Coloured Winchester 1000ml
1564375	Stream End	WS2(1)		02-Dec-2022	BC	Coloured Winchester 1000ml
1564377	BH03	WSBH03		02-Dec-2022	BC	Coloured Winchester 1000ml
1564378	BH12	WSBH12		02-Dec-2022	BC	Coloured Winchester 1000ml
1564379	BH103	WSBH103		02-Dec-2022	BC	Coloured Winchester 1000ml

Test Methods

SOP	Title	Parameters included	Method summary
1010	pH Value of Waters	pH	pH Meter
1150	Dissolved Oxygen	Dissolved Oxygen (DO)	Electrometric determination (on site preferred), using oxygen sensitive membrane electrode.
1160	Aggressive Dissolved CO2	Aggressive Dissolved CO2	Titration
1220	Anions, Alkalinity & Ammonium in Waters	Fluoride; Chloride; Nitrite; Nitrate; Total; Oxidisable Nitrogen (TON); Sulfate; Phosphate; Alkalinity; Ammonium	Automated colorimetric analysis using 'Aquakem 600' Discrete Analyser.
1270	Total Hardness of Waters	Total hardness	Calculation applied to calcium and magnesium results, expressed as mg l-1 CaCO3 equivalent.
1300	Cyanides & Thiocyanate in Waters	Free (or easy liberatable) Cyanide; total Cyanide; complex Cyanide; Thiocyanate	Continuous Flow Analysis.
1325	Sulphide in Waters	Sulphides	Automated colorimetric analysis by 'Aquakem 600' Discrete Analyser using N,N-dimethyl-pphenylenediamine.
1455	Metals in Waters by ICP-MS	Metals, including: Antimony; Arsenic; Barium; Beryllium; Boron; Cadmium; Chromium; Cobalt; Copper; Lead; Manganese; Mercury; Molybdenum; Nickel; Selenium; Tin; Vanadium; Zinc	Filtration of samples followed by direct determination by inductively coupled plasma mass spectrometry (ICP-MS).
1495	Low Level Hexavalent Chromium in Waters	Chromium [VI]	Colorimetric determination of hexavalent chromium expressed as Cr (VI) µg/l in water, using Ion Chromatography and UV-visible spectrophotometry.
1610	Total/Dissolved Organic Carbon in Waters	Organic Carbon	TOC Analyser using Catalytic Oxidation
1675	TPH Aliphatic/Aromatic split in Waters by GC-FID(cf. Texas Method 1006 / TPH CWG)	Aliphatics: >C5–C6, >C6–C8, >C8– C10, >C10–C12, >C12–C16, >C16–C21, >C21– C35, >C35– C44 Aromatics: >C5–C7, >C7–C8, >C8– C10, >C10–C12, >C12–C16, >C16– C21, >C21– C35, >C35– C44	Pentane extraction / GCxGC FID detection
1760	Volatile Organic Compounds (VOCs) in Waters by Headspace GC-MS	Volatile organic compounds, including BTEX and halogenated Aliphatic/Aromatics. (cf. USEPA Method 8260)	Automated headspace gas chromatographic (GC) analysis of water samples with mass spectrometric (MS) detection of volatile organic compounds.
1790	Semi-Volatile Organic Compounds (SVOCs) in Waters by GC-MS	Semi-volatile organic compounds	Solvent extraction / GCMS detection
1800	Speciated Polynuclear Aromatic Hydrocarbons (PAH) in Waters by GC-MS	Acenaphthene; Acenaphthylene; Anthracene; Benzo[a]Anthracene; Benzo[a]Pyrene; Benzo[b]Fluoranthene; Benzo[ghi]Perylene; Benzo[k]Fluoranthene; Chrysene; Dibenzo[ah]Anthracene; Fluoranthene; Fluorene; Indeno[123cd]Pyrene; Naphthalene; Phenanthrene; Pyrene	Pentane extraction / GCMS detection
1815	Polychlorinated Biphenyls (PCB) ICES7 Congeners in Waters by GC-MS	ICES7 PCB congeners	Solvent extraction / GCMS detection
1920	Phenols in Waters by HPLC	Phenolic compounds including: Phenol, Cresols, Xylenols, Trimethylphenols Note: Chlorophenols are excluded.	Determination by High Performance Liquid Chromatography (HPLC) using electrochemical detection.

Report Information

Key

U	UKAS accredited
M	MCERTS and UKAS accredited
N	Unaccredited
S	This analysis has been subcontracted to a UKAS accredited laboratory that is accredited for this analysis
SN	This analysis has been subcontracted to a UKAS accredited laboratory that is not accredited for this analysis
T	This analysis has been subcontracted to an unaccredited laboratory
I/S	Insufficient Sample
U/S	Unsuitable Sample
N/E	not evaluated
<	"less than"
>	"greater than"
SOP	Standard operating procedure
LOD	Limit of detection

Comments or interpretations are beyond the scope of UKAS accreditation

The results relate only to the items tested

Uncertainty of measurement for the determinands tested are available upon request

None of the results in this report have been recovery corrected

All results are expressed on a dry weight basis

The following tests were analysed on samples as received and the results subsequently corrected to a dry weight basis TPH, BTEX, VOCs, SVOCs, PCBs, Phenols

For all other tests the samples were dried at < 37°C prior to analysis

All Asbestos testing is performed at the indicated laboratory

Issue numbers are sequential starting with 1 all subsequent reports are incremented by 1

Sample Deviation Codes

A - Date of sampling not supplied

B - Sample age exceeds stability time (sampling to extraction)

C - Sample not received in appropriate containers

D - Broken Container

E - Insufficient Sample (Applies to LOI in Trommel Fines Only)

Sample Retention and Disposal

All soil samples will be retained for a period of 30 days from the date of receipt

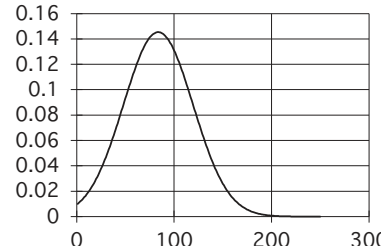
All water samples will be retained for 14 days from the date of receipt

Charges may apply to extended sample storage

If you require extended retention of samples, please email your requirements to:
customerservices@chemtest.com

Appendix 15

Geotechnical Laboratory Results (Rock)

(Diametrial) POINT LOAD STRENGTH INDEX TEST DATA										
Contract: Halverstown			Sample Type: Core							
Contract no. 24330			Date of test: 31/05/2023							
RC No.	Depth m	D (Diameter) mm	P (failure load) kN	F	Is (index strength) Mpa	Is(50) (index strength) Mpa	*UCS MPa	Type	Orientation	
RC02	15.4	78	29.0	1.222	4.77	5.83	117	d	//	
	17.0	78	26.2	1.222	4.31	5.26	105	d	//	
	18.5	78	24.0	1.222	3.95	4.82	96	d	//	
	19.5	78	19.4	1.222	3.19	3.90	78	d	//	
RC03	9.9	78	18.5	1.222	3.04	3.71	74	d	//	
	11.0	78	2.8	1.222	0.47	0.57	11	d	//	
	11.6	78	21.6	1.222	3.54	4.33	87	d	//	
	12.7	78	23.0	1.222	3.78	4.62	92	d	//	
RC04	14.0	78	22.0	1.222	3.62	4.42	88	d	//	
	13.0	78	30.9	1.222	5.08	6.20	124	d	//	
	13.3	78	3.0	1.222	0.49	0.60	12	d	//	
	15.1	78	30.0	1.222	4.93	6.02	120	d	//	
	16.0	78	20.6	1.222	3.39	4.14	83	d	//	
Statistical Summary Data			Is(50)	UCS*	*UCS Normal Distribution Curve			Abbreviations		
Number of Samples Tested			13	13	0.16				i	irregular
Minimum			0.57	11	0.14				a	axial
Average			4.19	84	0.12				b	block
Maximum			6.20	124	0.1				d	diametral
Standard Dev.			1.78	36	0.08				approx. orientation to planes of weakness/bedding	
Upper 95% Confidence Limit			7.68	153.65	0.06					
Lower 95% Confidence Limit			0.69	13.77	0.04					
					0.02					
					0					
<u>Comments:</u>									U	unknown
*UCS taken as k x Point Load Is(50):			k=	20					P	perpendicular
									//	parallel

Appendix 16

Exploratory Hole Location Plans

2022 Investigation

DWG01 – DWG05

2023 Investigation

Additional Works

24330 - Halverstown

Exploratory Hole Location Plan - DWG 01

Legend

 Cable Percussion Borehole

 Dynamic Probe

 Soakaway Test (to BRE365)

 Plate Bearing Test

 Trial Pit



24330 - Halverstown

Exploratory Hole Location Plan - DWG 02

Legend

-  Cable Percussion Borehole
-  Dynamic Probe
-  Soakaway Test (to BRE365)
-  Plate Bearing Test
-  Trial Pit



24330 - Halverstown

Exploratory Hole Location Plan - DWG 03

Legend

- Cable Percussion Borehole
- Dynamic Probe
- Soakaway Test (to BRE365)
- Plate Bearing Test
- Trial Pit



24330 - Halverstown

Exploratory Hole Location Plan - DWG 04

Legend

 Cable Percussion Borehole

 Dynamic Probe

 Soakaway Test (to BRE365)

 Plate Bearing Test

 Trial Pit



24330 - Halverstown

Additional Works - Exploratory Hole Location Plan

Legend

- Rotary Open Hole
- Rotary Drillhole
- Soakaway Pit
- Trial Pit
- Trial Pit / Rotary Open Hole

