


- NOTES:**
1. ALL DIMENSIONS ARE IN METERS UNLESS OTHERWISE STATED
  2. USE DIMENSIONS ON DRAWINGS (DO NOT SCALE FROM DRAWINGS)
  3. SWEEP PATH ANALYSIS OF VEHICLE IS IN PLAN VIEW ONLY. FULL 3D KINEMATIC ANALYSIS OF THE VEHICLE HAS NOT BEEN CARRIED OUT. AREAS WHERE UNDERSIDE OF THE TRAILER MAY CLASH WITH THE ROAD OR GROUND SURFACE HAVE BEEN HIGHLIGHTED, AND REQUIRE REMEDIATION.
  4. SATELLITE IMAGERY FROM © 2022 MICROSOFT CORP. © 2022 MAXAR © CNES (2022) DISTRIBUTION AIRBUS DS - MICROSOFT BING. ACCURACY NOT GUARANTEED.
  5. PHOTOS AND SURVEY POINTS WERE RECORDED BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022.
  6. EXTENTS OF PRIVATE LANDS ARE INDICATIVE ONLY.

- LEGEND:**
- PROPERTY BOUNDARIES INDICATIVE ONLY
  - FOLIO N. 123456 | LANDDIRECT MAP VIEWER, 2022. FOLIO NUMBERS
  - SWEEP PATH: EXTENTS OF WT BLADE OVERSAIL
  - SWEEP PATH: EXTENTS OF VEHICLE CHASSIS MOVEMENT
  - SWEEP PATH: EXTENTS OF VEHICLE BODY MOVEMENT
  - BUILDING INDICATIVE LOCATION
  - FOOT PATH INDICATIVE LOCATION
  - CLASHING AREAS
  - TREES INDICATIVE LOCATION
  - RECORDED POINTS BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022
  - ROAD SIGNALS / SIGNS
  - LAMP POST
  - PHOTO VIEW
  - CHANGE OF THE LANE, CRUISING COUNTER FLOW

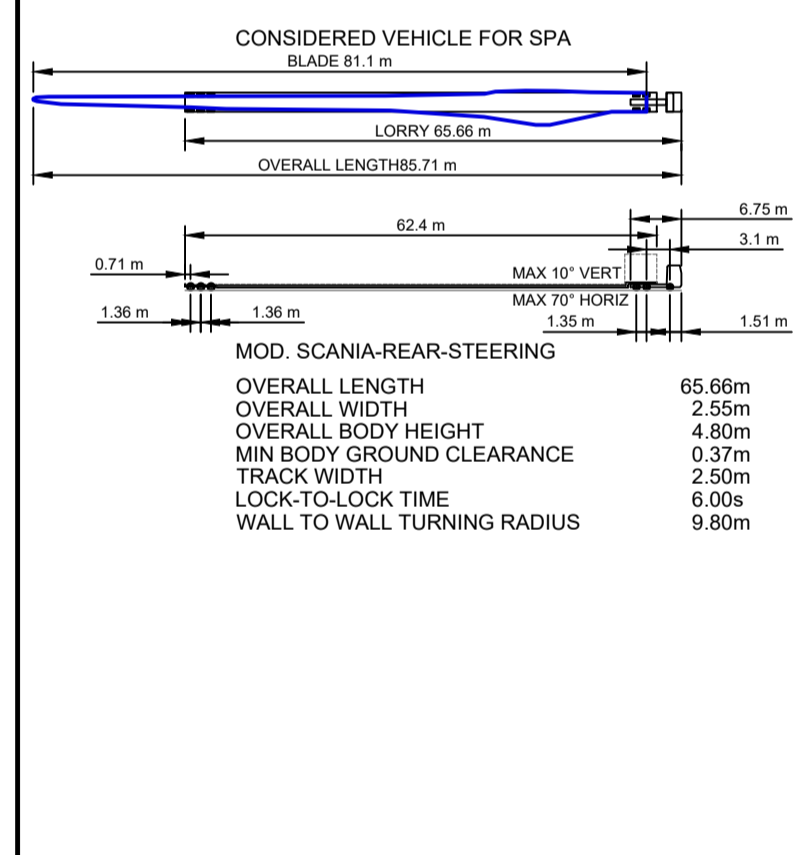

REV: FI -00 | DATE: 23/05/22 | DRAWN BY: EFC | CHECKED BY: EJB  
 DESCRIPTION: ISSUED FOR INFORMATION

**GDG**  
 GAVIN & DOHERTY  
 GEOSOLUTIONS

Unit A2,  
 Nutgrove Office Park,  
 Rathfarnham,  
 Dublin 14, D14 X627  
 Ireland.  
 T +353 (0)1-2071000  
 E info@gdgeo.com  
 www.gdgeo.com

ISSUED AS: FOR INFORMATION

CLIENT: **atmos**  
 CONSULTING

PROJECT TITLE: CLYDAGHROE WIND FARM  
 ROUTE ASSESSMENT

DRAWING No: 20263-GDG-ZZ-XX-DR-C-0200  
 Revision: -FI -00

DRAWING TITLE: JUNCTION 1  
 LAYOUT

SCALE: 1:250 | SHEET SIZE: A1 | DATE: 23/05/2022  
 DRAWN BY: EFC | CHECKED BY: S.C. | APPROVED BY: L.B.



PHOTO 1 - JUNCTION SOUTH/WEST SIDE

04 May 2022, 14:38:12




PHOTO 2 - JUNCTION SOUTH/EAST SIDE

04 May 2022, 14:32:17




PHOTO 3 - JUNCTION SOUTH SIDE

04 May 2022, 14:32:46

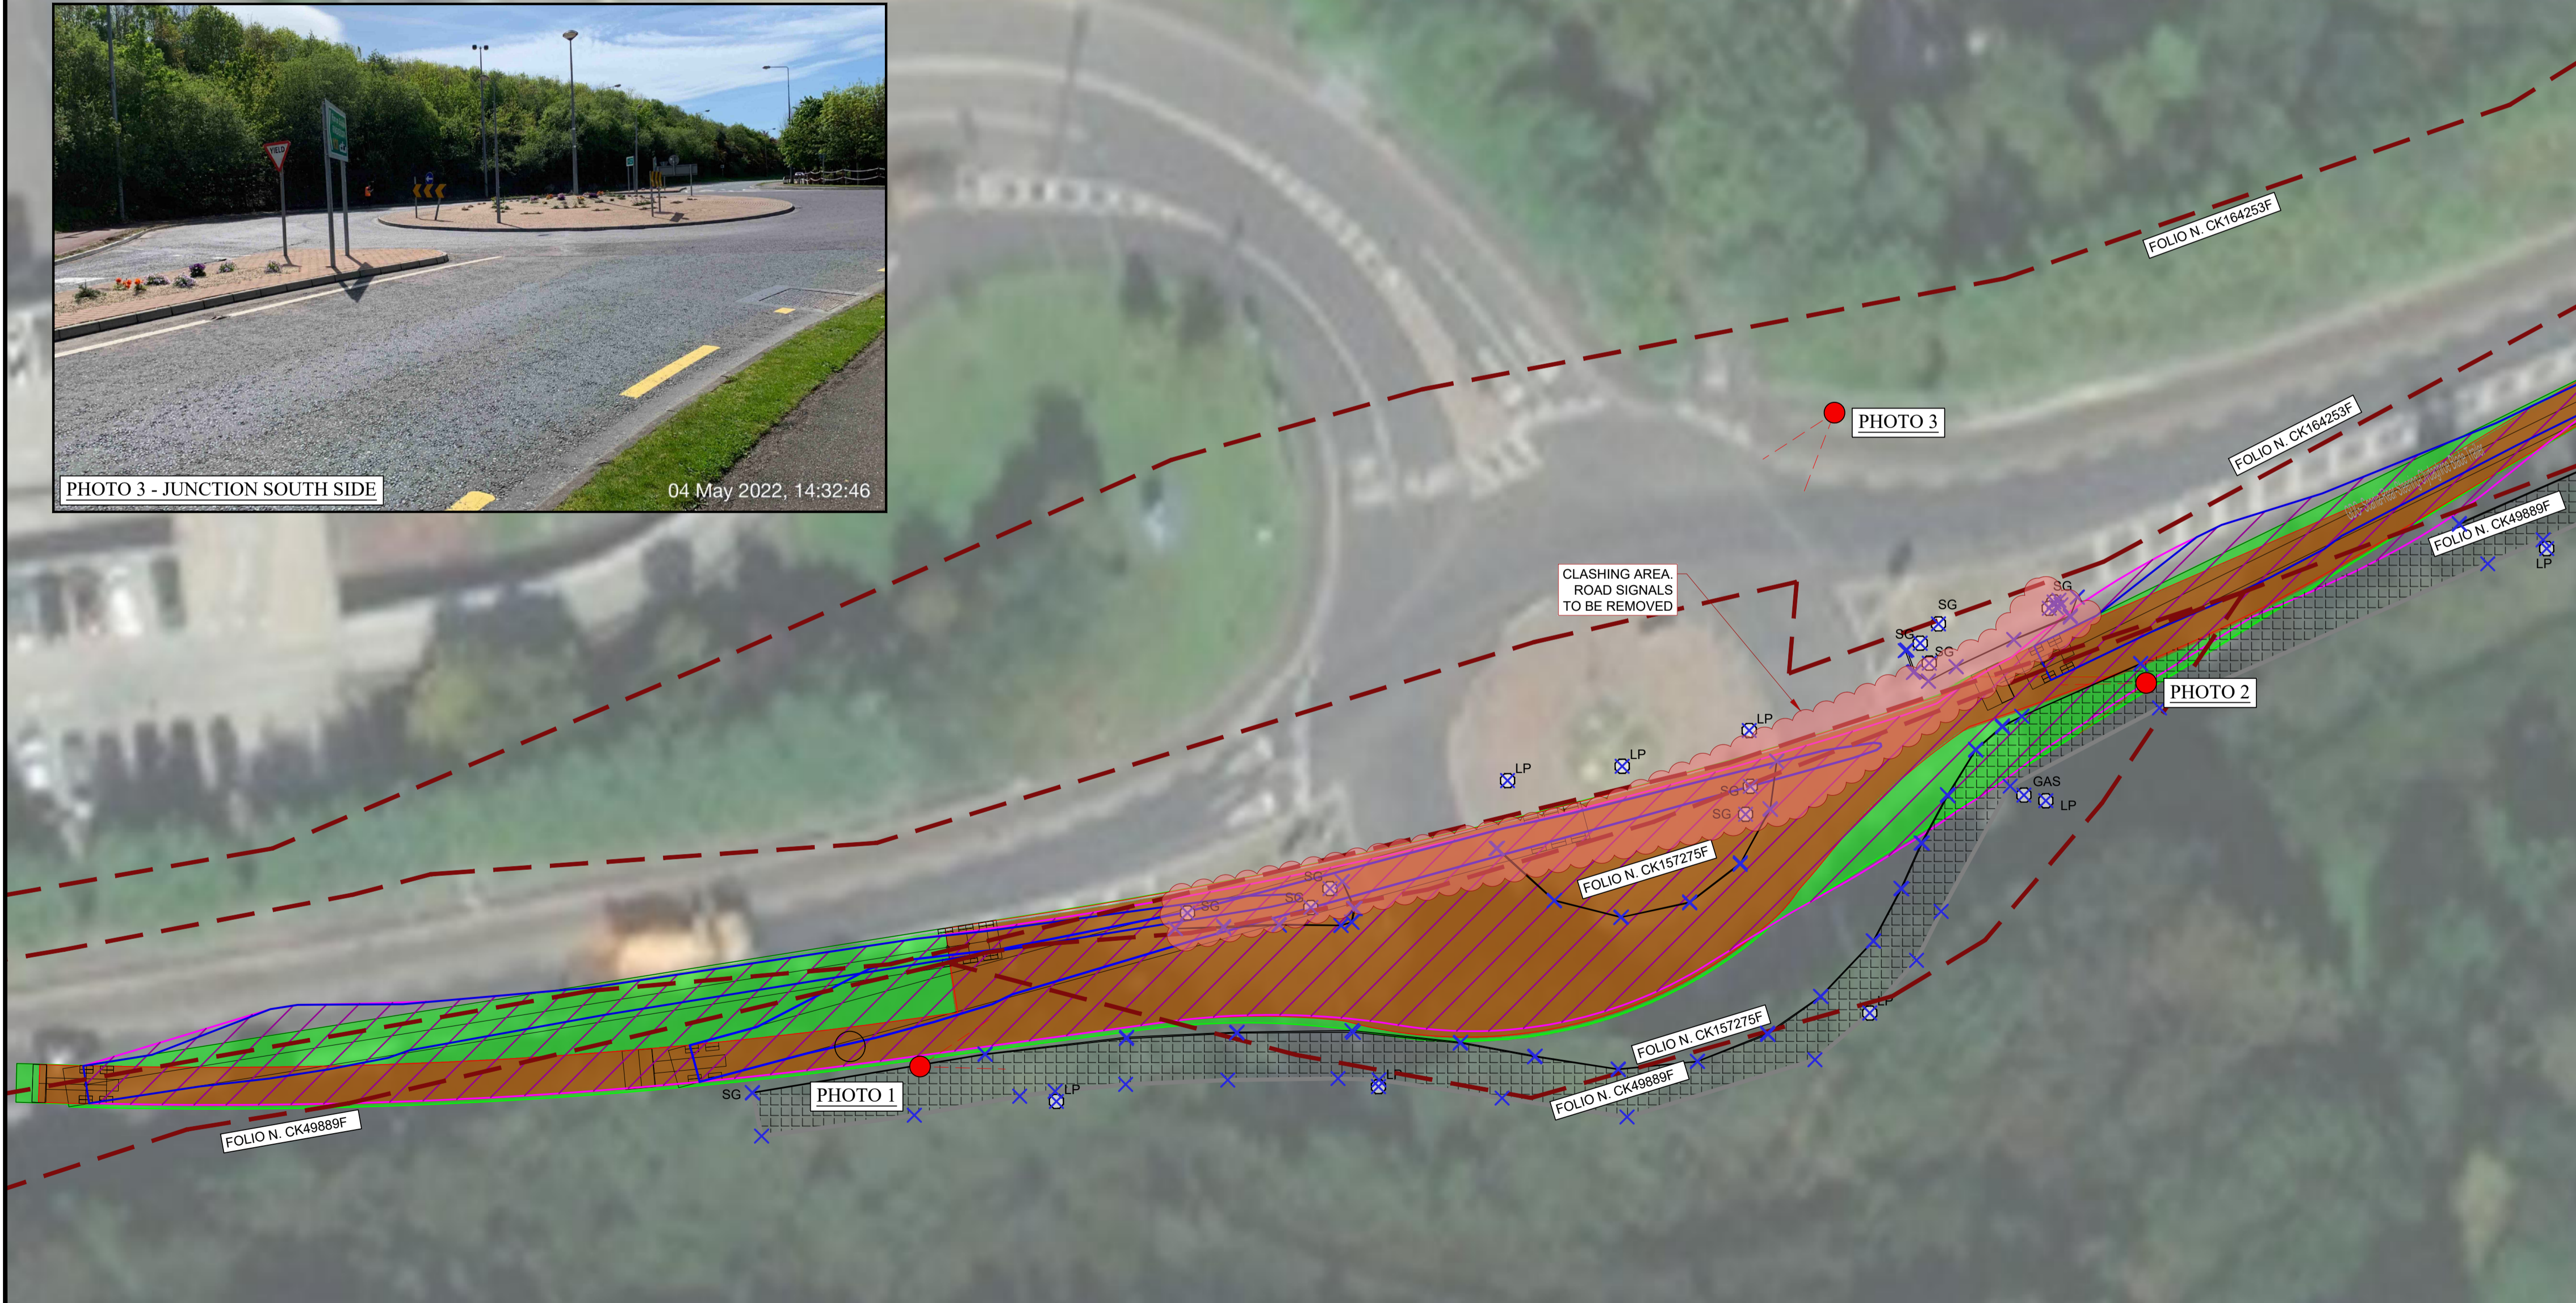

**JUNCTION 2 - PLAN**

SCALE 1:250

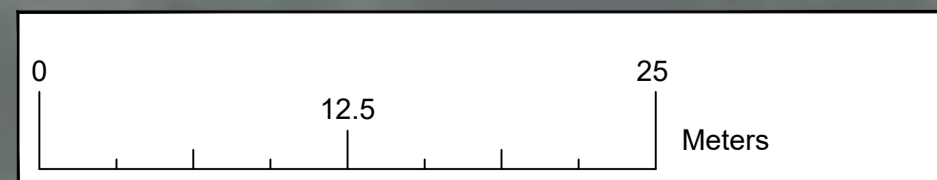


**NOTES:**

1. ALL DIMENSIONS ARE IN METERS UNLESS OTHERWISE STATED
2. USE DIMENSIONS ON DRAWINGS (DO NOT SCALE FROM DRAWINGS)
3. SWEEP PATH ANALYSIS OF VEHICLE IS IN PLAN VIEW ONLY. FULL 3D KINEMATIC ANALYSIS OF THE VEHICLE HAS NOT BEEN CARRIED OUT. AREAS WHERE UNDERSIDE OF THE TRAILER MAY CLASH WITH THE ROAD OR GROUND SURFACE HAVE BEEN HIGHLIGHTED, AND REQUIRE REMEDIATION.
4. SATELLITE IMAGERY FROM © 2022 MICROSOFT CORP. © 2022 MAXAR © CNES (2022) DISTRIBUTION AIRBUS DS - MICROSOFT BING. ACCURACY NOT GUARANTEED.
5. PHOTOS AND SURVEY POINTS WERE RECORDED BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022.
6. EXTENTS OF PRIVATE LANDS ARE INDICATIVE ONLY.

**LEGEND:**

- PROPERTY BOUNDARIES INDICATIVE ONLY
- FOLIO N. 123456 | LANDDIRECT MAP VIEWER, 2022. FOLIO NUMBERS
- SWEEP PATH: EXTENTS OF WT BLADE OVERSAIL
- SWEEP PATH: EXTENTS OF VEHICLE CHASSIS MOVEMENT
- SWEEP PATH: EXTENTS OF VEHICLE BODY MOVEMENT
- FOOT PATH INDICATIVE LOCATION
- CLASHING AREAS
- RECORDED POINTS BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022
- ROAD SIGNALS / SIGNS
- LAMP POST
- HIGH PRESSURE GAS PIPELINE SIGNAL
- PHOTO VIEW


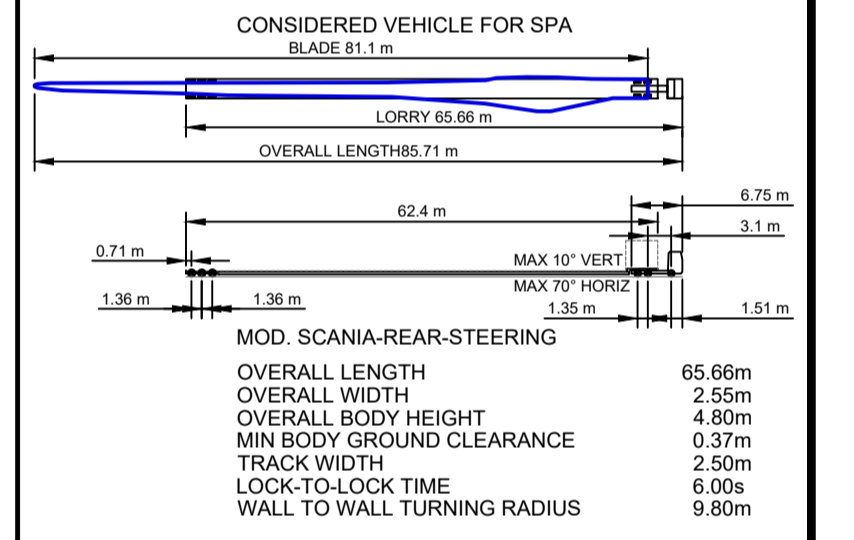


REV: FI -00	DATE: 23/05/22	DRAWN BY: EFC	CHECKED BY: EJB
DESCRIPTION: ISSUED FOR INFORMATION			

**GDG**  
GAVIN & DOHERTY  
GEOSOLUTIONS


Unit A2,  
Nuttgrove Office Park,  
Rathfarnham,  
Dublin 14, D14 X627  
Ireland.  
T +353 (0)1-2071000  
E info@gdgeo.com  
www.gdgeo.com

ISSUED AS:	FOR INFORMATION
CLIENT:	
PROJECT TITLE:	CLYDAGHROE WIND FARM ROUTE ASSESSMENT
DRAWING No:	20263-GDG-ZZ-XX-DR-C-0201
Revision:	-FI -00
DRAWING TITLE:	JUNCTION 2 LAYOUT
SCALE:	1:250
SHEET SIZE:	A1
DATE:	23/05/2022
DRAWN BY:	EFC
CHECKED BY:	S.C.
APPROVED BY:	L.B.

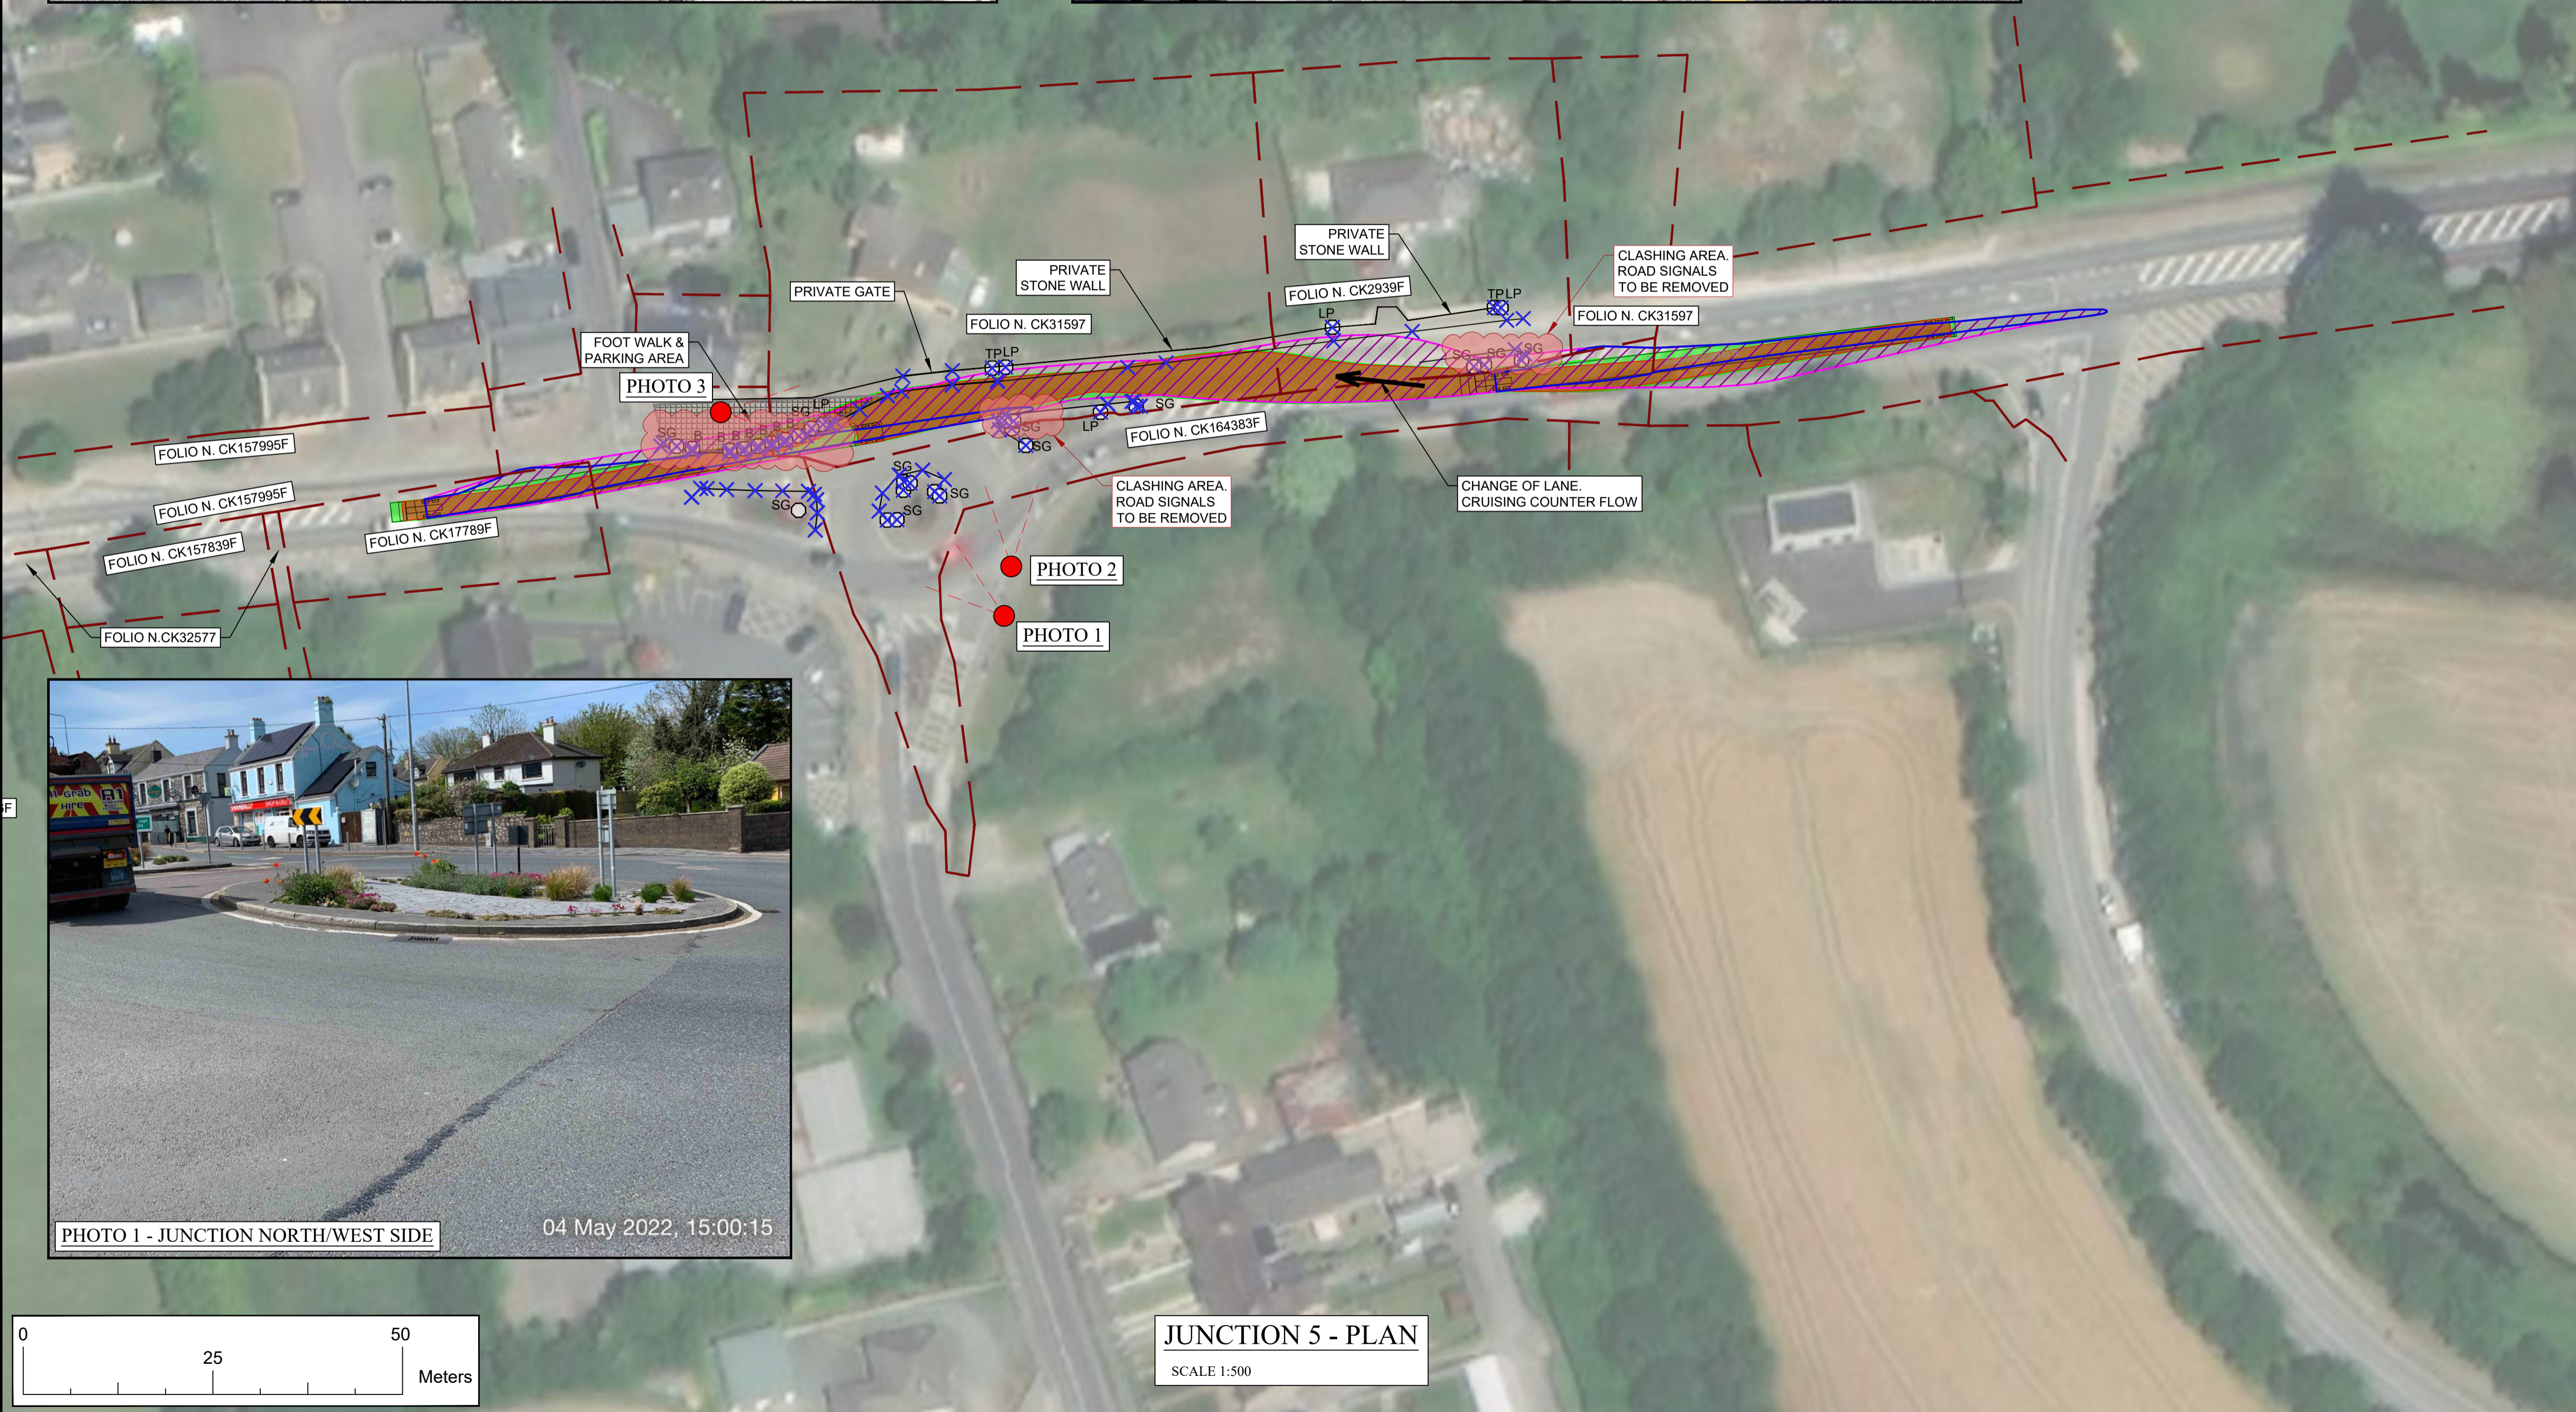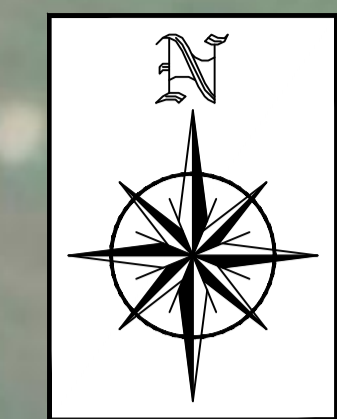

- NOTES:**
1. ALL DIMENSIONS ARE IN METERS UNLESS OTHERWISE STATED
  2. USE DIMENSIONS ON DRAWINGS (DO NOT SCALE FROM DRAWINGS)
  3. SWEEP PATH ANALYSIS OF VEHICLE IS IN PLAN VIEW ONLY. FULL 3D KINEMATIC ANALYSIS OF THE VEHICLE HAS NOT BEEN CARRIED OUT. AREAS WHERE UNDERSIDE OF THE TRAILER MAY CLASH WITH THE ROAD OR GROUND SURFACE HAVE BEEN HIGHLIGHTED, AND REQUIRE REMEDIATION.
  4. SATELLITE IMAGERY FROM © 2022 MICROSOFT CORP. © 2022 MAXAR © CNES (2022) DISTRIBUTION AIRBUS DS - MICROSOFT BING. ACCURACY NOT GUARANTEED.
  5. PHOTOS AND SURVEY POINTS WERE RECORDED BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022.
  6. EXTENTS OF PROPERTY LANDS ARE INDICATIVE ONLY.


- LEGEND:**
- PROPERTY BOUNDARIES INDICATIVE ONLY
  - FOLIO N. 123456 | LANDDIRECT MAP VIEWER, 2022. FOLIO NUMBERS
  - ▨ SWEEP PATH: EXTENTS OF WT BLADE OVERSAIL
  - ▨ SWEEP PATH: EXTENTS OF VEHICLE CHASSIS MOVEMENT
  - ▨ SWEEP PATH: EXTENTS OF VEHICLE BODY MOVEMENT
  - ▨ FOOT PATH/PARKING INDICATIVE LOCATION
  - ☁ CLASHING AREAS
  - × RECORDED POINTS BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022
  - <sup>SG</sup> ROAD SIGNALS / SIGNS
  - <sup>LP</sup> LAMP POST
  - <sup>TP</sup> TELEPHONE POLE
  - <sup>B</sup> ROAD BOLLARD
  - PHOTO VIEW
  - ← CHANGE OF THE LANE. CRUISING COUNTER FLOW

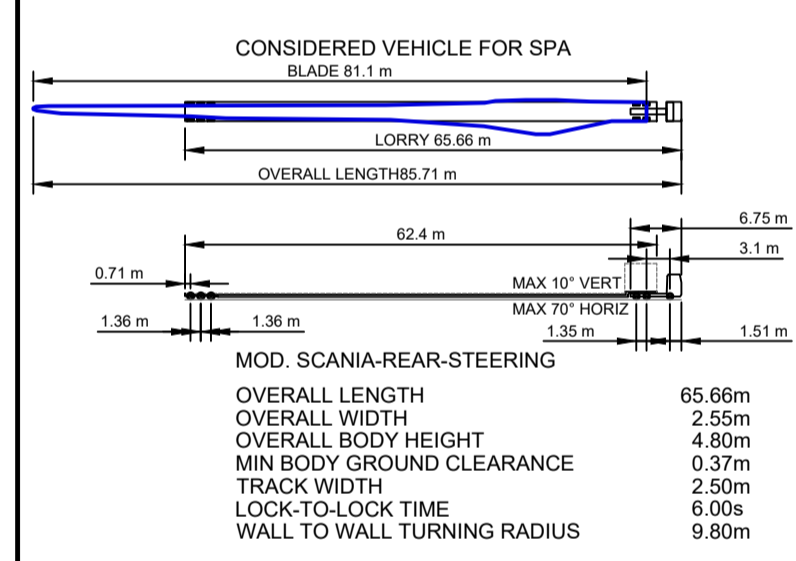

REV: FI -00 DATE: 23/05/22 DRAWN BY: EFC CHECKED BY: EJB  
 DESCRIPTION: ISSUED FOR INFORMATION

**GDG**  
 GAVIN & DOHERTY  
 GEOSOLUTIONS  
 Unit A2,  
 Nutgrove Office Park,  
 Rathfarnham,  
 Dublin 14, D14 X627  
 Ireland.  
 T +353 (0)1-2071000  
 E info@gdgeo.com  
 www.gdgeo.com

ISSUED AS: FOR INFORMATION  
 CLIENT: **atmos** CONSULTING  
 PROJECT TITLE: CLYDAGHROE WIND FARM ROUTE ASSESSMENT  
 DRAWING No: 20263-GDG-ZZ-XX-DR-C-0202  
 Revision: -FI -00  
 DRAWING TITLE: JUNCTION 5 LAYOUT  
 SCALE: 1:500 SHEET SIZE: A1 DATE: 23/05/2022  
 DRAWN BY: EFC CHECKED BY: S.C. APPROVED BY: L.B.

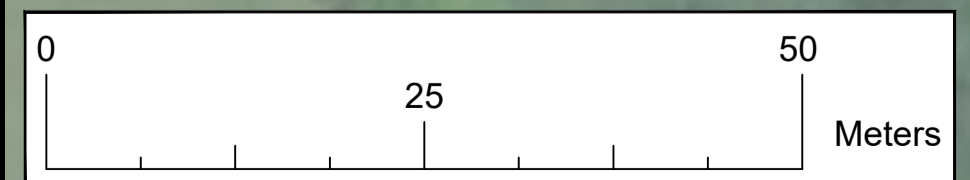


**JUNCTION 5 - PLAN**  
 SCALE 1:500



- NOTES:**
1. ALL DIMENSIONS ARE IN METERS UNLESS OTHERWISE STATED
  2. USE DIMENSIONS ON DRAWINGS (DO NOT SCALE FROM DRAWINGS)
  3. SWEEP PATH ANALYSIS OF VEHICLE IS IN PLAN VIEW ONLY. FULL 3D KINEMATIC ANALYSIS OF THE VEHICLE HAS NOT BEEN CARRIED OUT. AREAS WHERE UNDERSIDE OF THE TRAILER MAY CLASH WITH THE ROAD OR GROUND SURFACE HAVE BEEN HIGHLIGHTED, AND REQUIRE REMEDIATION.
  4. SATELLITE IMAGERY FROM © 2022 MICROSOFT CORP. © 2022 MAXAR © CNES (2022) DISTRIBUTION AIRBUS DS - MICROSOFT BING. ACCURACY NOT GUARANTEED.
  5. PHOTOS AND SURVEY POINTS WERE RECORDED BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022.
  6. EXTENTS OF PROPERTY LANDS ARE INDICATIVE ONLY.

- LEGEND:**
- PROPERTY BOUNDARIES INDICATIVE ONLY
  - FOLIO N. 123456 | LANDDIRECT MAP VIEWER, 2022. FOLIO NUMBERS
  - ▨ SWEEP PATH: EXTENTS OF WT BLADE OVERSAIL
  - ▨ SWEEP PATH: EXTENTS OF VEHICLE CHASSIS MOVEMENT
  - ▨ SWEEP PATH: EXTENTS OF VEHICLE BODY MOVEMENT
  - ▨ FOOT PATH INDICATIVE LOCATION
  - ☁ CLASHING AREAS
  - ✕ RECORDED POINTS BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022
  - SG ROAD SIGNALS / SIGNS
  - LP LAMP POST
  - PHOTO VIEW
  - ← CHANGE OF THE LANE. CRUISING COUNTER FLOW

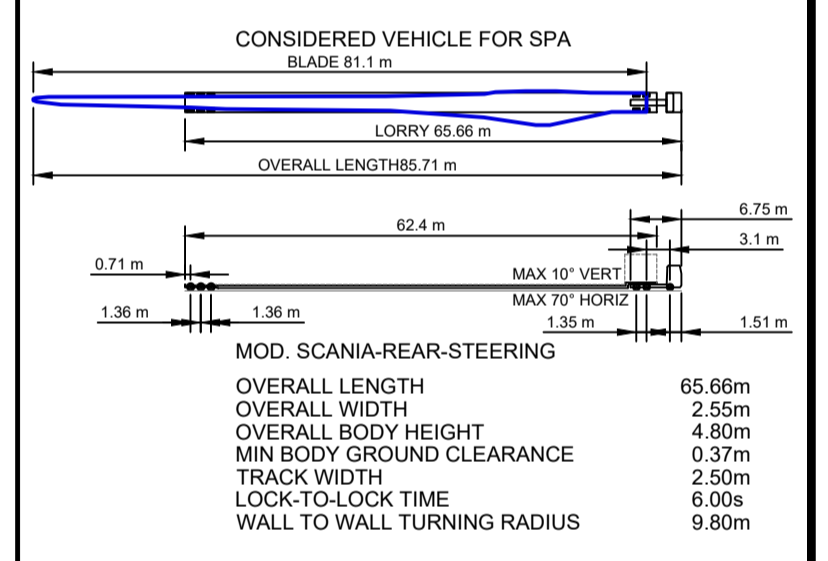

REV: FI -00 | DATE: 23/05/22 | DRAWN BY: EFC | CHECKED BY: EJB  
 DESCRIPTION: ISSUED FOR INFORMATION

**GDG**  
 GAVIN & DOHERTY  
 GEOSOLUTIONS

Unit A2,  
 Nutgrove Office Park,  
 Rathfarnham,  
 Dublin 14, D14 X627  
 Ireland.  
 T +353 (0)1-2071000  
 E info@gdgeo.com  
 www.gdgeo.com

ISSUED AS: FOR INFORMATION





CLIENT: **atmos**  
 CONSULTING

PROJECT TITLE: CLYDAGHROE WIND FARM  
 ROUTE ASSESSMENT

DRAWING No: 20263-GDG-ZZ-XX-DR-C-0203  
 Revision: -FI -00

DRAWING TITLE: JUNCTION 13  
 LAYOUT

SCALE: 1:500 | SHEET SIZE: A1 | DATE: 23/05/2022  
 DRAWN BY: EFC | CHECKED BY: G.O'S | APPROVED BY: L.B.

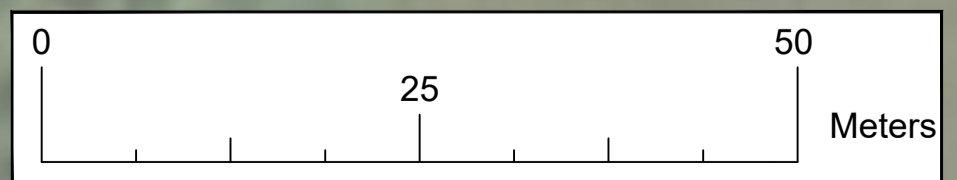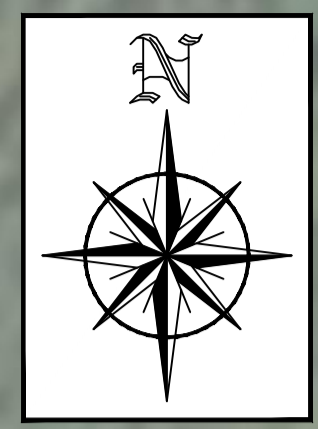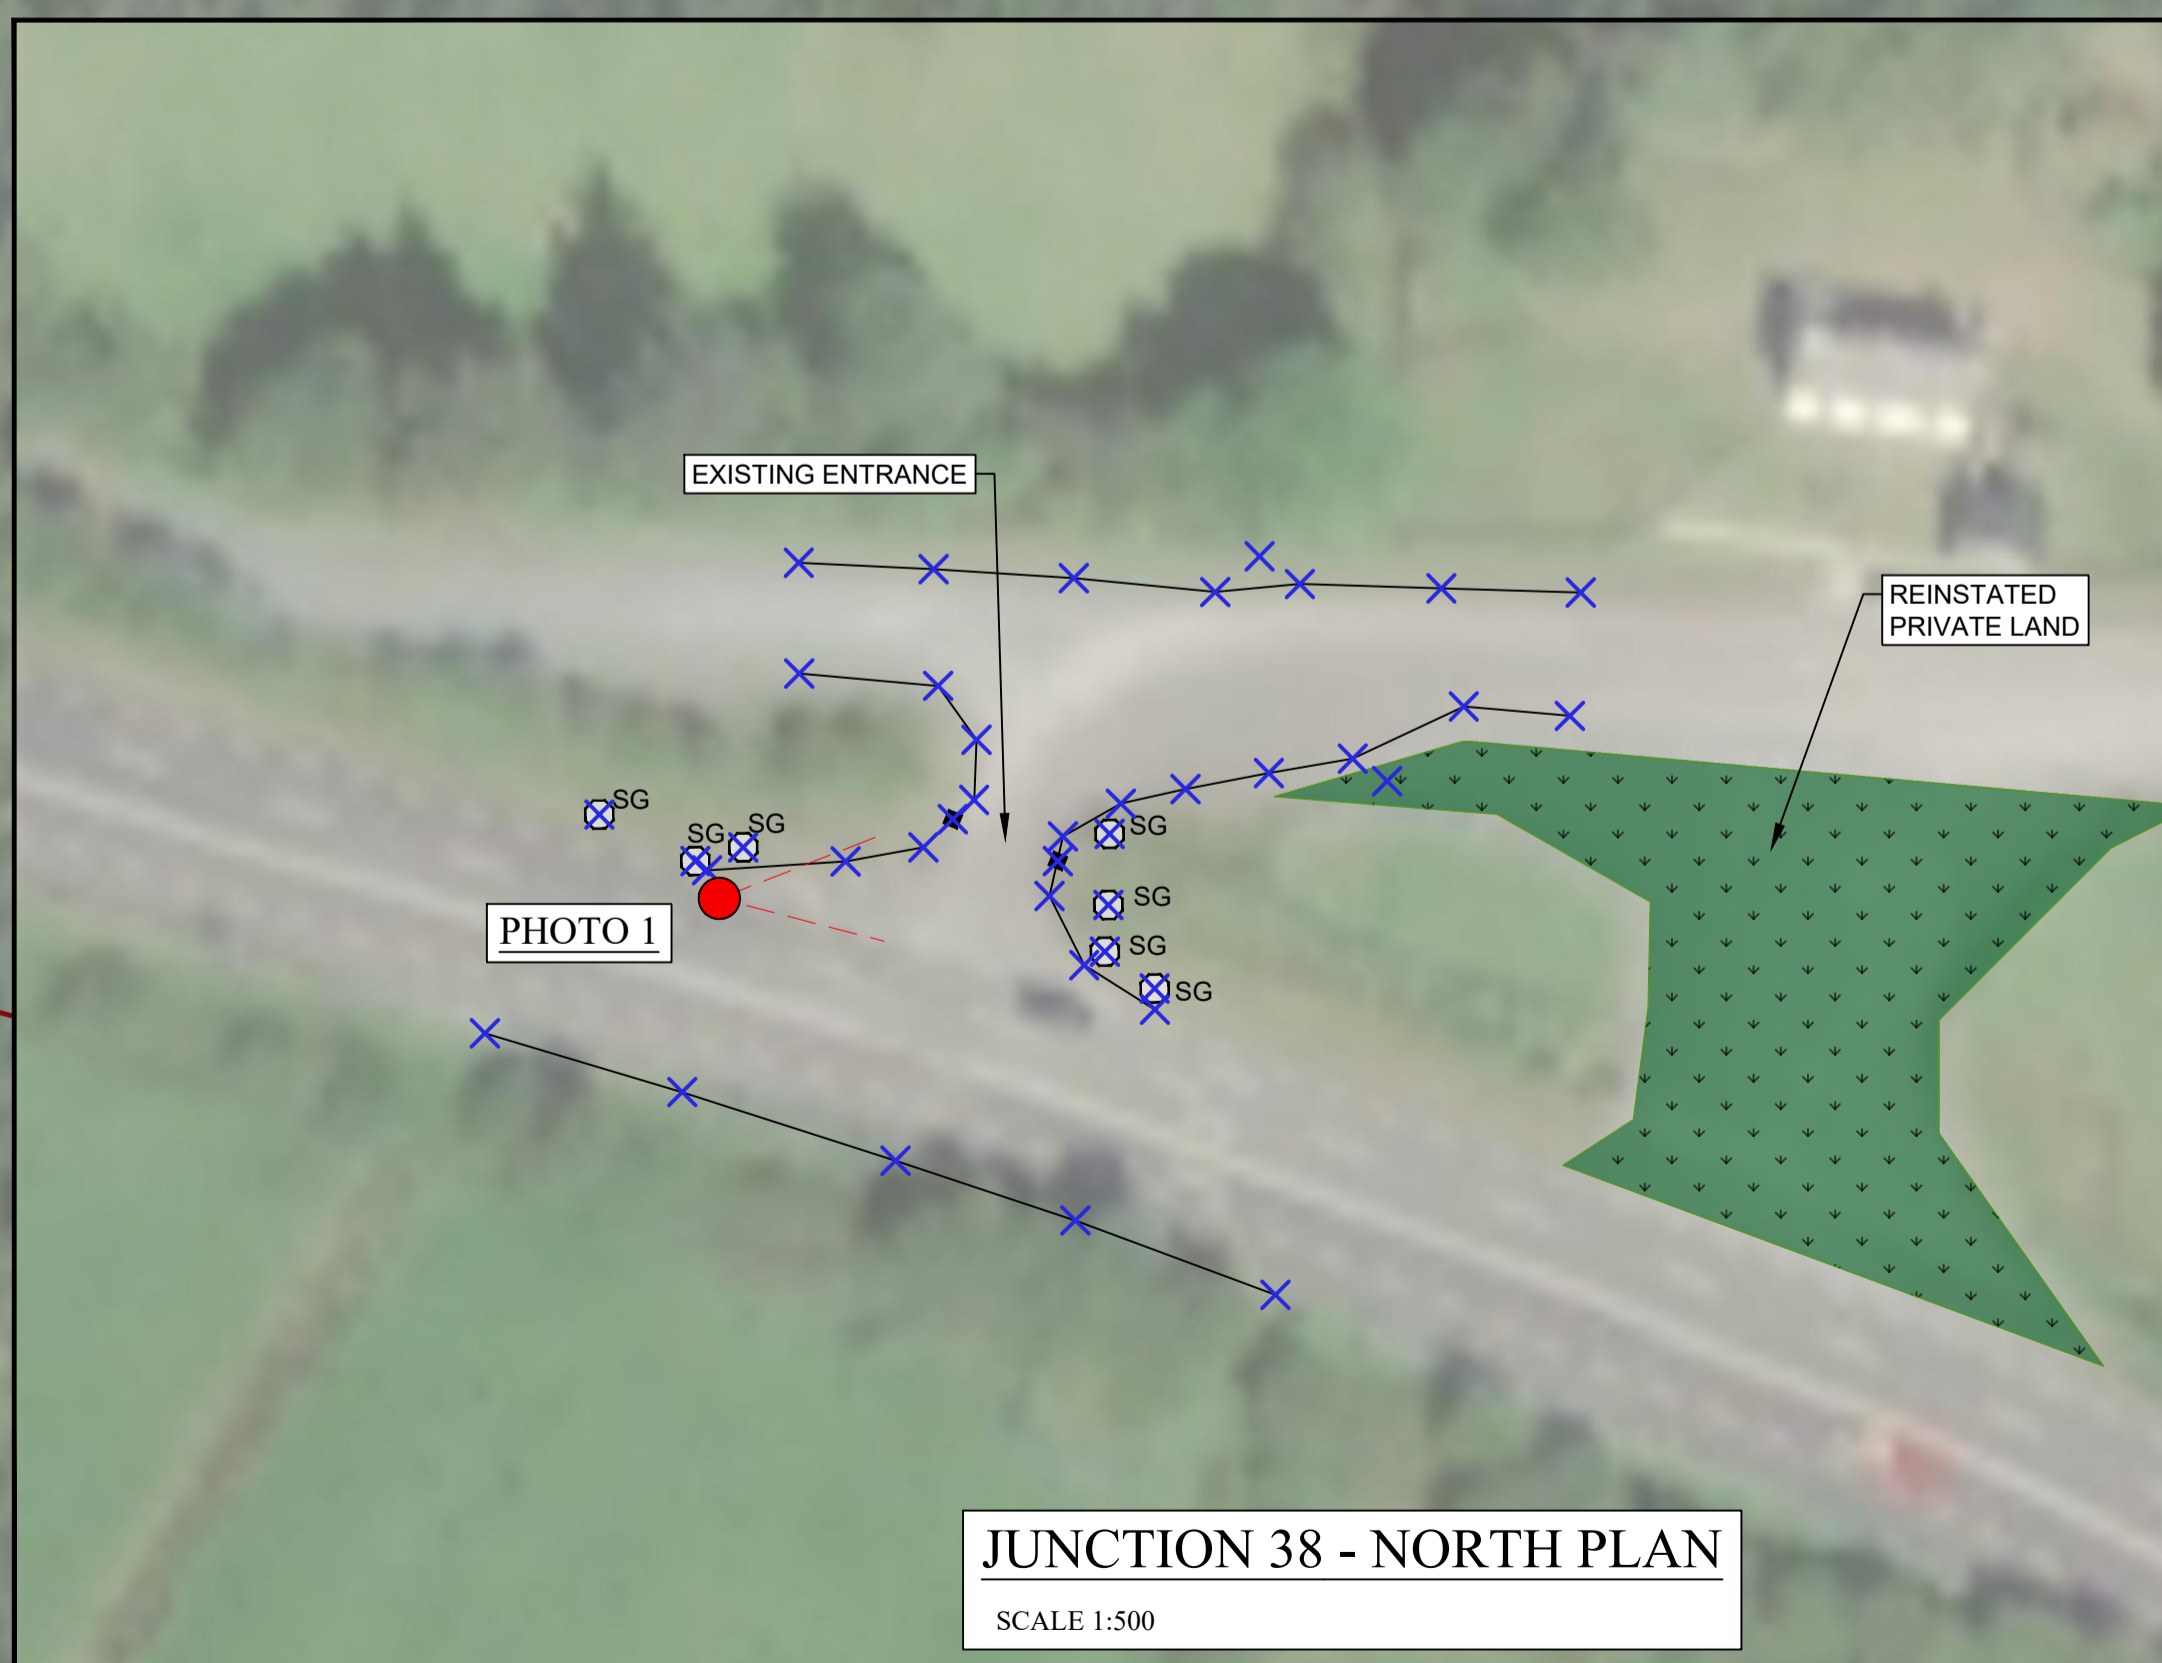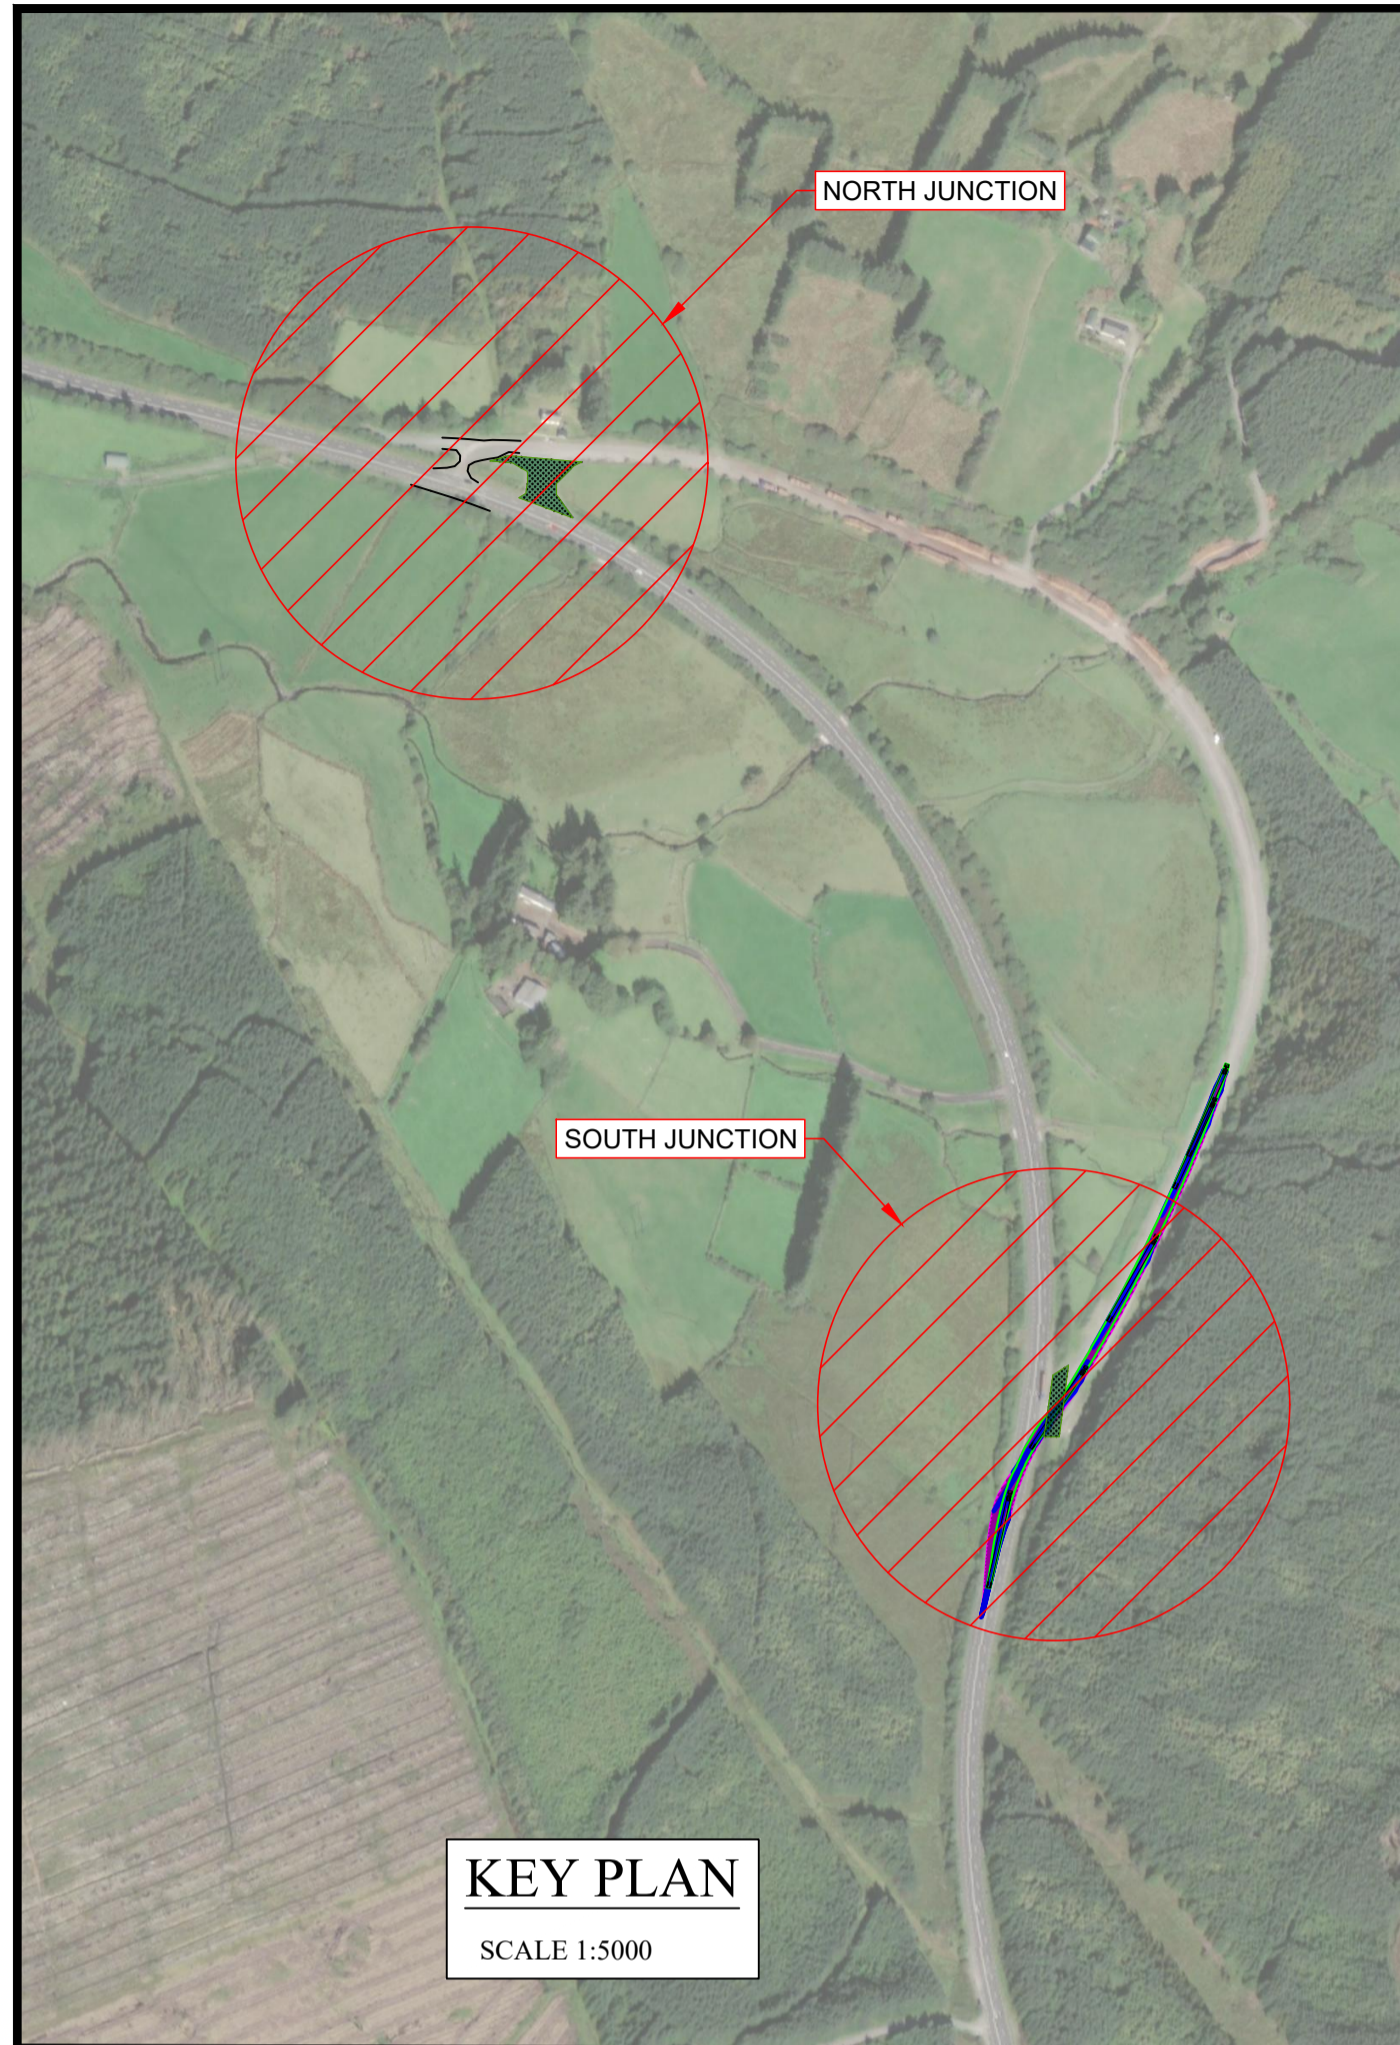

- NOTES:**
- ALL DIMENSIONS ARE IN METERS UNLESS OTHERWISE STATED
  - USE DIMENSIONS ON DRAWINGS (DO NOT SCALE FROM DRAWINGS)
  - SWEEP PATH ANALYSIS OF VEHICLE IS IN PLAN VIEW ONLY. FULL 3D KINEMATIC ANALYSIS OF THE VEHICLE HAS NOT BEEN CARRIED OUT. AREAS WHERE UNDERSIDE OF THE TRAILER MAY CLASH WITH THE ROAD OR GROUND SURFACE HAVE BEEN HIGHLIGHTED, AND REQUIRE REMEDIATION.
  - SATELLITE IMAGERY FROM © 2022 MICROSOFT CORP. © 2022 MAXAR © CNES (2022) DISTRIBUTION AIRBUS DS - MICROSOFT BING. ACCURACY NOT GUARANTEED.
  - PHOTOS AND SURVEY POINTS WERE RECORDED BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022. EXTENTS OF PROPERTY LANDS ARE INDICATIVE ONLY.
  - THE SOUTHERN ACCESS POINT IS THE PREFERRED ACCESS ROUTE. ACCESS AT THE NORTHERN ACCESS POINT IS RESTRICTED DUE TO THE JUNCTIONS GEOMETRY.

**LEGEND:**

- PROPERTY BOUNDARIES INDICATIVE ONLY
- FOLIO N. 123456 | LANDDIRECT MAP VIEWER, 2022, FOLIO NUMBERS
- SWEPT PATH: EXTENTS OF WT BLADE OVERSAIL
- SWEPT PATH: EXTENTS OF VEHICLE CHASSIS MOVEMENT
- SWEPT PATH: EXTENTS OF VEHICLE BODY MOVEMENT
- REINSTATED LAND LOCATION
- CLASHING AREAS
- RECORDED POINTS BY GDG DURING ROUTE INSPECTION ON THE 4<sup>th</sup> OF MAY 2022
- ROAD SIGNALS / SIGNS
- PHOTO VIEW

**CONSIDERED VEHICLE FOR SPA**

BLADE	81.1 m
LORRY	65.66 m
OVERALL LENGTH	85.71 m
MOD. SCANIA-REAR-STEERING	
OVERALL LENGTH	65.66m
OVERALL WIDTH	2.55m
OVERALL BODY HEIGHT	4.80m
MIN BODY GROUND CLEARANCE	0.37m
TRACK WIDTH	2.50m
LOCK-TO-LOCK TIME	6.00s
WALL TO WALL TURNING RADIUS	9.80m

REV: FI -00 | DATE: 23/05/22 | DRAWN BY: EFC | CHECKED BY: EJB

DESCRIPTION: ISSUED FOR INFORMATION

**GDG**  
GAVIN & DOHERTY  
GEOSOLUTIONS

Unit A2,  
Nutmog Office Park,  
Rathfarnham,  
Dublin 14, D14 X627  
Ireland.  
T +353 (0)1-2071000  
E info@gdgeo.com  
www.gdgeo.com

ISSUED AS: FOR INFORMATION

CLIENT: **atmos** CONSULTING

PROJECT TITLE: CLYDAGHROE WIND FARM ROUTE ASSESSMENT

DRAWING No: 20263-GDG-ZZ-XX-DR-C-0204

Revision: -FI -00



DRAWING TITLE: **JUNCTION 38 LAYOUT**

SCALE: SHOWN | SHEET SIZE: A1 | DATE: 23/05/2022


DRAWN BY: EFC | CHECKED BY: S.C. | APPROVED BY: L.B.



PHOTO 1 - JUNCTION NORTH SIDE

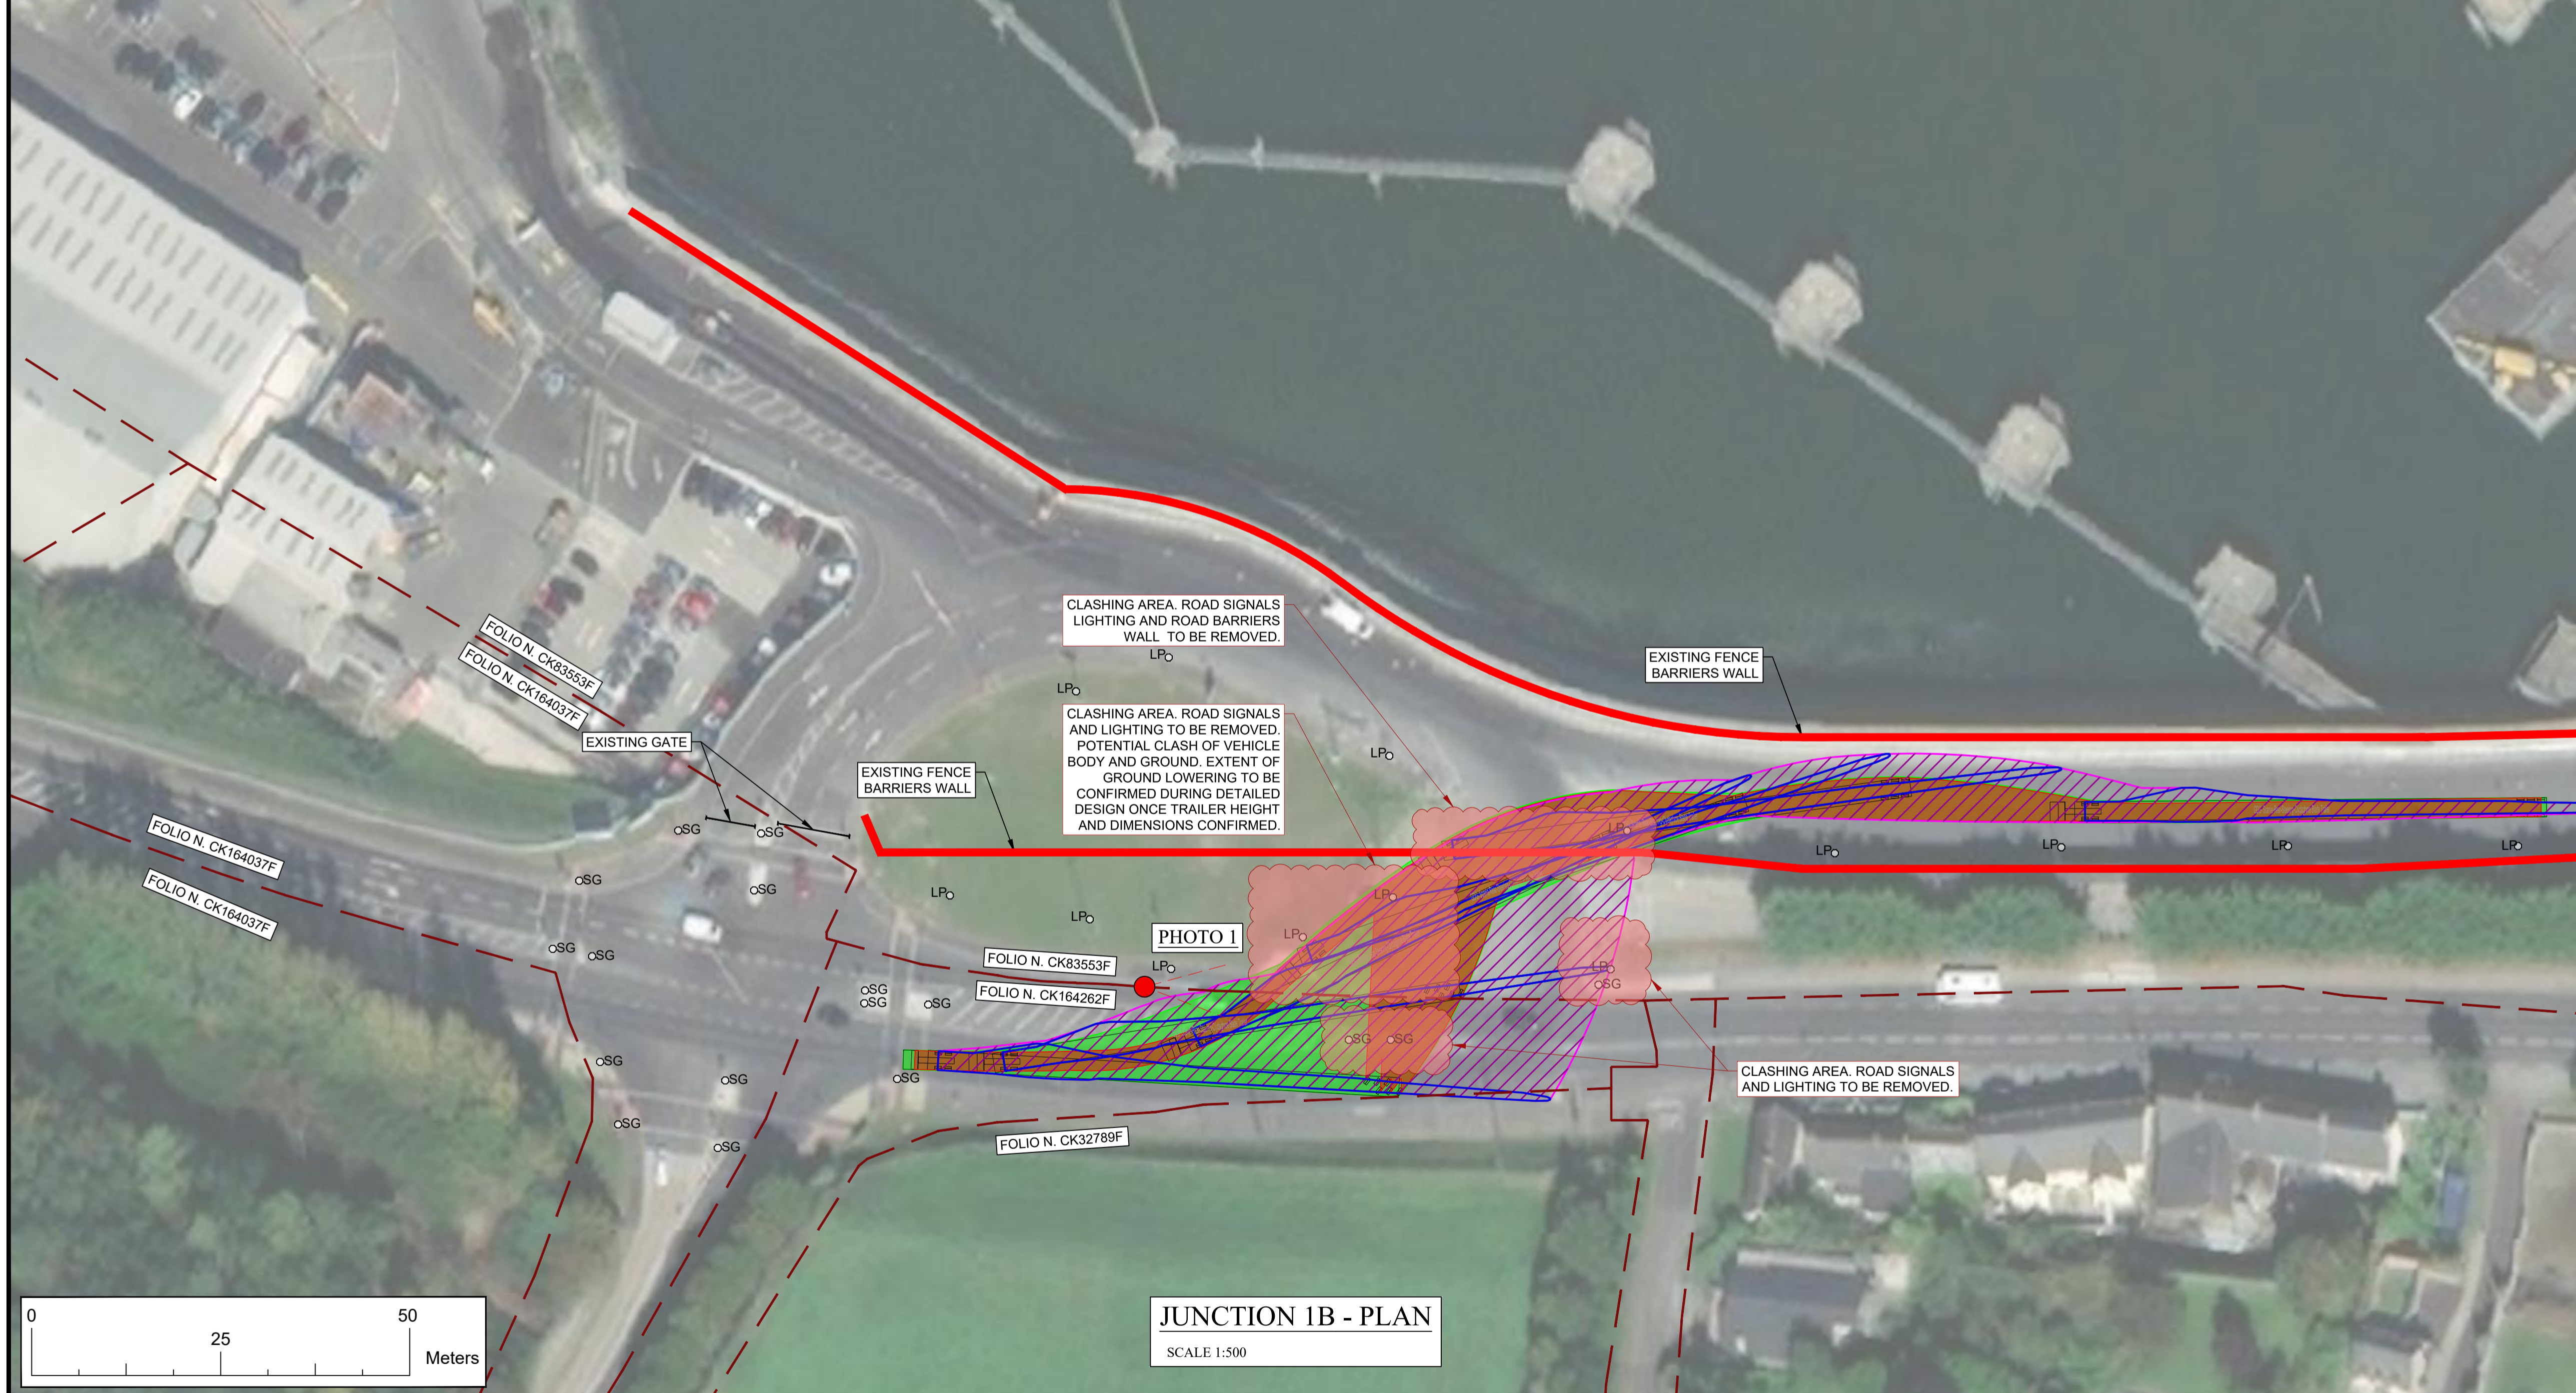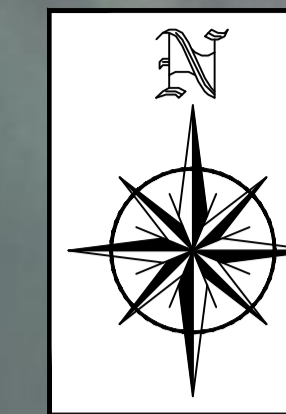

JUNCTION 1B - PLAN  
SCALE 1:500

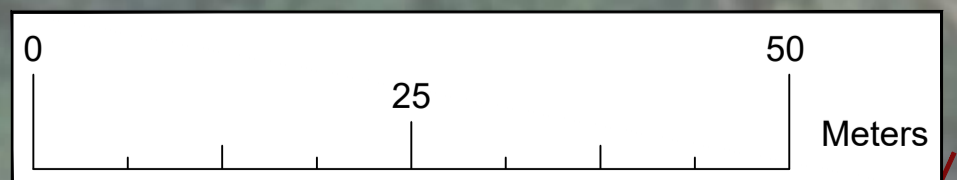


NOTES:

1. ALL DIMENSIONS ARE IN METERS UNLESS OTHERWISE STATED
2. USE DIMENSIONS ON DRAWINGS (DO NOT SCALE FROM DRAWINGS)
3. SWEEP PATH ANALYSIS OF VEHICLE IS IN PLAN VIEW ONLY. FULL 3D KINEMATIC ANALYSIS OF THE VEHICLE HAS NOT BEEN CARRIED OUT. AREAS WHERE UNDERSIDE OF THE TRAILER MAY CLASH WITH THE ROAD OR GROUND SURFACE HAVE BEEN HIGHLIGHTED, AND REQUIRE REMEDIATION.
4. SATELLITE IMAGERY FROM © 2022 MICROSOFT CORP. © 2022 MAXAR © CNES (2022) DISTRIBUTION AIRBUS DS - MICROSOFT BING. ACCURACY NOT GUARANTEED.
5. PHOTO IS INDICATIVE ONLY.
6. EXTENTS OF PRIVATE LANDS ARE INDICATIVE ONLY.
7. ALL STREET FURNITURE, SIGNALS / SIGNS AND LIGHTINGS LOCATED FROM AERIAL MAP. THE EXACT LOCATIONS OF ALL THE STREET FURNITURE, SIGNALS AND LIGHTINGS TO BE DETERMINED BY SURVEY.

LEGEND:

- PROPERTY BOUNDARIES INDICATIVE ONLY
- FOLIO N. 123456 | LANDDIRECT MAP VIEWER, 2022, FOLIO NUMBERS
- [Pink hatched] SWEEP PATH: EXTENTS OF WT BLADE OVERSAIL
- [Orange] SWEEP PATH: EXTENTS OF VEHICLE CHASSIS MOVEMENT
- [Green] SWEEP PATH: EXTENTS OF VEHICLE BODY MOVEMENT
- [Red cloud] CLASHING AREAS
- [Red line] FENCE WALL INDICATIVE EXTENTS
- [oSG] ROAD SIGNALS / SIGNS INDICATIVE LOCATIONS
- [oLP] LAMP POST INDICATIVE LOCATIONS
- [Red dot] PHOTO VIEW

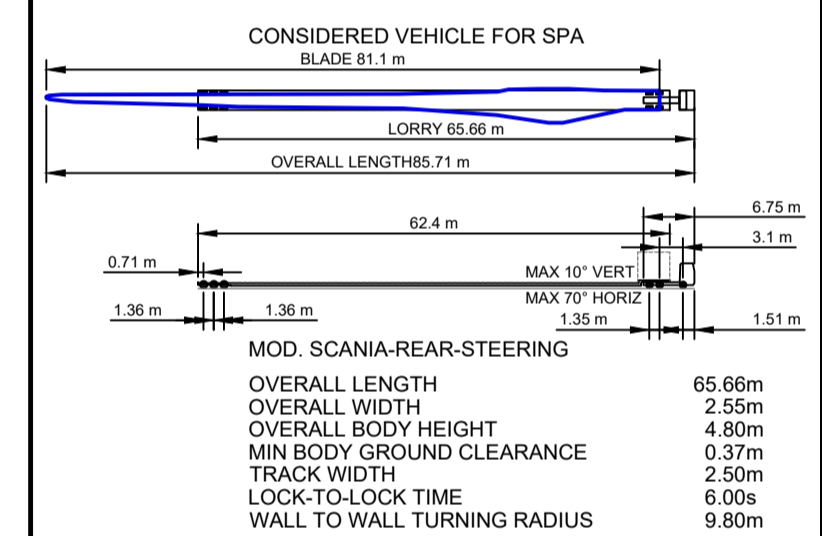

REV: FI-00	DATE: 23/05/22	DRAWN BY: EFC	CHECKED BY: EJB
DESCRIPTION: ISSUED FOR INFORMATION			

Unit A2,  
Nugrove Office Park,  
Rathfarnham,  
Dublin 14, D14 X627  
Ireland.  
T +353 (0)1-2071000  
E info@gdgeo.com  
www.gdgeo.com

ISSUED AS: FOR INFORMATION

CLIENT: **atmos**  
CONSULTING

PROJECT TITLE: CLYDAGHROE WIND FARM  
ROUTE ASSESSMENT

DRAWING No: 20263-GDG-ZZ-XX-DR-C-0205  
Revision: -FI-00

DRAWING TITLE: JUNCTION 1B  
LAYOUT

SCALE: 1:500	SHEET SIZE: A1	DATE: 23/05/2022
DRAWN BY: EFC	CHECKED BY: S.C.	APPROVED BY: L.B.